

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR017041


Type : GSLRD

Built Year : 2001

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

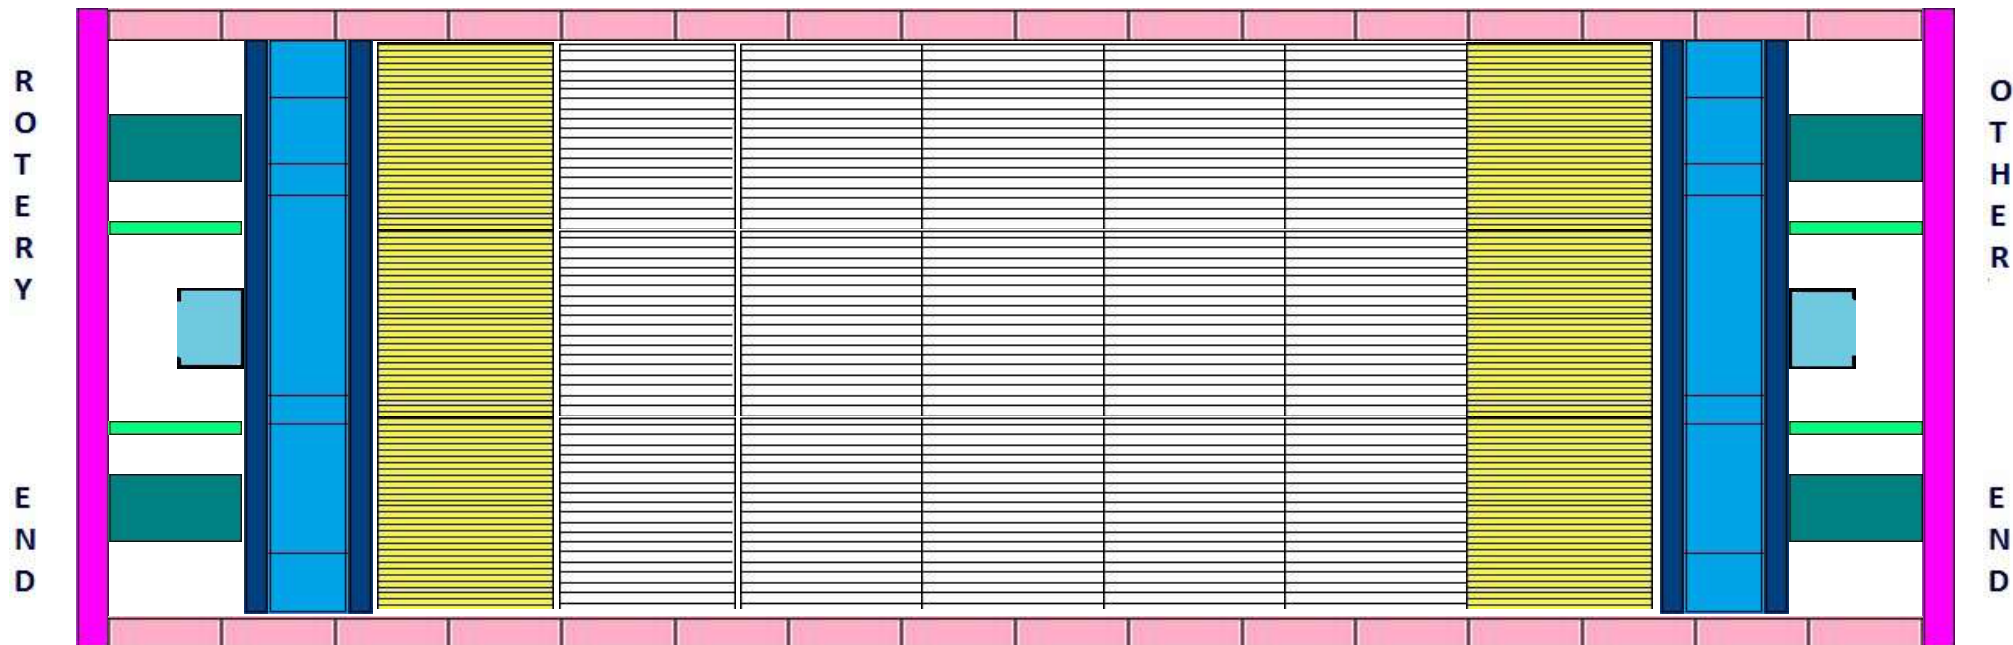

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	10	53%		Window Bar	20	24%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 1, WEST : -5 Other End - EAST : 5, WEST : 0
Start Date : 26-Mar-2019, Completion Date : 05-Apr-2019, Net Repair Days : 10, Total Man Hours : 1851

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062941


Type : WGSCN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

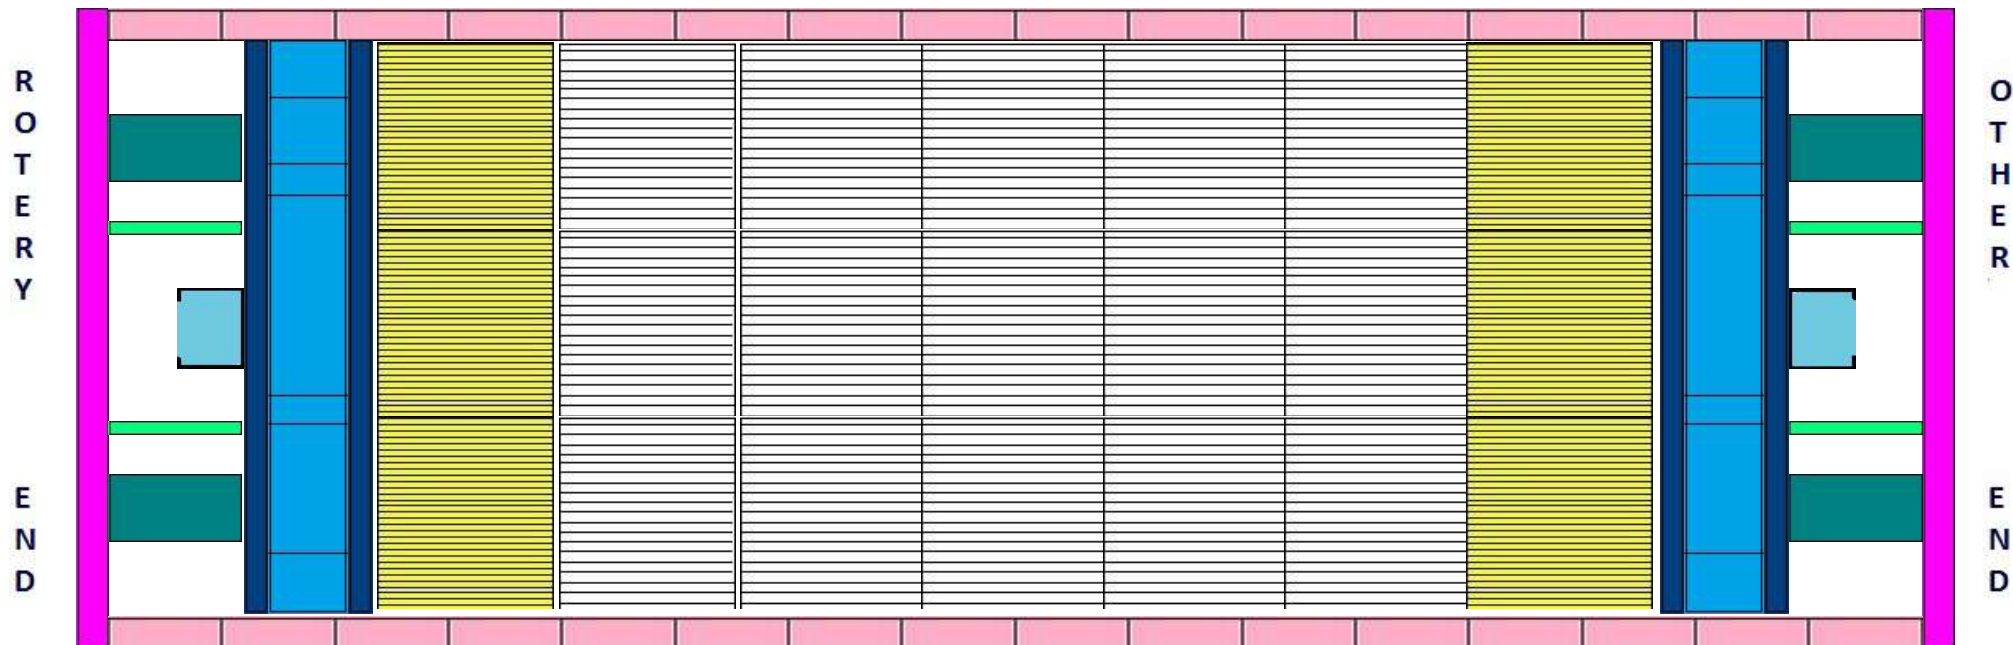

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Light Blue	Sole Bar	16	100%	Dark Green	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%	Dark Green	SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	35%		Window Bar	40	22%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -2, WEST : -6 Other End - EAST : -4, WEST : -2
Start Date : 01-Jul-2019, Completion Date : 11-Jul-2019, Net Repair Days : 10, Total Man Hours : 1393

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR063020


Type : WGSCN

Built Year : 2006

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

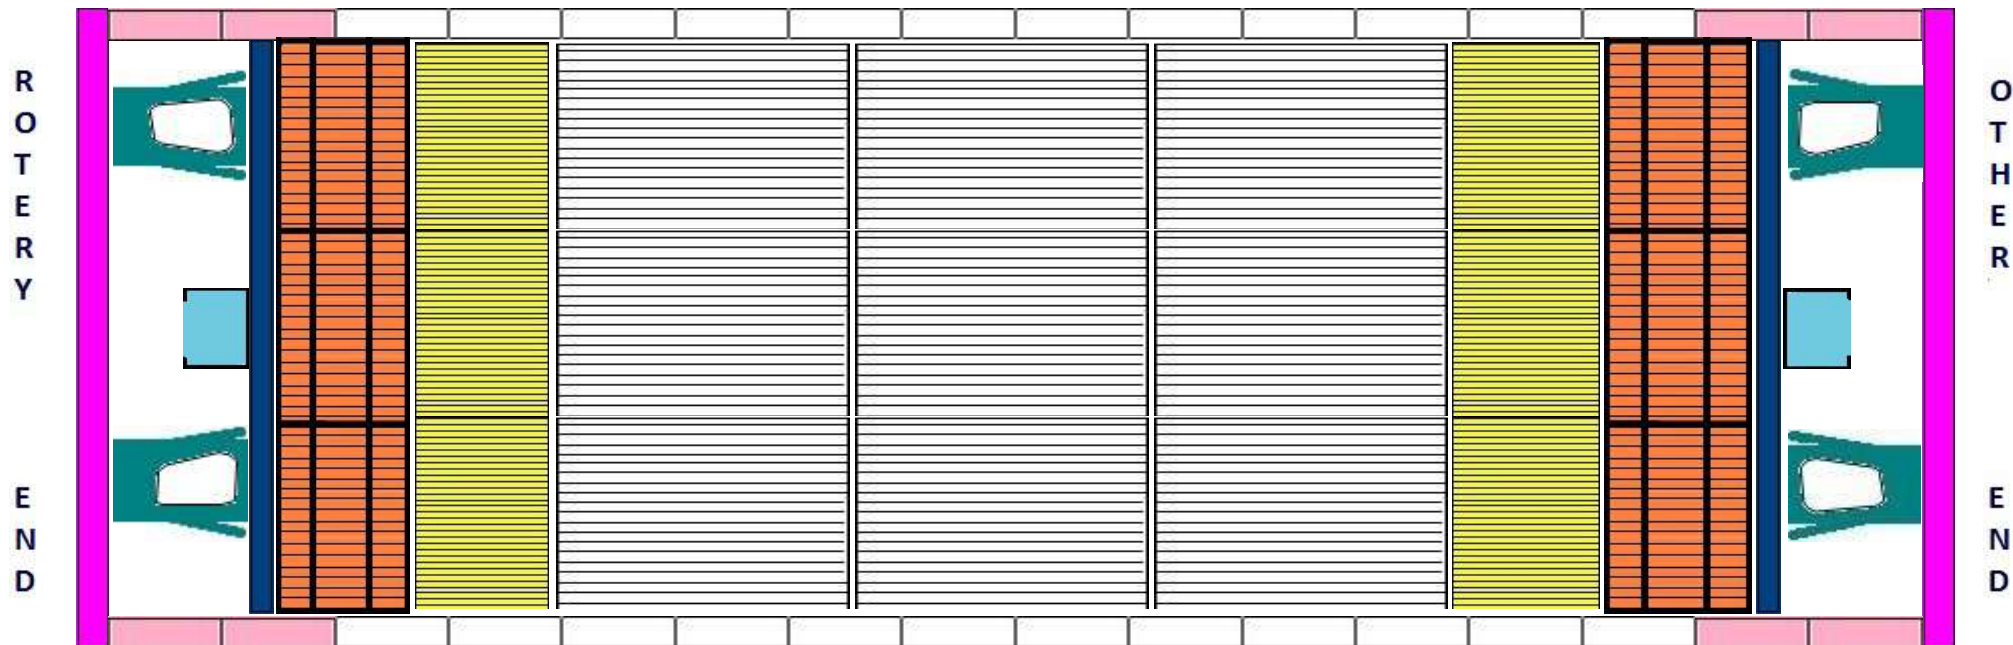

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	7	18%
	Window Bar	28	15%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : 0, WEST : 3 Other End - EAST : 3, WEST : -4
Start Date : 14-Aug-2019, Completion Date : 22-Aug-2019, Net Repair Days : 8, Total Man Hours : 1076

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
--------------------	-------------------	------------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR052631


Type : WGSCN

Built Year : 2005

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

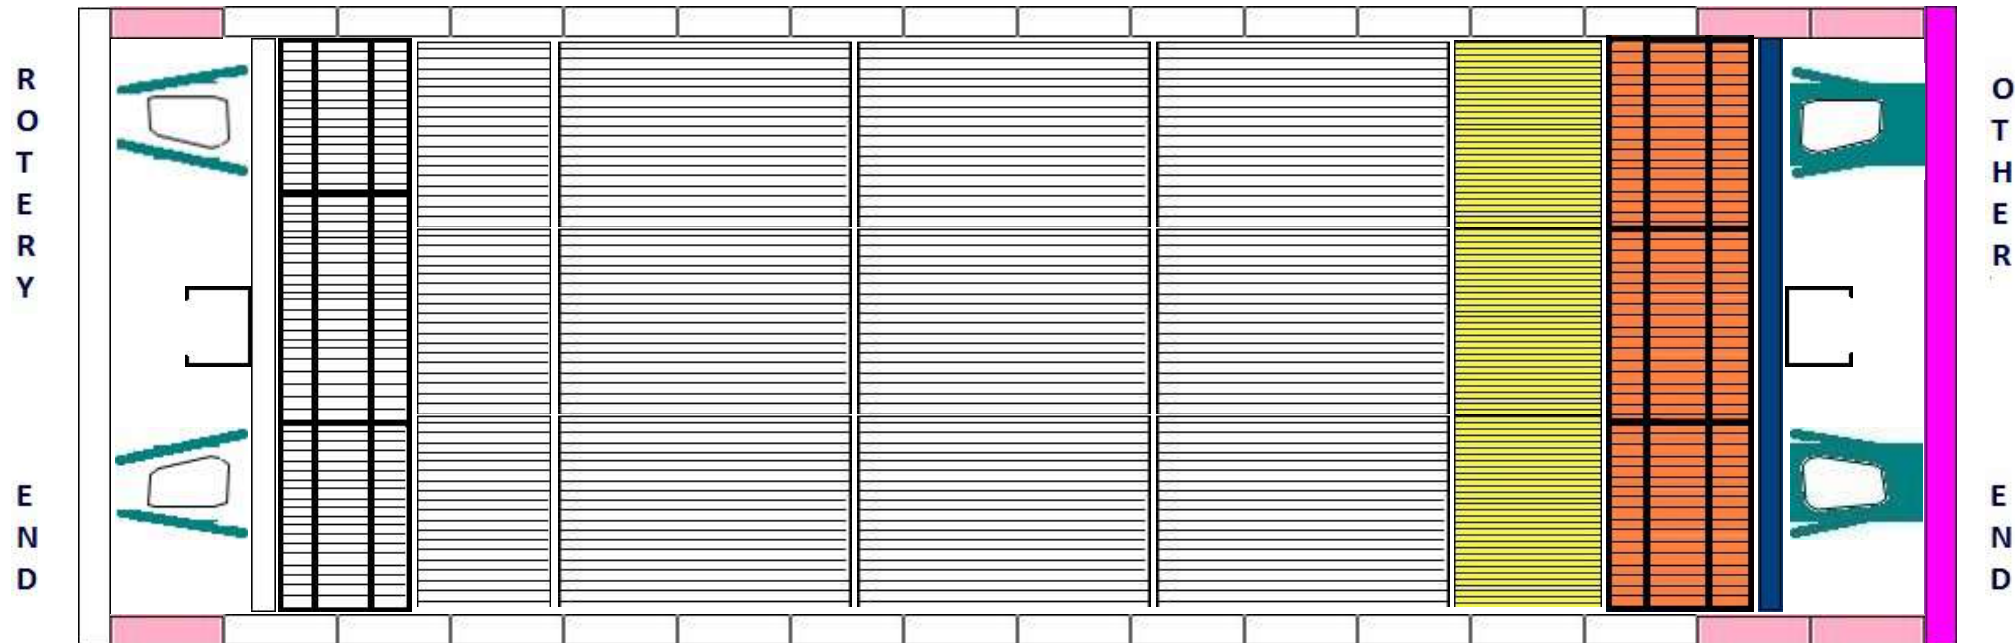

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	1	50%		Diagonal	4	100%		Logitudinal Channel Structure	1	50%
	Aux. Head stock	1	50%		Sole Bar	3	19%		Draft Gear Bracket	1	50%
	Trough floor	1	20%		Bottom Wall Part	3	19%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	7	18%
	Window Bar	14	8%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	17	100%								

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : -7, WEST : -5
Start Date : 16-Oct-2019, Completion Date : 22-Oct-2019, Net Repair Days : 6, Total Man Hours : 932

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
---------------	-------------------	-----------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR061020
Form No. F/BR/ICF/002

Type : WGACCN

Built Year : 2006

Make : RCF

Valid From: 02/04/2015

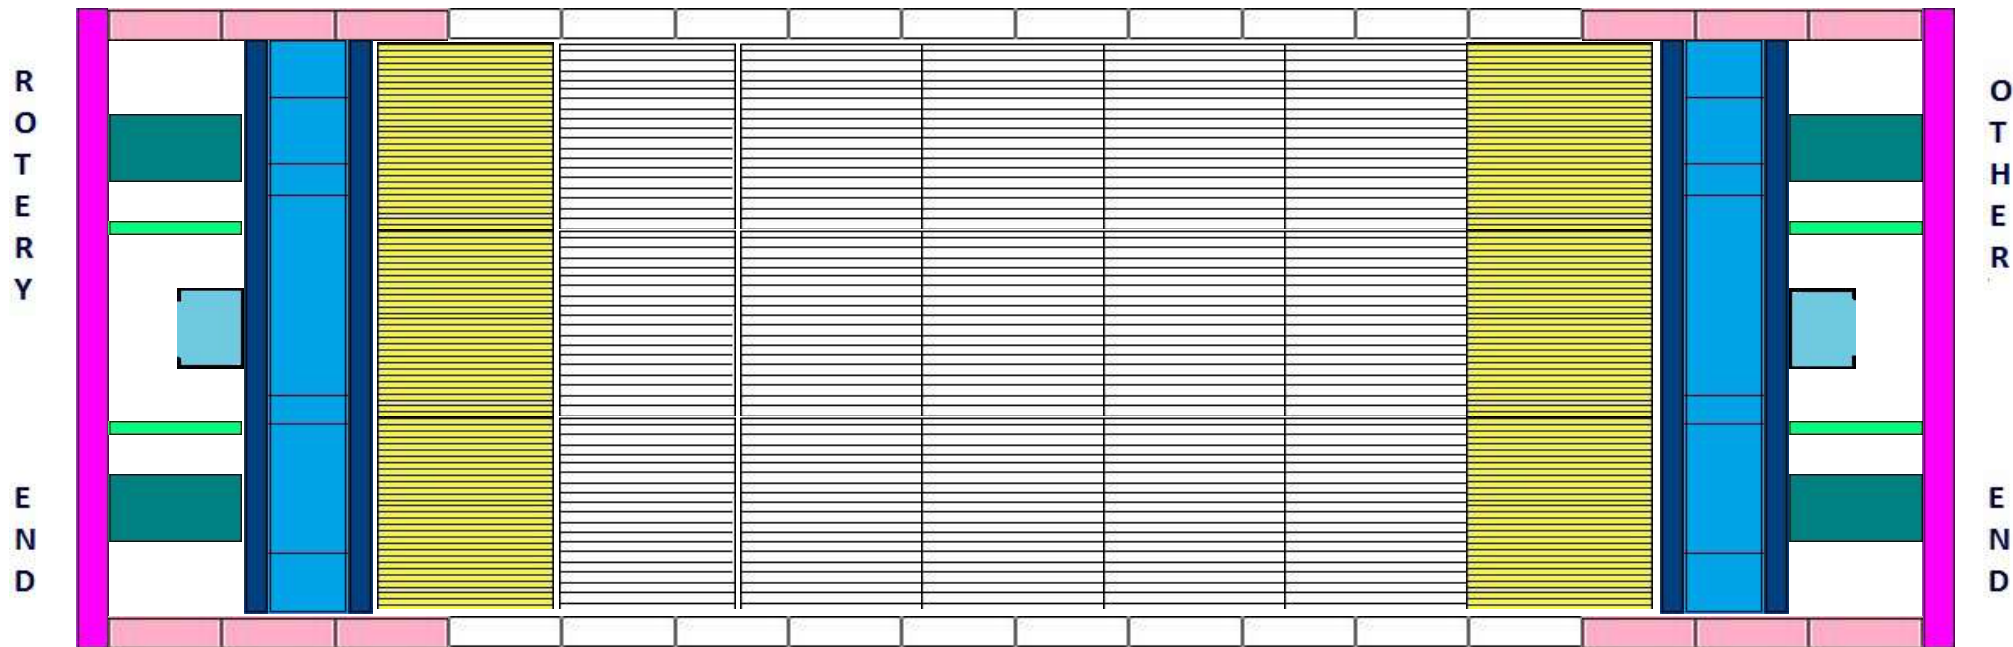

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
 	Headstock Beam	2	100%	 	Centre Stiffner for Headstock	4	100%	 	Floor Stiffner for Headstock	4	100%
 	Aux. Head stock	4	100%	 	Sole Bar	6	38%	 	Draft Gear Bracket	2	100%
 	Trough floor	2	29%	 	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	6	38%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		3%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 2, WEST : 3 Other End - EAST : 4, WEST : 4
Start Date : 24-Oct-2019, Completion Date : 02-Nov-2019, Net Repair Days : 9, Total Man Hours : 1372

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR052660


Type : CN

Built Year : 2005

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

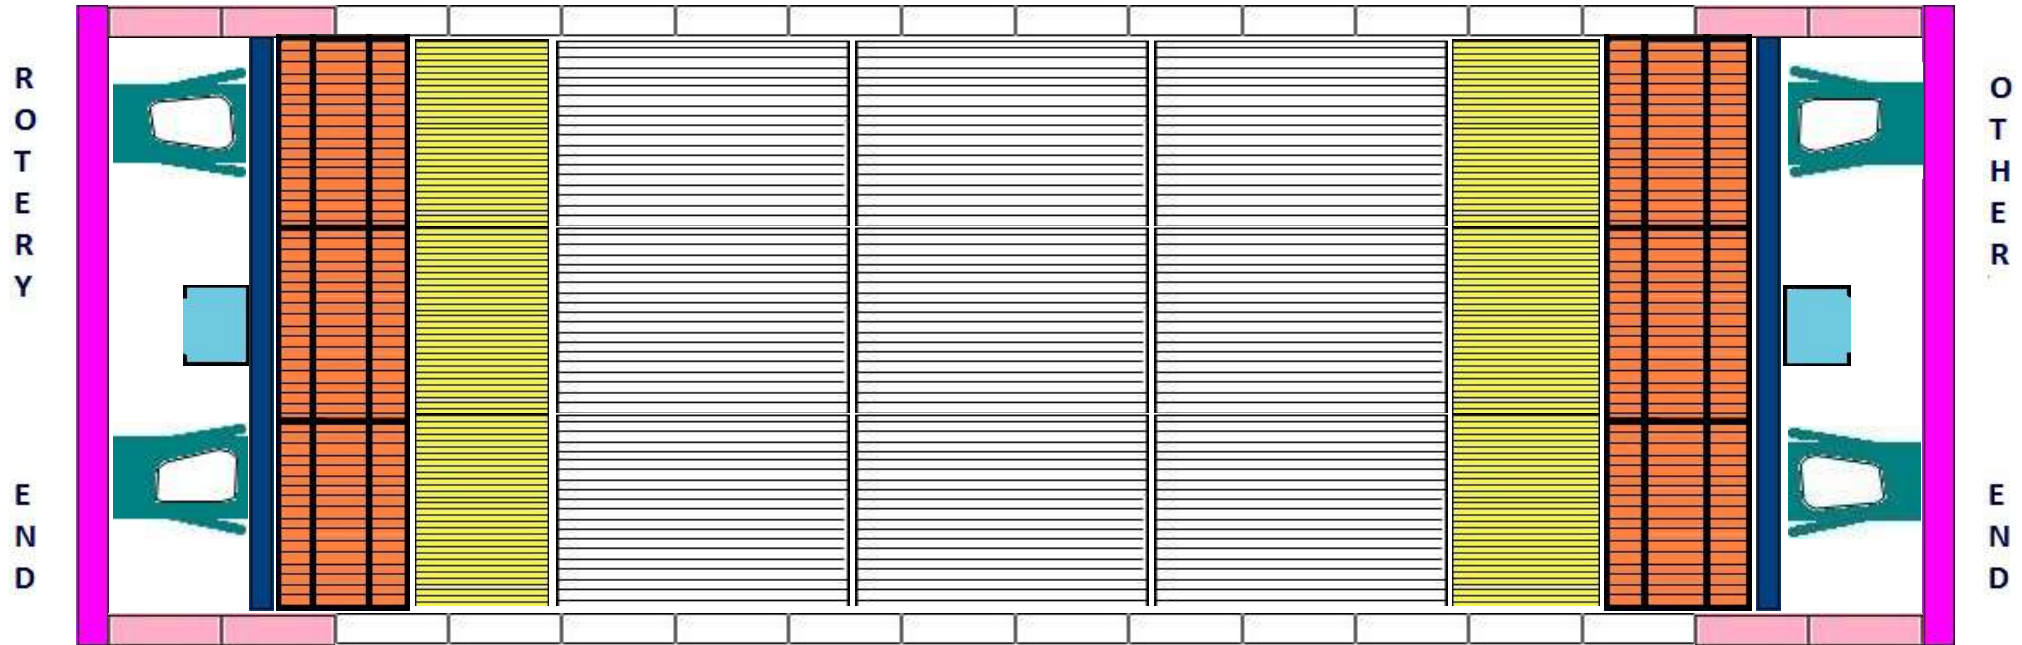

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	7	18%
	Window Bar	30	16%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 07-Nov-2019, Completion Date : 16-Nov-2019, Net Repair Days : 9, Total Man Hours : 912

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
--------------------	------------------	--------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR072460


Type : WGSCN

Built Year : 2007

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

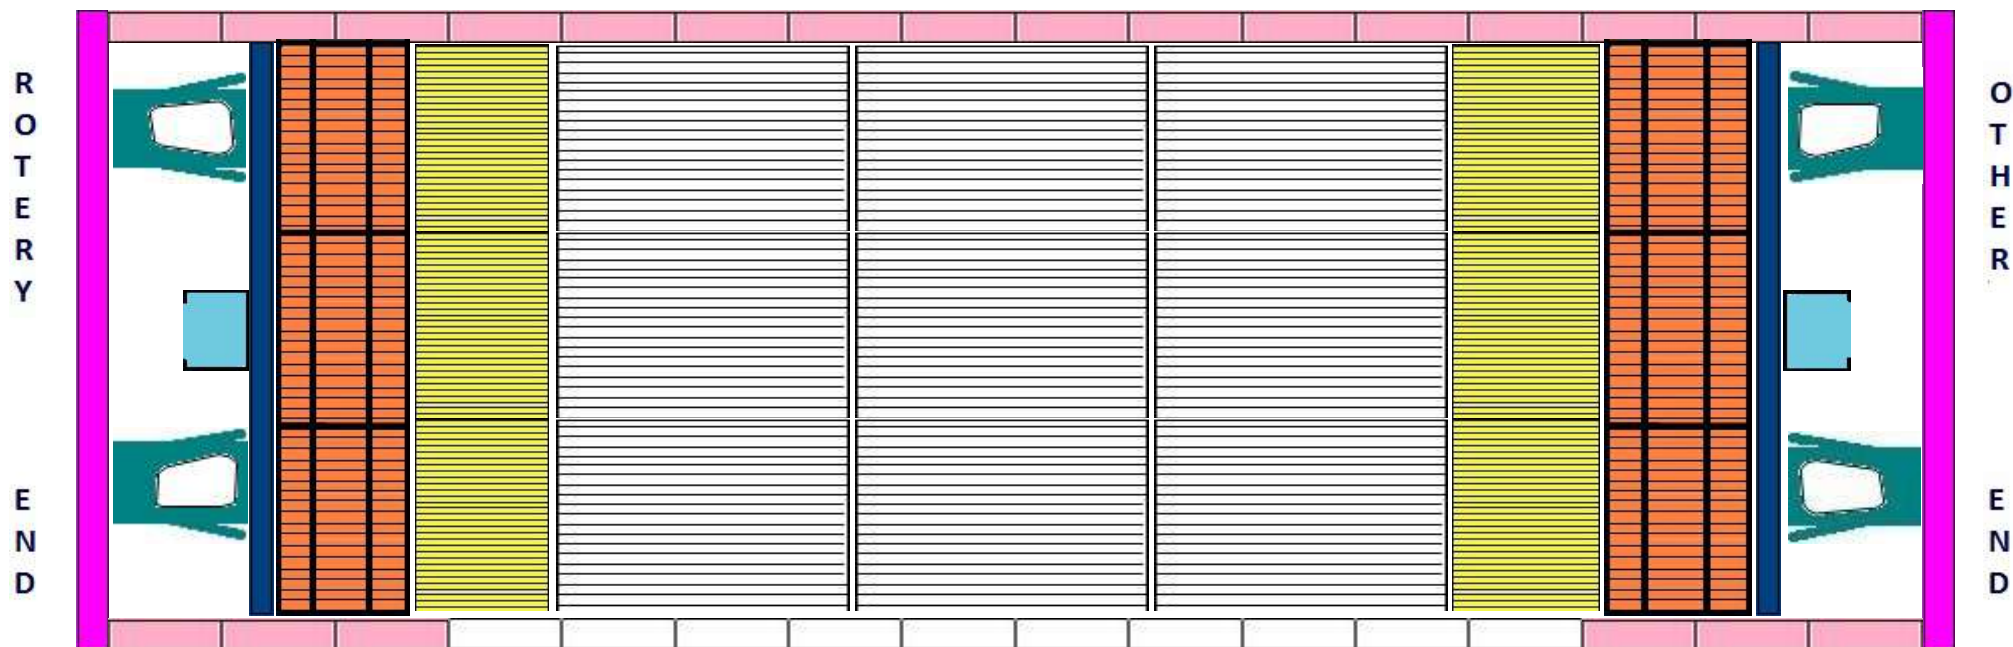

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	11	69%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	11	69%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	7	18%
	Window Bar	26	14%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	61	100%								

End Drooping: Rotary End - EAST : -5, WEST : 0 Other End - EAST : -5, WEST : -2

Start Date : 18-Nov-2019, Completion Date : 25-Nov-2019, Net Repair Days : 7, Total Man Hours : 1348

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
------------------	--------------------	--------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR074434


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

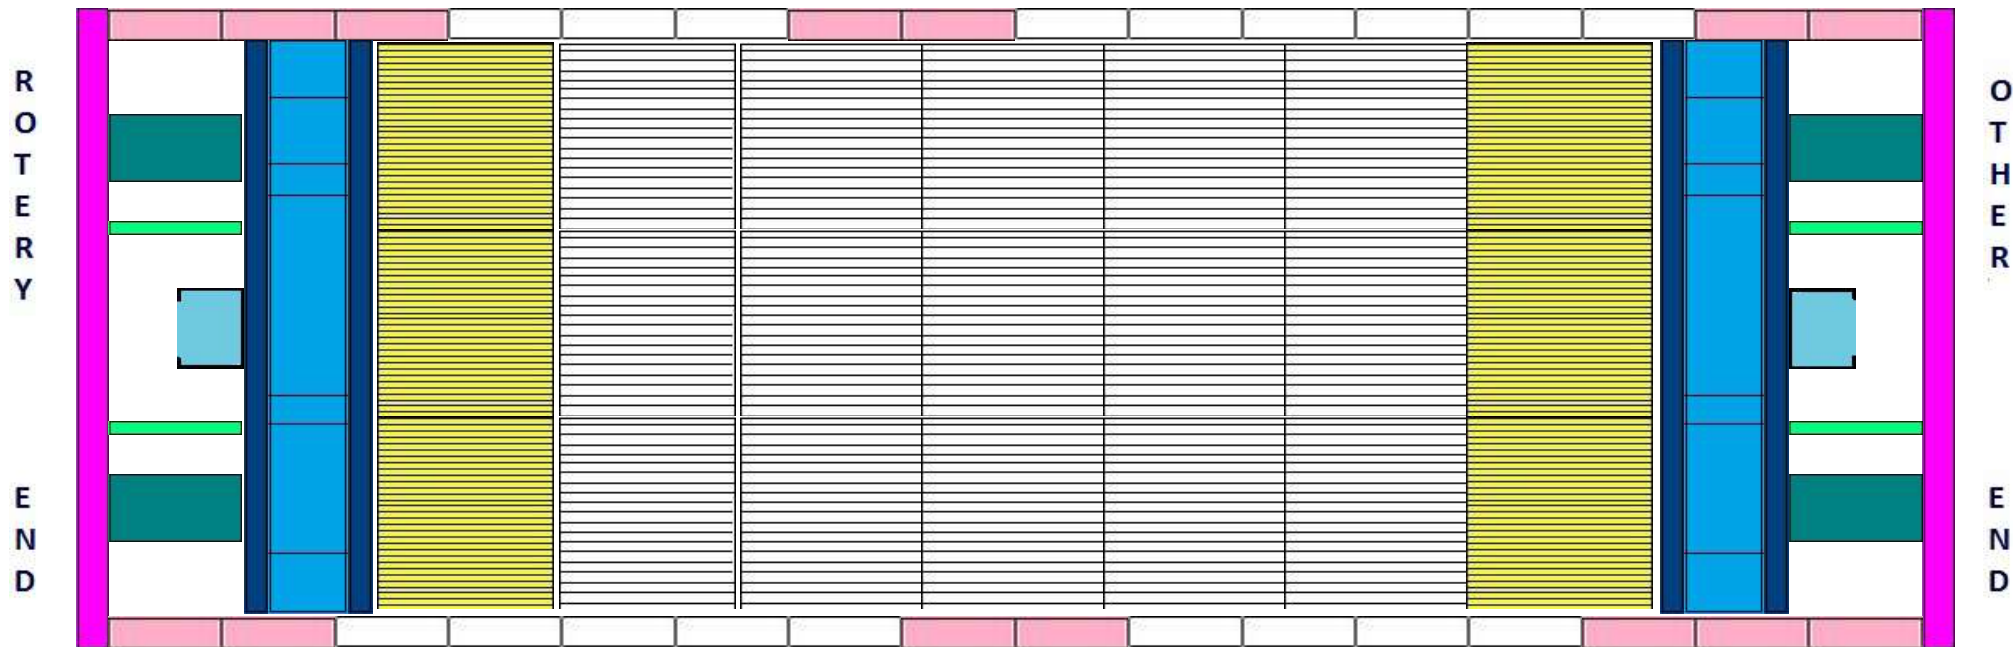

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	7	44%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	7	44%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	50	28%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -3, WEST : -6 Other End - EAST : 0, WEST : 0
Start Date : 09-Dec-2019, Completion Date : 19-Dec-2019, Net Repair Days : 10, Total Man Hours : 1632

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR064321


Type : GS

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

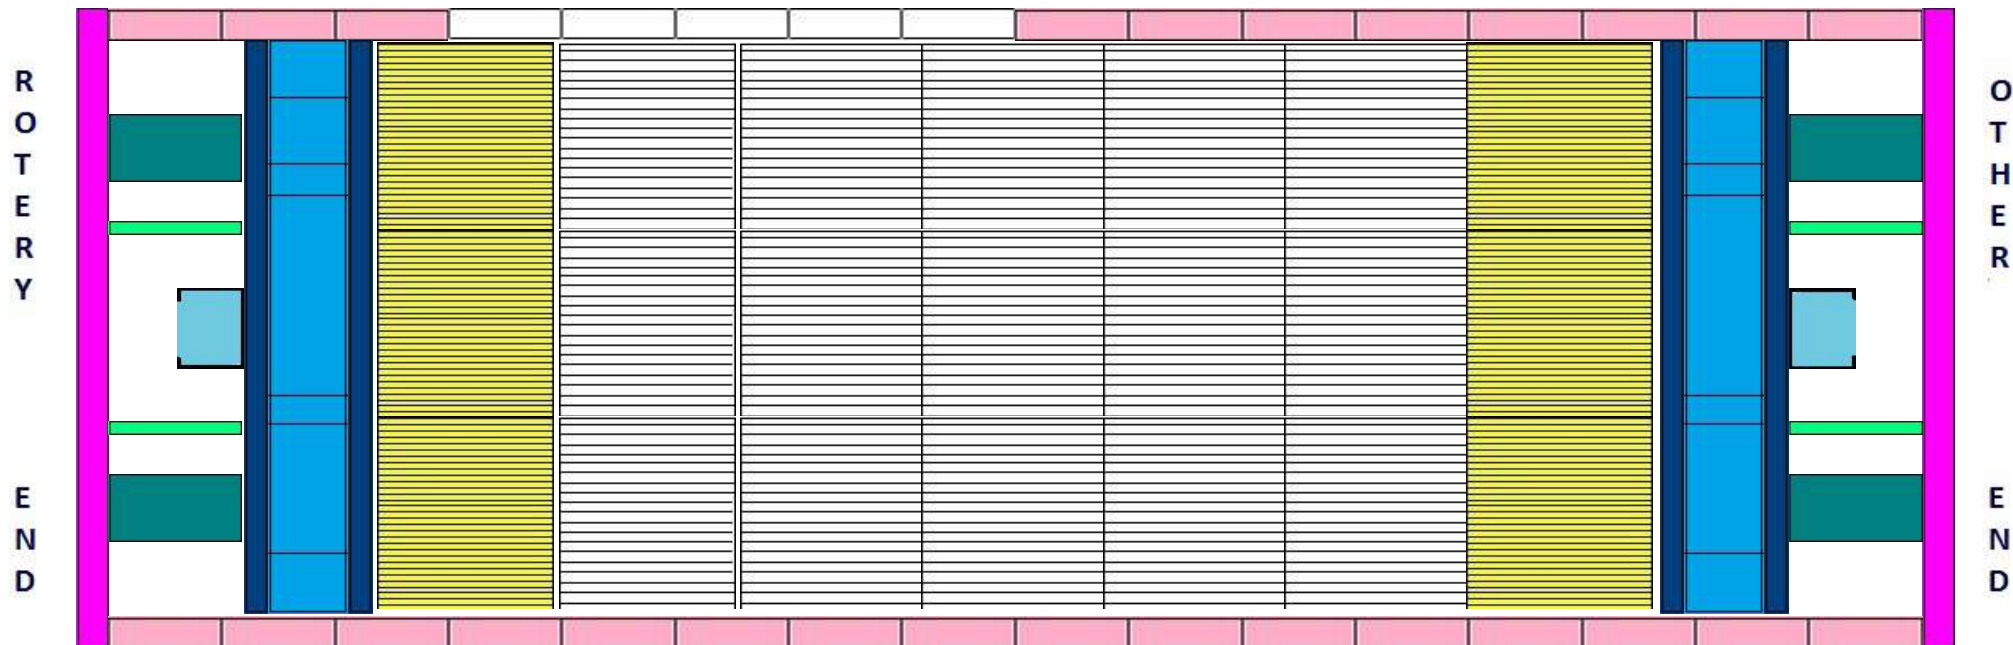

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	13.5	84%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	13.5	84%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -6, WEST : -8 Other End - EAST : 7, WEST : 6

Start Date : 13-Dec-2019, Completion Date : 19-Dec-2019, Net Repair Days : 6, Total Man Hours : 1956

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR072200


Type : WGSCN

Built Year : 2007

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

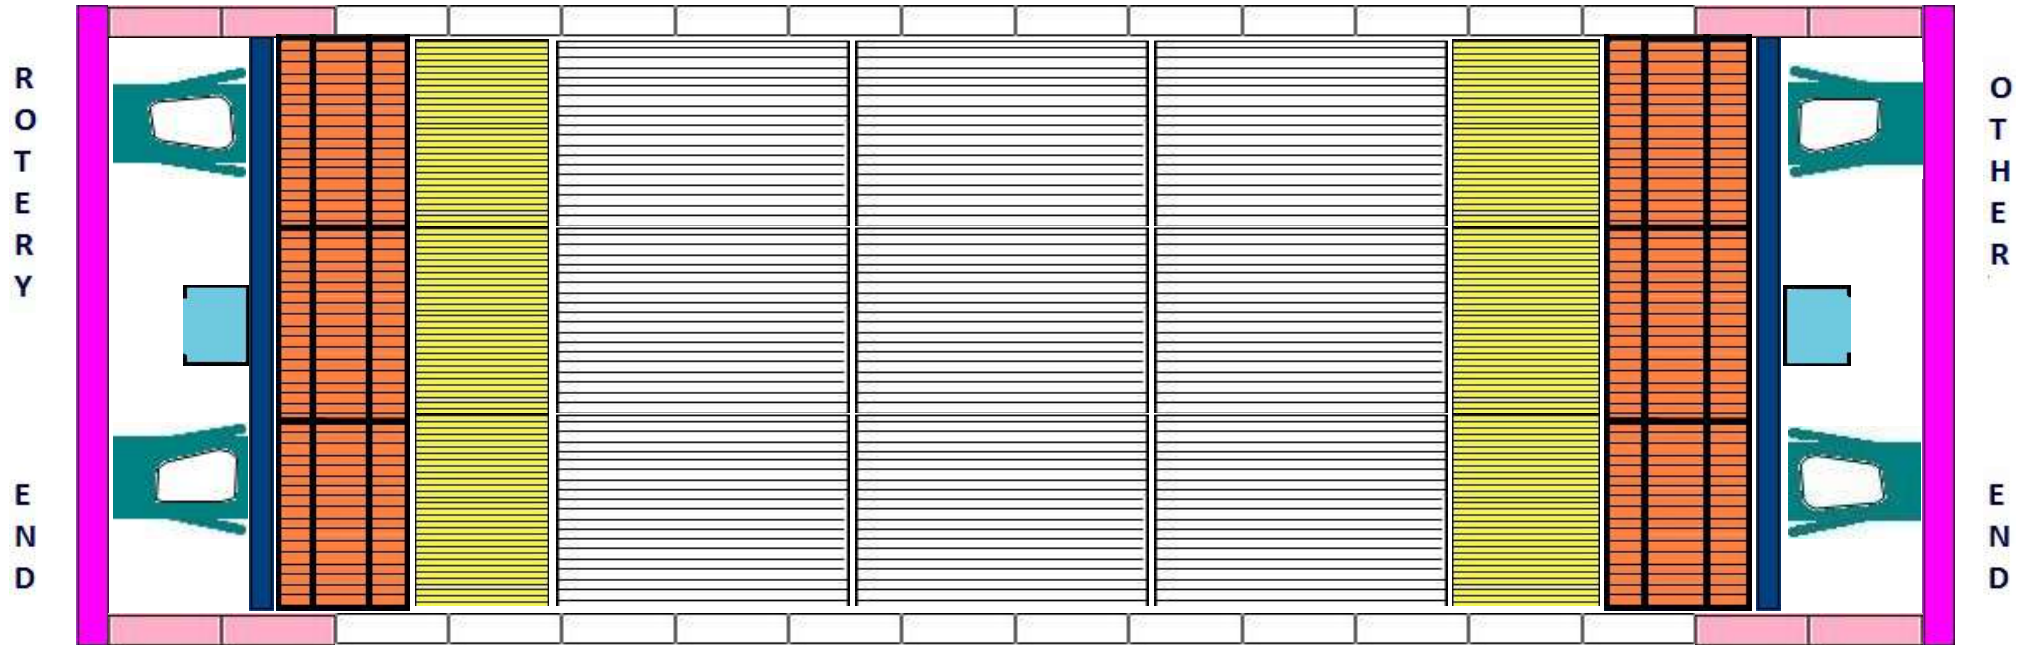

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	0	0%
	Window Bar	32	17%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : -7, WEST : -10 Other End - EAST : -10, WEST : -10
Start Date : 09-Dec-2019, Completion Date : 14-Dec-2019, Net Repair Days : 6, Total Man Hours : 1416

HAMANT JADAV - JE	M L KOLI - JE	T K PANJA - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
-------------------	---------------	-----------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR063080


Type : WGSCN

Built Year : 2006

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

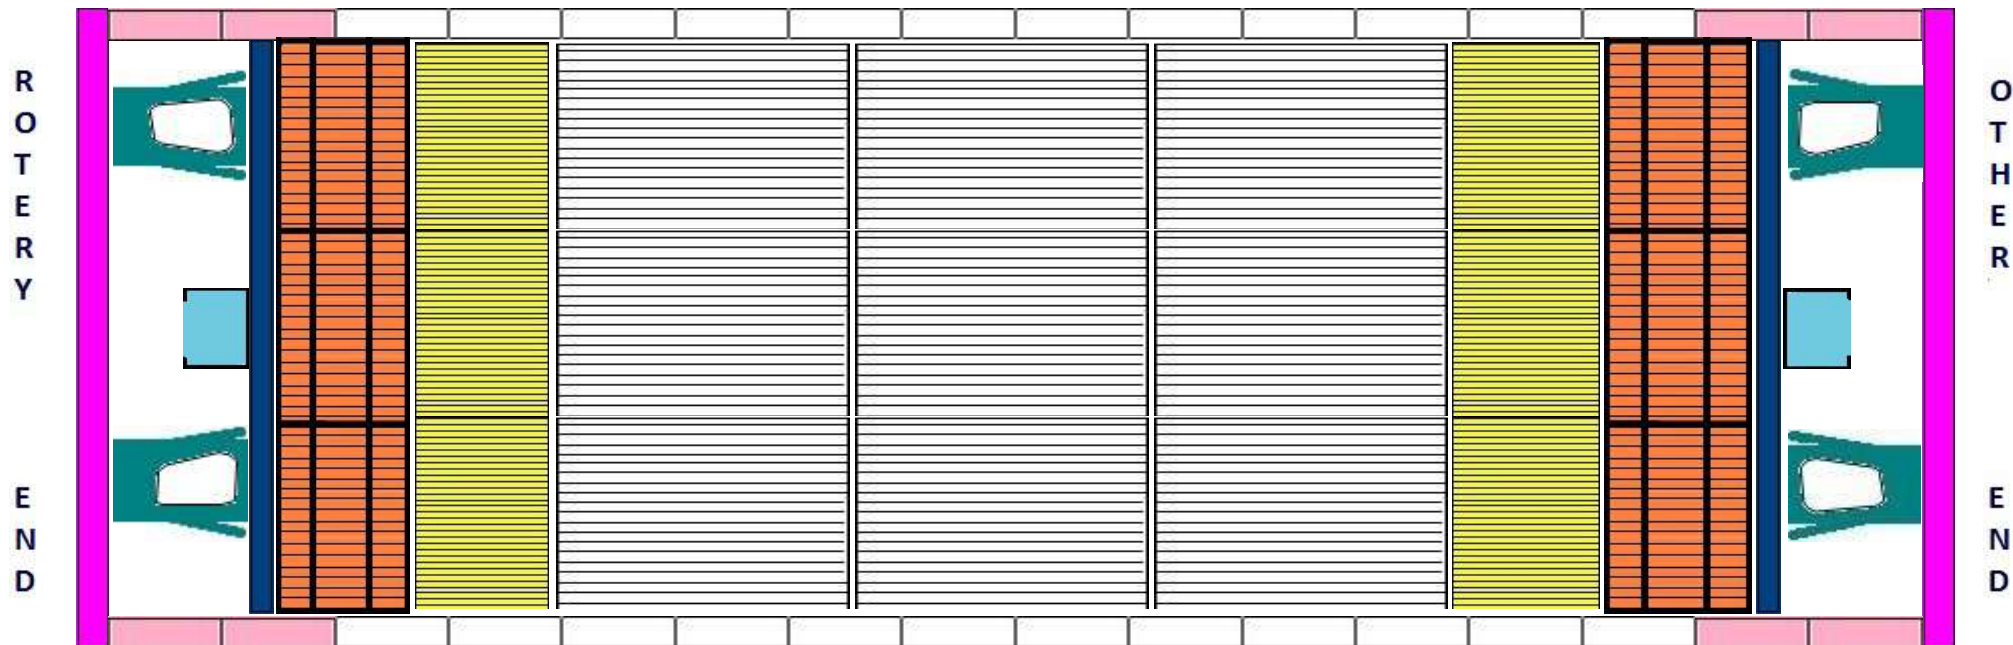

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	14	35%
	Window Bar	30	16%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : -3, WEST : -2 Other End - EAST : 2, WEST : 0
Start Date : 04-Dec-2019, Completion Date : 12-Dec-2019, Net Repair Days : 8, Total Man Hours : 0

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
------------------	----------------------	------------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR074102
Form No. F/BR/ICF/002

Type : GS

Built Year : 2007

Make : ICF

Valid From: 02/04/2015

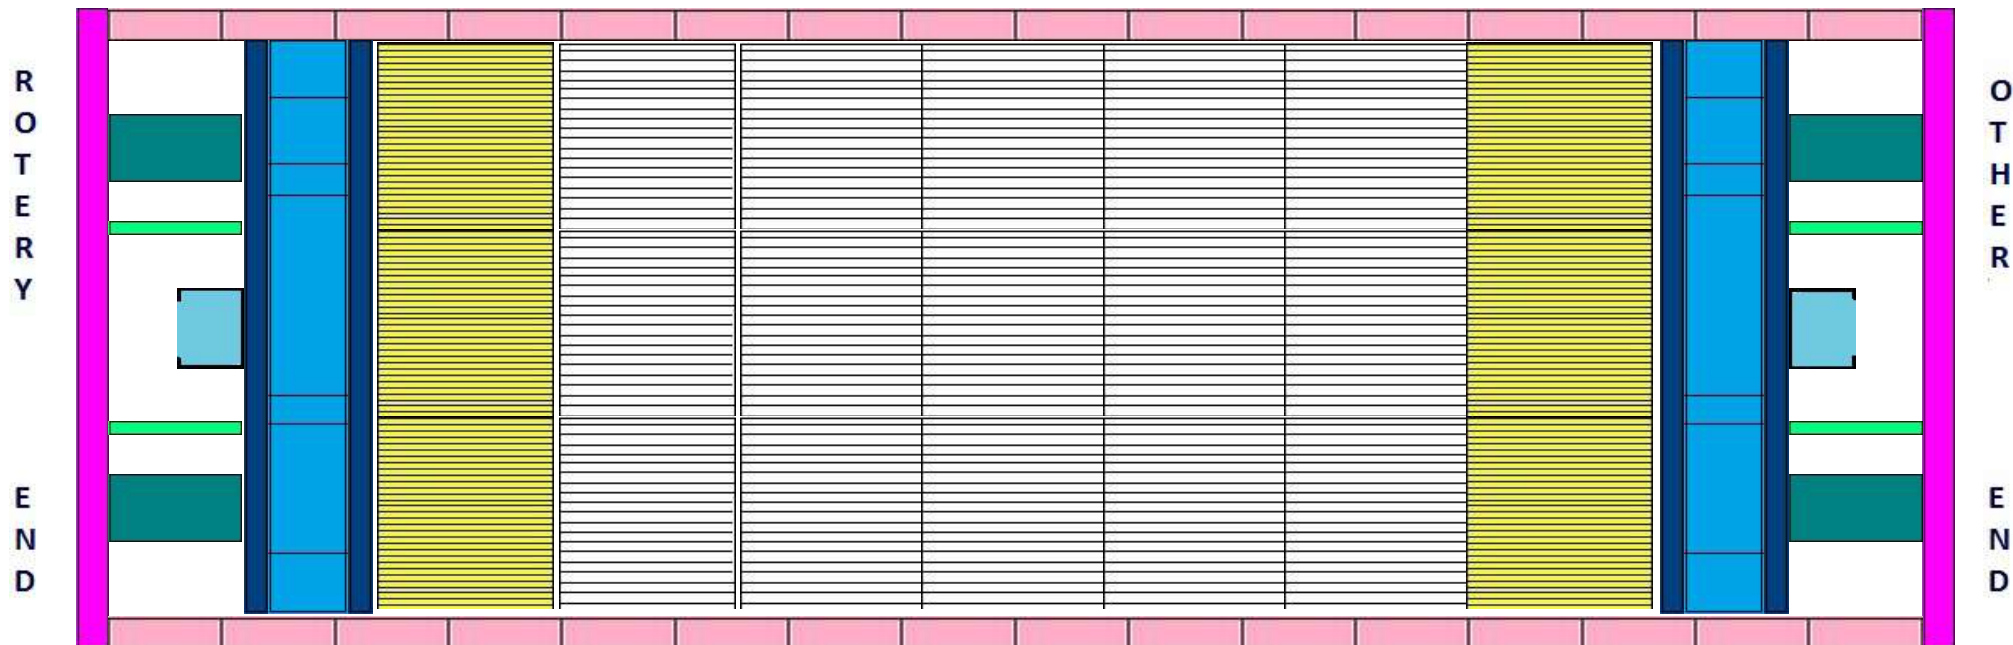

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	100	57%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 4 Other End - EAST : 5, WEST : 6
Start Date : 27-Dec-2019, Completion Date : 04-Jan-2020, Net Repair Days : 8, Total Man Hours : 1204

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR076043
Form No. F/BR/ICF/002

Type : WGSCZ

Built Year : 2007

Make : ICF

Valid From: 02/04/2015

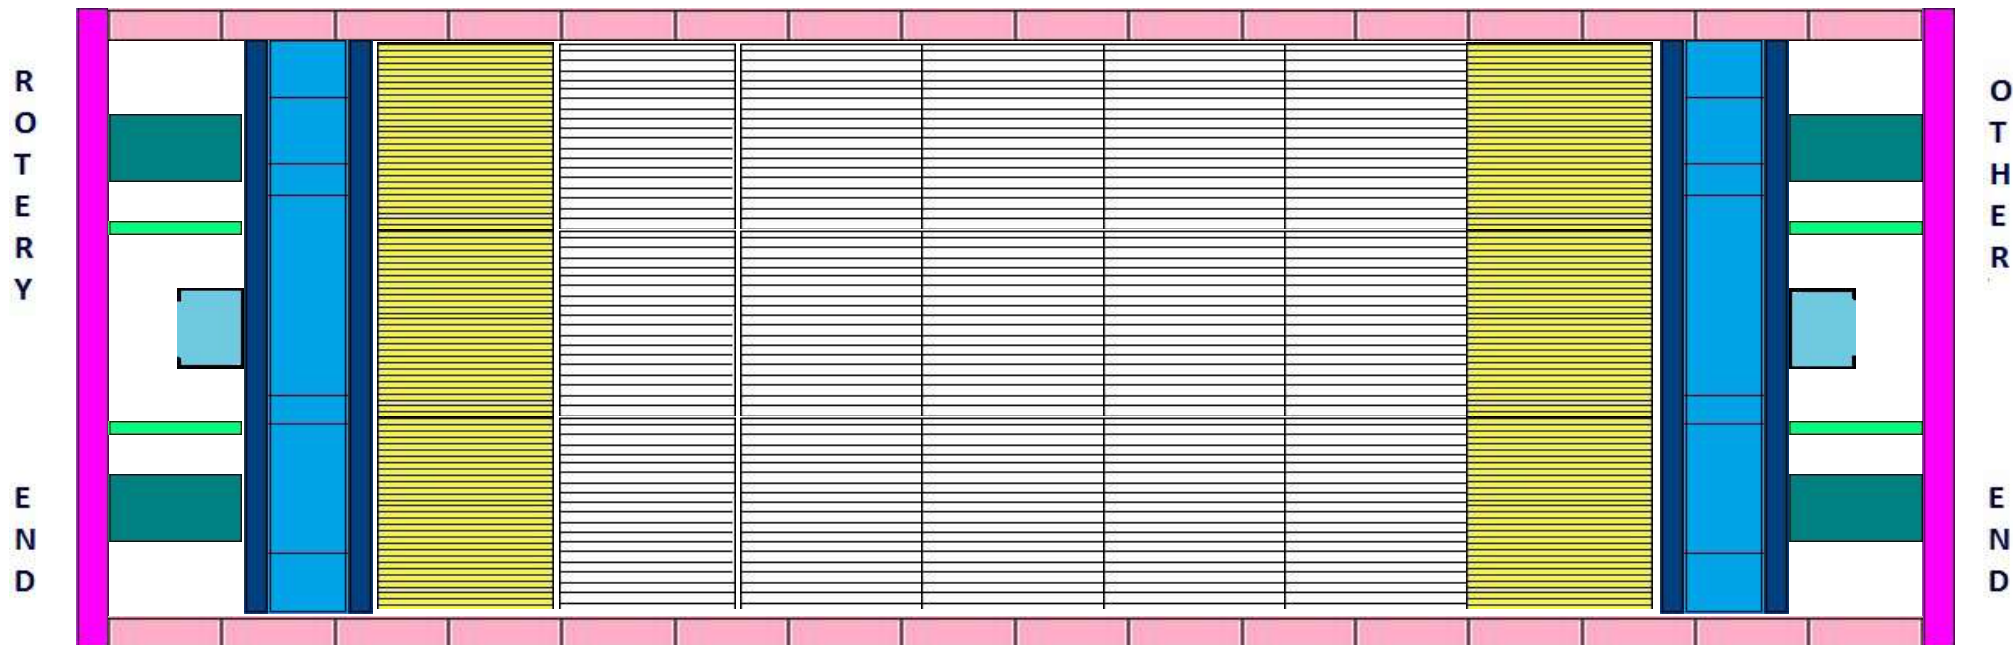

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Bright Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	22	55%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -8, WEST : -5 Other End - EAST : -8, WEST : -4
Start Date : 31-Dec-2019, Completion Date : 07-Jan-2020, Net Repair Days : 7, Total Man Hours : 932

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR064511


Type : GS

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

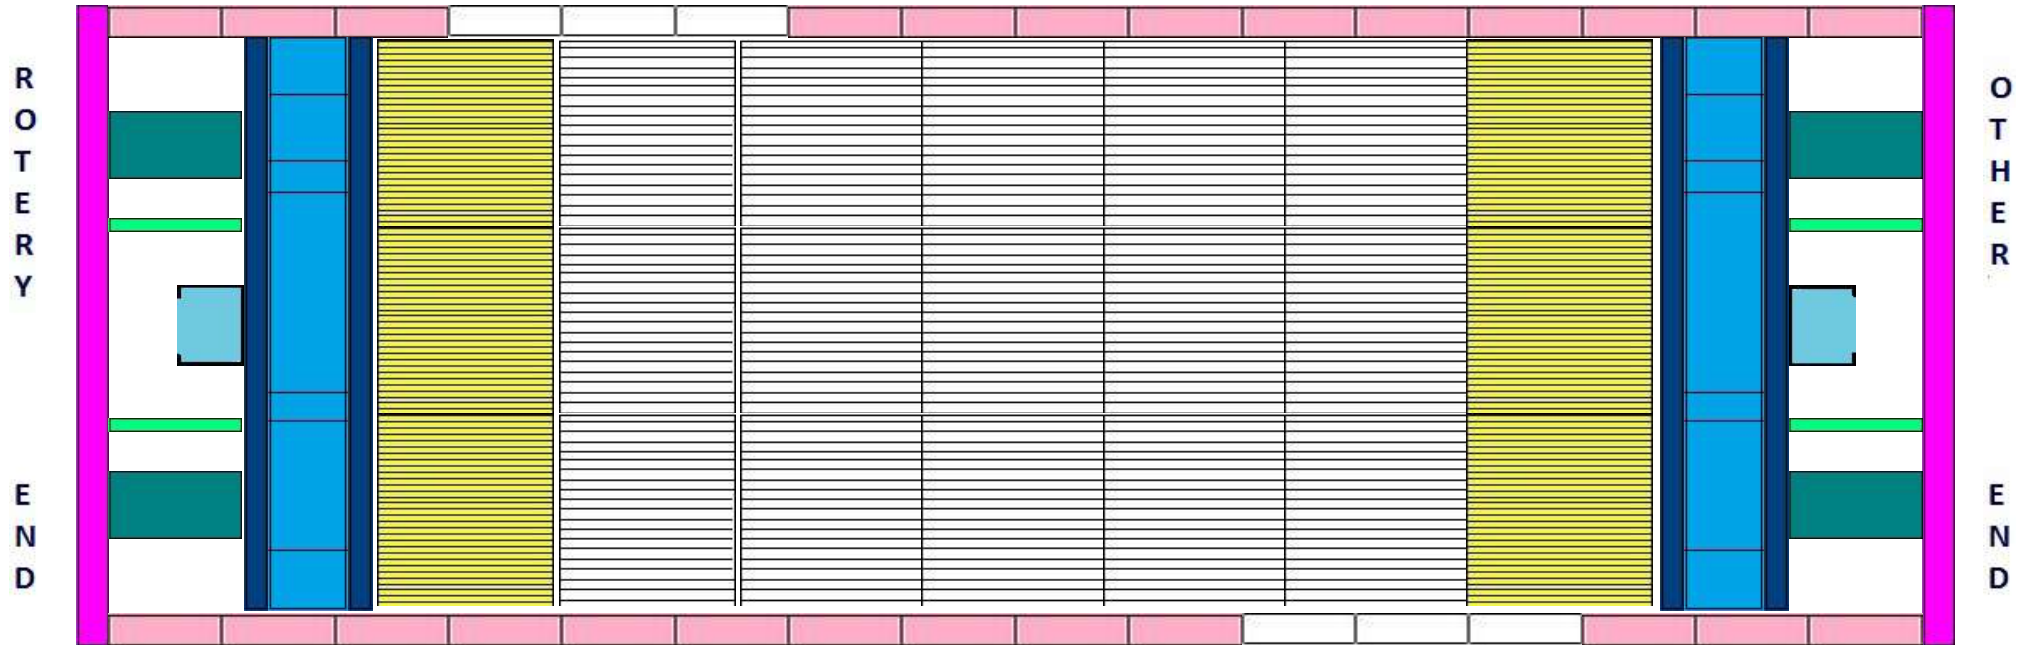

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	13	81%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	13	81%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	30	75%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -6, WEST : -5 Other End - EAST : -3, WEST : -10
Start Date : 06-Jun-2019, Completion Date : 14-Jun-2019, Net Repair Days : 8, Total Man Hours : 1428

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR064521


Type : GS

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

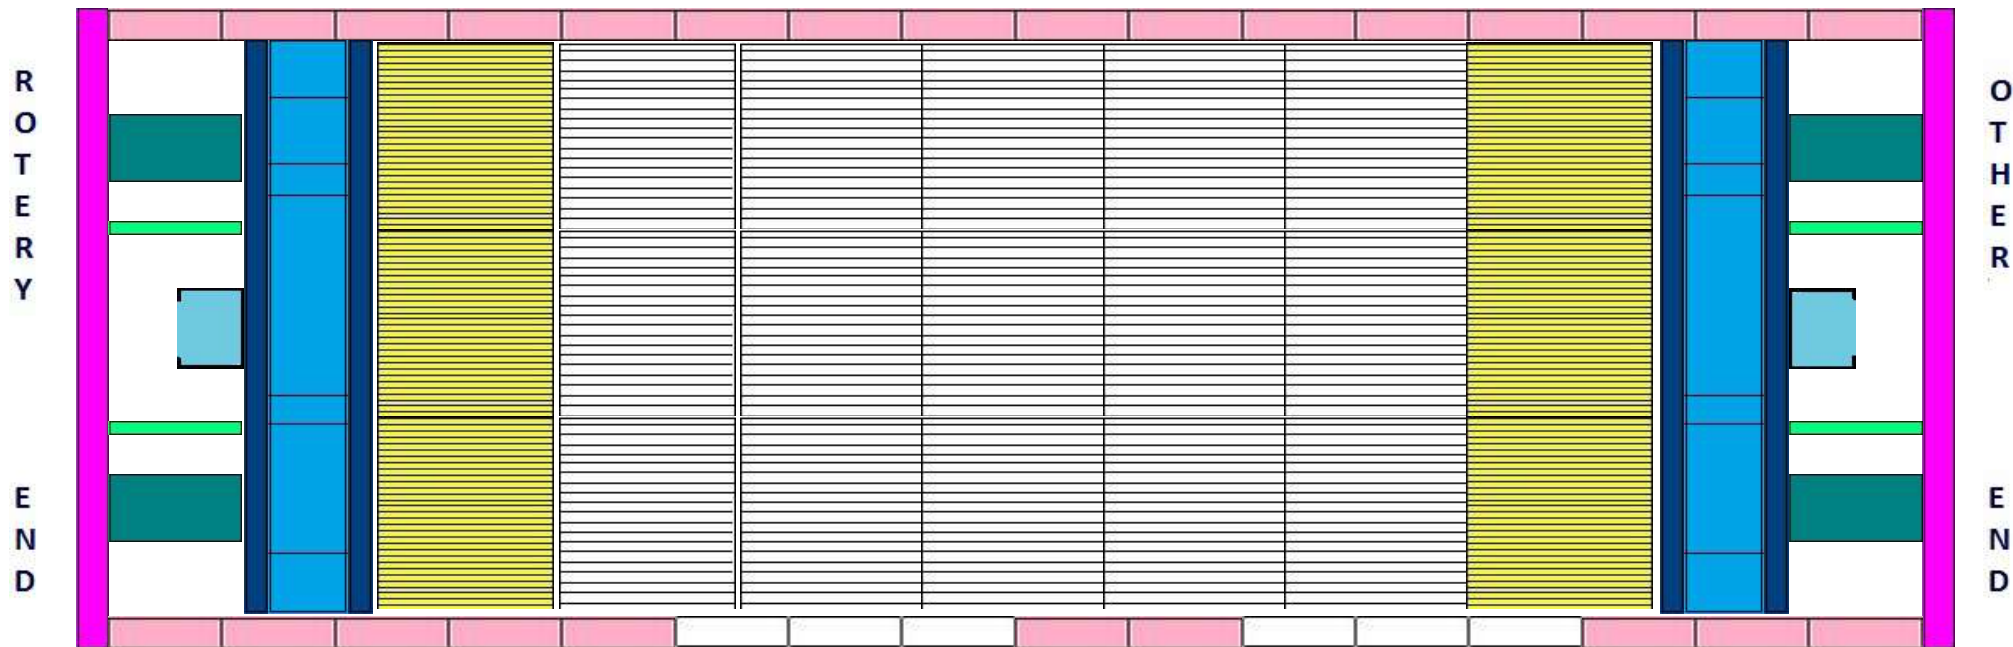

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	13	81%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	13	81%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	35%		Window Bar	46	26%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -4, WEST : 9 Other End - EAST : 5, WEST : 4
Start Date : 31-May-2019, Completion Date : 11-Jun-2019, Net Repair Days : 10, Total Man Hours : 1144

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR064100


Type : GS

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

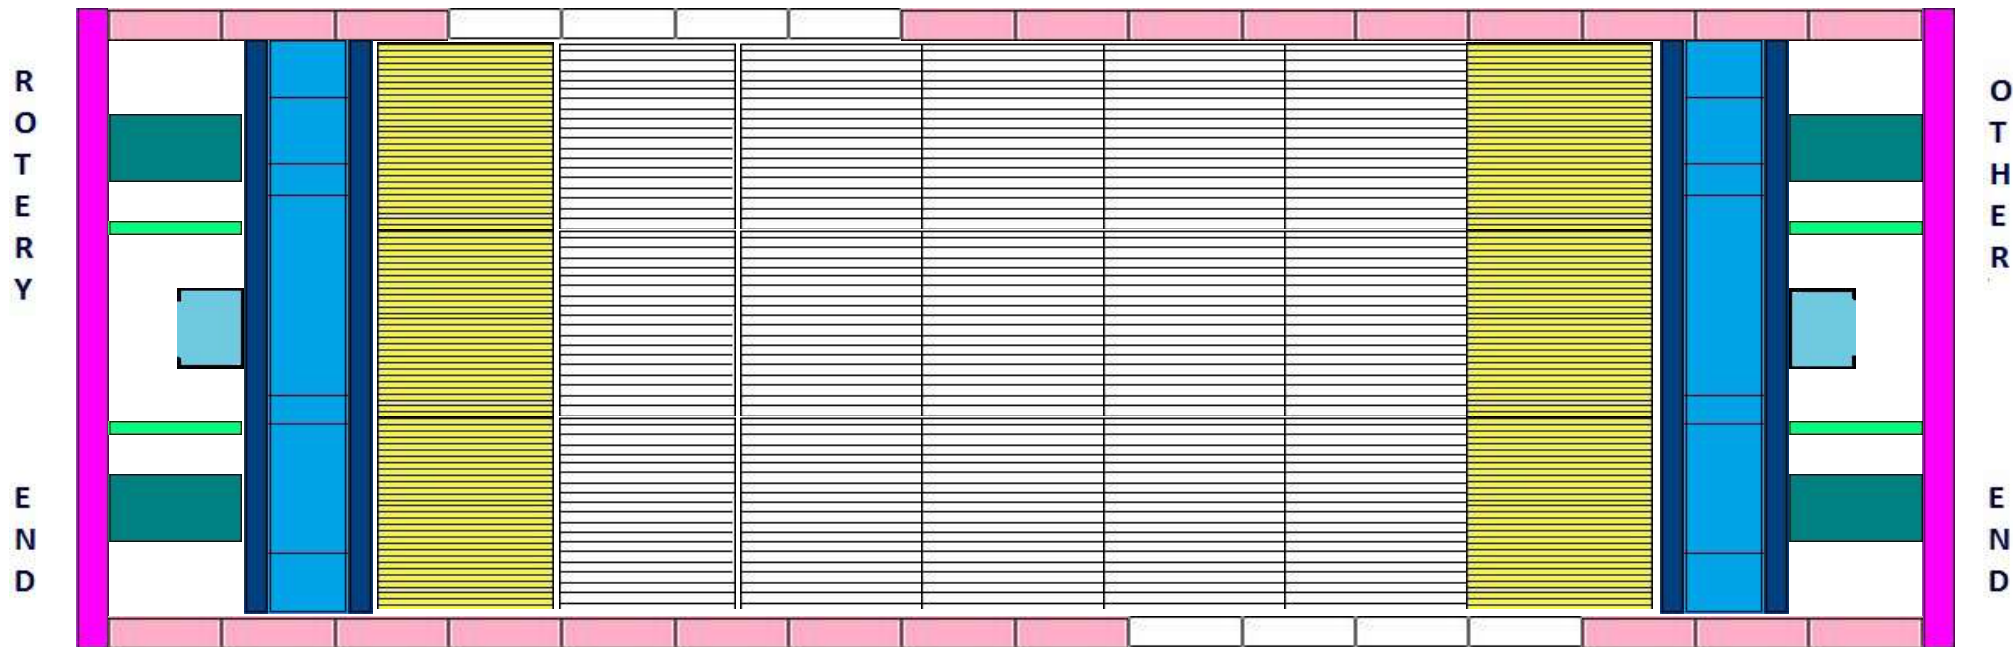

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	12	75%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	12	75%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 6, WEST : 5 Other End - EAST : 5, WEST : 5
Start Date : 07-Jun-2019, Completion Date : 18-Jun-2019, Net Repair Days : 10, Total Man Hours : 1456

M L KOLI - JE	HAMANT JADAV - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR062570
Form No. F/BR/ICF/002

Type : WGSCN

Built Year : 2006

Make : RCF

Valid From: 02/04/2015

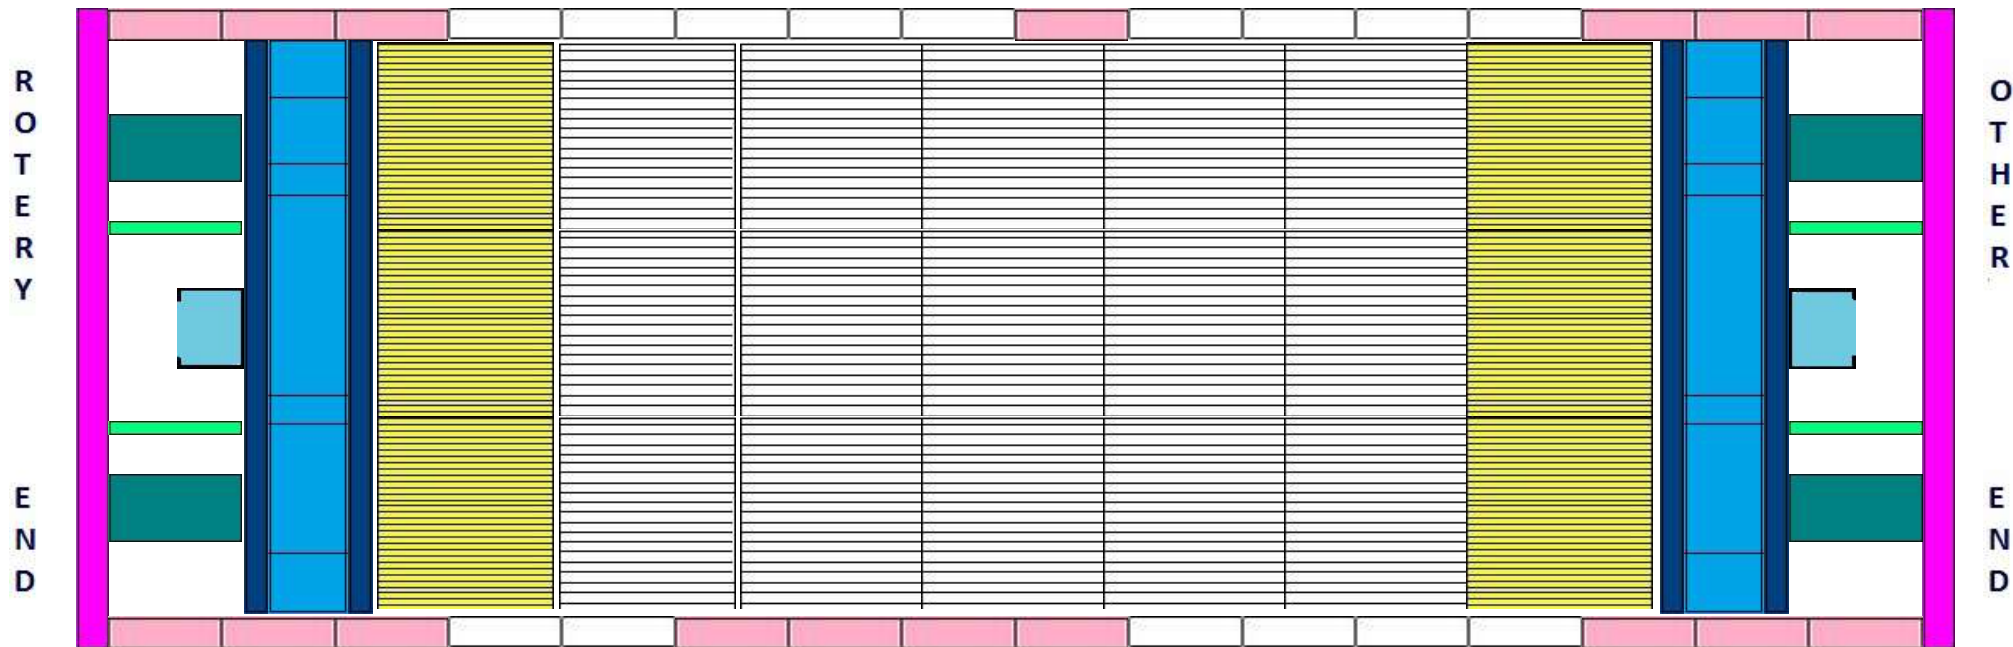

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	8.5	53%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	8.5	53%		Body panel/patch		100%		Door Top/Roof Patch		100%
	Window Module		0%		Window Sill	40	100%		Window Bar	48	26%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -6, WEST : -2 Other End - EAST : 5, WEST : 5
Start Date : 11-Dec-2019, Completion Date : 17-Dec-2019, Net Repair Days : 6, Total Man Hours : 1784

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062921


Type : CN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

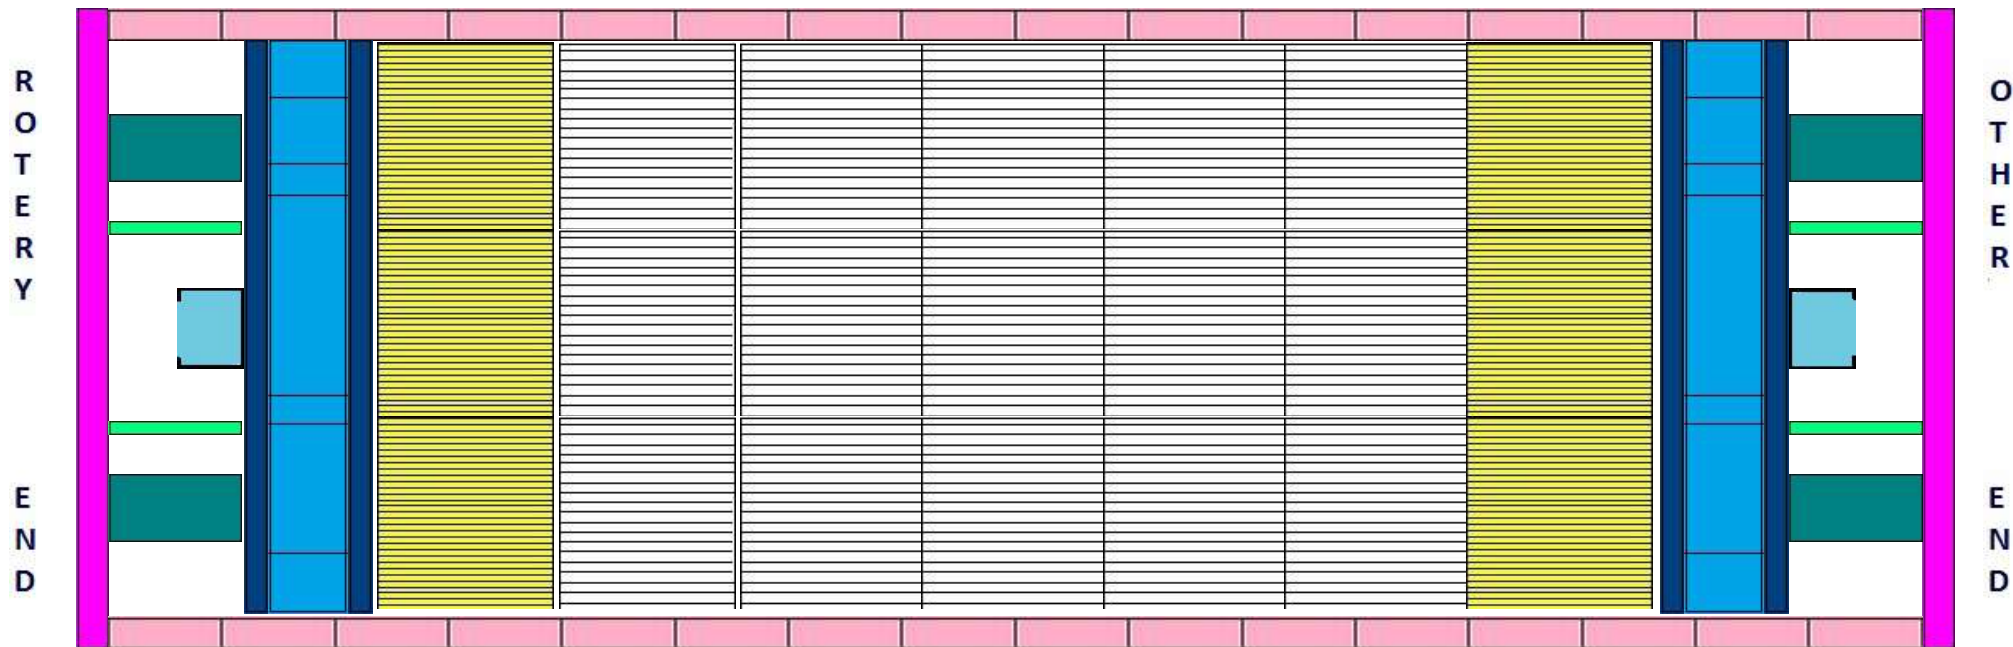

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	7	18%		Window Bar	20	11%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 4, WEST : 5 Other End - EAST : 6, WEST : 5
Start Date : 19-Aug-2019, Completion Date : 27-Aug-2019, Net Repair Days : 8, Total Man Hours : 1669

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062871


Type : CN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

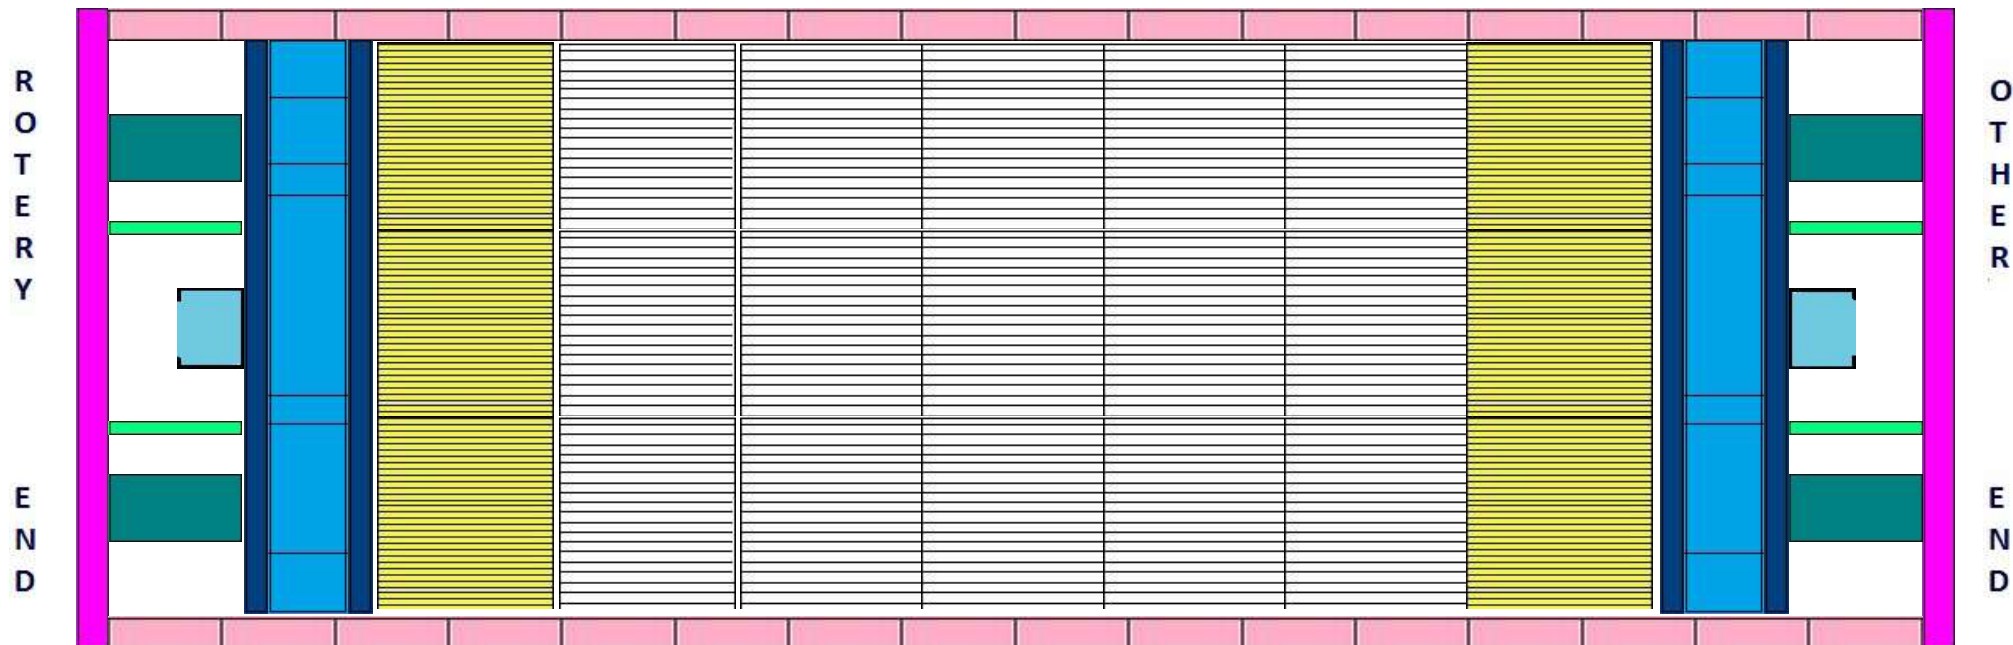

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	40	22%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -10, WEST : -10 Other End - EAST : -2, WEST : -6
Start Date : 07-Jun-2019, Completion Date : 19-Jun-2019, Net Repair Days : 11, Total Man Hours : 1607

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR063172


Type : WGSCN

Built Year : 2006

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

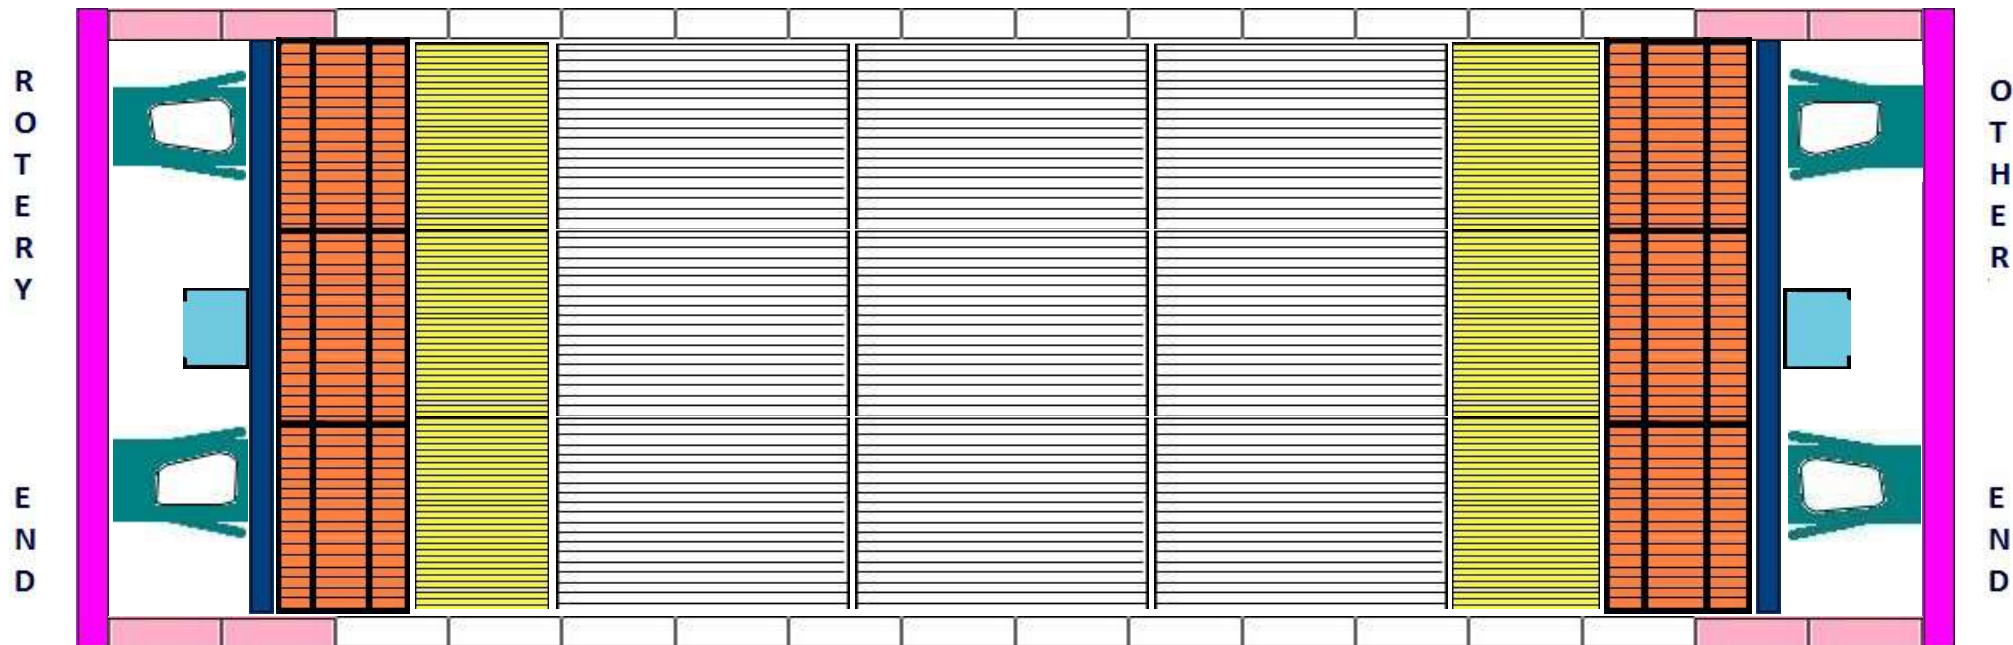

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	8	20%
	Window Bar	10	5%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 19-Jun-2019, Completion Date : 27-Jun-2019, Net Repair Days : 8, Total Man Hours : 1192

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
-------------------	--------------------	------------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR052464
Form No. F/BR/ICF/002

Type : WGSCN

Built Year : 2005

Make : ICF

Valid From: 02/04/2015

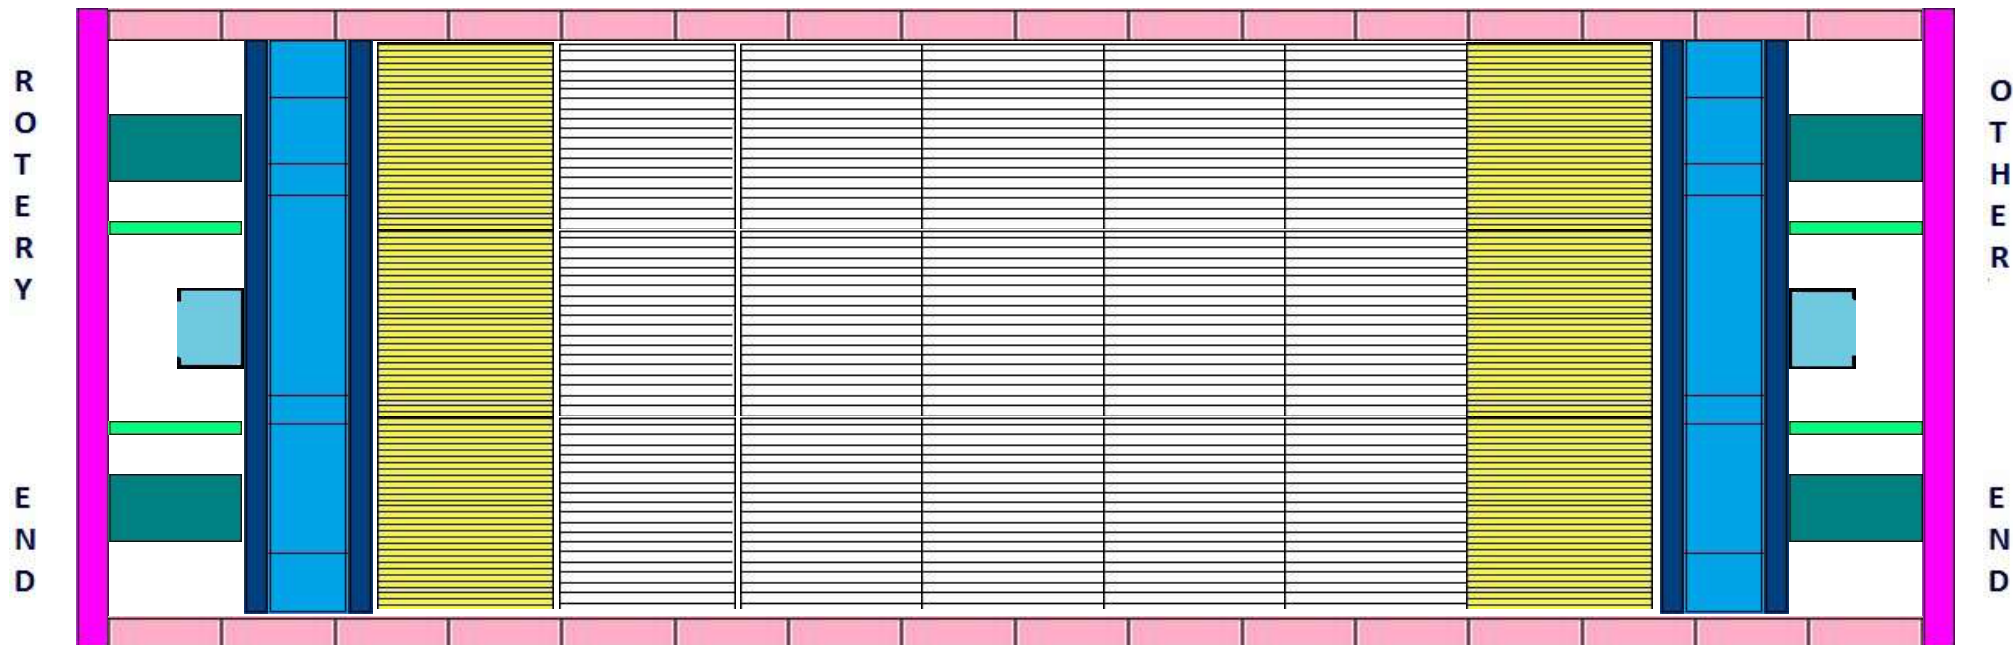

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	40	22%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : -3 Other End - EAST : 0, WEST : 0
Start Date : 13-Jun-2019, Completion Date : 20-Jun-2019, Net Repair Days : 7, Total Man Hours : 1368

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR044345


Type : GS

Built Year : 2004

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

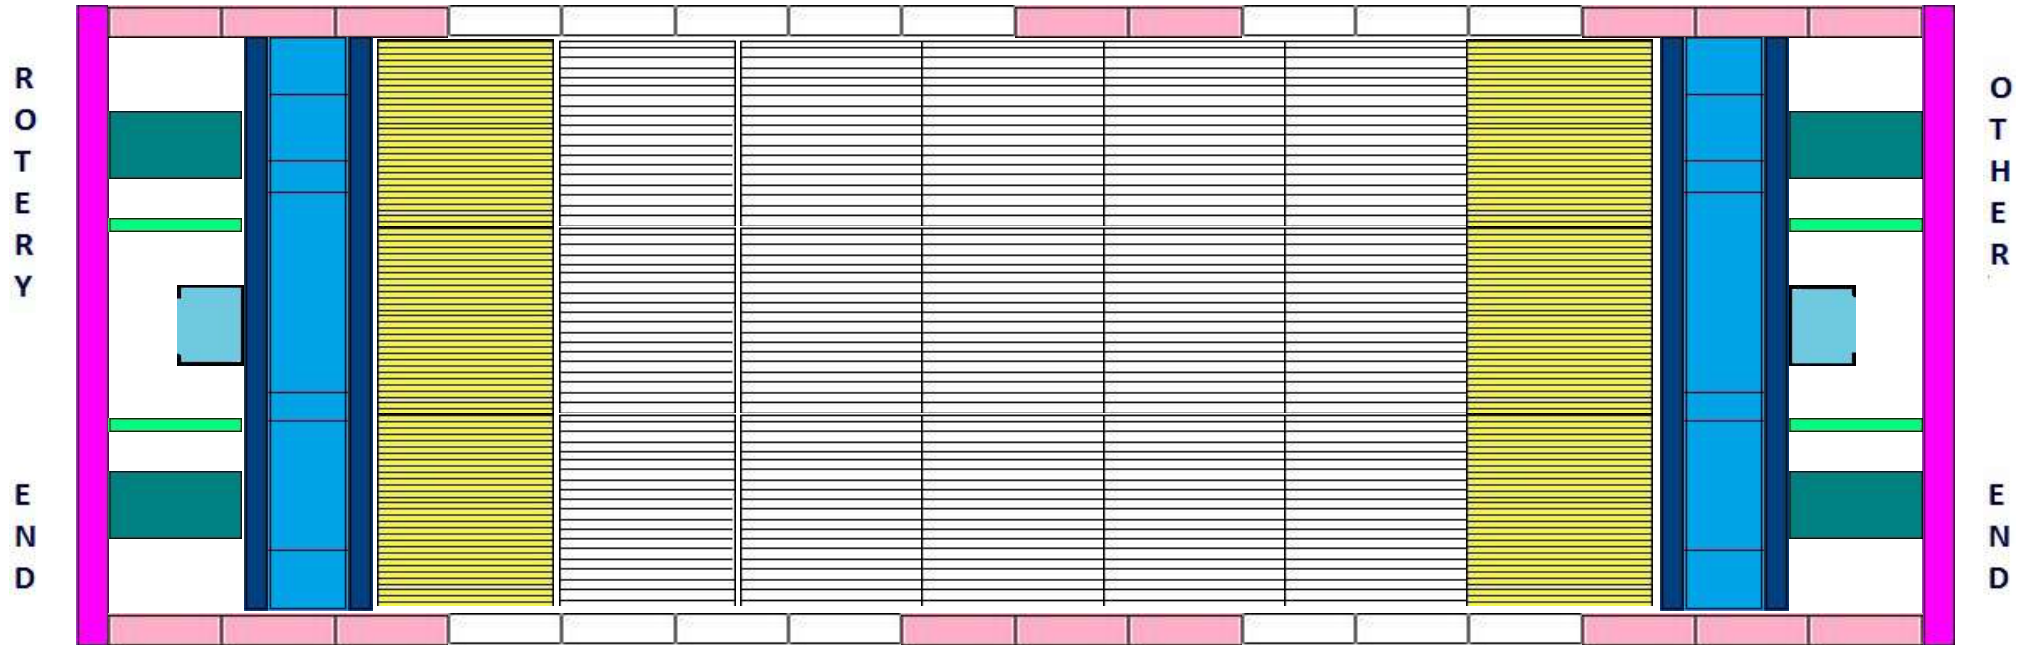

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	8.5	53%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8.5	53%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	52	29%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -4, WEST : -7 Other End - EAST : -7, WEST : -5
Start Date : 07-Jun-2019, Completion Date : 17-Jun-2019, Net Repair Days : 9, Total Man Hours : 1568

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR064371


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

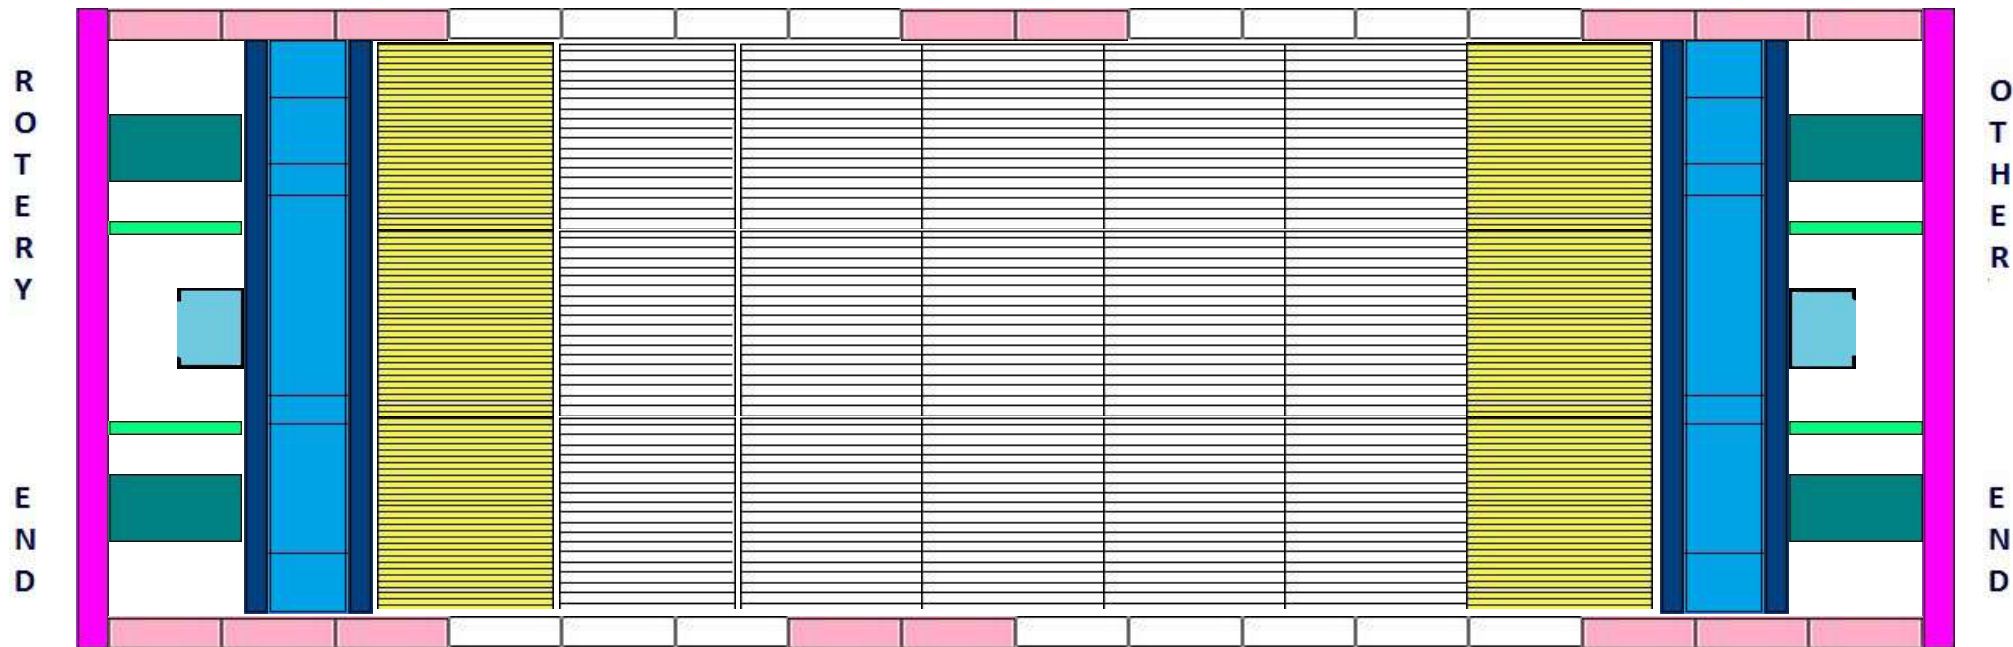

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	8	50%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8	50%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	32	80%		Window Bar	58	33%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 3 Other End - EAST : -2, WEST : -4
Start Date : 10-Jul-2019, Completion Date : 17-Jul-2019, Net Repair Days : 7, Total Man Hours : 1272

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR071250
Form No. F/BR/ICF/002

Type : WGACCN

Built Year : 2007

Make : RCF

Valid From: 02/04/2015

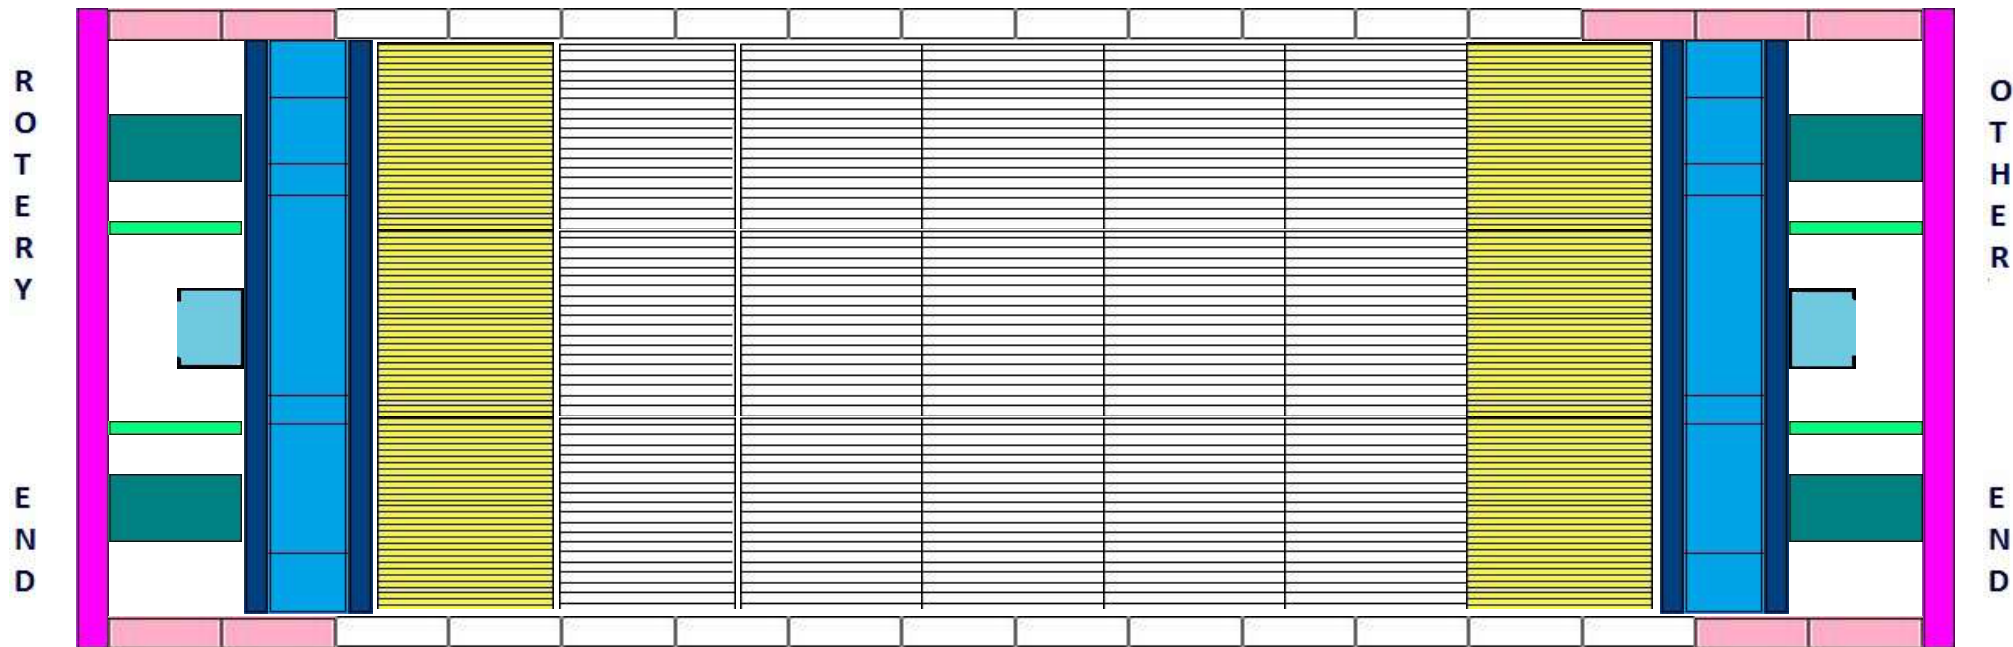

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	4.5	28%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4.5	28%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		3%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 6, WEST : 5 Other End - EAST : 6, WEST : 8
Start Date : 23-Jul-2019, Completion Date : 29-Jul-2019, Net Repair Days : 6, Total Man Hours : 932

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062831


Type : WGSCN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

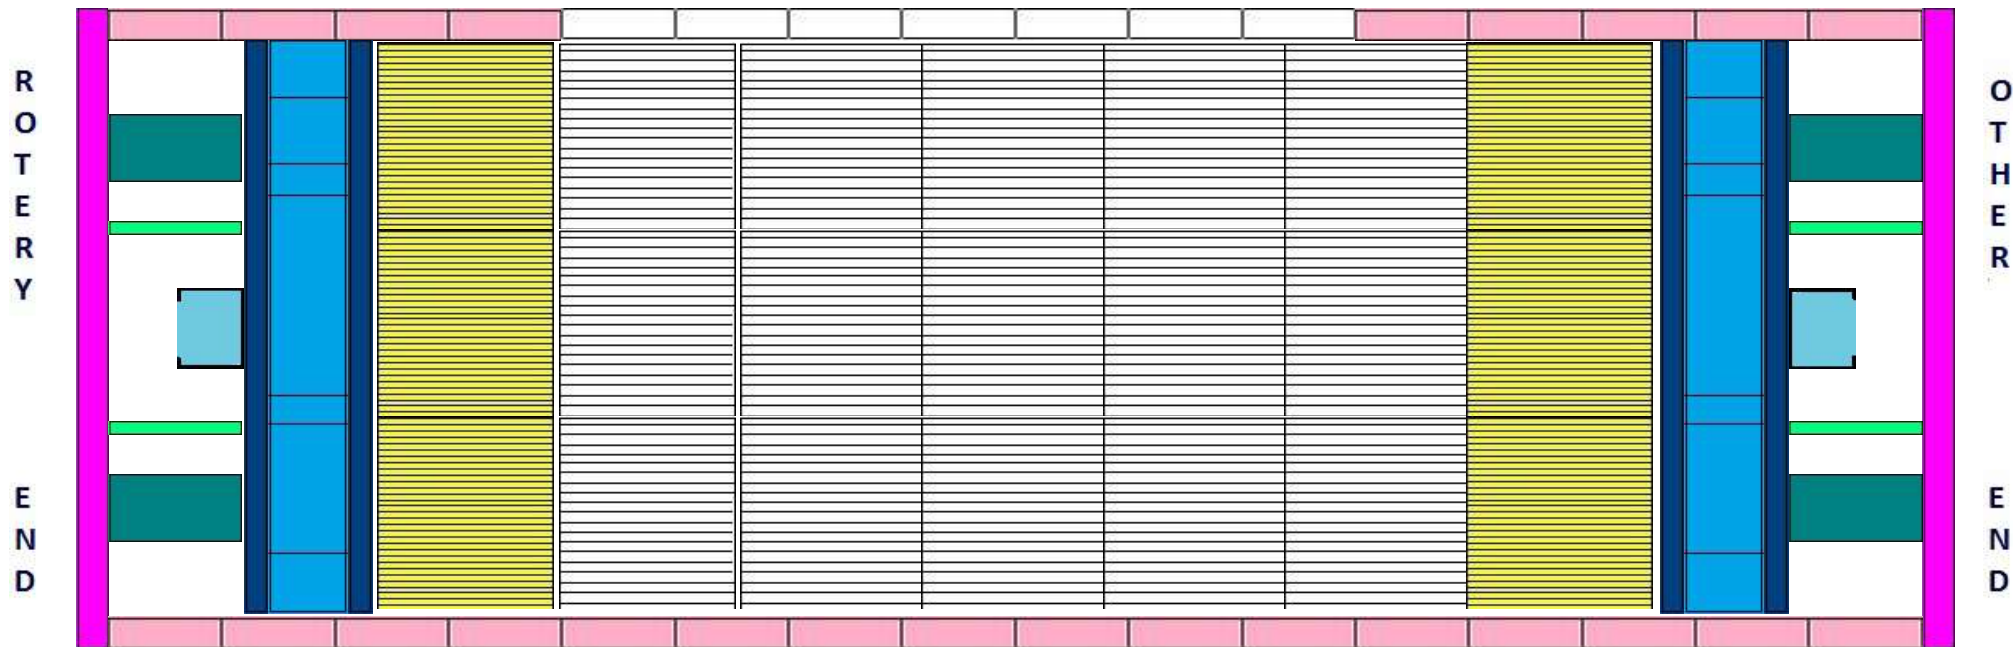

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	12.5	78%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	12.5	78%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	40	22%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 6, WEST : 4 Other End - EAST : -7, WEST : -4
Start Date : 19-Jul-2019, Completion Date : 30-Jul-2019, Net Repair Days : 10, Total Man Hours : 1440

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	--------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR064601


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

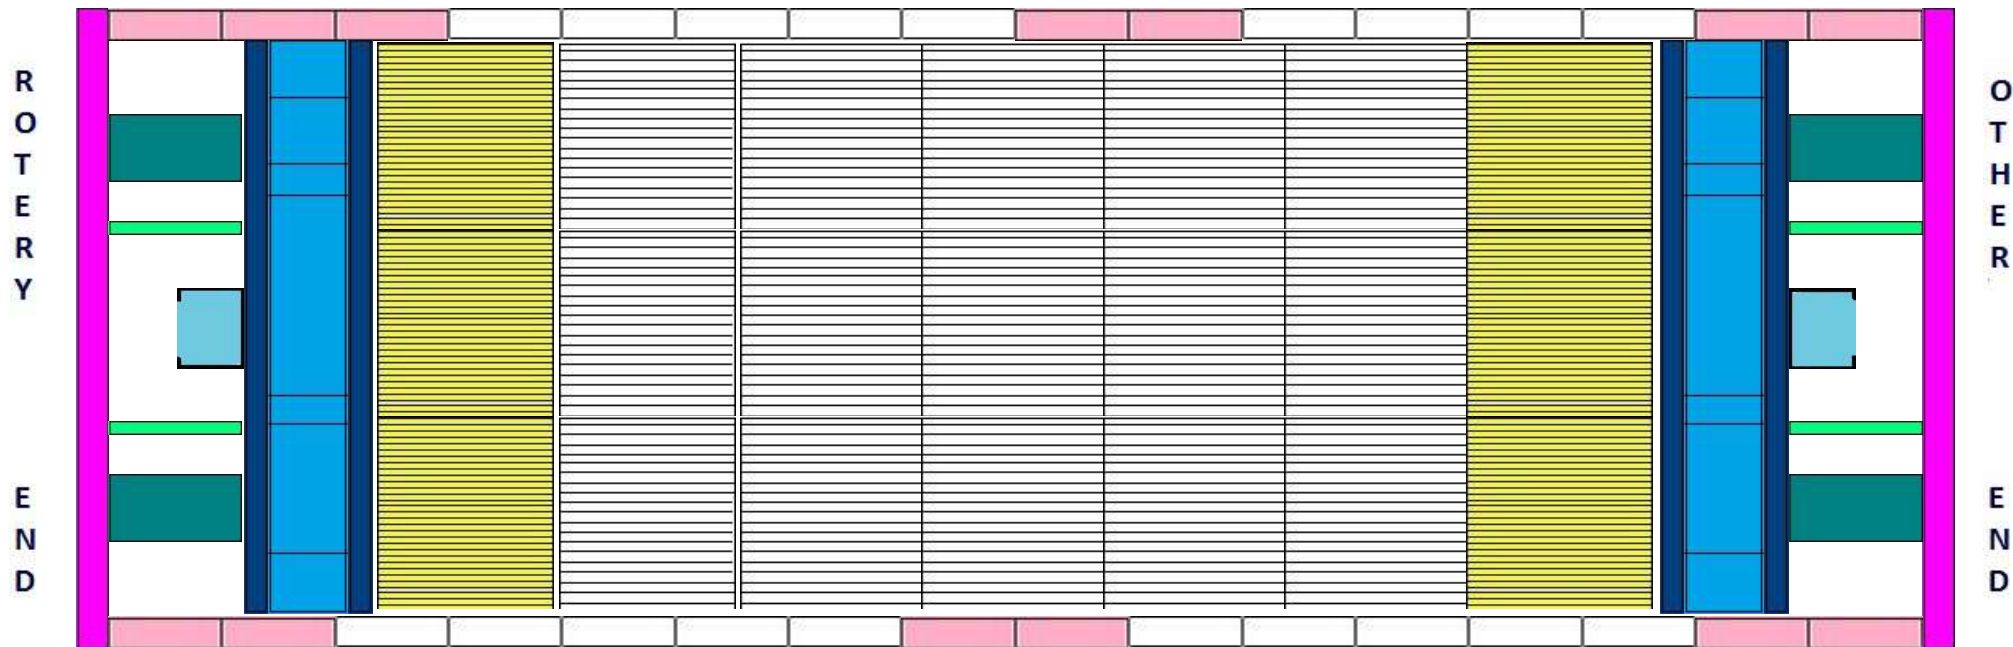

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	6.5	41%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	6.5	41%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	30	75%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -3, WEST : -10 Other End - EAST : -5, WEST : 5
Start Date : 30-May-2019, Completion Date : 06-Jun-2019, Net Repair Days : 7, Total Man Hours : 1276

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR057400
Form No. F/BR/ICF/002

Type : GSLRD

Built Year : 2005

Make : RCF

Valid From: 02/04/2015

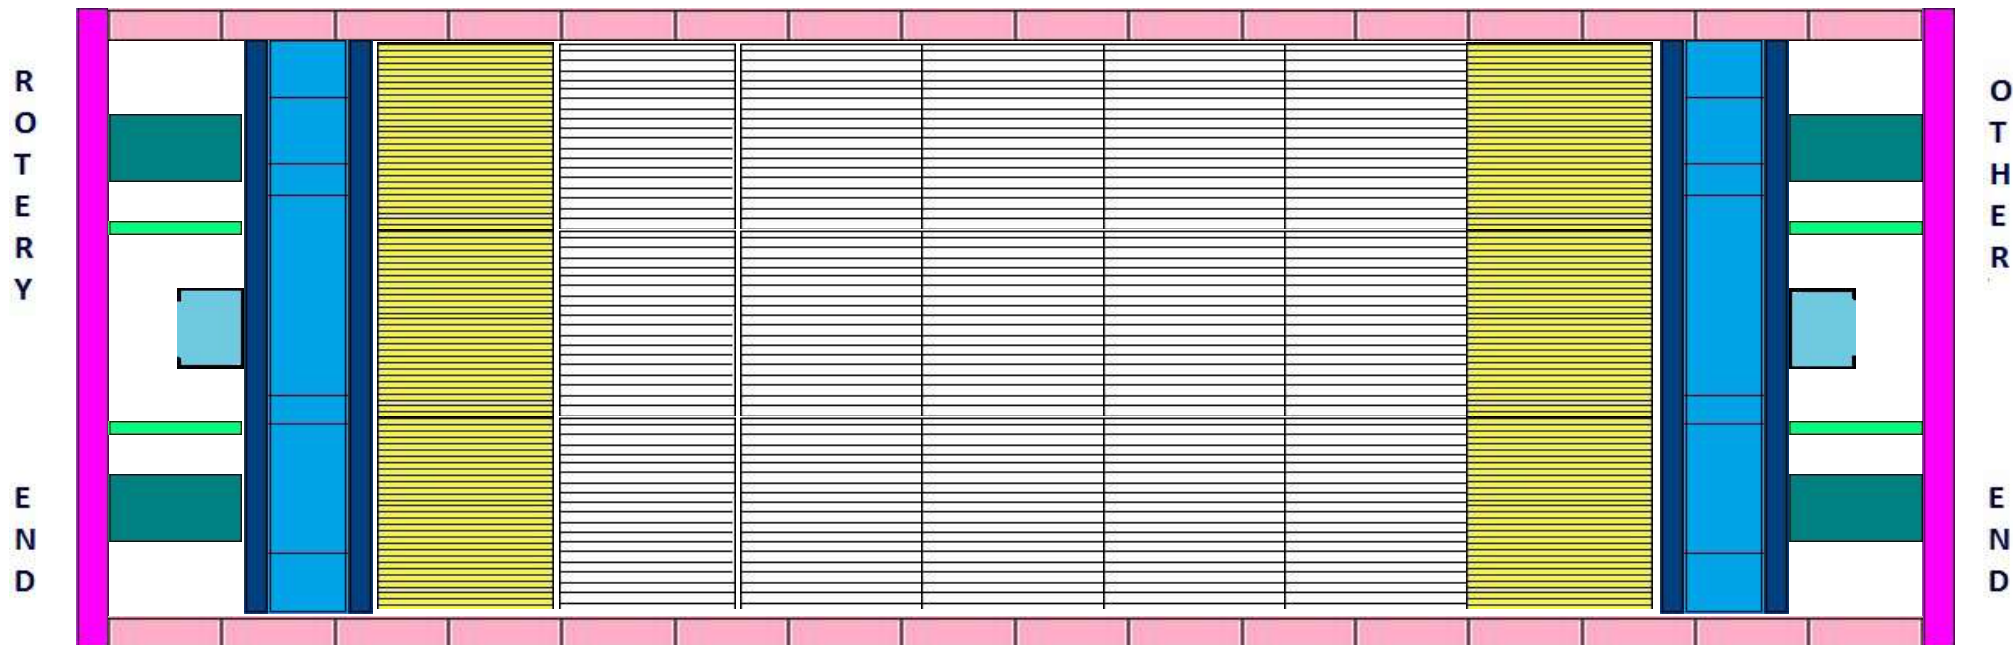

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Light Blue	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	10	53%		Window Bar	18	21%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -8, WEST : -8 Other End - EAST : -6, WEST : -5
Start Date : 13-Jun-2019, Completion Date : 25-Jun-2019, Net Repair Days : 11, Total Man Hours : 1752

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062040


Type : WGSCN

Built Year : 2006

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

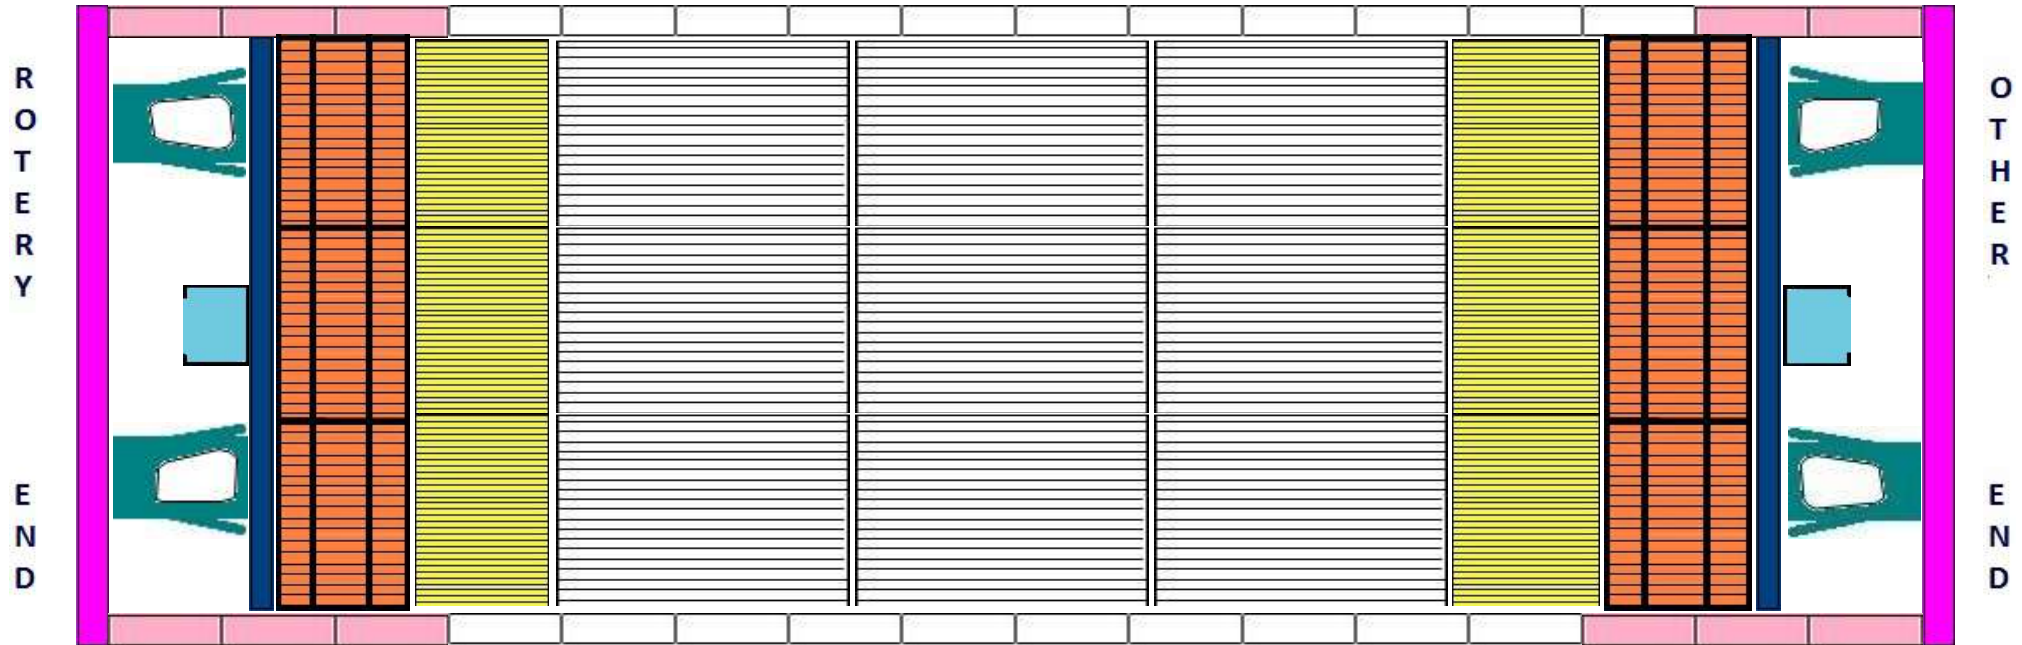

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	5.5	34%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	5.5	34%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	14	35%
	Window Bar	34	18%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	30	100%								

End Drooping: Rotary End - EAST : -10, WEST : -8 Other End - EAST : -7, WEST : -10
Start Date : 20-Jun-2019, Completion Date : 29-Jun-2019, Net Repair Days : 9, Total Man Hours : 1292

M L KOLI - JE	HAMANT JADAV - JE	S K SHARMA - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
---------------	-------------------	------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062861


Type : WGSCN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

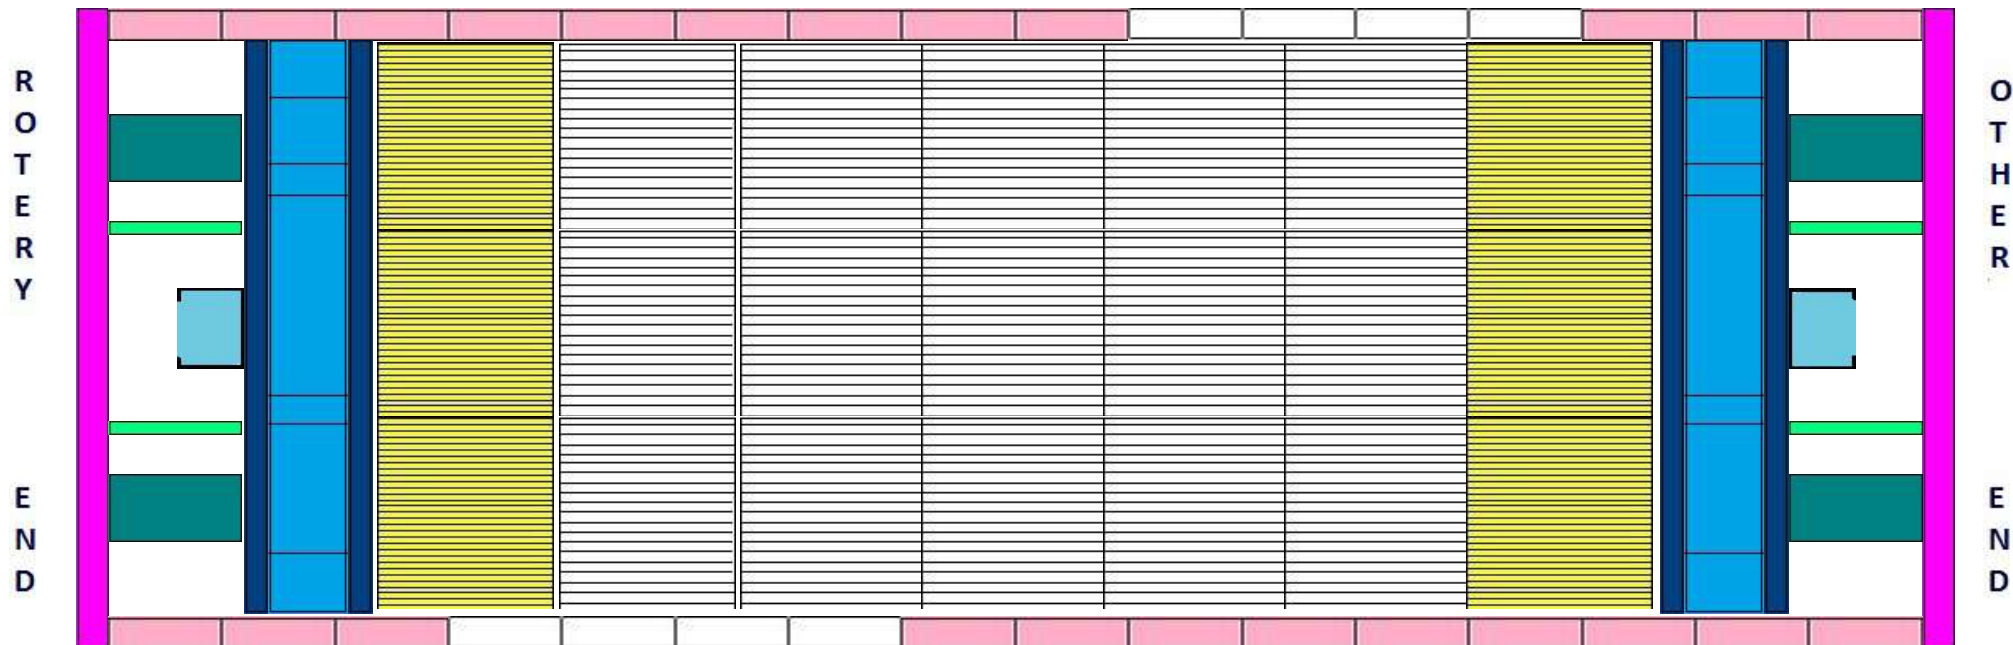

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	12	75%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	12	75%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	42	23%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 25-Jun-2019, Completion Date : 04-Jul-2019, Net Repair Days : 9, Total Man Hours : 0

HAMANT JADAV - JE	M L KOLI - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	---------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR052610


Type : WGSCN

Built Year : 2005

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

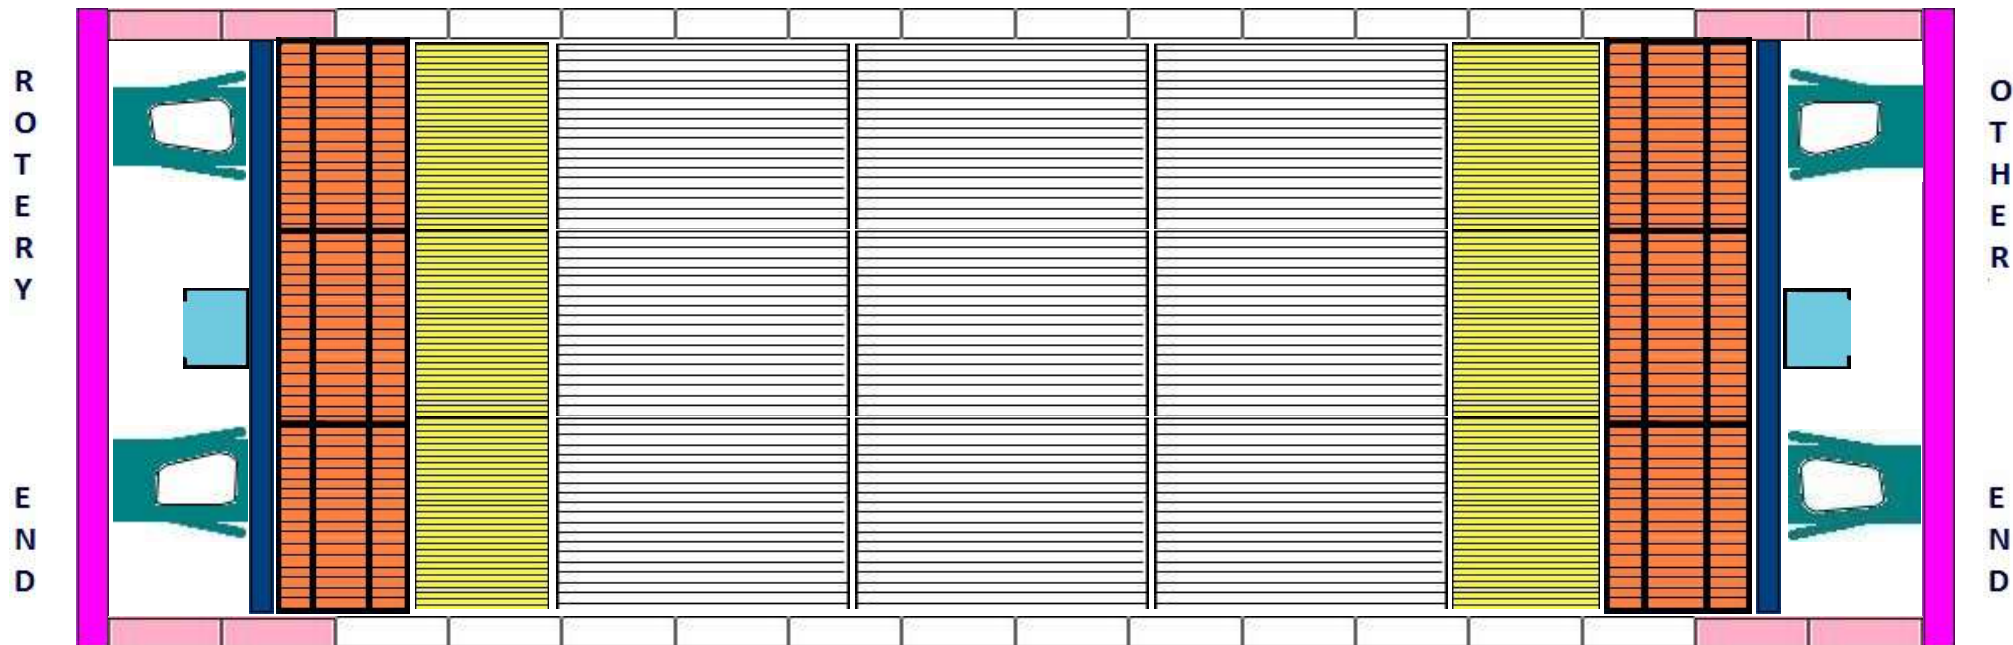

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	18	45%
	Window Bar	20	11%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : -5, WEST : -8 Other End - EAST : 2, WEST : 0
Start Date : 26-Jun-2019, Completion Date : 03-Jul-2019, Net Repair Days : 7, Total Man Hours : 904

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
------------------	--------------------	--------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR044461


Type : GS

Built Year : 2004

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

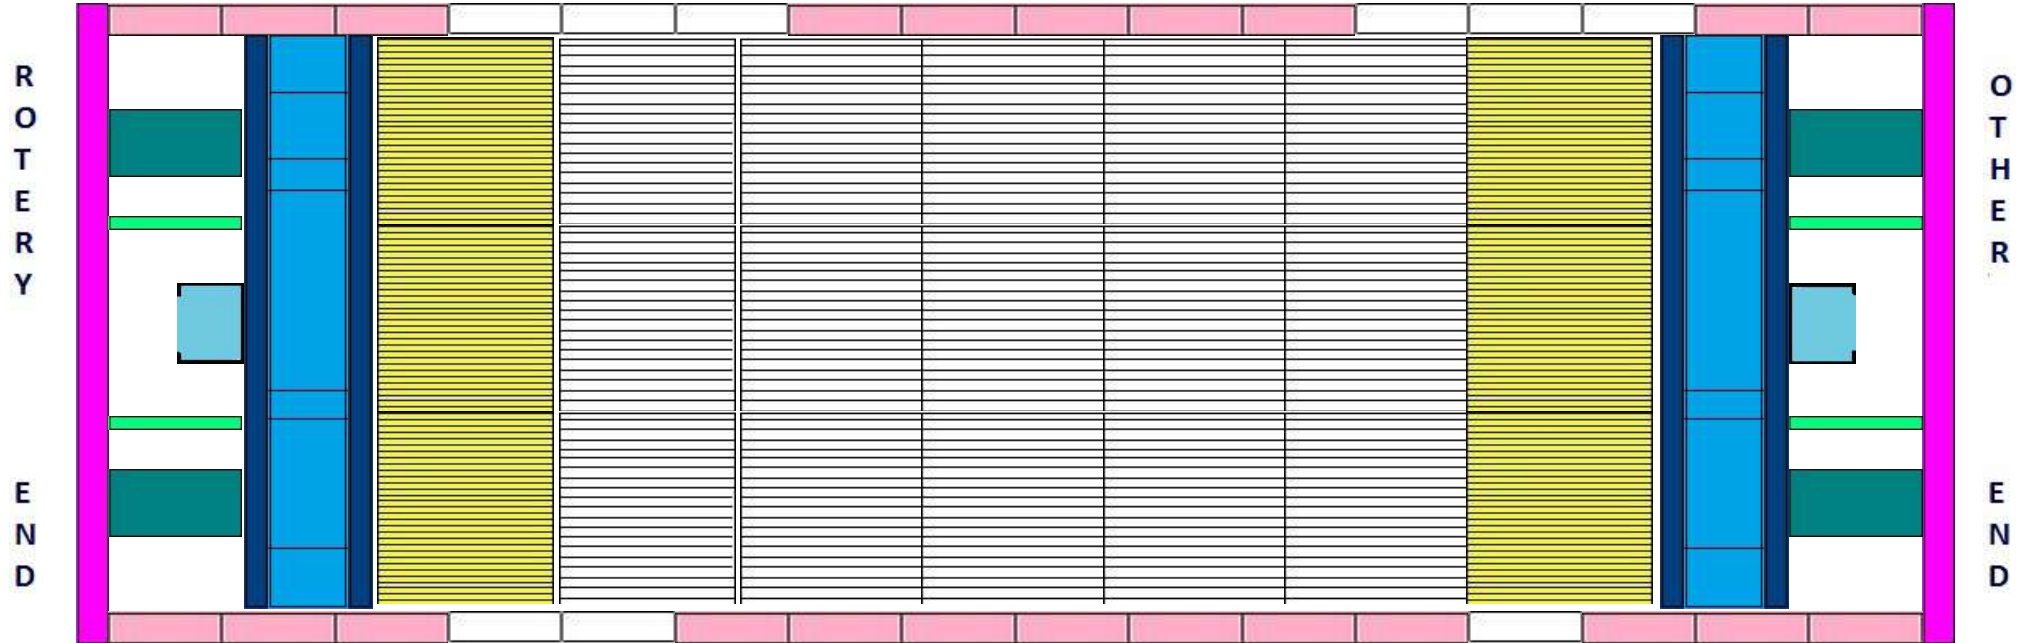

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	11.5	72%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	11.5	72%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	46	26%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : 5 Other End - EAST : -4, WEST : -3
Start Date : 06-Jul-2019, Completion Date : 15-Jul-2019, Net Repair Days : 8, Total Man Hours : 1448

HAMANT JADAV - JE	M L KOLI - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	---------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062881


Type : WGSCN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

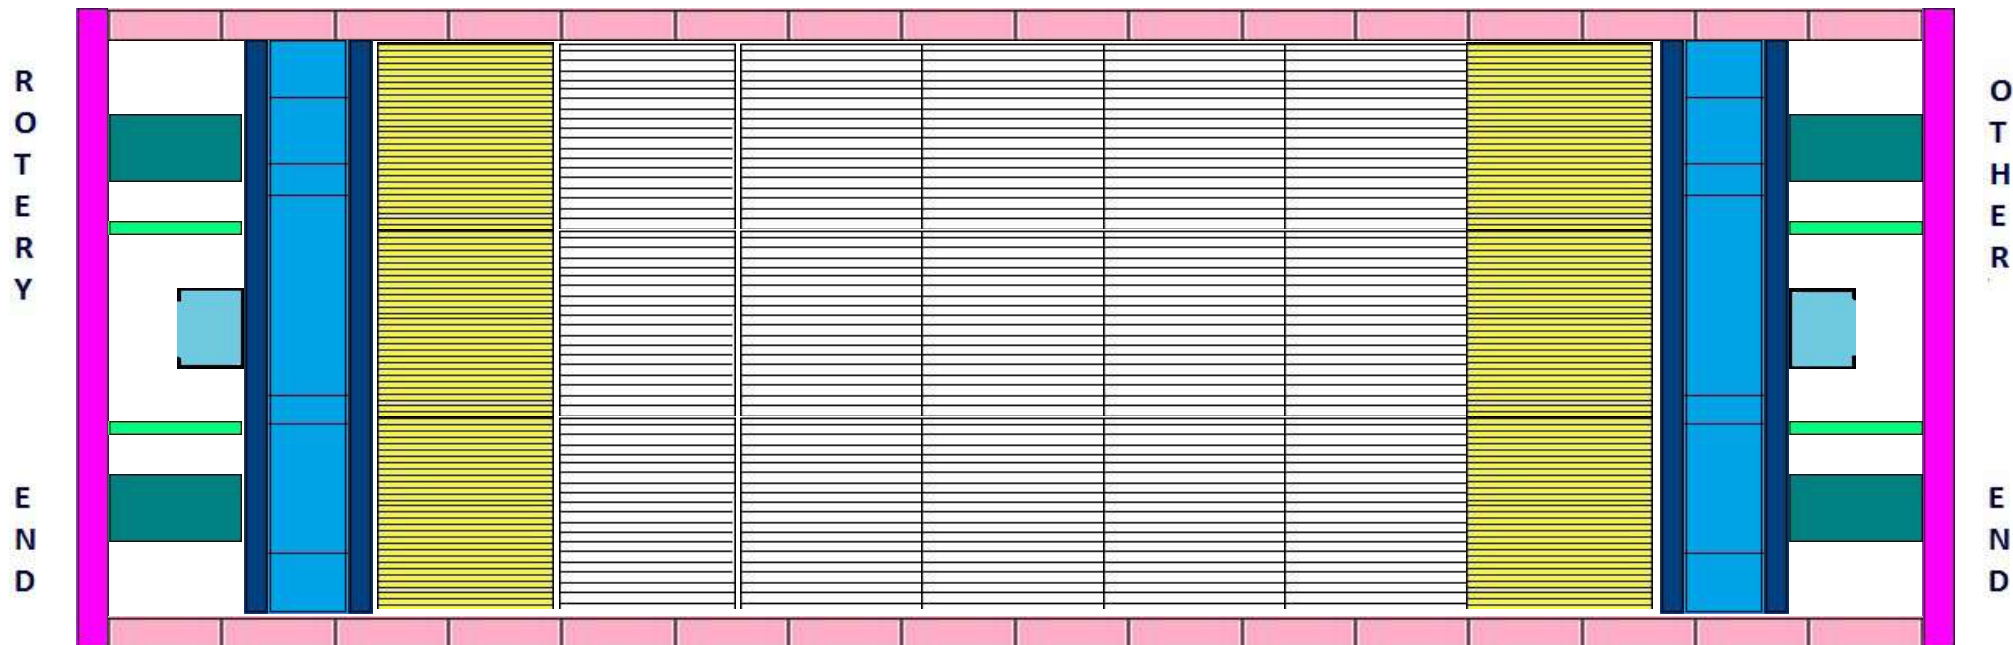

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Light Blue	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	18	45%		Window Bar	32	17%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -10, WEST : -10 Other End - EAST : 10, WEST : 9
Start Date : 03-Jul-2019, Completion Date : 09-Jul-2019, Net Repair Days : 6, Total Man Hours : 1488

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR052580


Type : WGSCN

Built Year : 2005

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

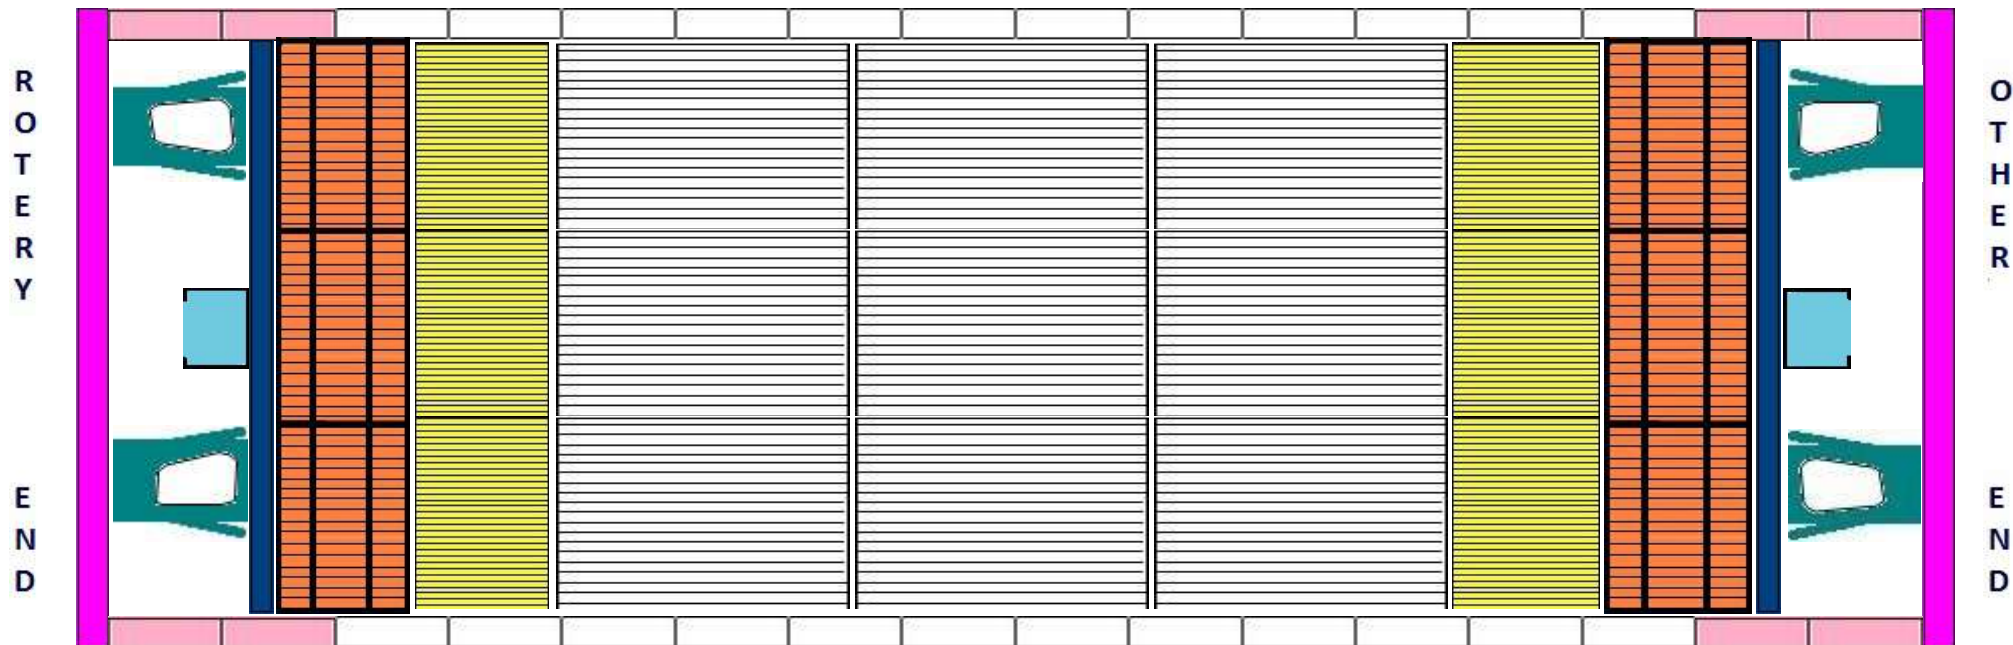

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	12	30%
	Window Bar	14	8%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : 3, WEST : -8 Other End - EAST : -10, WEST : -5
Start Date : 10-Jul-2019, Completion Date : 16-Jul-2019, Net Repair Days : 6, Total Man Hours : 1024

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
-----------------------	------------------	--------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR052300
Form No. F/BR/ICF/002

Type : WGSCN

Built Year : 2005

Make : ICF

Valid From: 02/04/2015

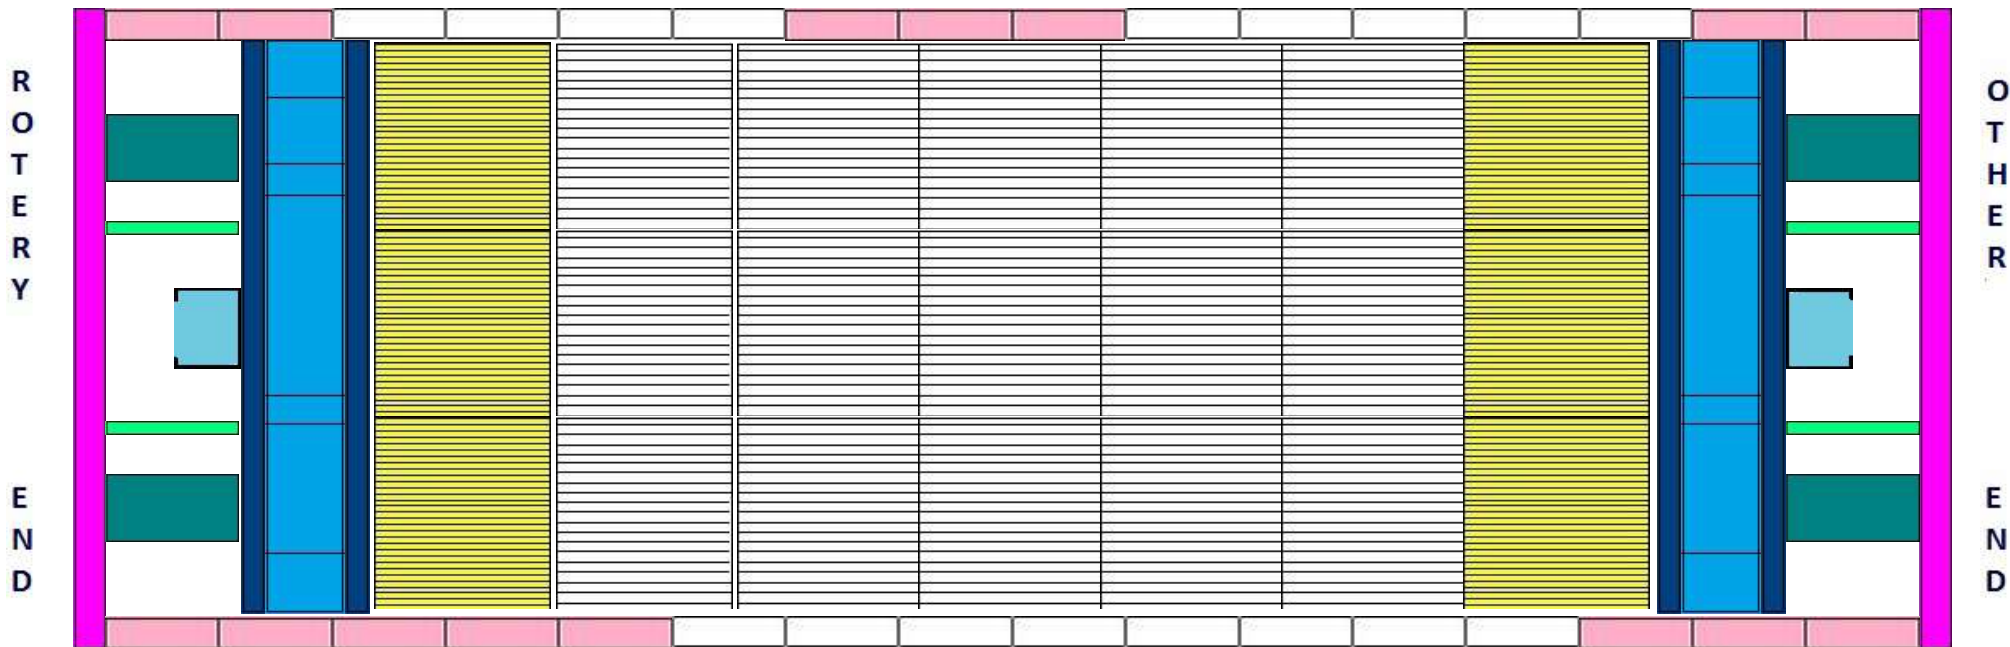

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
 	Headstock Beam	2	100%	 	Centre Stiffner for Headstock	4	100%	 	Floor Stiffner for Headstock	4	100%
 	Aux. Head stock	4	100%	 	Sole Bar	7.5	47%	 	Draft Gear Bracket	2	100%
 	Trough floor	2	29%	 	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	7.5	47%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	78	42%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : 0 Other End - EAST : -6, WEST : -4
Start Date : 28-Jun-2019, Completion Date : 08-Jul-2019, Net Repair Days : 9, Total Man Hours : 1432

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR052394
Form No. F/BR/ICF/002

Type : WGSCN

Built Year : 2005

Make : ICF

Valid From: 02/04/2015

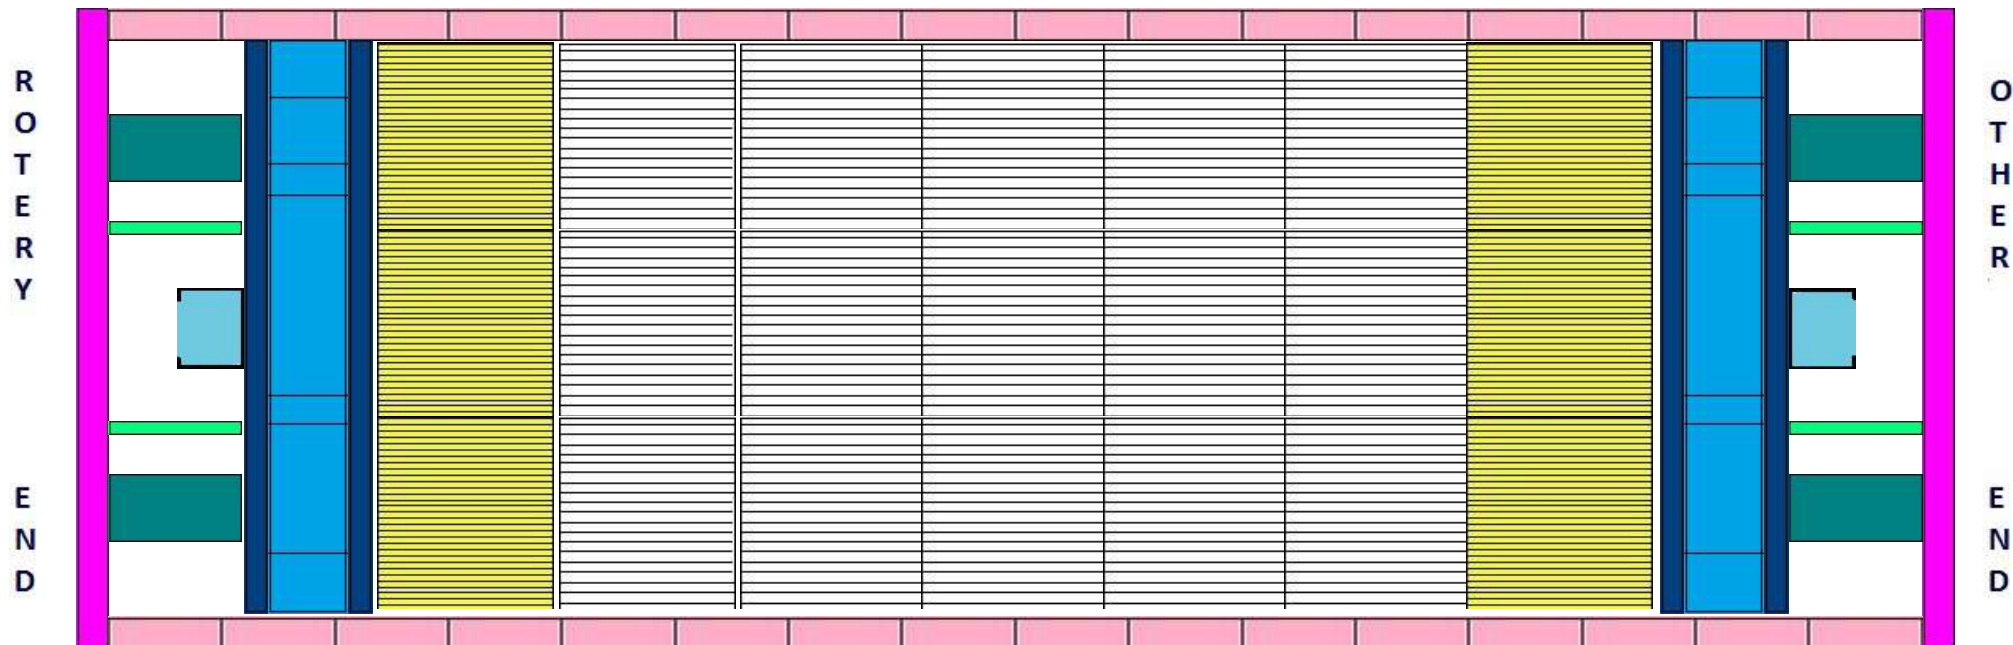

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Blue	Aux. Head stock	4	100%	Orange	Sole Bar	16	100%	Purple	Draft Gear Bracket	2	100%
Pink	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	30	75%		Window Bar	44	24%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : 6 Other End - EAST : -6, WEST : -5
Start Date : 24-Jun-2019, Completion Date : 29-Jun-2019, Net Repair Days : 6, Total Man Hours : 1504

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062100


Type : WGSCN

Built Year : 2006

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

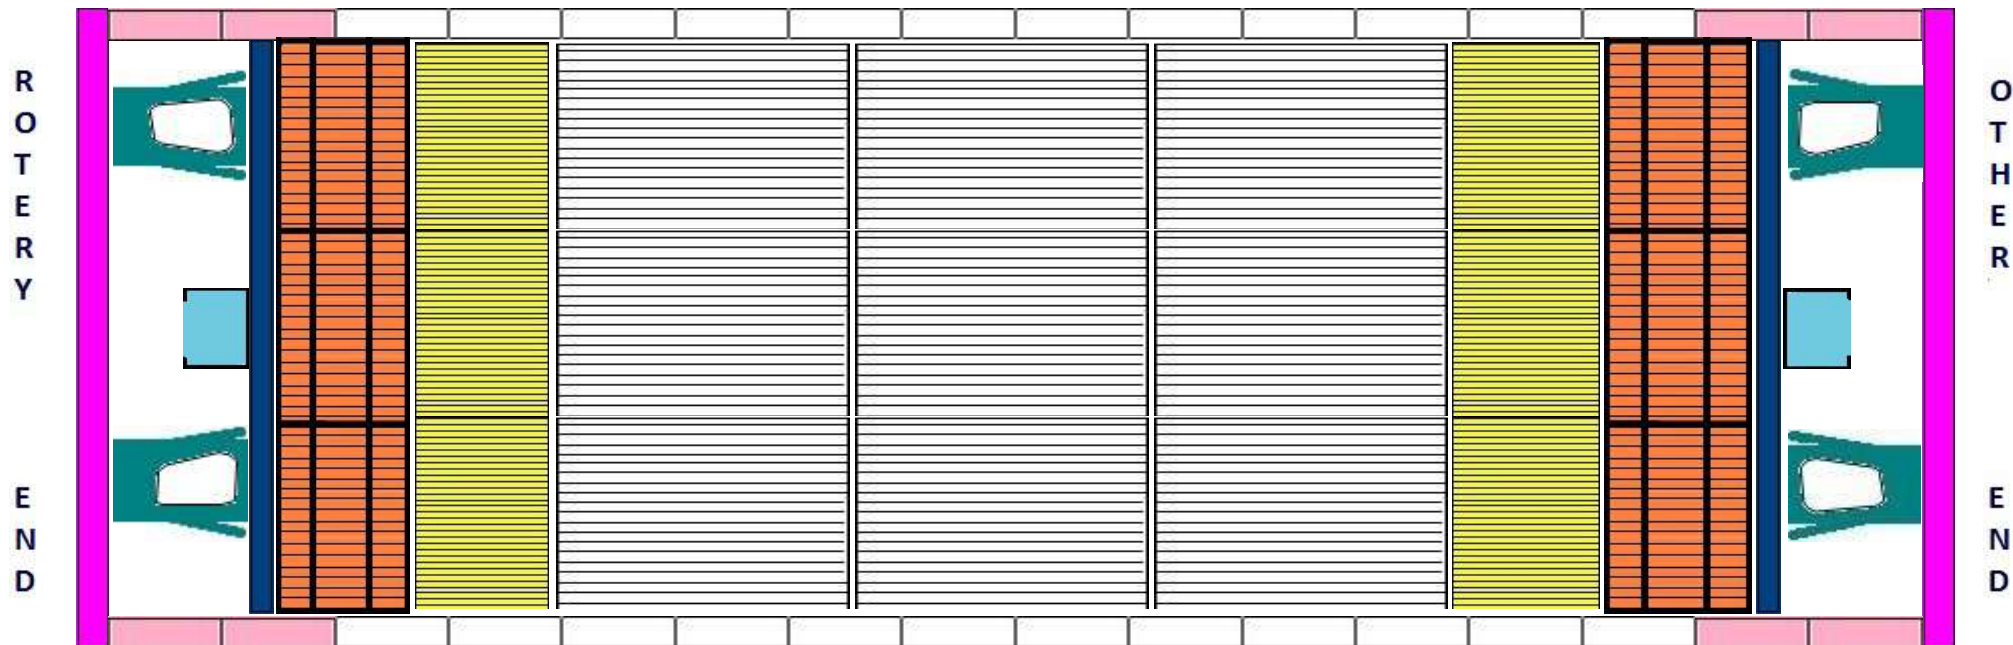

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	8	20%
	Window Bar	14	8%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : -2, WEST : -7 Other End - EAST : 3, WEST : 5
Start Date : 01-Jul-2019, Completion Date : 08-Jul-2019, Net Repair Days : 7, Total Man Hours : 1256

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
----------------------	---------------------	-----------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062718


Type : WGSCN

Built Year : 2006

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

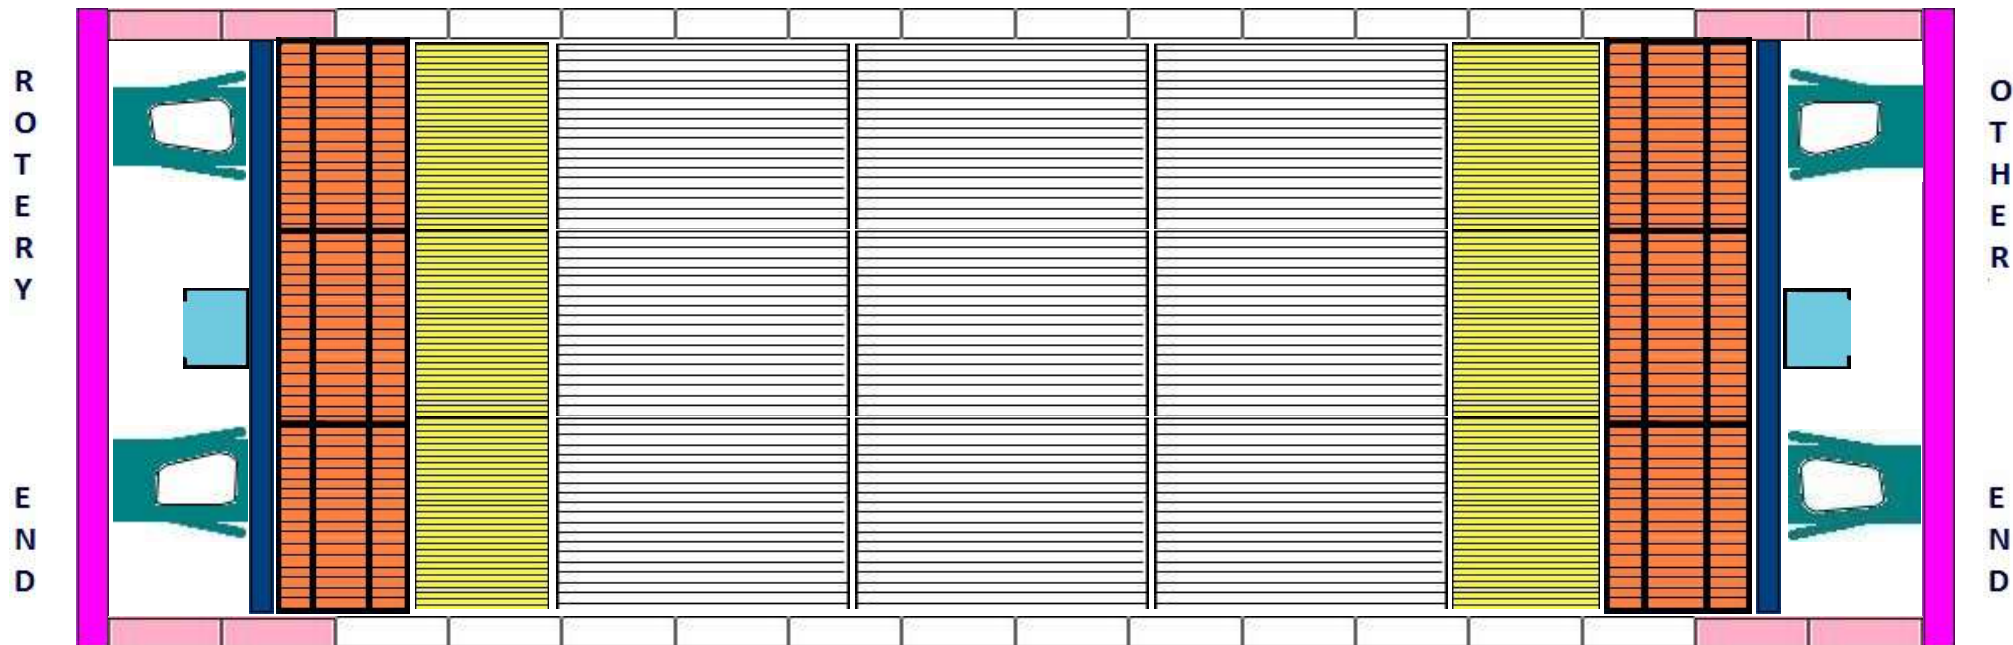

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	10	25%
	Window Bar	14	8%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : -5, WEST : -4 Other End - EAST : -10, WEST : -10
Start Date : 29-Jun-2019, Completion Date : 08-Jul-2019, Net Repair Days : 8, Total Man Hours : 1058

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
--------------------	------------------	--------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062961


Type : WGSCN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

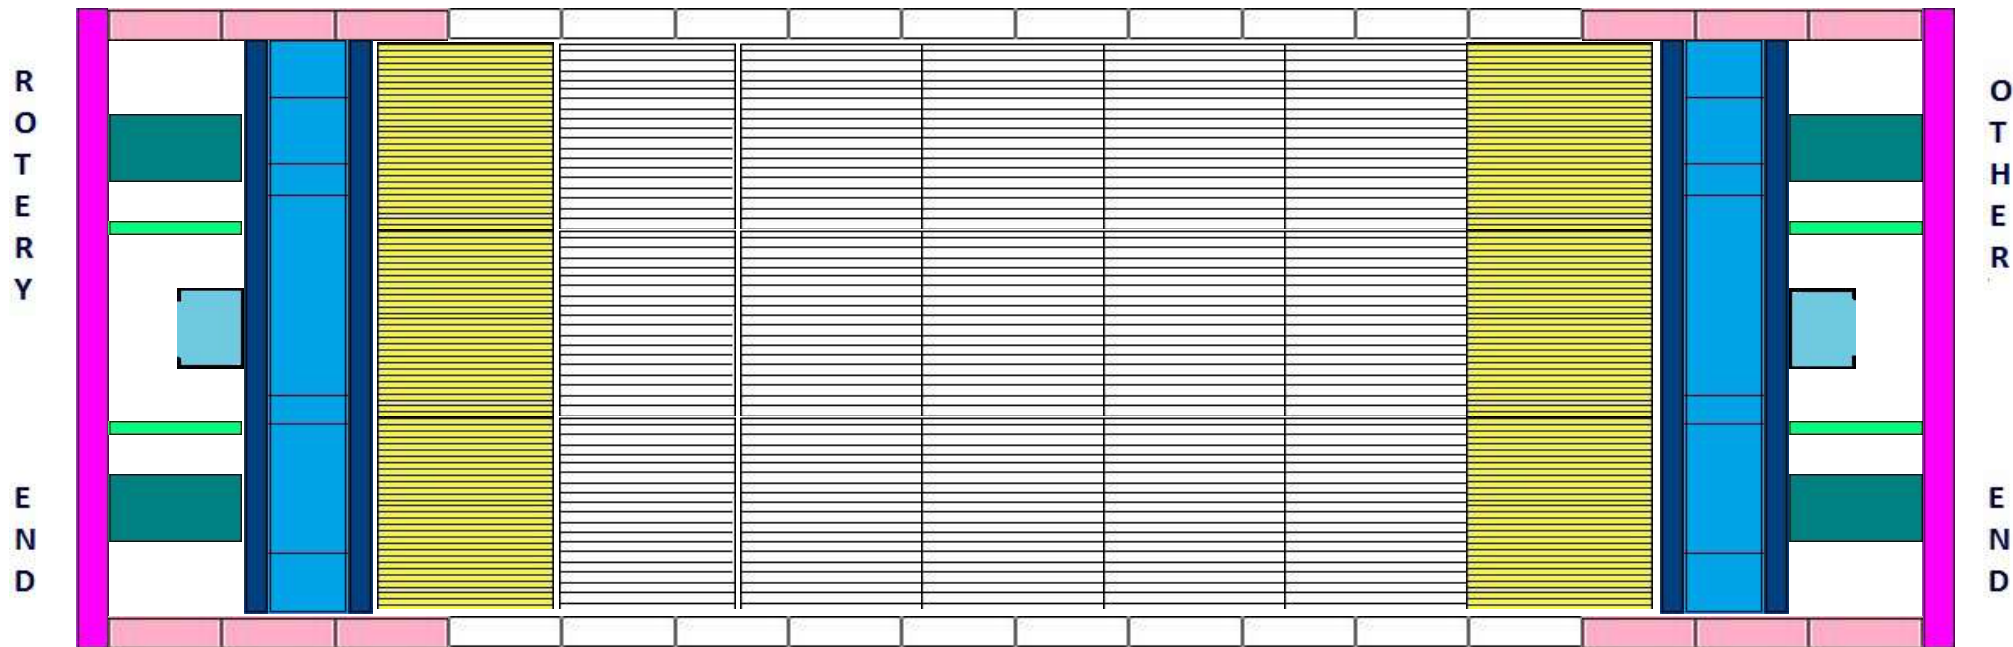

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	6	38%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	6	38%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	30	75%		Window Bar	44	24%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 4, WEST : -4 Other End - EAST : -5, WEST : -4
Start Date : 04-Jul-2019, Completion Date : 10-Jul-2019, Net Repair Days : 6, Total Man Hours : 1200

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR052280


Type : WGSCN

Built Year : 2005

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

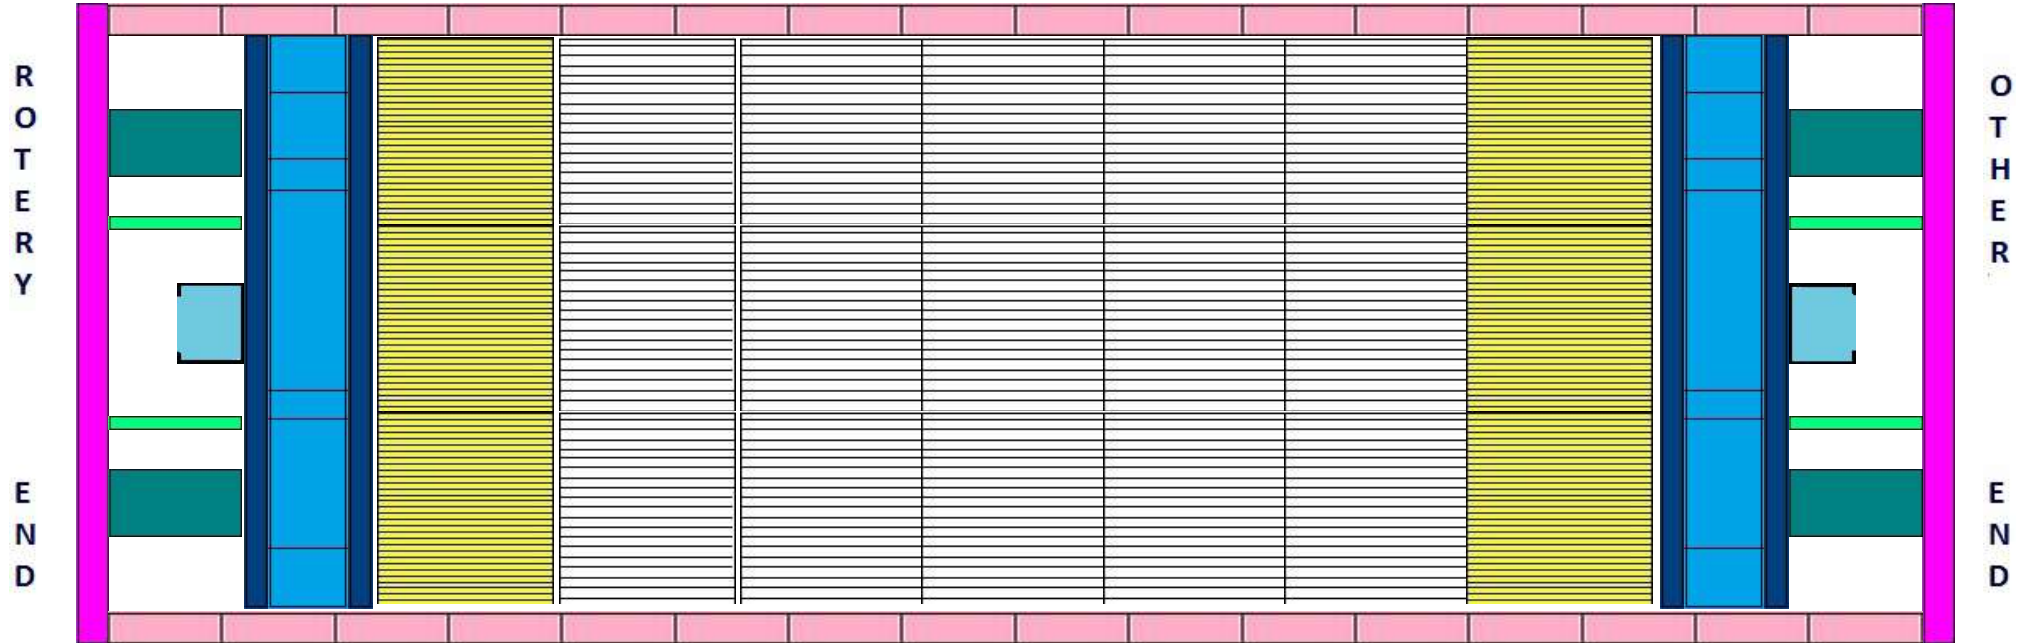

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	34	85%		Window Bar	48	26%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 2, WEST : 5 Other End - EAST : -1, WEST : 3
Start Date : 21-Dec-2019, Completion Date : 01-Jan-2020, Net Repair Days : 10, Total Man Hours : 1224

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR072090
Form No. F/BR/ICF/002

Type : WGSCN

Built Year : 2007

Make : ICF

Valid From: 02/04/2015

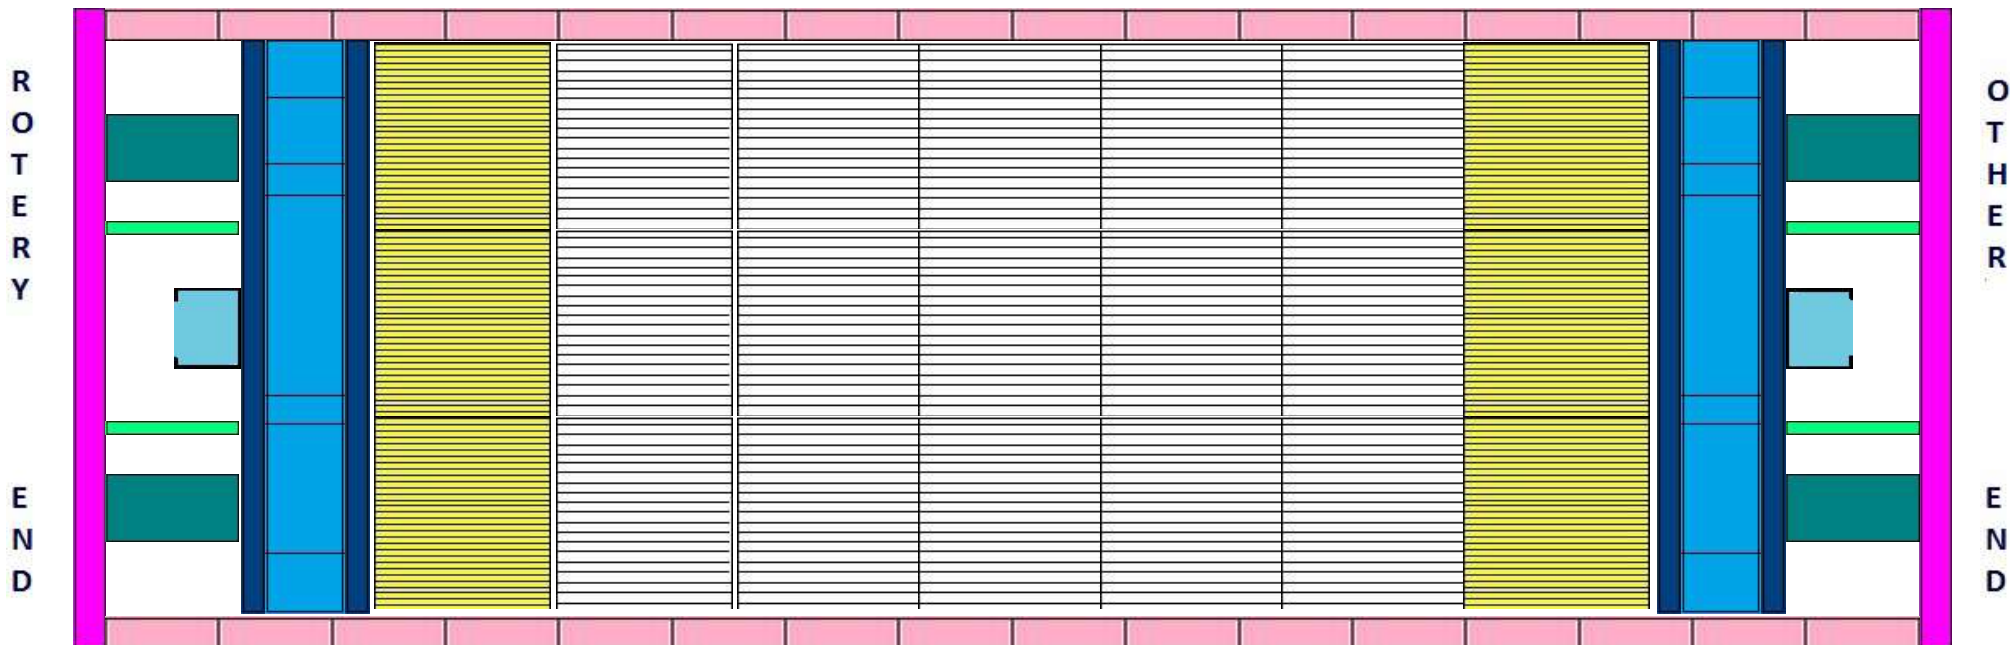

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	24	60%		Window Bar	48	26%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : 4 Other End - EAST : -5, WEST : -7
Start Date : 19-Dec-2019, Completion Date : 01-Jan-2020, Net Repair Days : 12, Total Man Hours : 963

K K TRIPATHI - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062951


Type : CN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

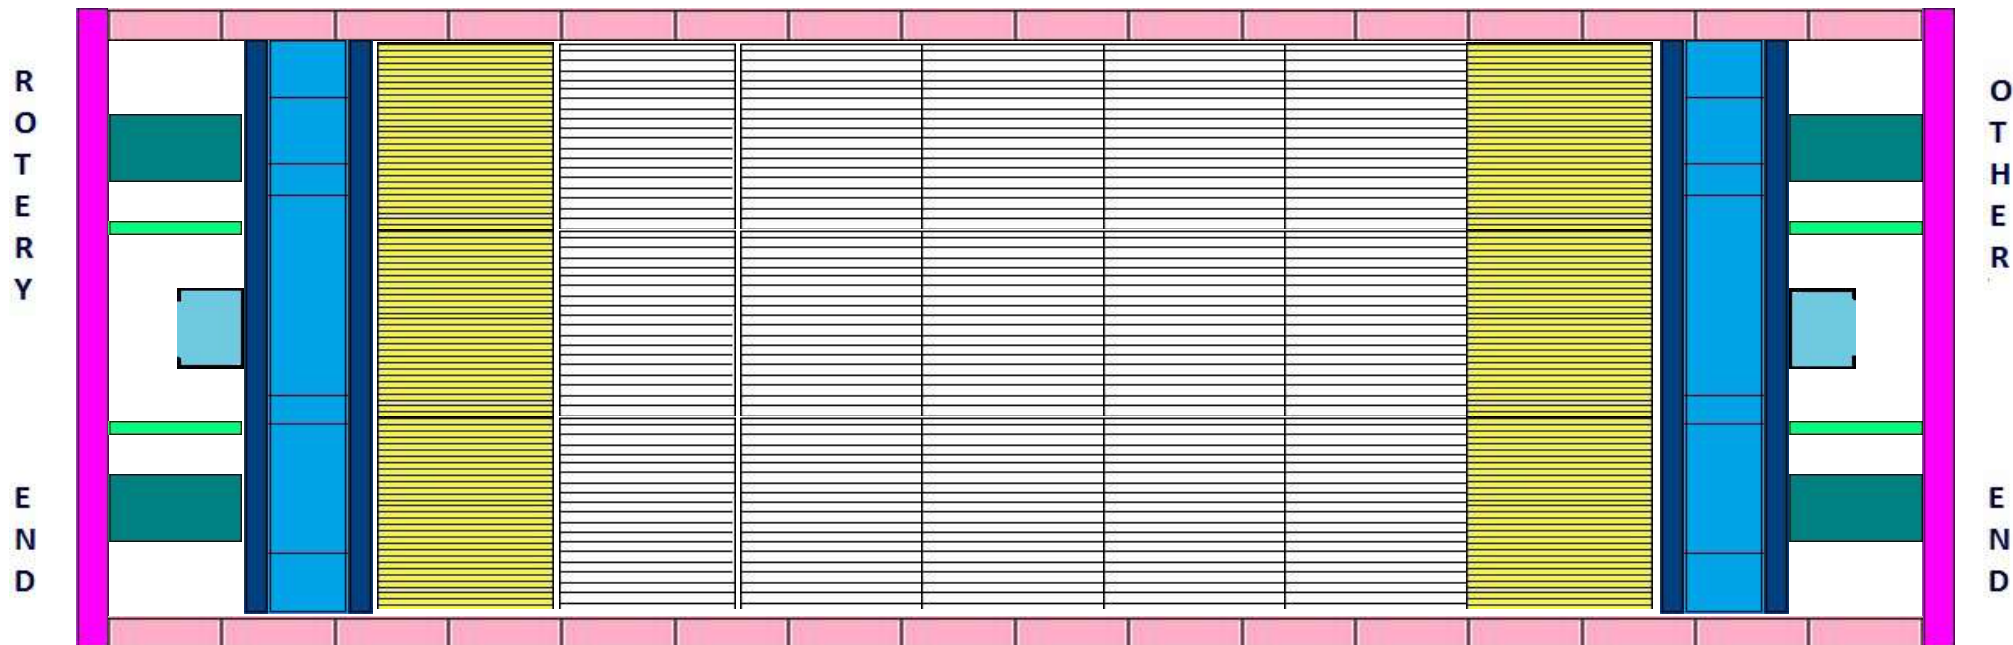

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	35%		Window Bar	44	24%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -4, WEST : -5 Other End - EAST : -4, WEST : 0
Start Date : 10-May-2019, Completion Date : 23-May-2019, Net Repair Days : 12, Total Man Hours : 0

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062640


Type : CN

Built Year : 2006

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

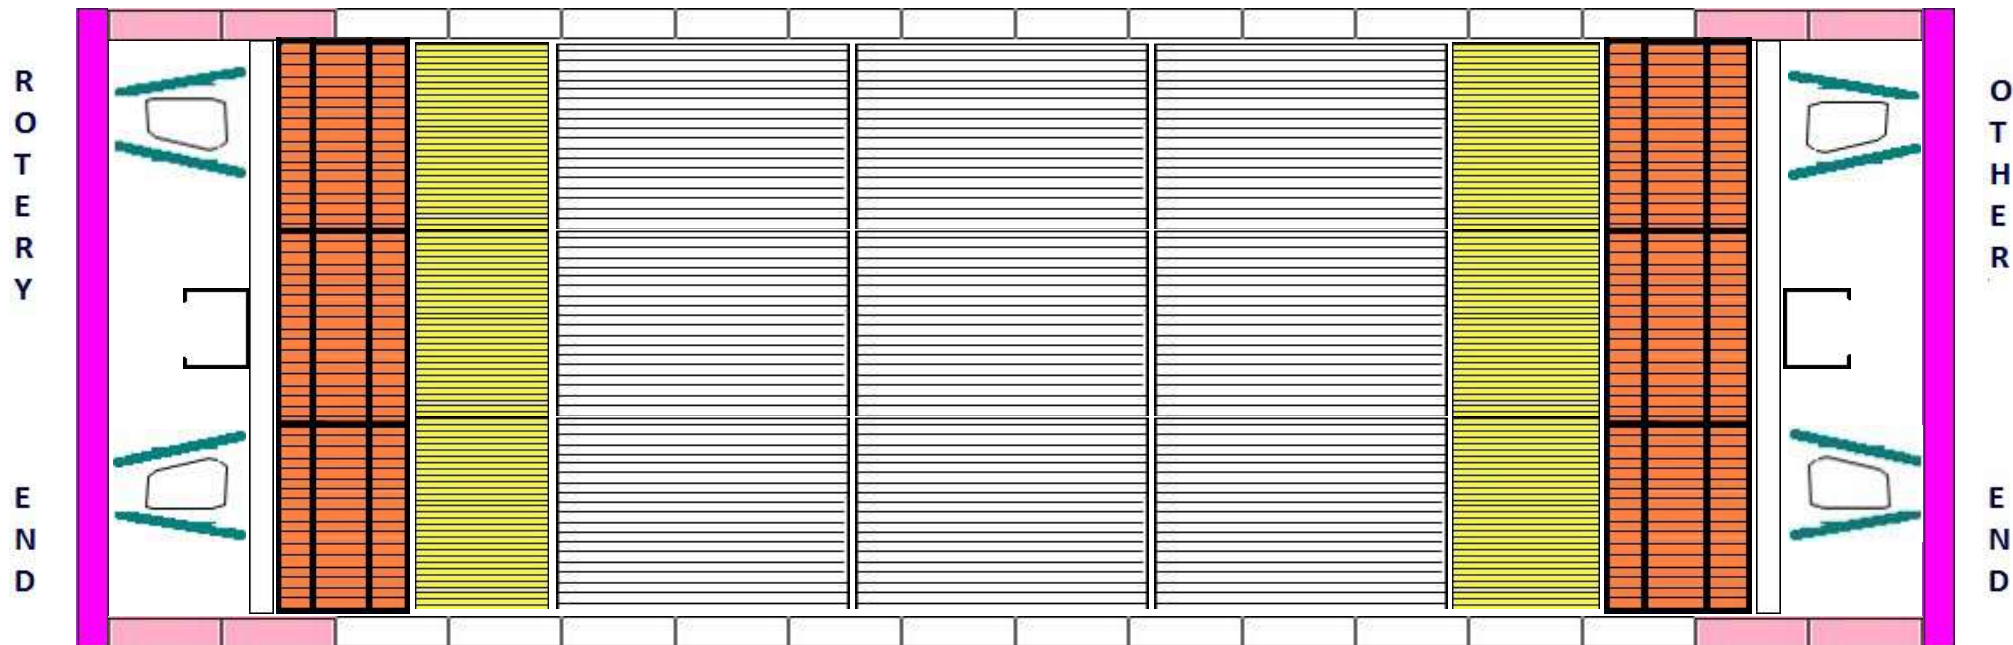

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	0	0%		Sole Bar	4	25%		Draft Gear Bracket	0	0%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	4	10%
	Window Bar	18	10%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	0	100%								

End Drooping: Rotary End - EAST : 5, WEST : 6 Other End - EAST : 10, WEST : 0
Start Date : 10-May-2019, Completion Date : 22-May-2019, Net Repair Days : 11, Total Man Hours : 0

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
-------------------	--------------------	------------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR074052


Type : GS

Built Year : 2007

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

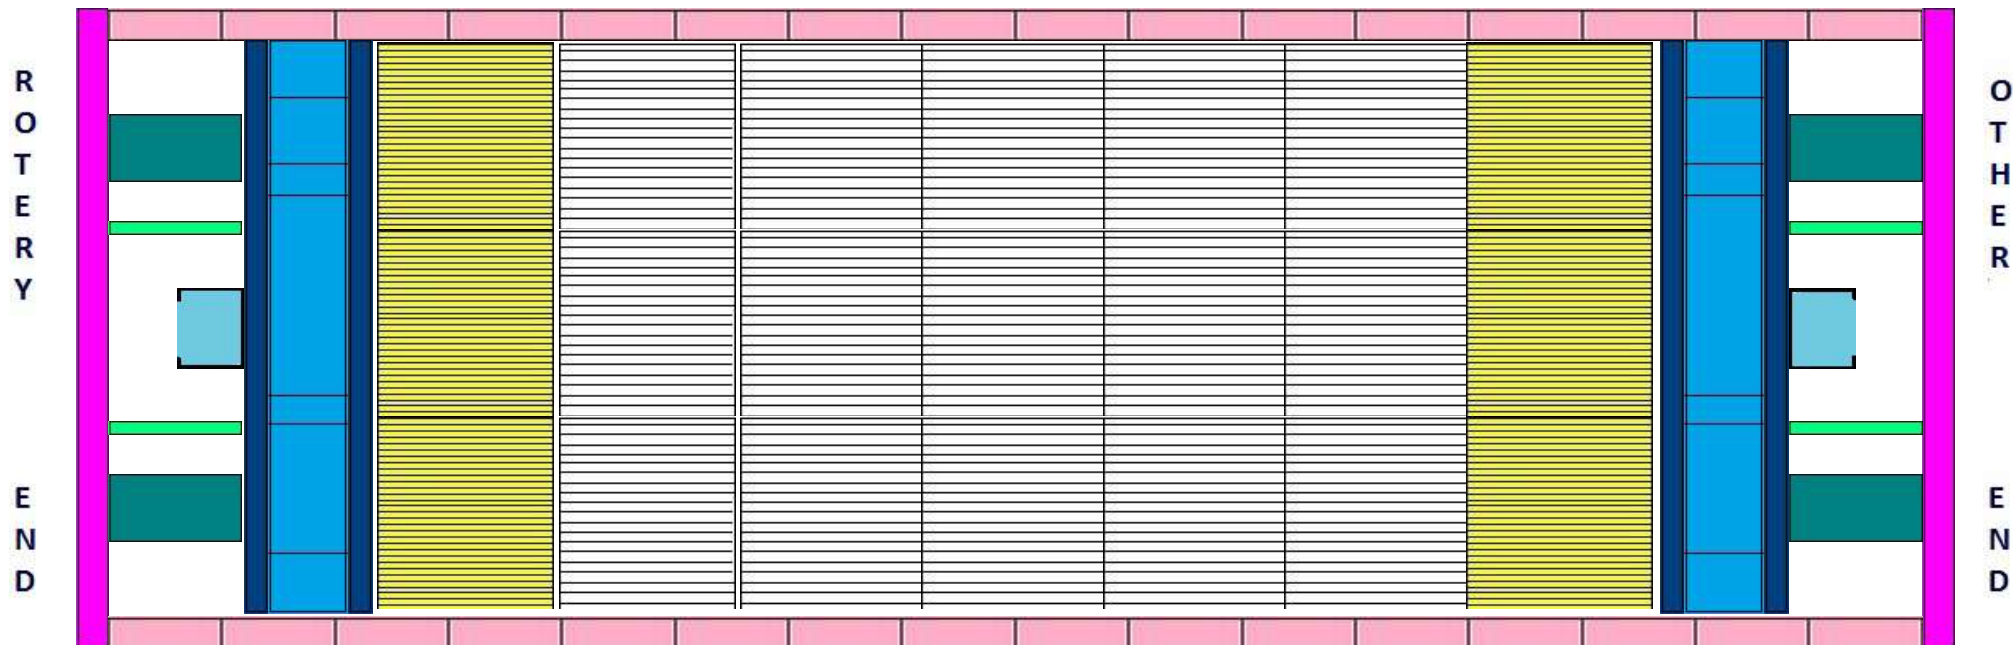

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Black	Aux. Head stock	4	100%	Blue	Sole Bar	16	100%	Yellow	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Red	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	35%		Window Bar	40	23%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 10, WEST : -2 Other End - EAST : -7, WEST : 0
Start Date : 04-Sep-2019, Completion Date : 13-Sep-2019, Net Repair Days : 9, Total Man Hours : 1512

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR064632


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

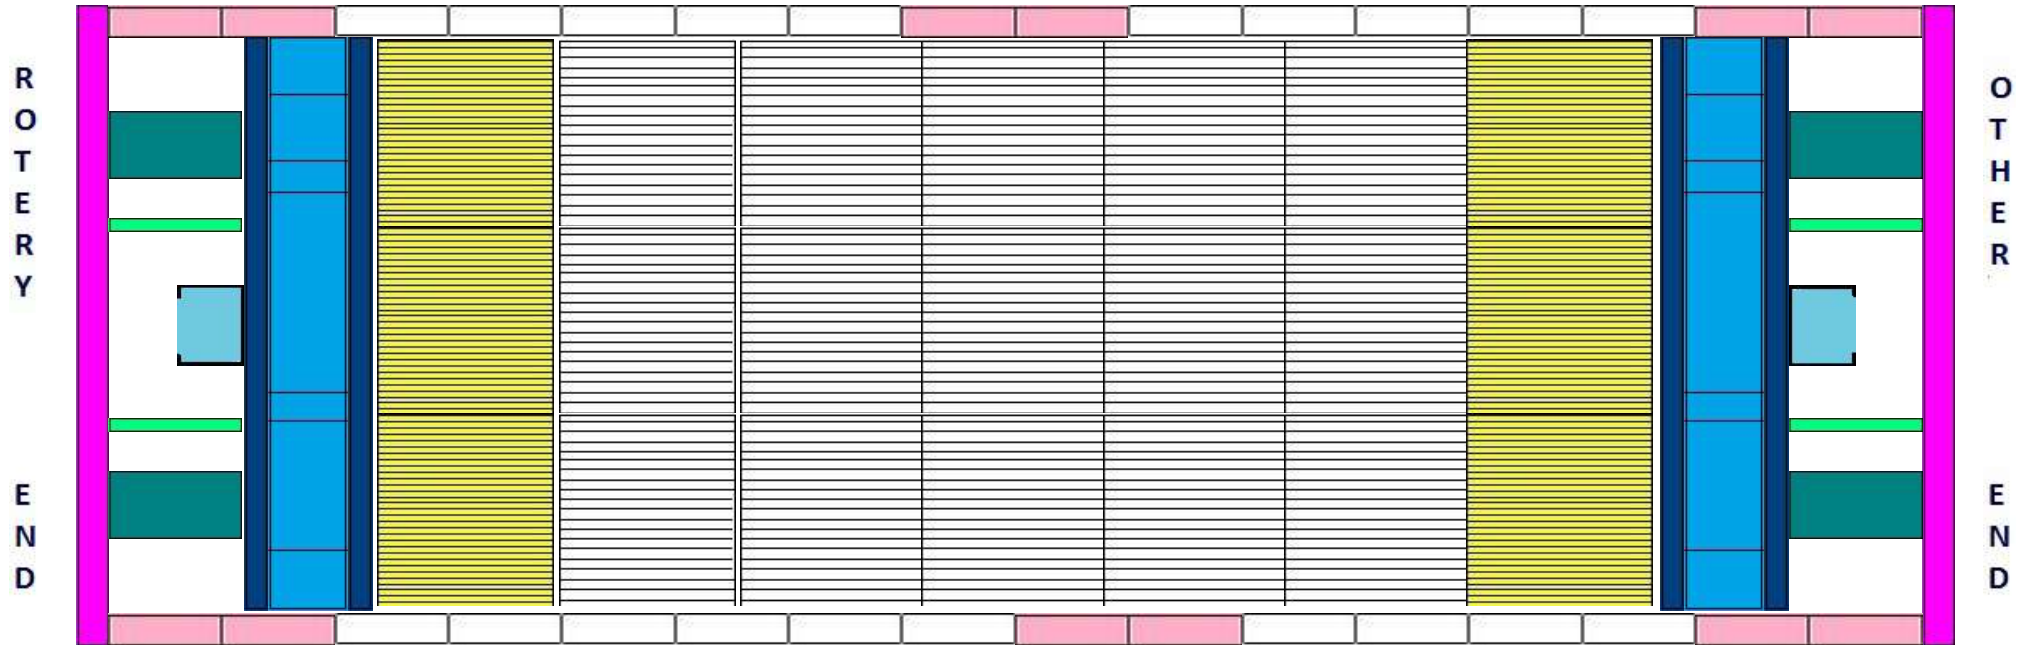

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	6	38%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	6	38%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 4, WEST : 5 Other End - EAST : 6, WEST : 5
Start Date : 25-Jul-2019, Completion Date : 02-Aug-2019, Net Repair Days : 8, Total Man Hours : 1256

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR063050


Type : WGSCN

Built Year : 2006

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

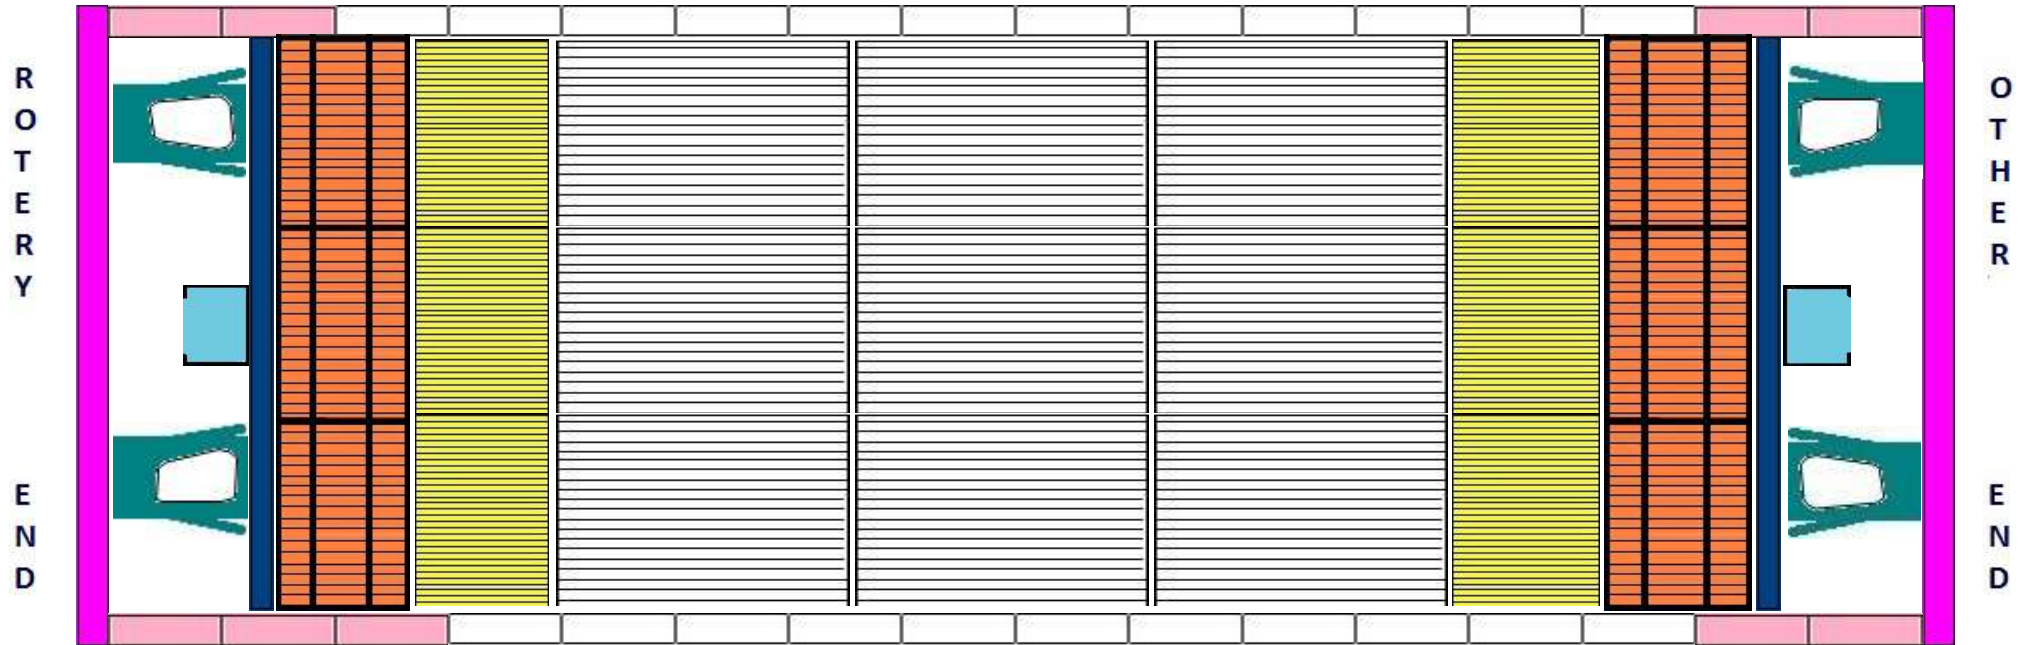

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4.5	28%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4.5	28%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	14	35%
	Window Bar	22	12%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	25	100%								

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 06-Aug-2019, Completion Date : 14-Aug-2019, Net Repair Days : 8, Total Man Hours : 0

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
--------------------	------------------	--------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR052424
Form No. F/BR/ICF/002

Type : WGSCN

Built Year : 2005

Make : ICF

Valid From: 02/04/2015



Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Yellow	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	7	44%	Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	7	44%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	7	18%		Window Bar	28	15%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : -6 Other End - EAST : -3, WEST : -4
Start Date : 28-Aug-2019, Completion Date : 02-Sep-2019, Net Repair Days : 5, Total Man Hours : 976

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR067170
Form No. F/BR/ICF/002

Type : GSLRD

Built Year : 2006

Make : RCF

Valid From: 02/04/2015

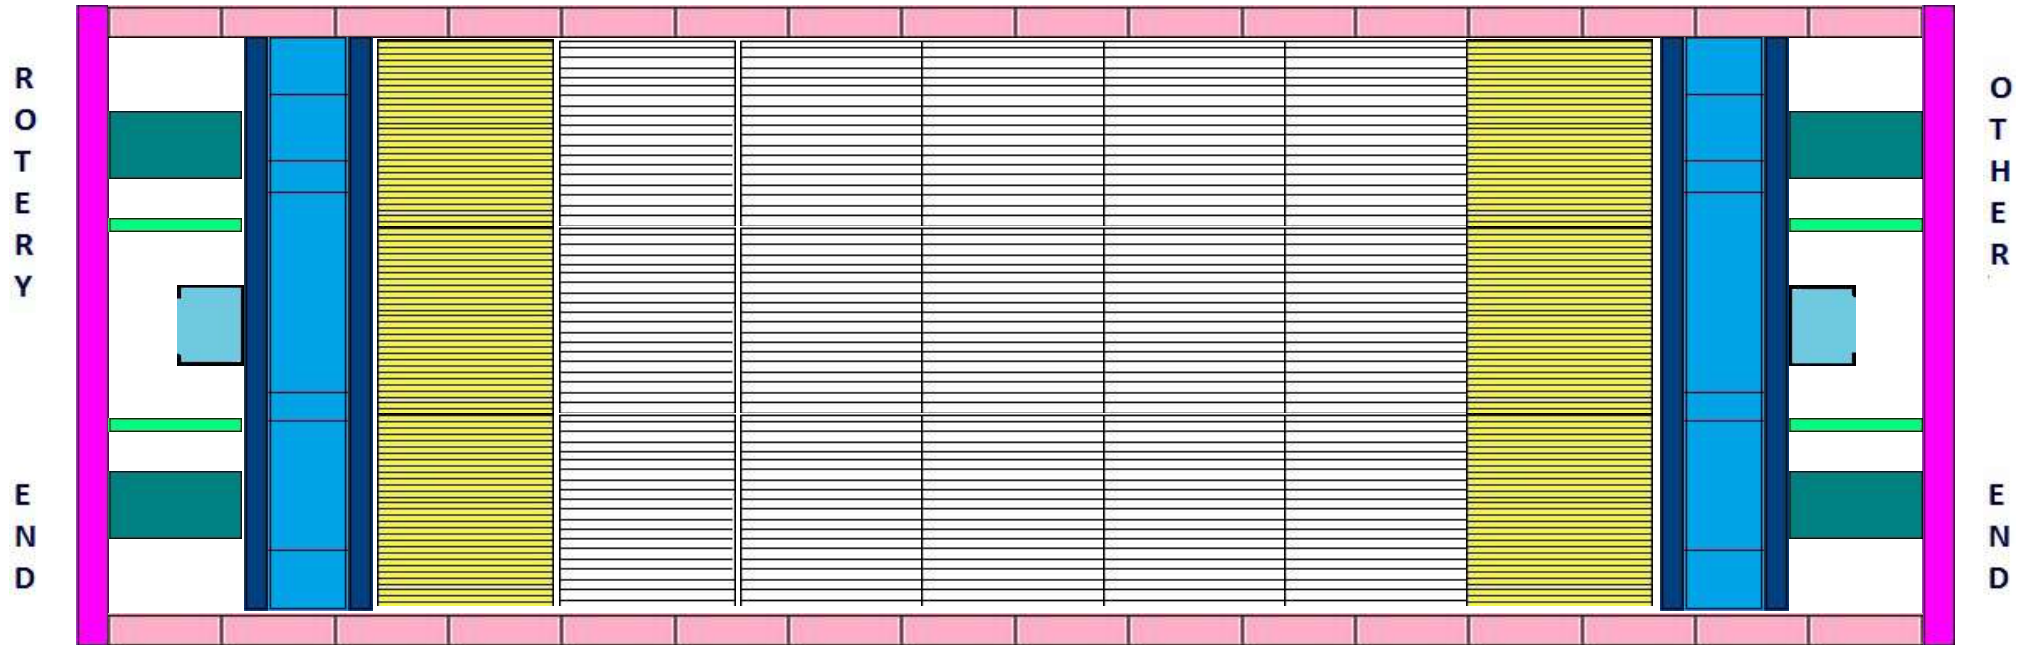

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Yellow	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	12	63%		Window Bar	20	24%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -10, WEST : -10 Other End - EAST : 6, WEST : 8
Start Date : 31-Aug-2019, Completion Date : 09-Sep-2019, Net Repair Days : 8, Total Man Hours : 1932

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR057490
Form No. F/BR/ICF/002

Type : GSLRD

Built Year : 2005

Make : RCF

Valid From: 02/04/2015

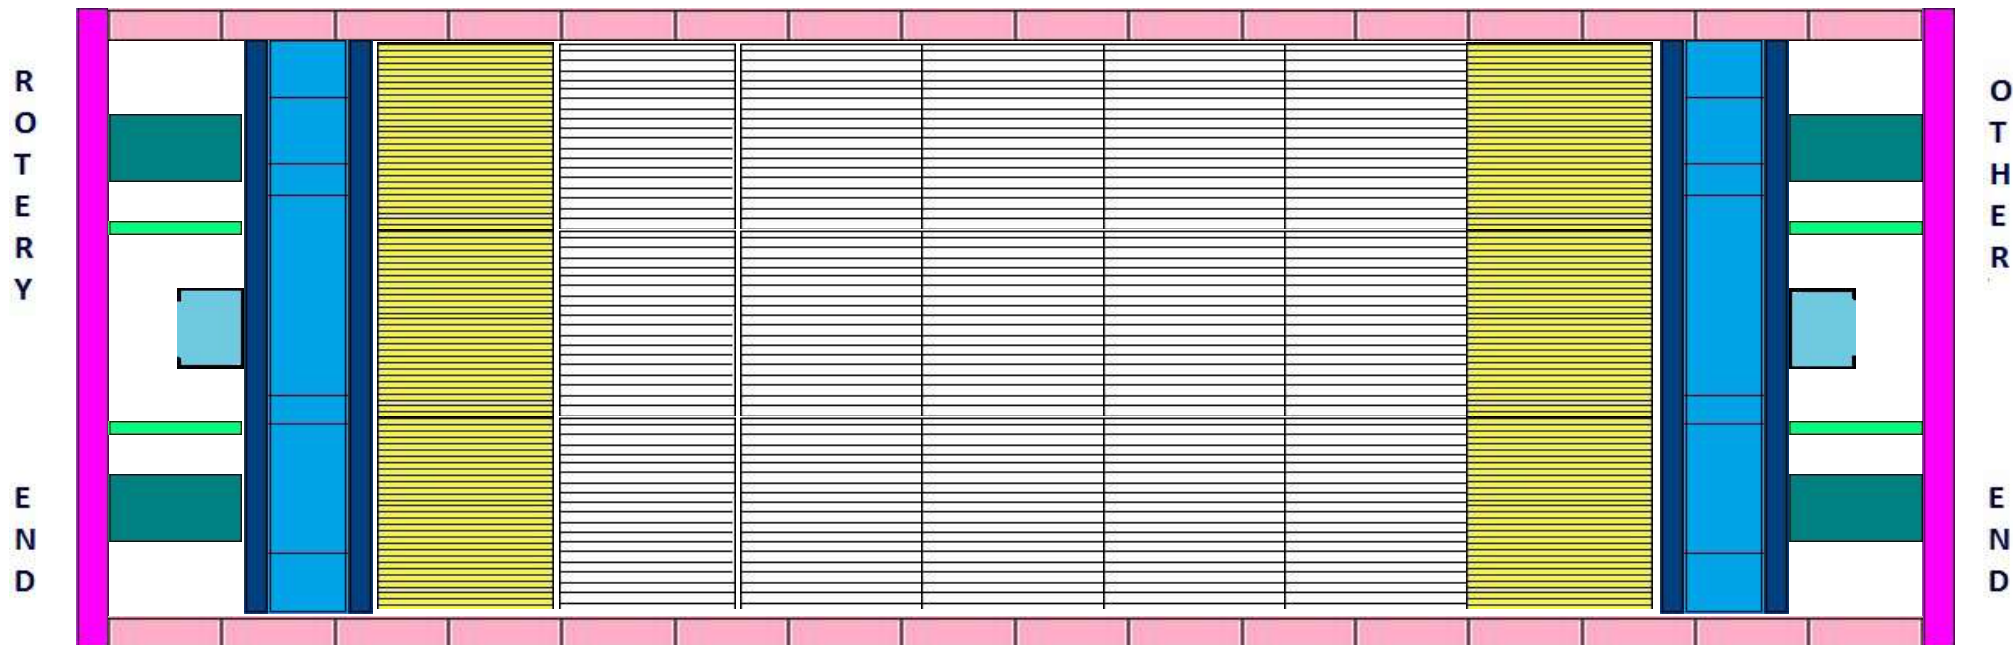

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Black	Aux. Head stock	4	100%	Yellow	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Orange	Trough floor	2	29%	Dark Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	74%		Window Bar	36	43%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 3, WEST : 2 Other End - EAST : 0, WEST : 2
Start Date : 02-Sep-2019, Completion Date : 11-Sep-2019, Net Repair Days : 9, Total Man Hours : 2056

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR077162


Type : GSRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

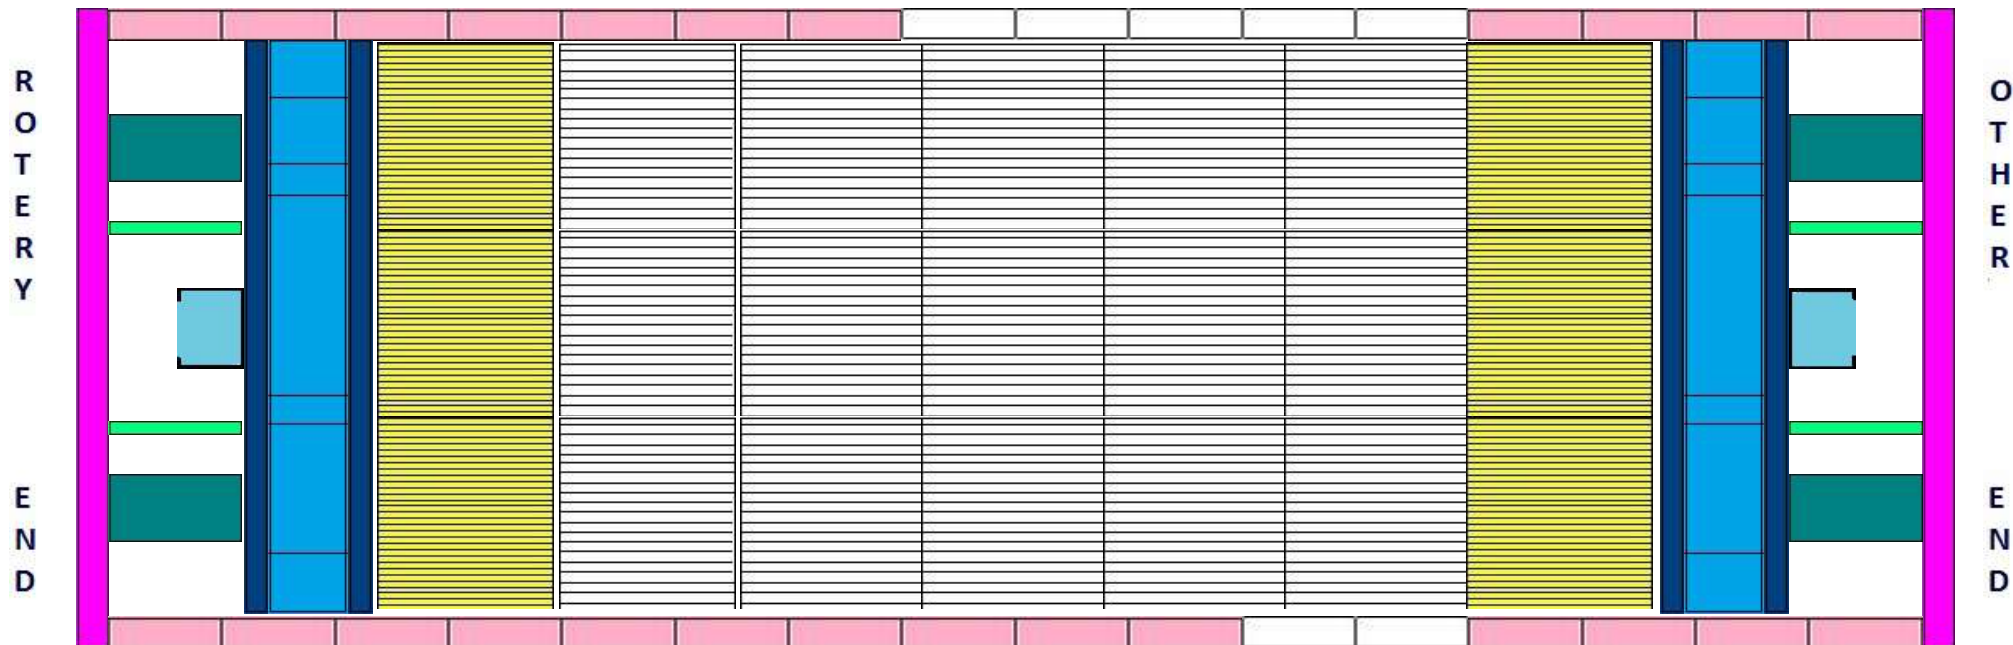

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	12.5	78%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	12.5	78%		Body panel/patch		100%		Door Top/Roof Patch		100%
	Window Module		0%		Window Sill	40	100%		Window Bar	46	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 6, WEST : 6 Other End - EAST : 6, WEST : 3
Start Date : 03-Sep-2019, Completion Date : 10-Sep-2019, Net Repair Days : 9, Total Man Hours : 1484

HAMANT JADAV - JE	M L KOLI - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	---------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR077101


Type : GSRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

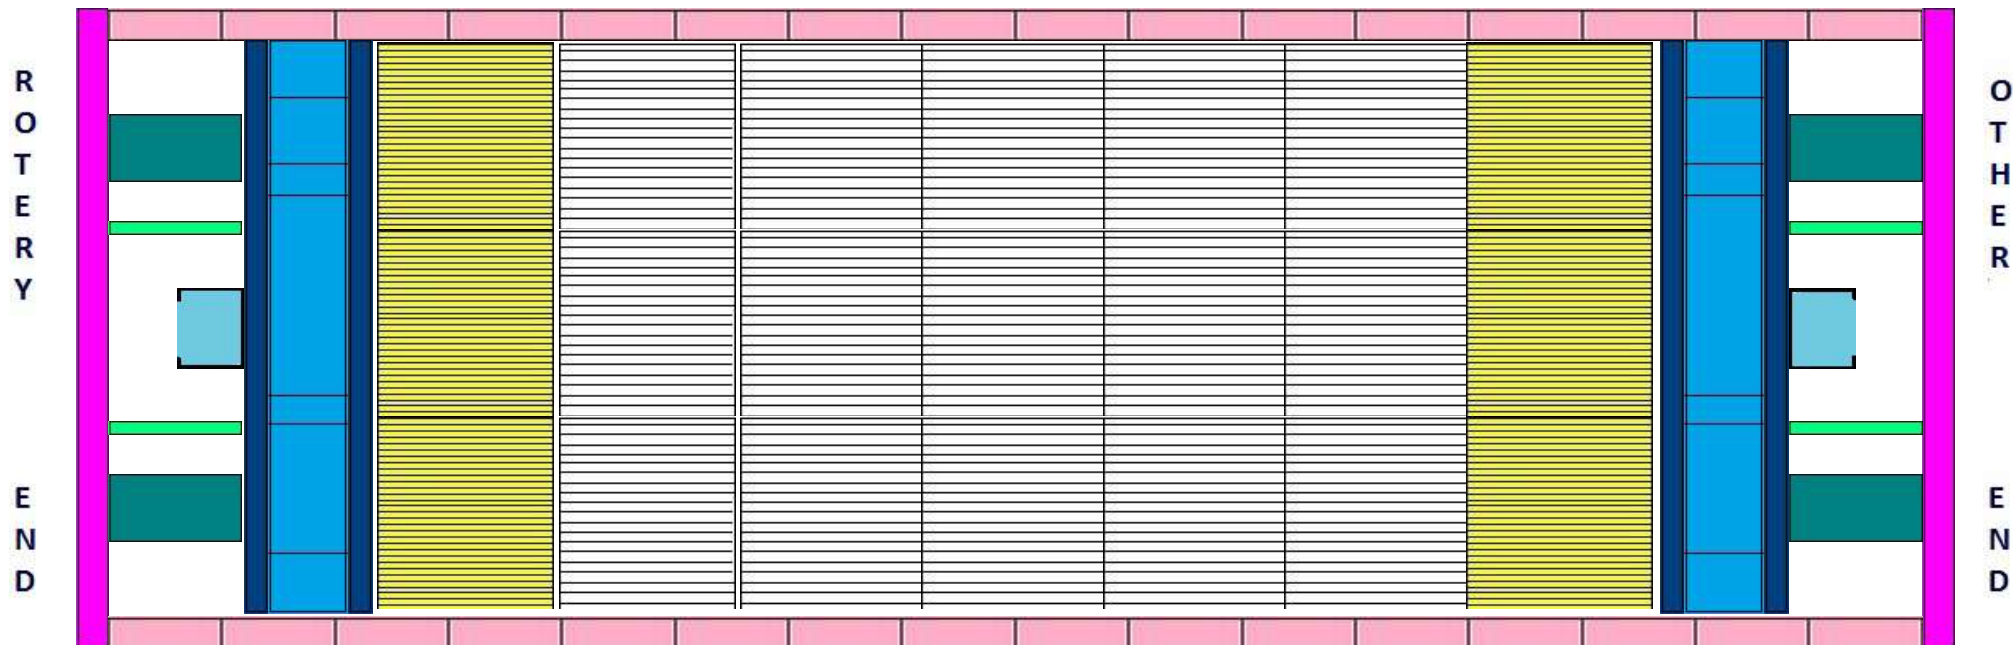

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	34	94%		Window Bar	70	38%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -3, WEST : -2 Other End - EAST : 5, WEST : 0

Start Date : 02-Sep-2019, Completion Date : 11-Sep-2019, Net Repair Days : 9, Total Man Hours : 1608

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062680


Type : WGSCN

Built Year : 2006

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

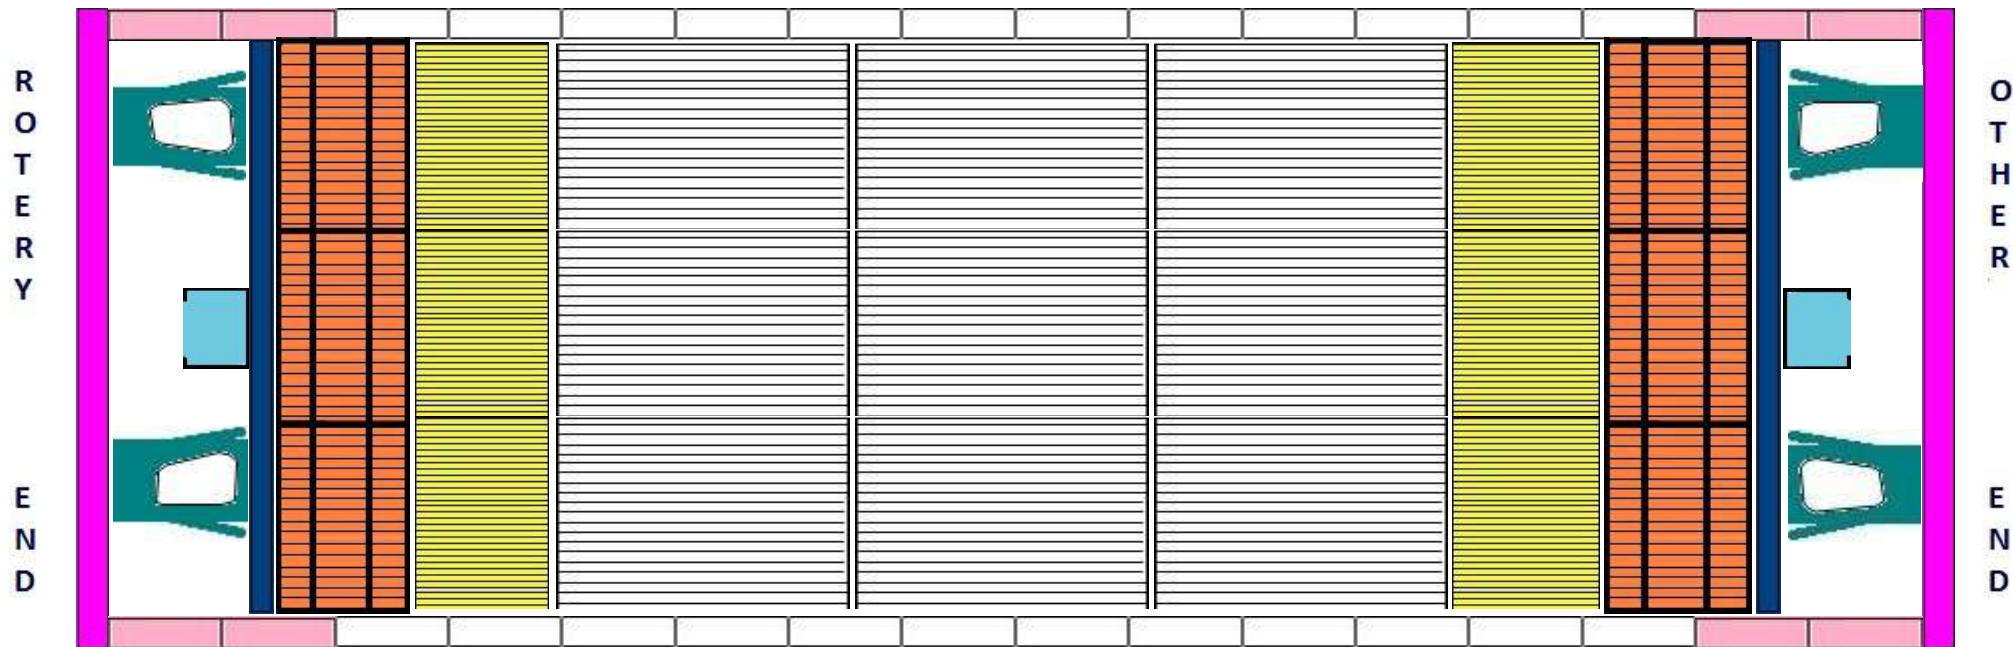

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	30	75%
	Window Bar	36	20%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : -10, WEST : -10 Other End - EAST : -8, WEST : -10
Start Date : 30-Aug-2019, Completion Date : 06-Sep-2019, Net Repair Days : 7, Total Man Hours : 1028

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
------------------	--------------------	--------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR074032
Form No. F/BR/ICF/002

Type : GS

Built Year : 2007

Make : ICF

Valid From: 02/04/2015

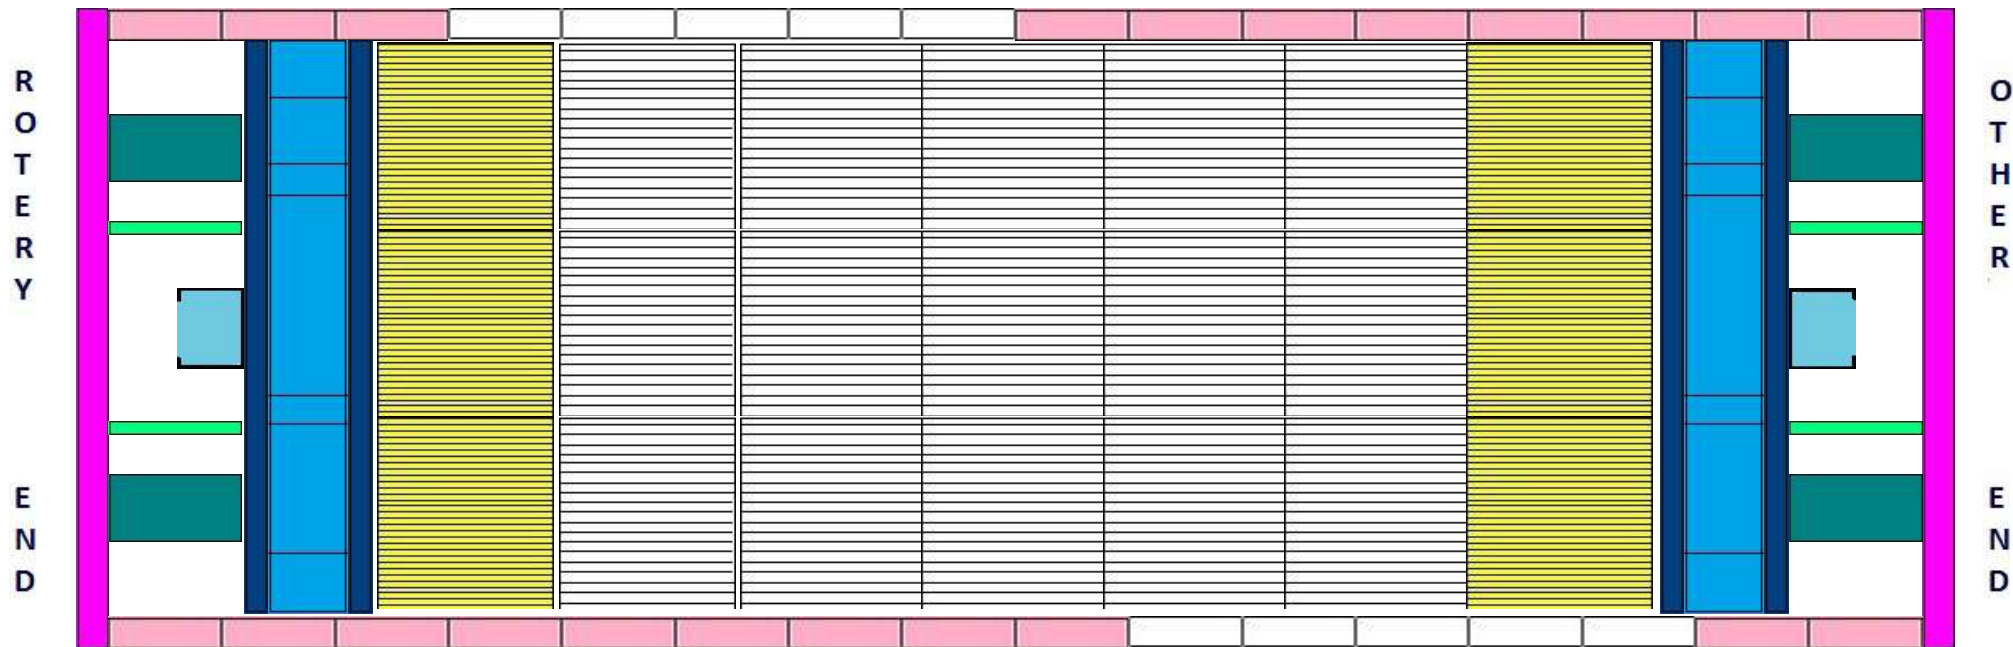

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	11	69%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	11	69%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	7	18%		Window Bar	36	20%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : -2 Other End - EAST : 0, WEST : -3
Start Date : 03-Sep-2019, Completion Date : 10-Sep-2019, Net Repair Days : 7, Total Man Hours : 1168

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	--------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR072230


Type : WGSCN

Built Year : 2007

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

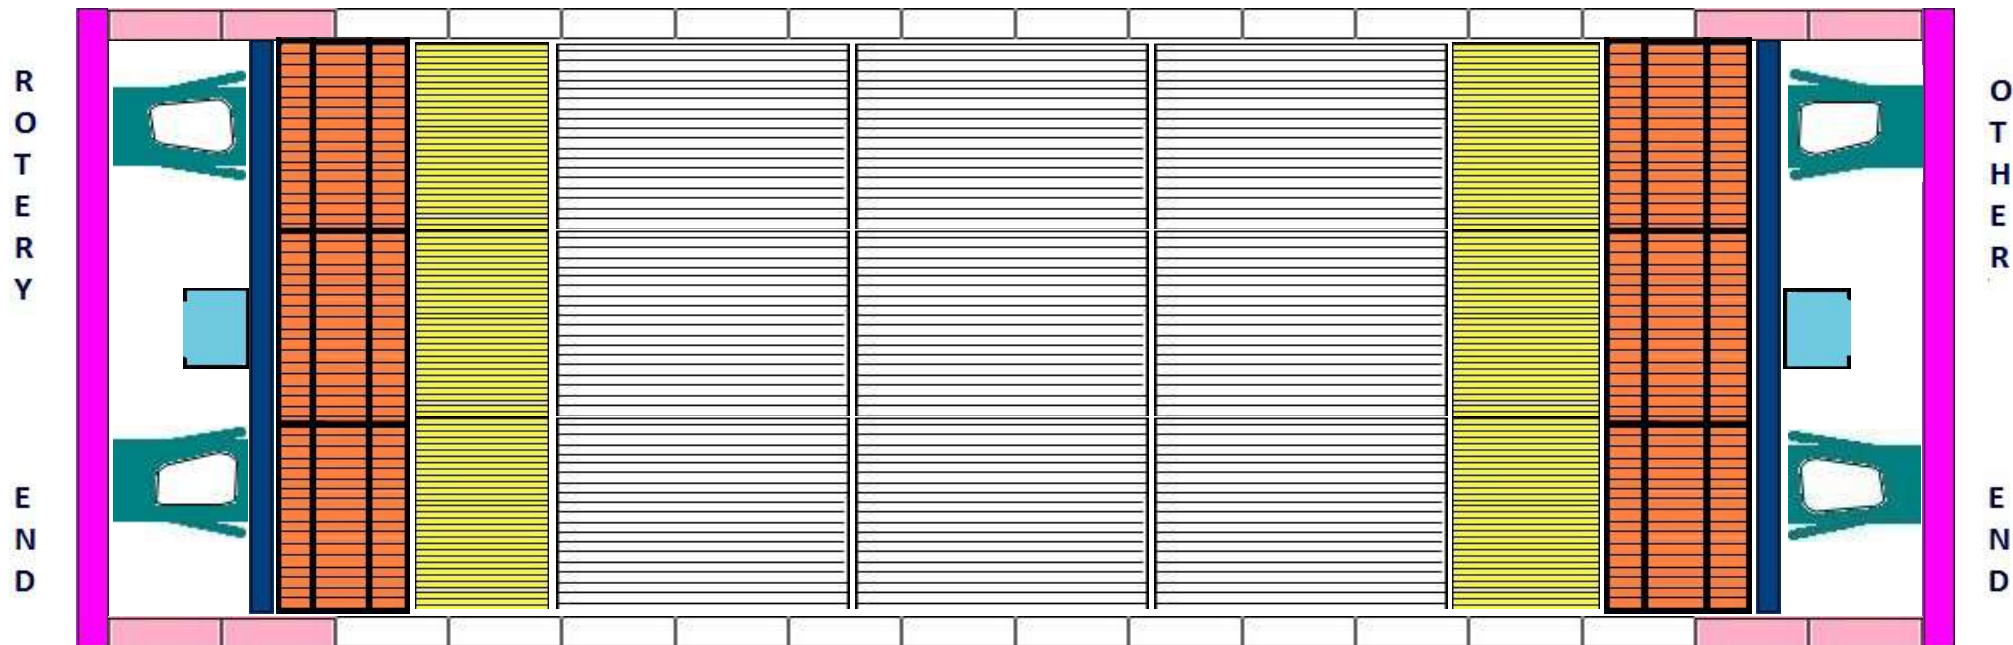

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	28	70%
	Window Bar	48	26%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : -5, WEST : -7 Other End - EAST : -3, WEST : -6
Start Date : 22-Nov-2019, Completion Date : 30-Nov-2019, Net Repair Days : 8, Total Man Hours : 1096

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
-------------------	--------------------	------------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR074022


Type : GS

Built Year : 2007

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

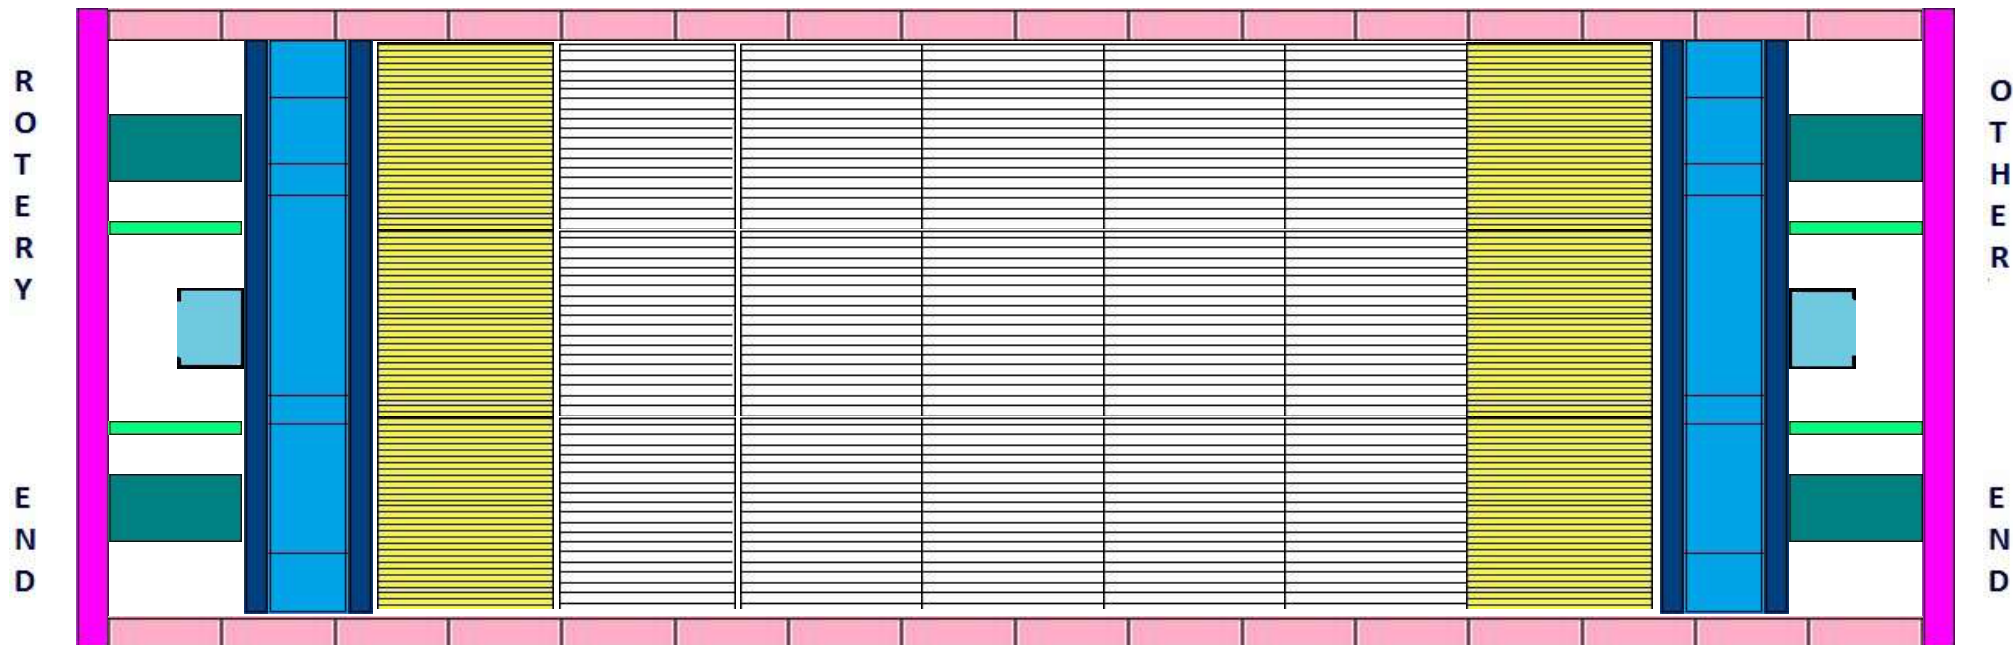

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Light Blue	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	72	41%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -10, WEST : -4 Other End - EAST : -8, WEST : -10
Start Date : 12-Oct-2019, Completion Date : 21-Oct-2019, Net Repair Days : 8, Total Man Hours : 1904

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR077172


Type : GSRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

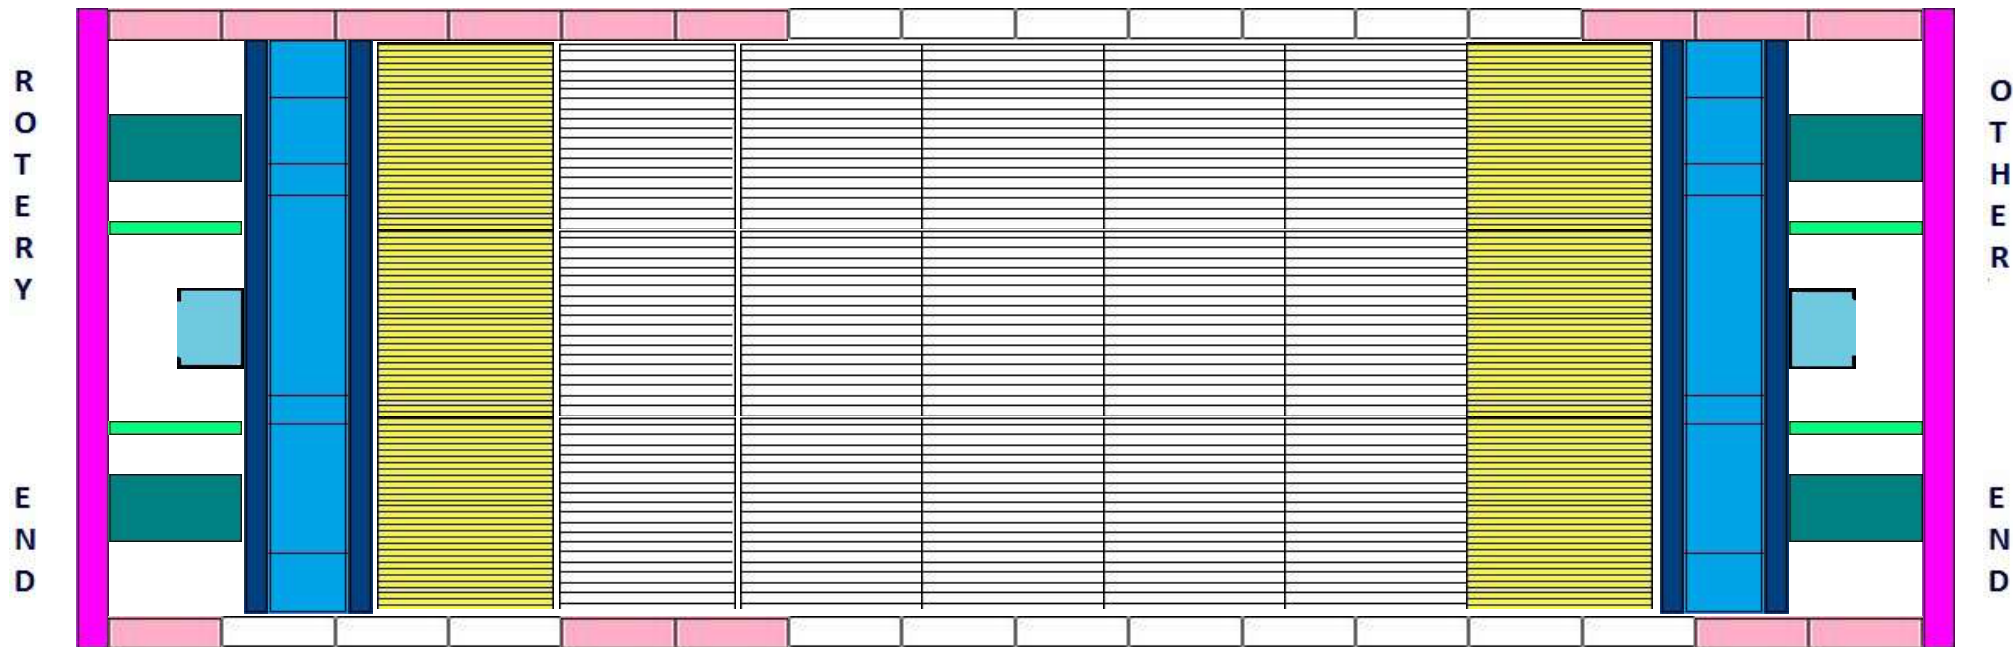

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	7	44%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	7	44%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	34	94%		Window Bar	40	23%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : -10 Other End - EAST : 4, WEST : 3
Start Date : 09-Oct-2019, Completion Date : 21-Oct-2019, Net Repair Days : 11, Total Man Hours : 1400

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR077091


Type : GSRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

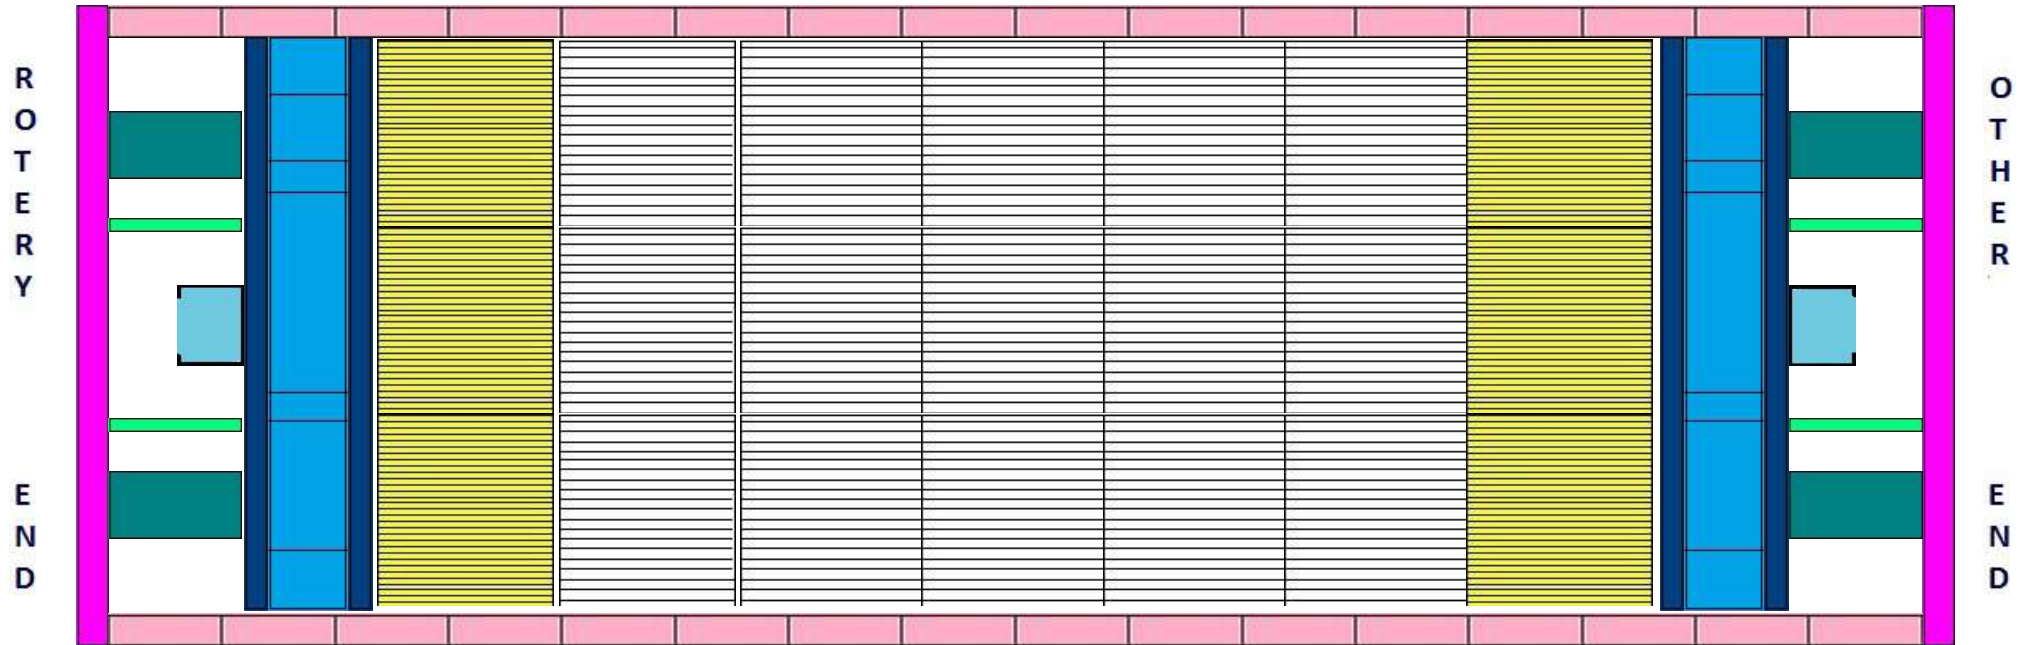

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	36	100%		Window Bar	68	40%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -4, WEST : -4 Other End - EAST : 8, WEST : 0
Start Date : 15-Oct-2019, Completion Date : 30-Oct-2019, Net Repair Days : 14, Total Man Hours : 1797

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062984


Type : WGSCN

Built Year : 2006

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

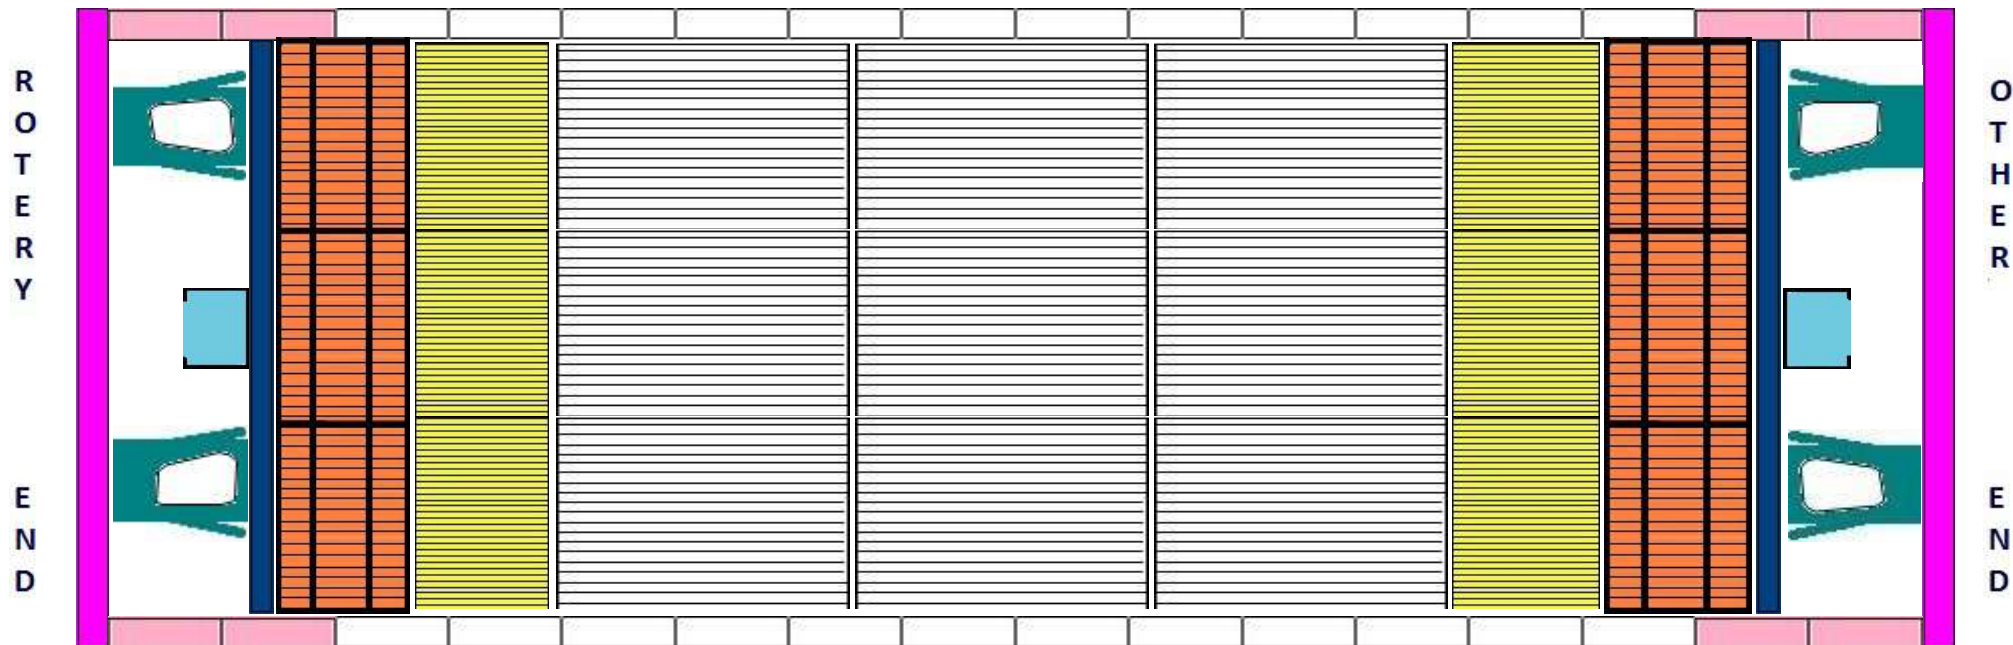

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	6	15%
	Window Bar	14	8%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : -4, WEST : -4 Other End - EAST : 0, WEST : -3
Start Date : 30-Sep-2019, Completion Date : 10-Oct-2019, Net Repair Days : 10, Total Man Hours : 1248

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
-------------------	--------------------	------------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062761


Type : WGSCN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

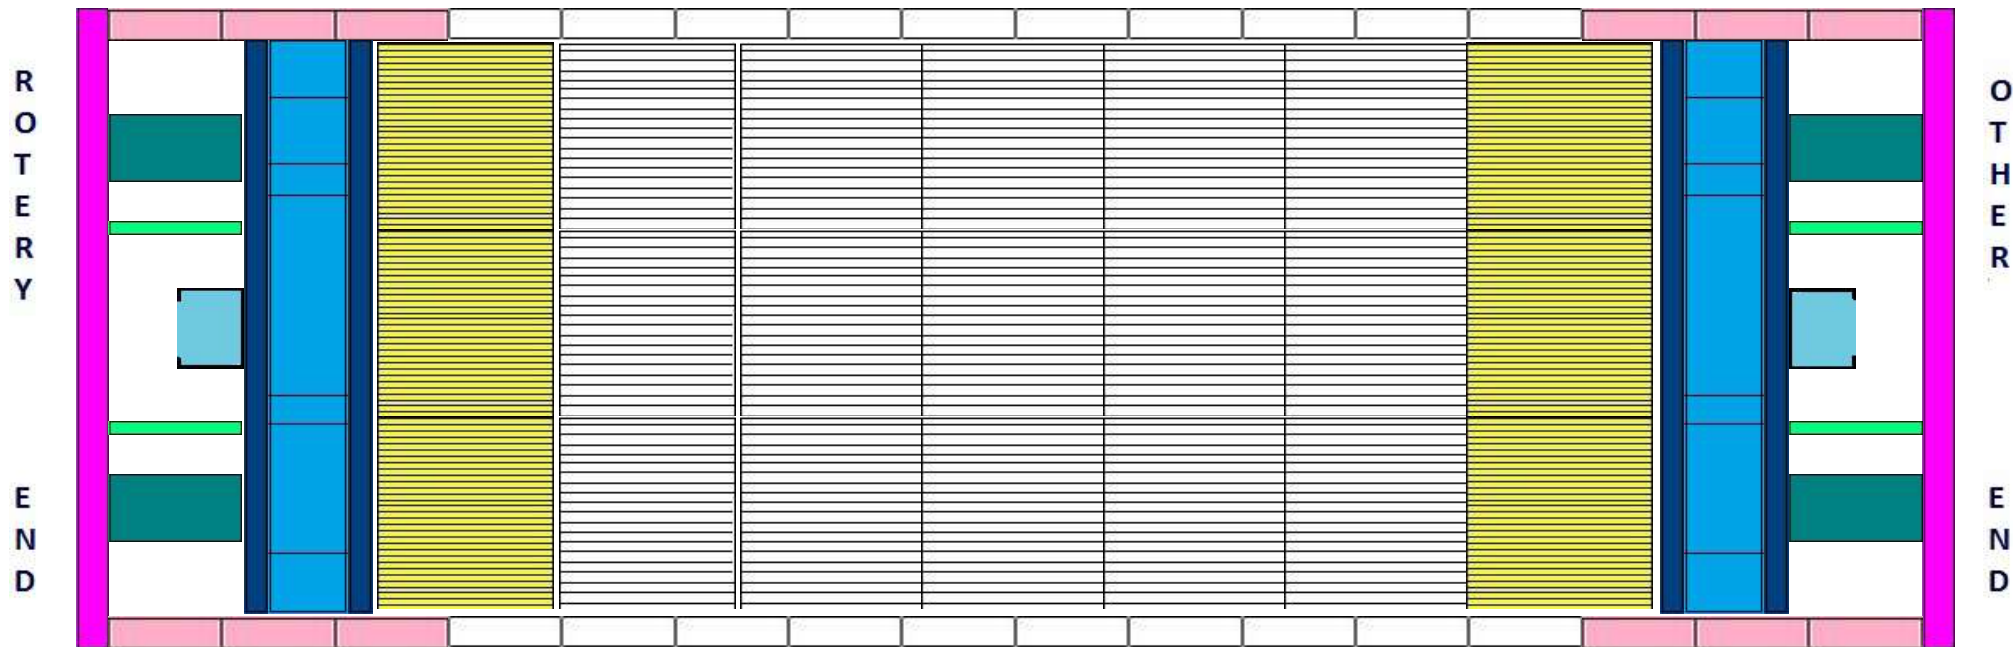

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Blue	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Black	Aux. Head stock	4	100%	Green	Sole Bar	6	38%	Orange	Draft Gear Bracket	2	100%
Blue	Trough floor	2	29%	Red	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	6	38%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	7	18%		Window Bar	46	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -2, WEST : -5 Other End - EAST : 0, WEST : 0

Start Date : 09-Nov-2019, Completion Date : 18-Nov-2019, Net Repair Days : 8, Total Man Hours : 1224

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR063090


Type : WGSCN

Built Year : 2006

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

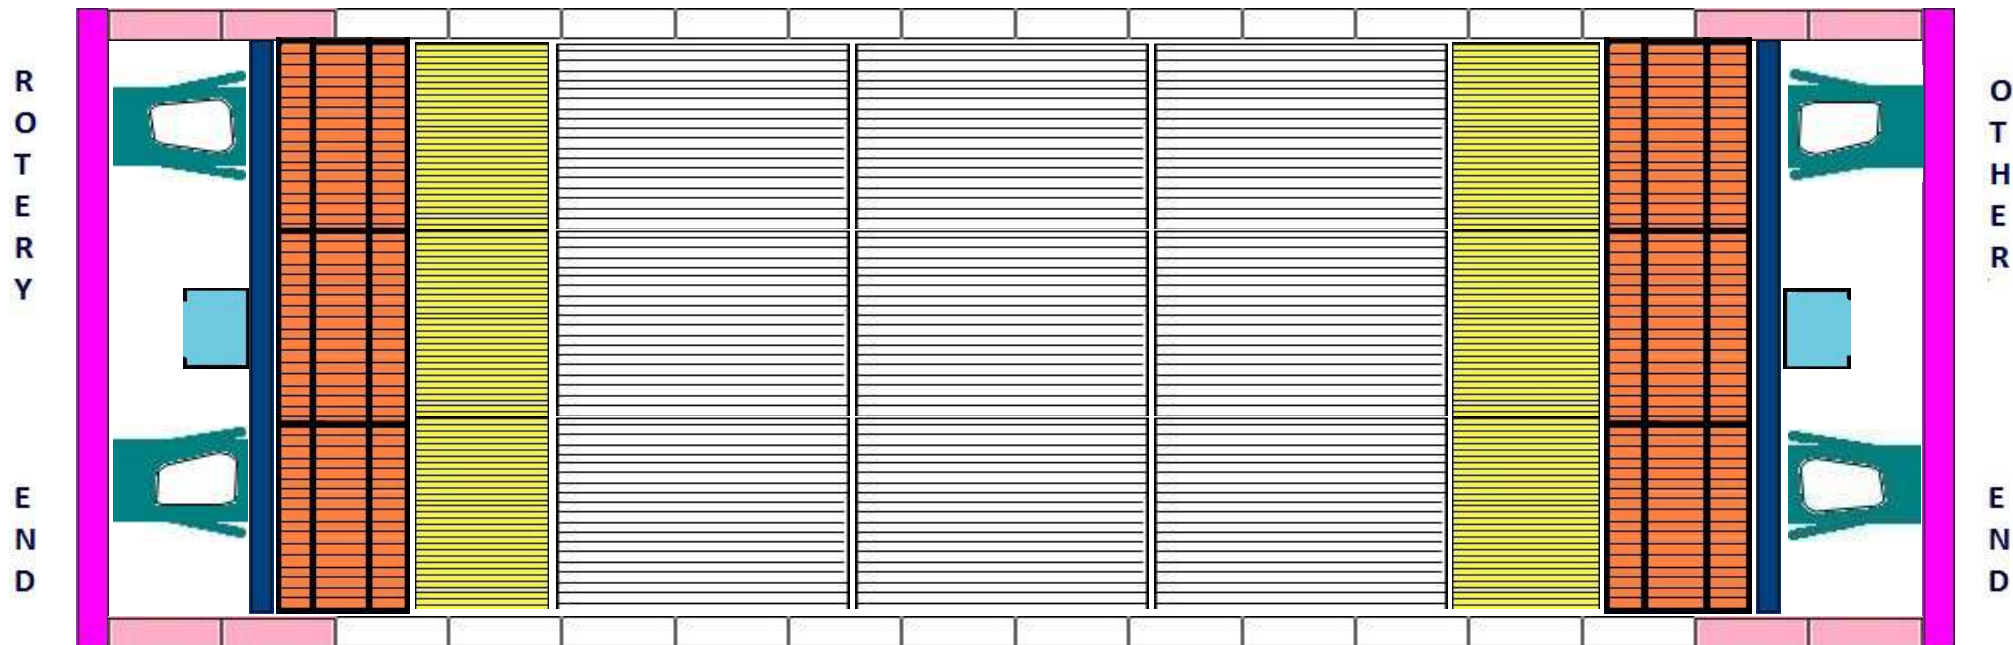

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	7	18%
	Window Bar	0	0%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : -3, WEST : 4 Other End - EAST : -3, WEST : -4

Start Date : 07-Nov-2019, Completion Date : 15-Nov-2019, Net Repair Days : 8, Total Man Hours : 1096

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
----------------------	---------------------	-----------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR064205


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

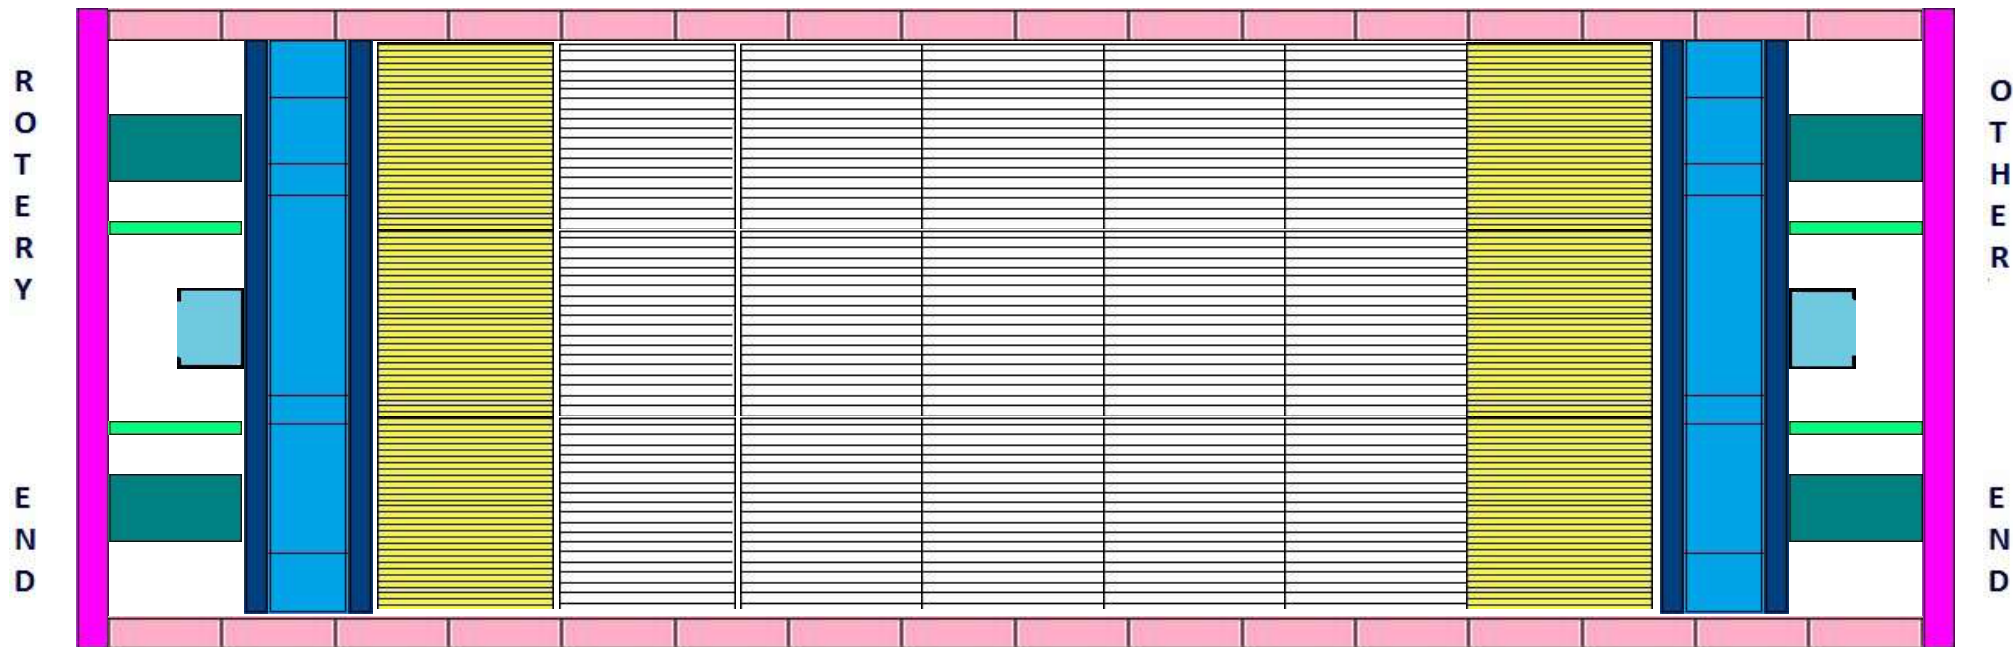

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Bright Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	70	40%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 9, WEST : 8 Other End - EAST : 0, WEST : 8
Start Date : 04-Nov-2019, Completion Date : 15-Nov-2019, Net Repair Days : 13, Total Man Hours : 1800

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR128356


Type : VPH

Built Year : 2012

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

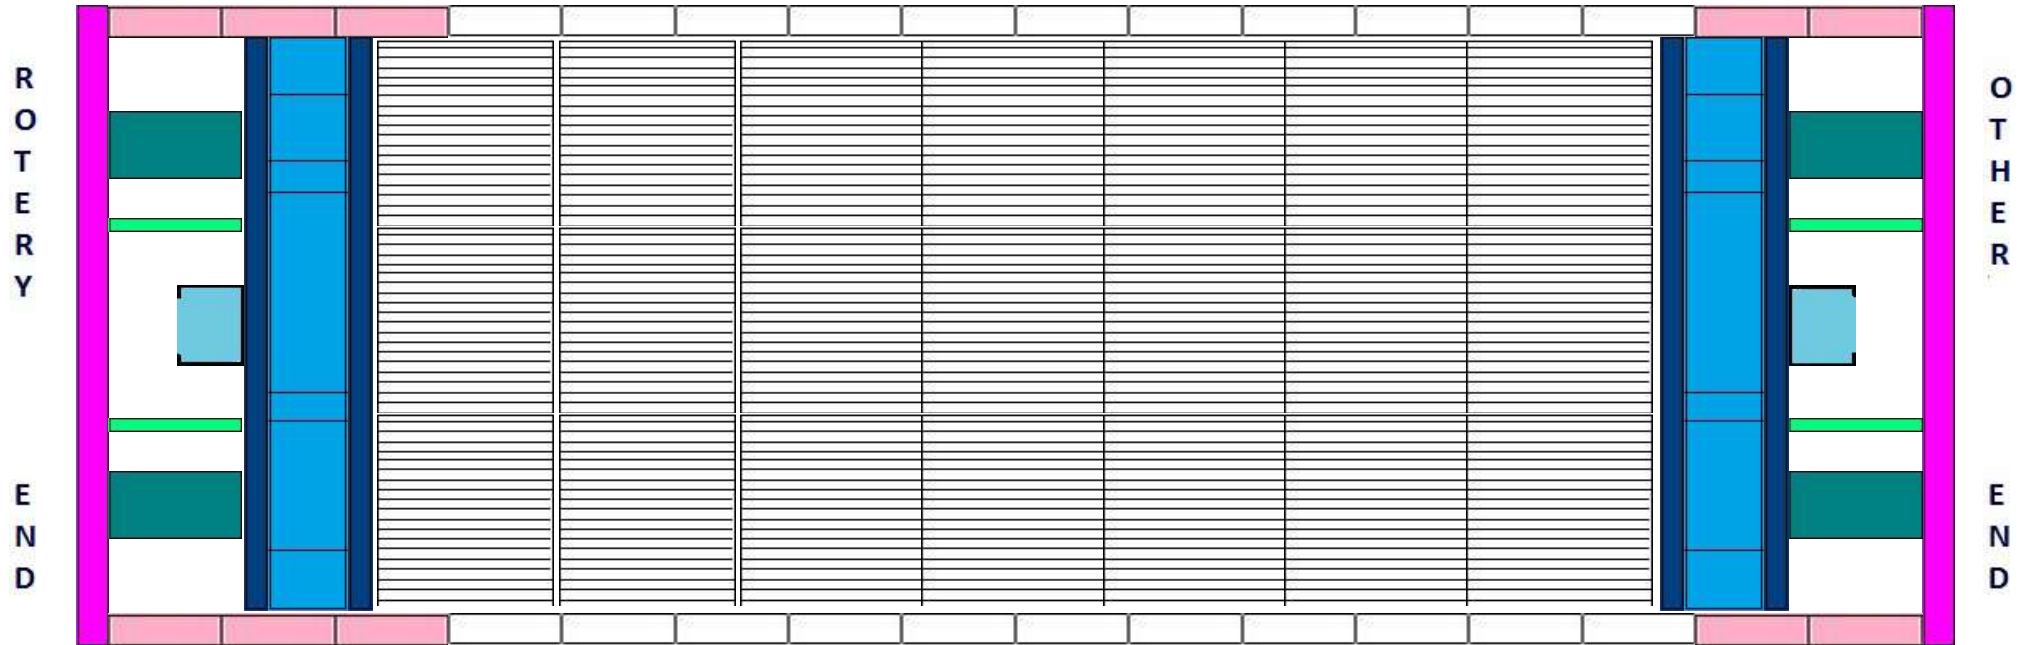

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	5	31%		Draft Gear Bracket	2	100%
	Trough floor	0	0%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	5	31%		Body panel/patch		20%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 12-Oct-2019, Completion Date : 18-Oct-2019, Net Repair Days : 6, Total Man Hours : 976

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	--------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR088341


Type : VPH

Built Year : 2008

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

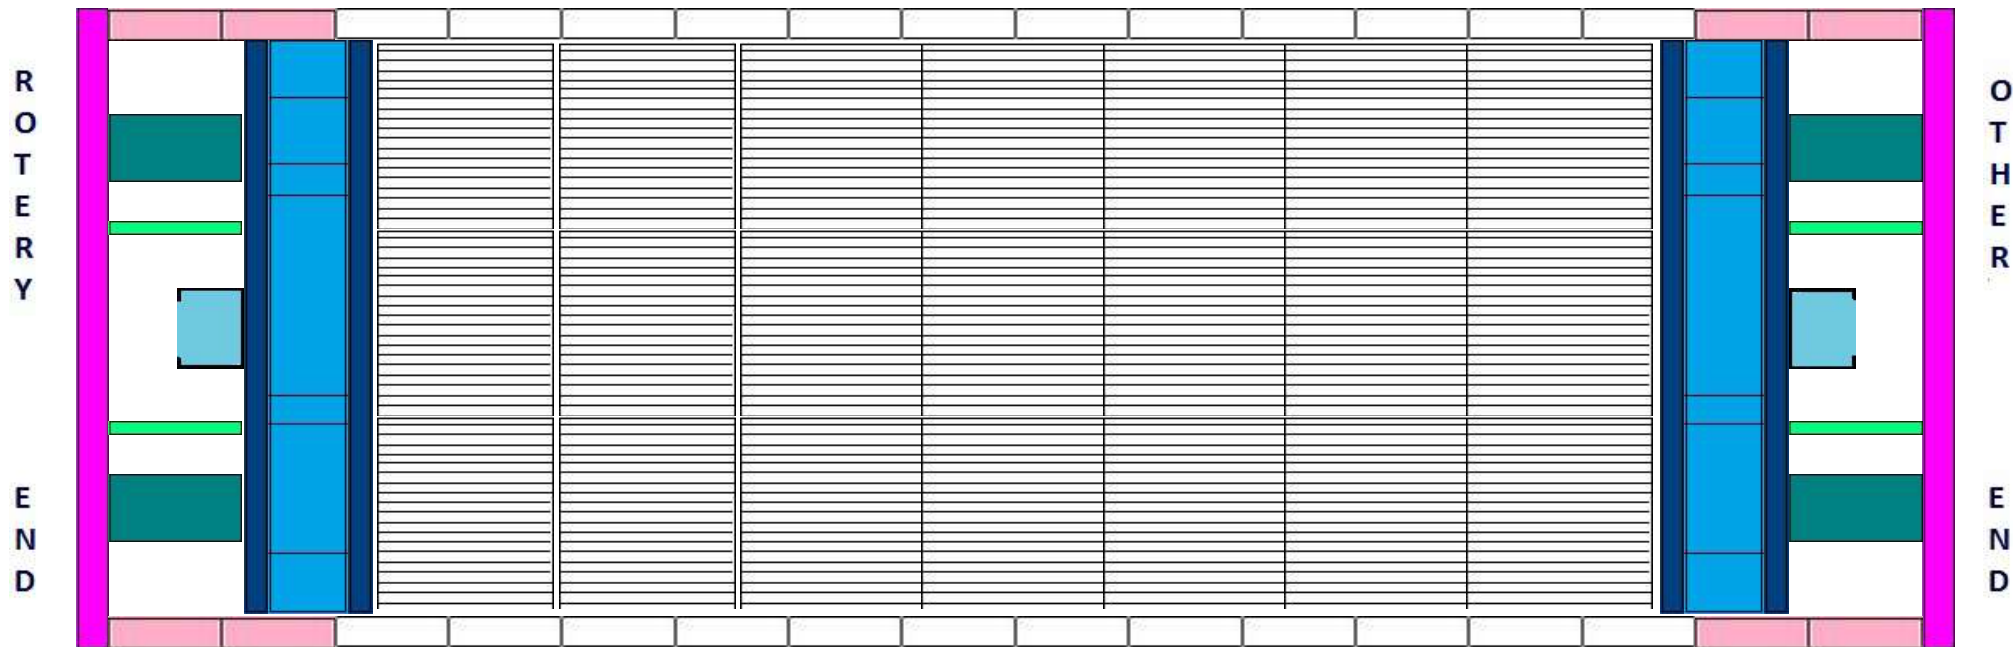

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	0	0%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4	25%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 11-Oct-2019, Completion Date : 15-Oct-2019, Net Repair Days : 4, Total Man Hours : 504

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR063061


Type : WGSCN

Built Year : 2006

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

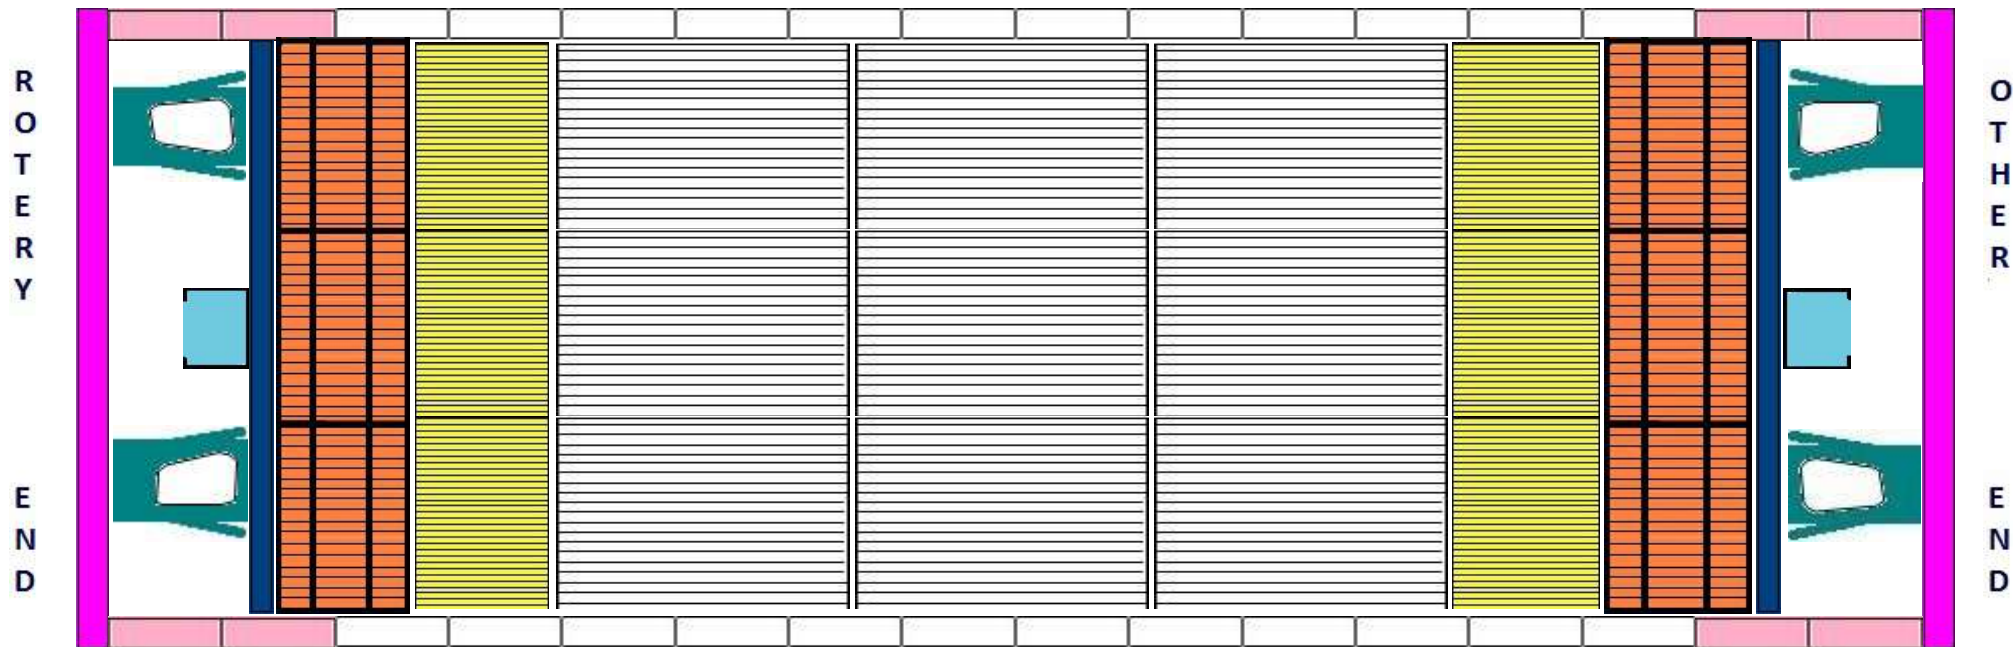

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	14	35%
	Window Bar	36	20%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : -6, WEST : -3 Other End - EAST : 3, WEST : 3
Start Date : 15-Oct-2019, Completion Date : 23-Oct-2019, Net Repair Days : 8, Total Man Hours : 1056

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
------------------	----------------------	------------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR057410
Form No. F/BR/ICF/002

Type : GSLRD

Built Year : 2005

Make : RCF

Valid From: 02/04/2015

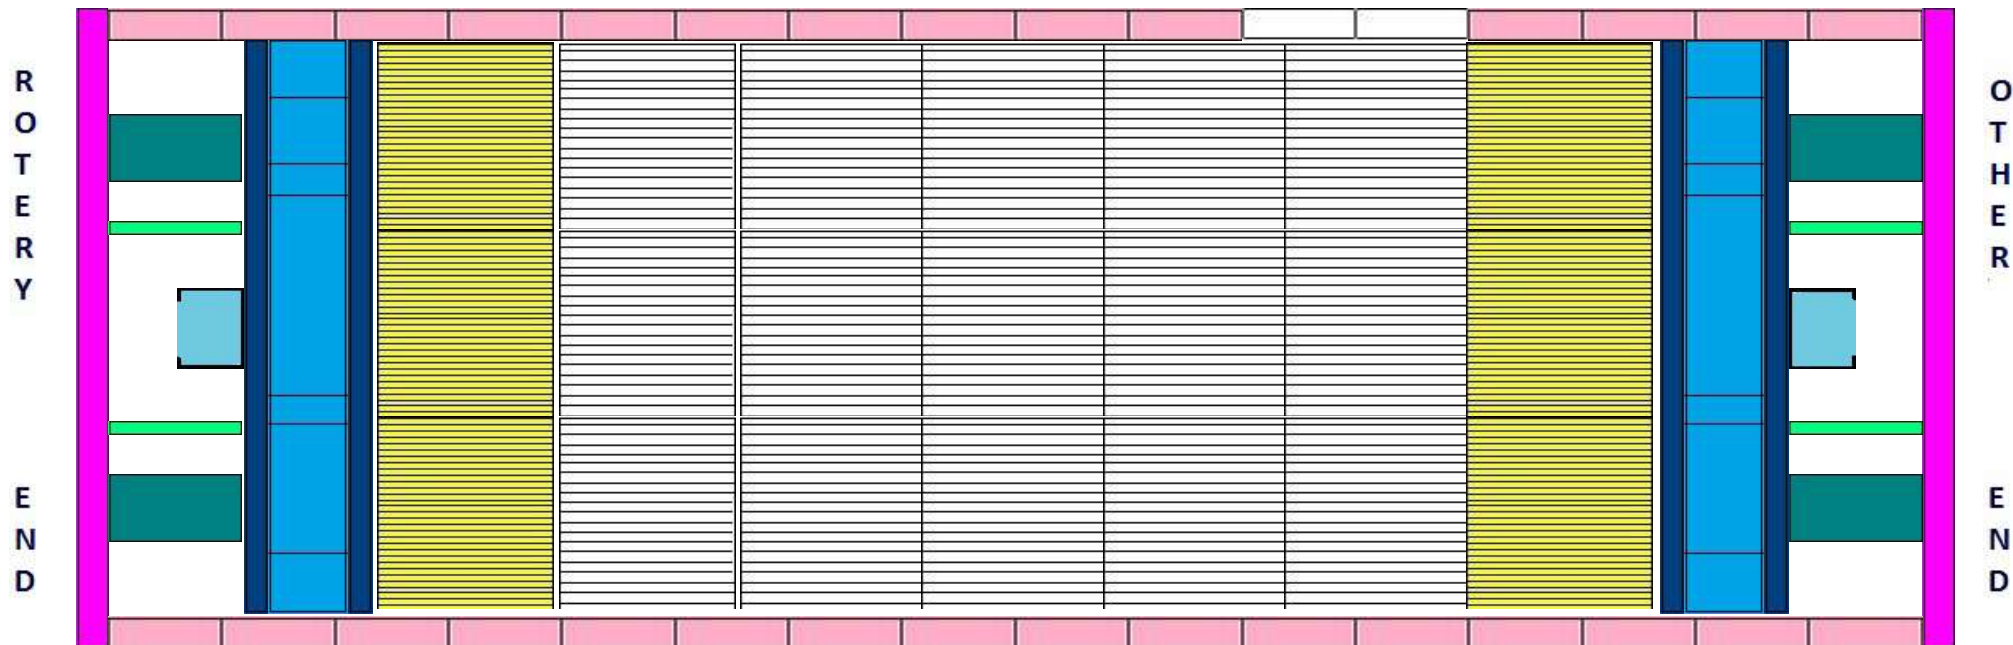

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	15	94%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	15	94%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	12	63%		Window Bar	30	36%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : 0 Other End - EAST : -3, WEST : 0
Start Date : 25-Nov-2019, Completion Date : 03-Dec-2019, Net Repair Days : 8, Total Man Hours : 2420

HAMANT JADAV - JE	M L KOLI - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	---------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR074624


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

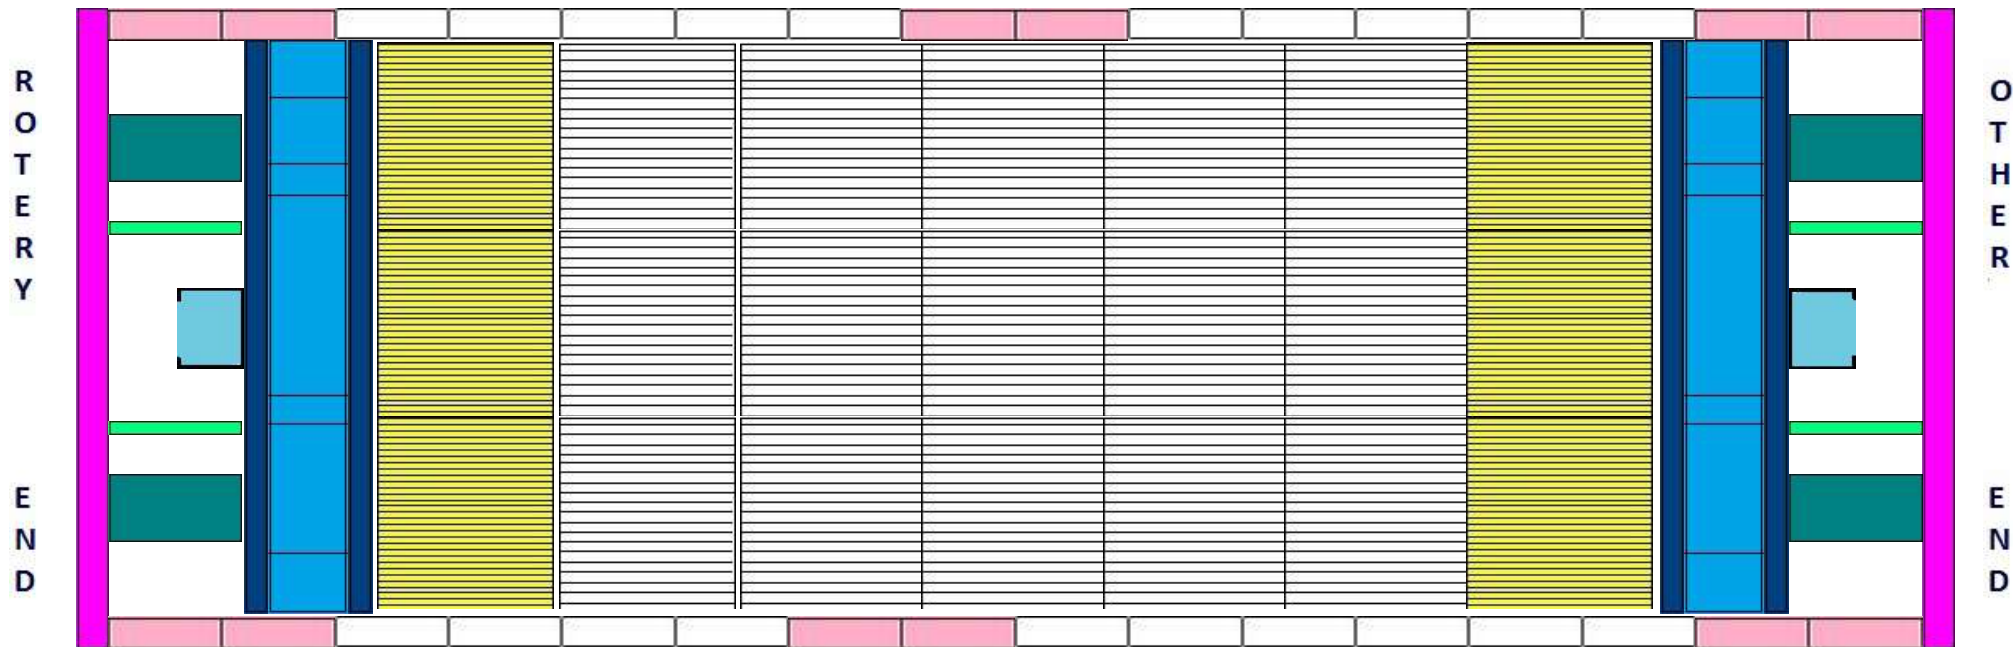

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	6	38%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	6	38%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	30	75%		Window Bar	64	36%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 8 Other End - EAST : -2, WEST : 0

Start Date : 07-Dec-2019, Completion Date : 16-Dec-2019, Net Repair Days : 8, Total Man Hours : 1596

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR057326
Form No. F/BR/ICF/002

Type : SLRD

Built Year : 2005

Make : RCF

Valid From: 02/04/2015

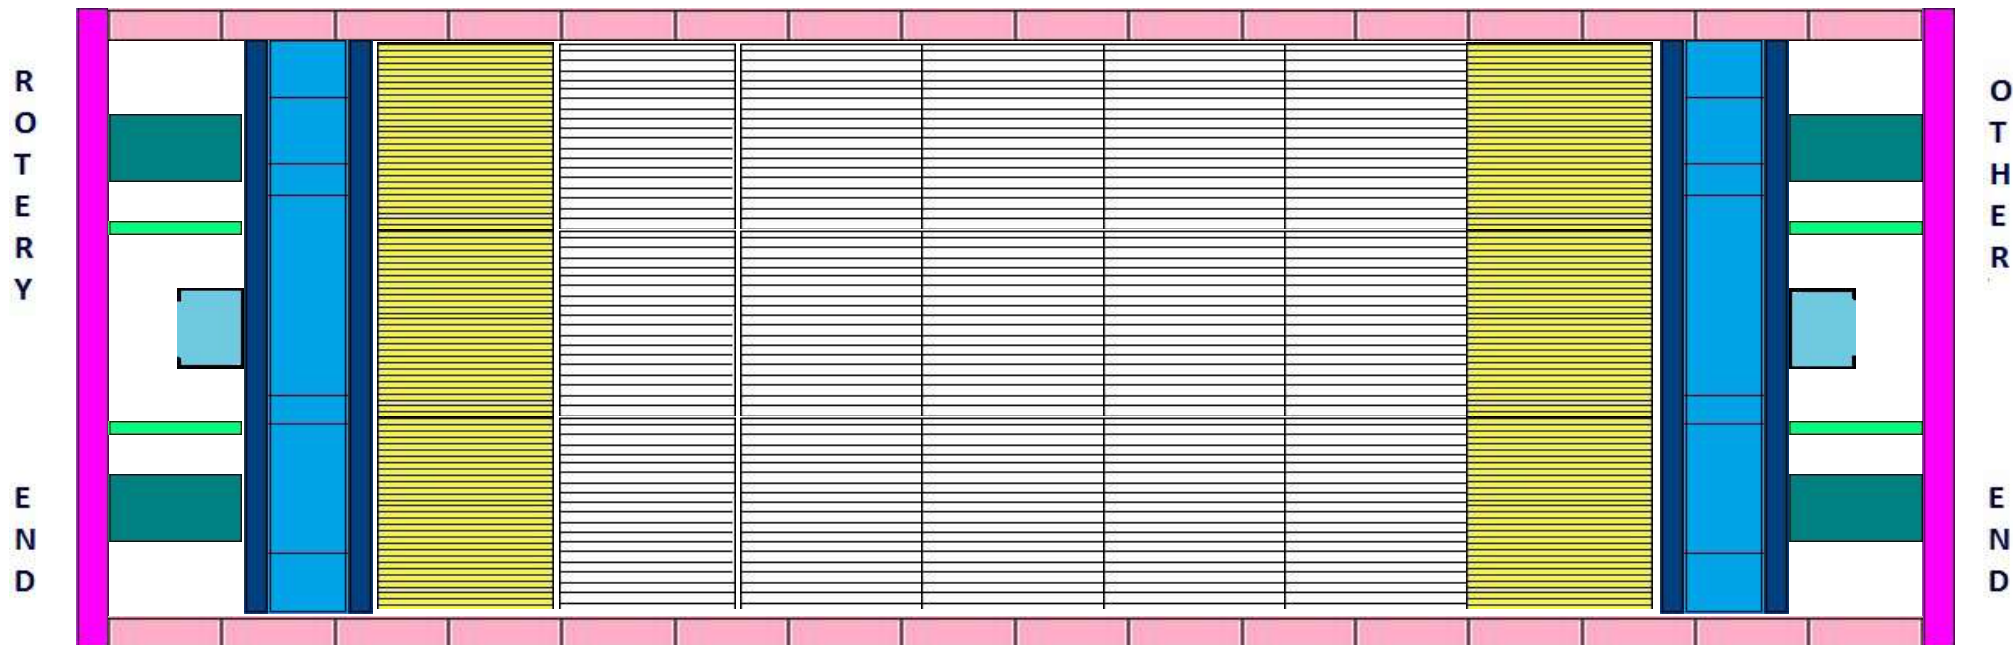

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Light Blue	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	10	53%		Window Bar	20	24%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 2, WEST : 5 Other End - EAST : -5, WEST : -4
Start Date : 07-Nov-2019, Completion Date : 19-Nov-2019, Net Repair Days : 11, Total Man Hours : 1176

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR052770
Form No. F/BR/ICF/002

Type : WGSCN

Built Year : 2005

Make : RCF

Valid From: 02/04/2015

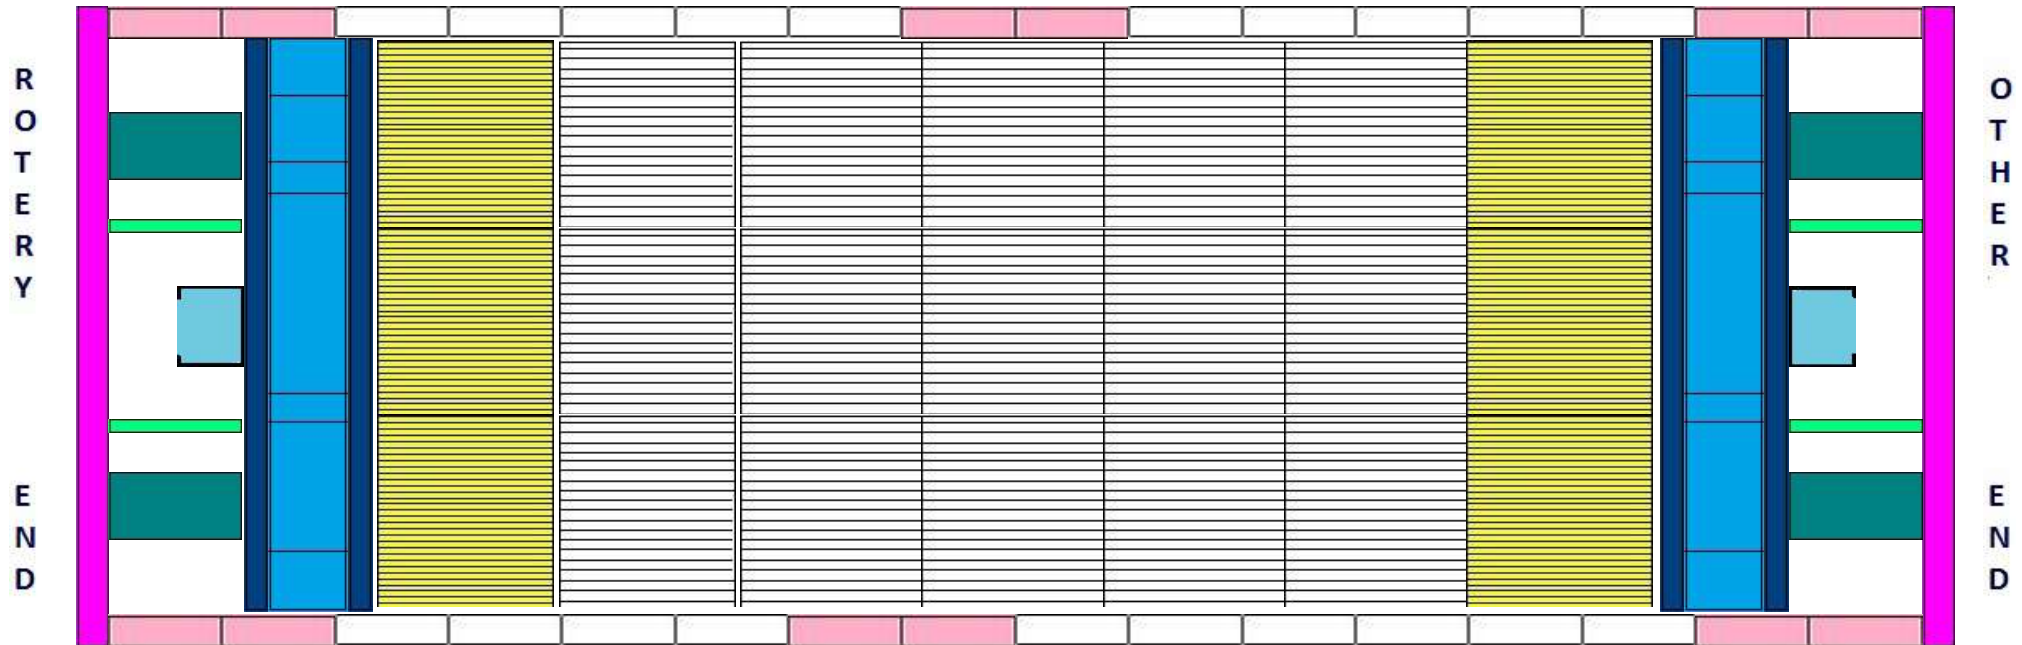

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Blue	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Light Blue	Sole Bar	6	38%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	6	38%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	46	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : -2 Other End - EAST : 6, WEST : -2
Start Date : 15-Nov-2019, Completion Date : 23-Nov-2019, Net Repair Days : 8, Total Man Hours : 1008

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR057480
Form No. F/BR/ICF/002

Type : GSLRD

Built Year : 2005

Make : RCF

Valid From: 02/04/2015

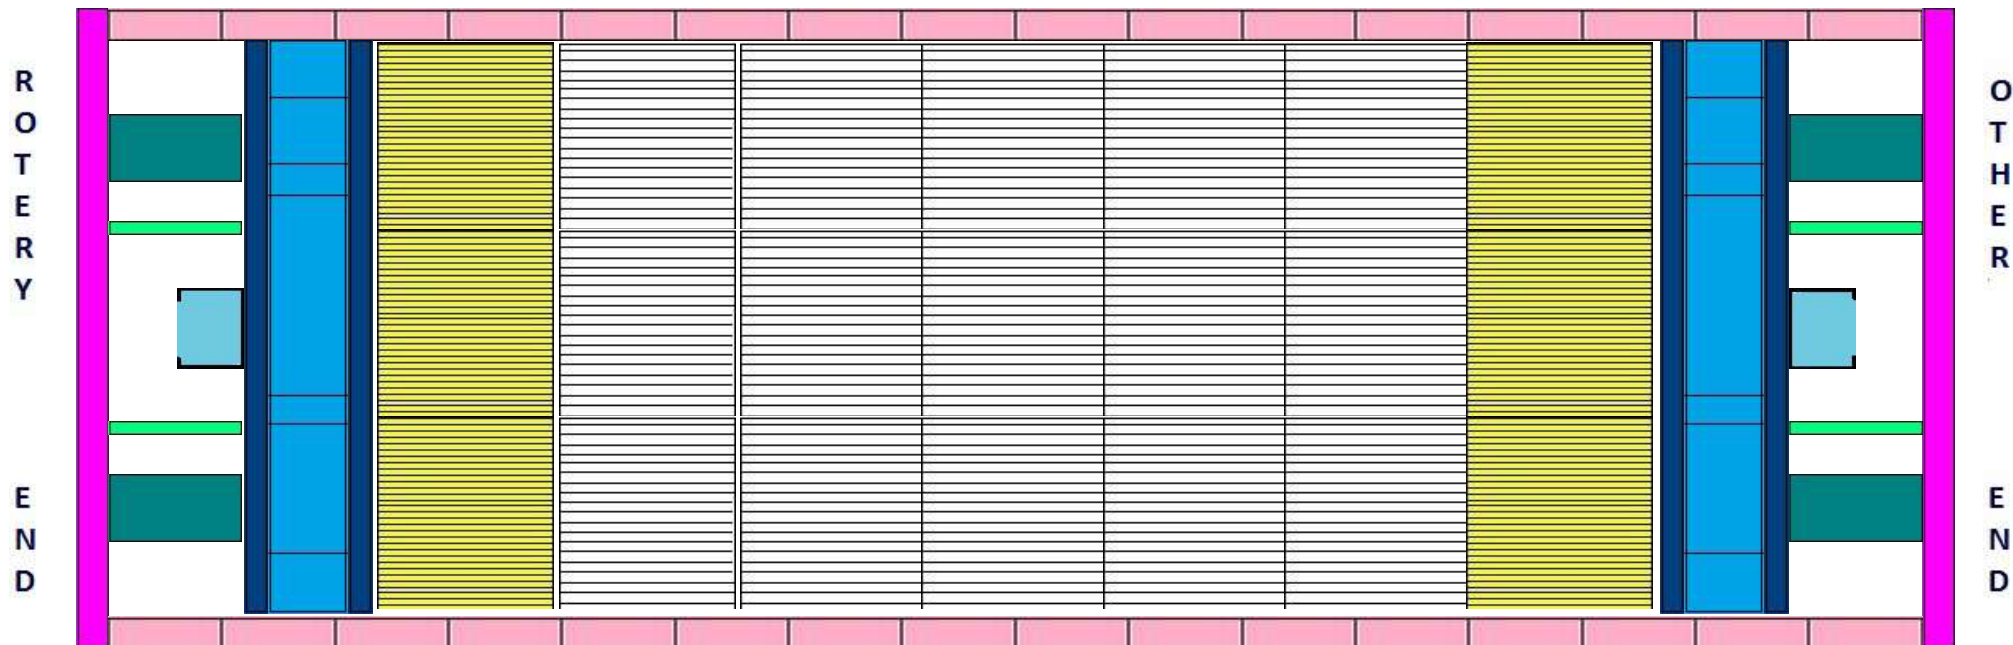

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	10	53%		Window Bar	16	19%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -10, WEST : -10 Other End - EAST : 3, WEST : 4
Start Date : 15-Nov-2019, Completion Date : 26-Nov-2019, Net Repair Days : 10, Total Man Hours : 0

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR057281


Type : GSLRD

Built Year : 2005

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

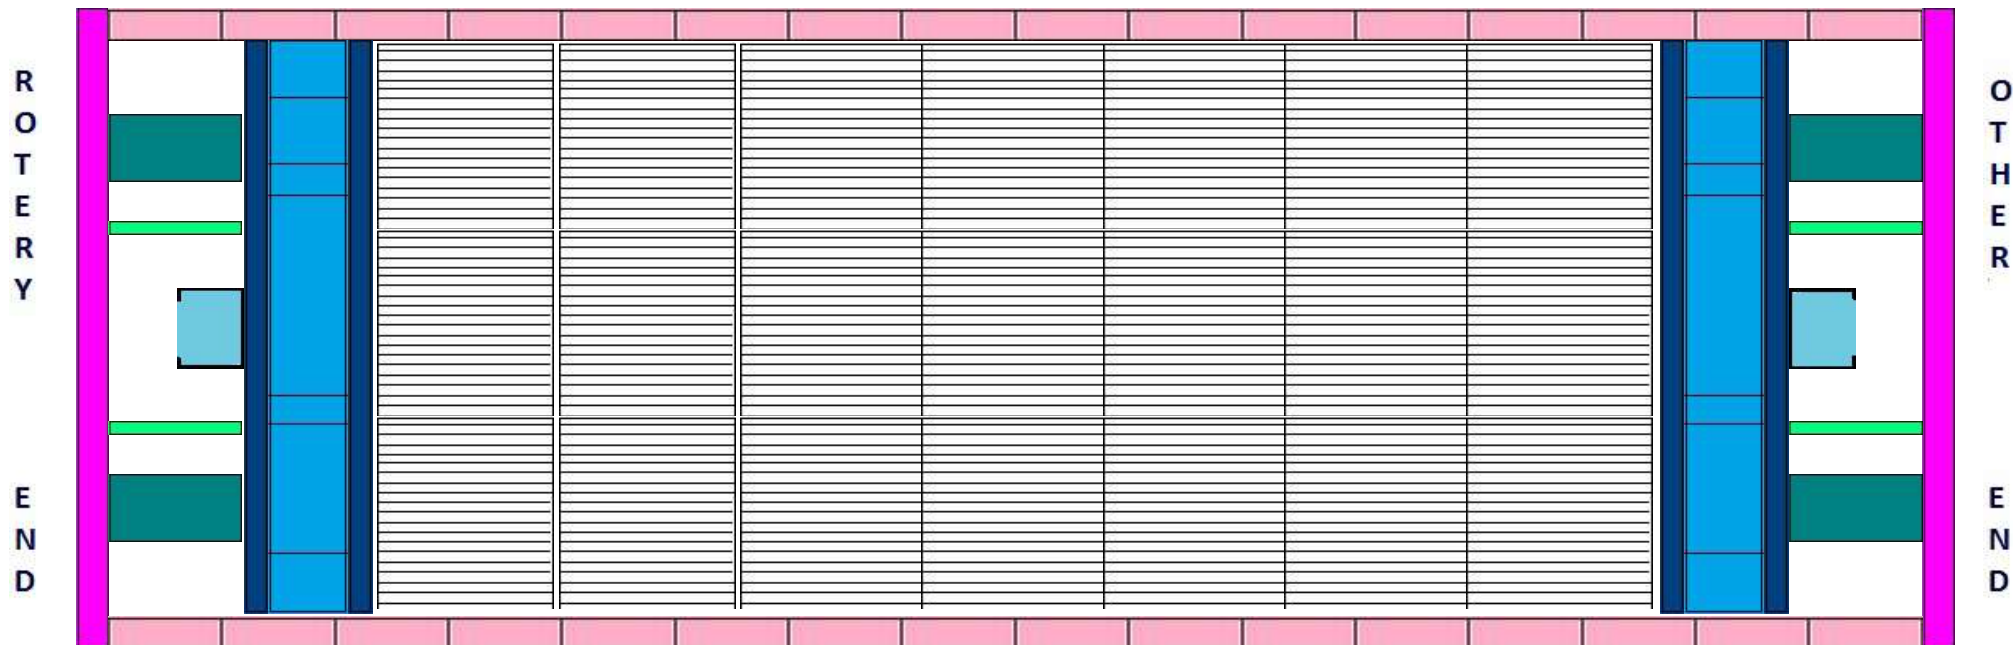

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Red	Centre Stiffner for Headstock	4	100%	Green	Floor Stiffner for Headstock	4	100%
Blue	Aux. Head stock	4	100%	Orange	Sole Bar	16	100%	Purple	Draft Gear Bracket	2	100%
Black	Trough floor	0	0%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	13	68%		Window Bar	24	29%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : 0 Other End - EAST : -10, WEST : -10
Start Date : 09-Nov-2019, Completion Date : 21-Nov-2019, Net Repair Days : 11, Total Man Hours : 1920

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR054194


Type : GS

Built Year : 2005

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

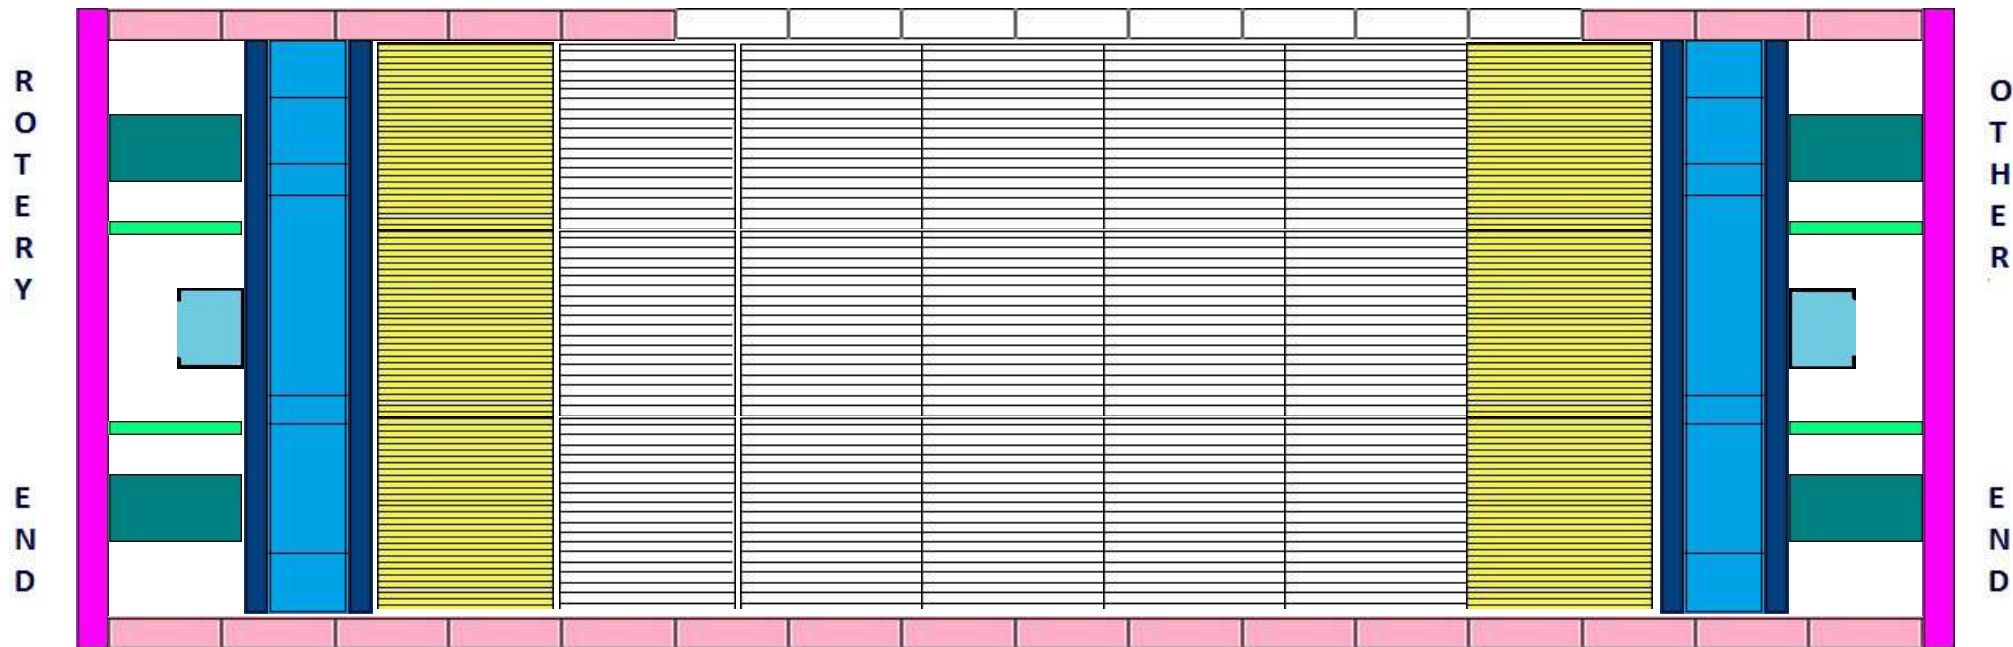

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	12	75%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	5	83%
	Bottom Wall Part	12	75%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : 6 Other End - EAST : -2, WEST : -6
Start Date : 15-Nov-2019, Completion Date : 26-Nov-2019, Net Repair Days : 10, Total Man Hours : 1312

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR128308


Type : VPH

Built Year : 2012

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

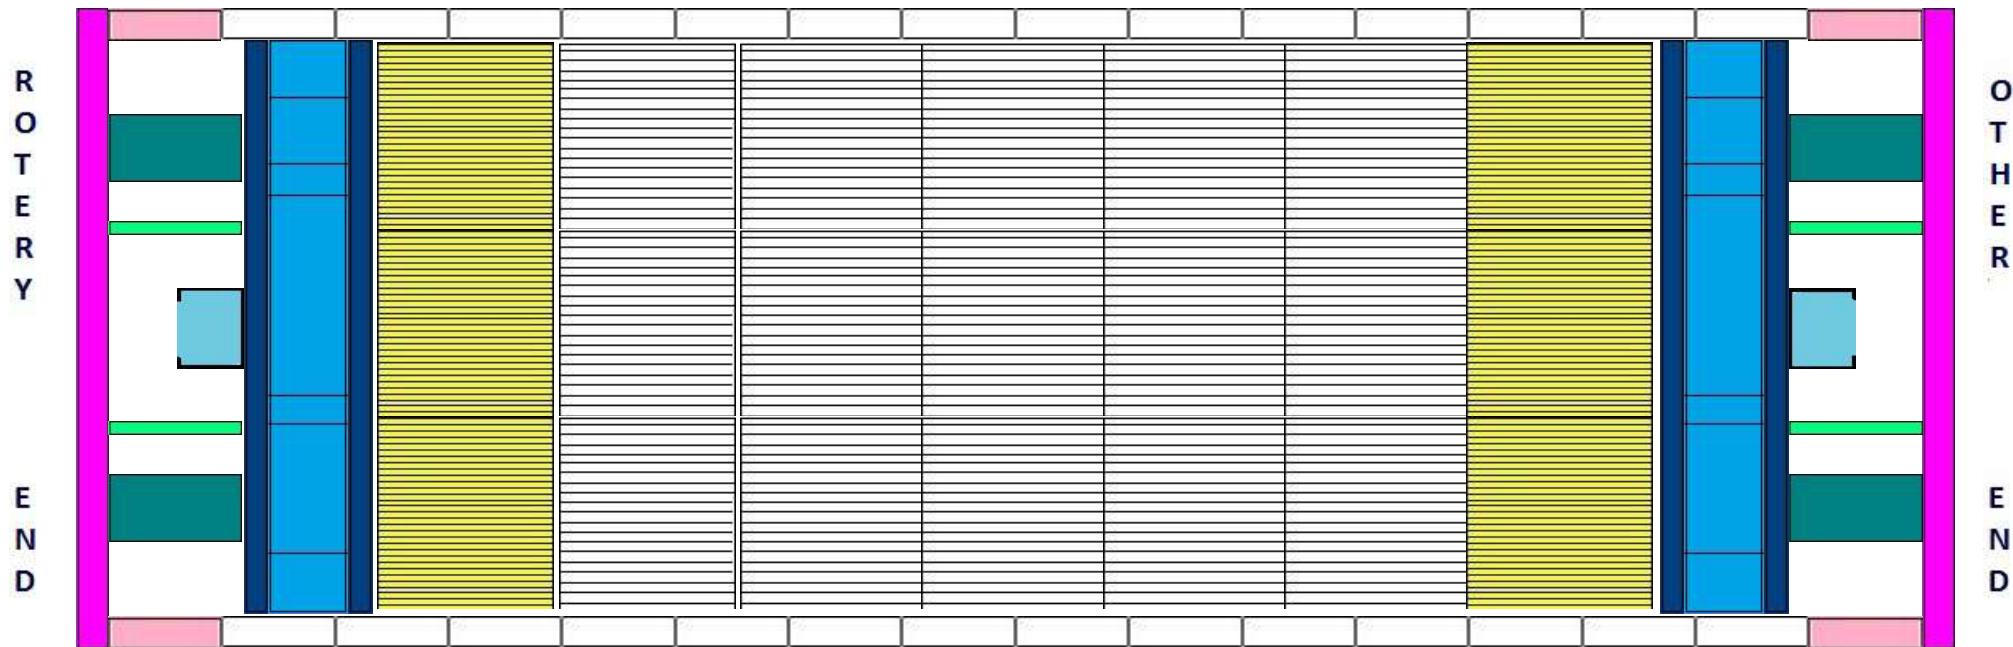

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	2	13%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2	13%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 3, WEST : 5 Other End - EAST : -6, WEST : -4
Start Date : 07-Nov-2019, Completion Date : 09-Nov-2019, Net Repair Days : 3, Total Man Hours : 368

HAMANT JADAV - JE	M L KOLI - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	---------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR052790


Type : WGSCN

Built Year : 2005

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

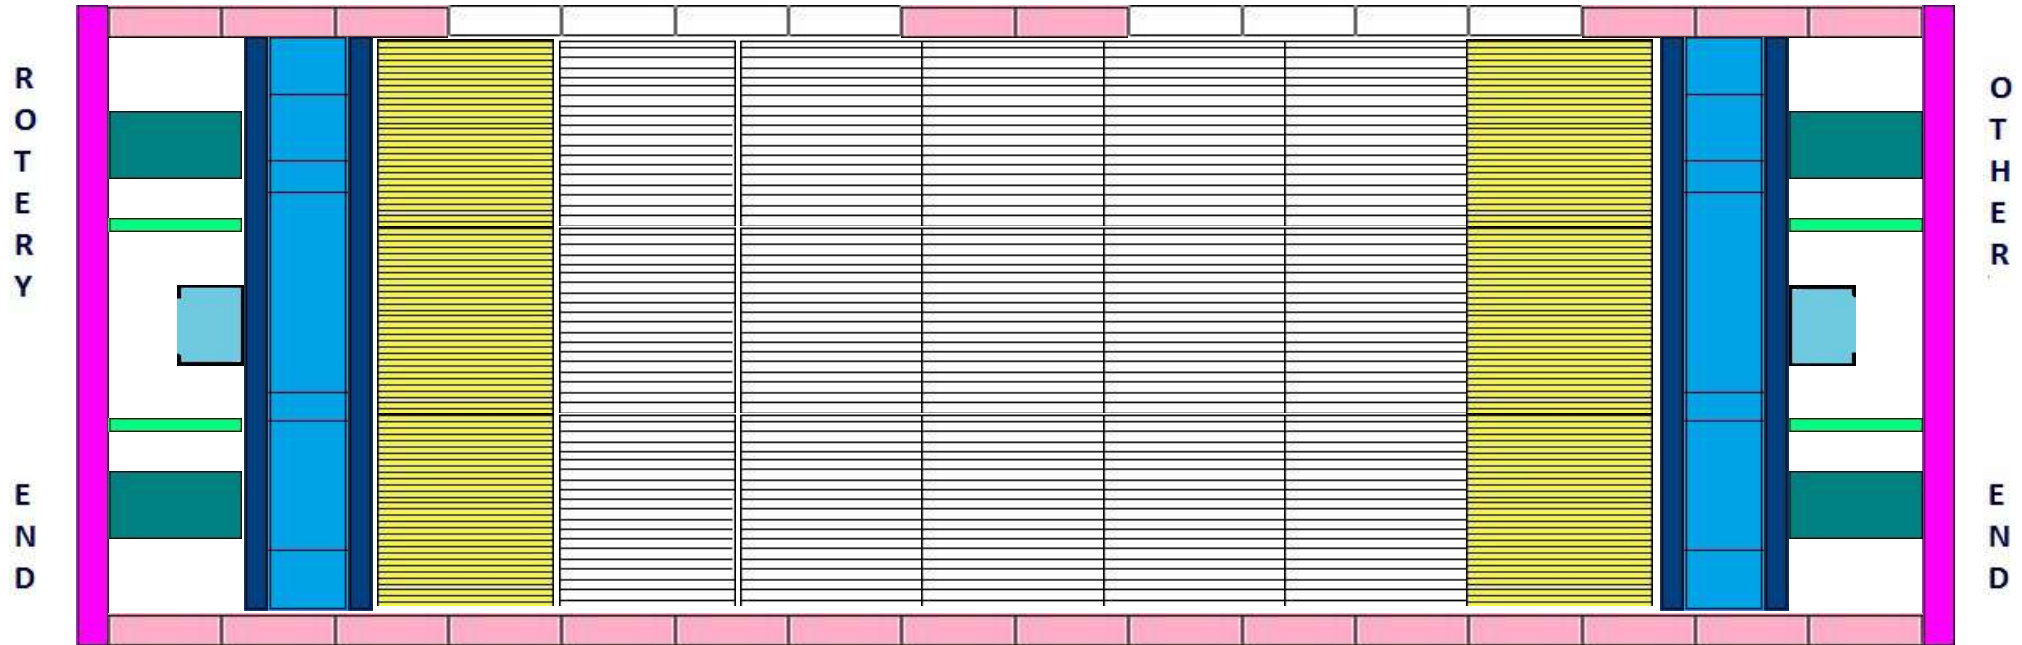

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	12	75%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	12	75%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	52	28%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : 4 Other End - EAST : -5, WEST : -3
Start Date : 27-Dec-2019, Completion Date : 04-Jan-2020, Net Repair Days : 8, Total Man Hours : 919

K K TRIPATHI - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR074170


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

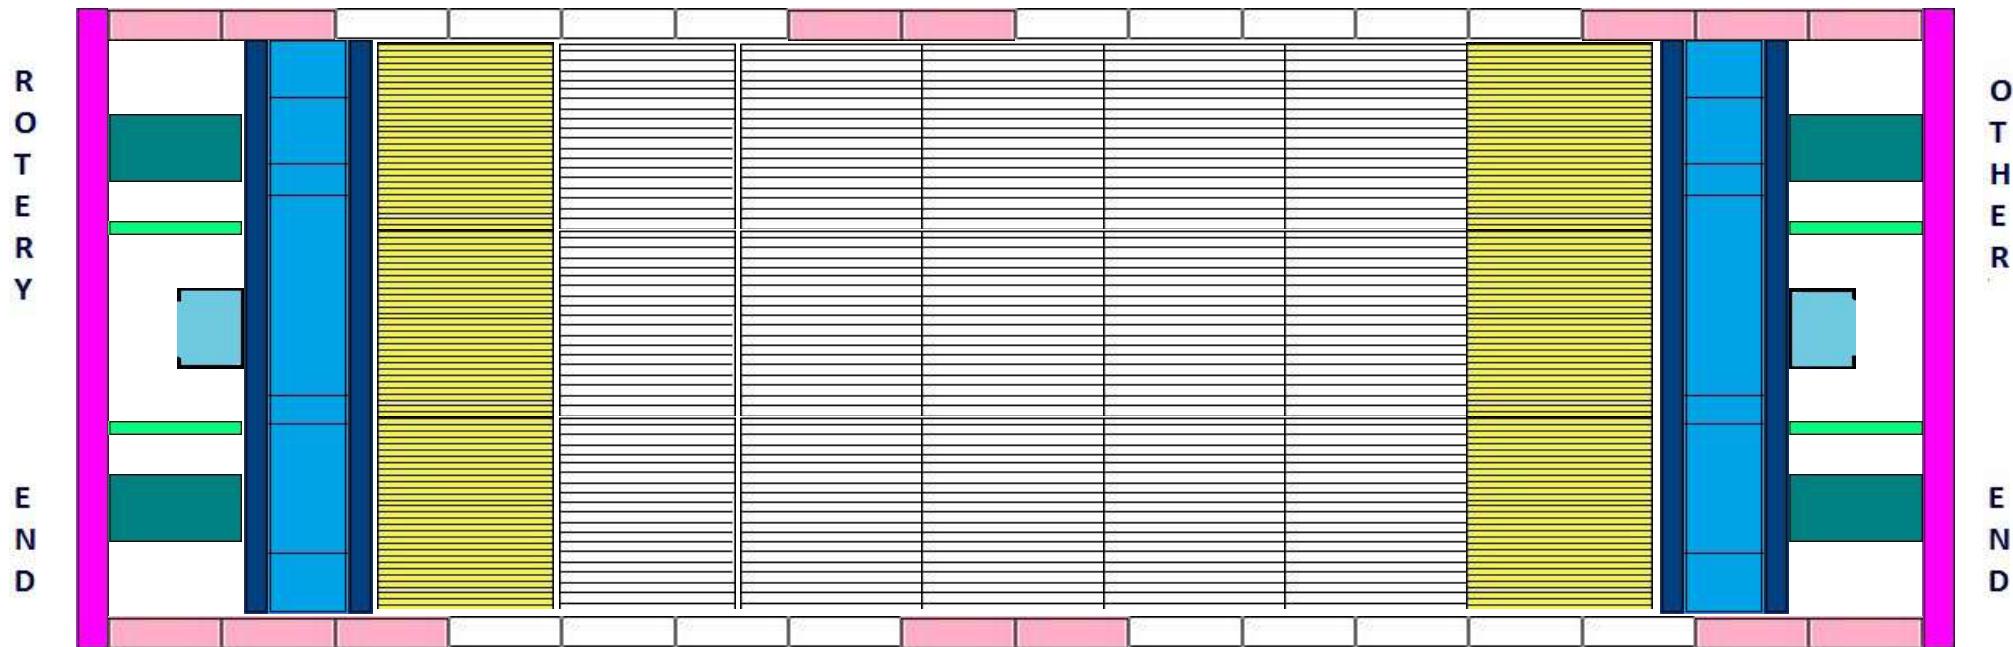

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Blue	Aux. Head stock	4	100%	Orange	Sole Bar	7	44%	Purple	Draft Gear Bracket	2	100%
Red	Trough floor	2	29%	Green	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	7	44%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -2, WEST : -5 Other End - EAST : 2, WEST : 3
Start Date : 30-Dec-2019, Completion Date : 09-Jan-2020, Net Repair Days : 10, Total Man Hours : 768

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR138326


Type : VPH

Built Year : 2013

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

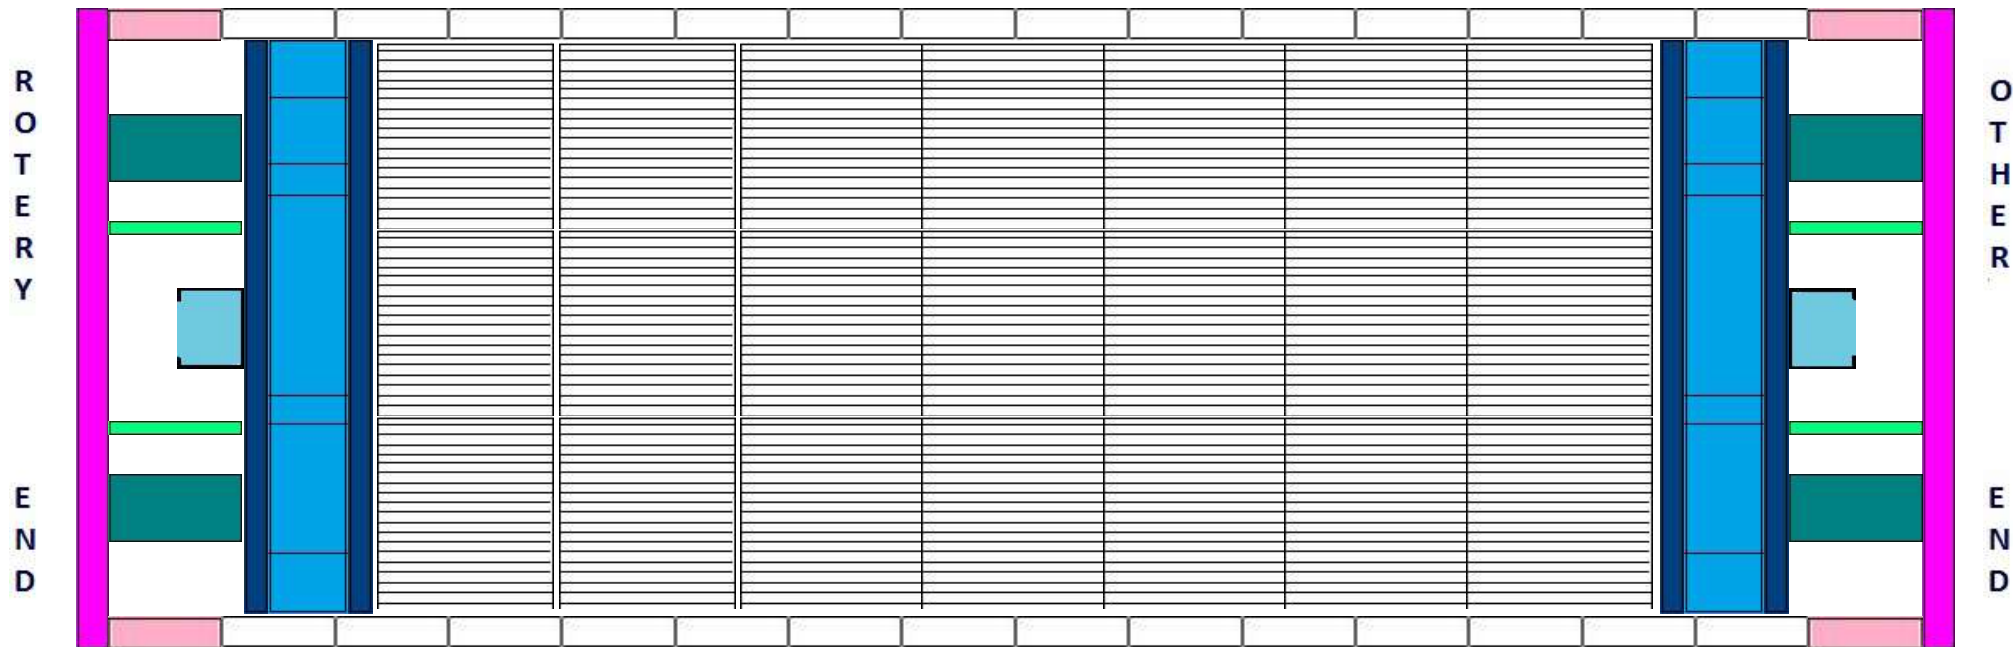

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Light Pink	Sole Bar	2	13%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	0	0%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2	13%		Body panel/patch		0%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 4, WEST : 6 Other End - EAST : 5, WEST : 4
Start Date : 23-Sep-2019, Completion Date : 27-Sep-2019, Net Repair Days : 5, Total Man Hours : 464

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR088290
Form No. F/BR/ICF/002

Type : VPH

Built Year : 2008

Make : RCF

Valid From: 02/04/2015

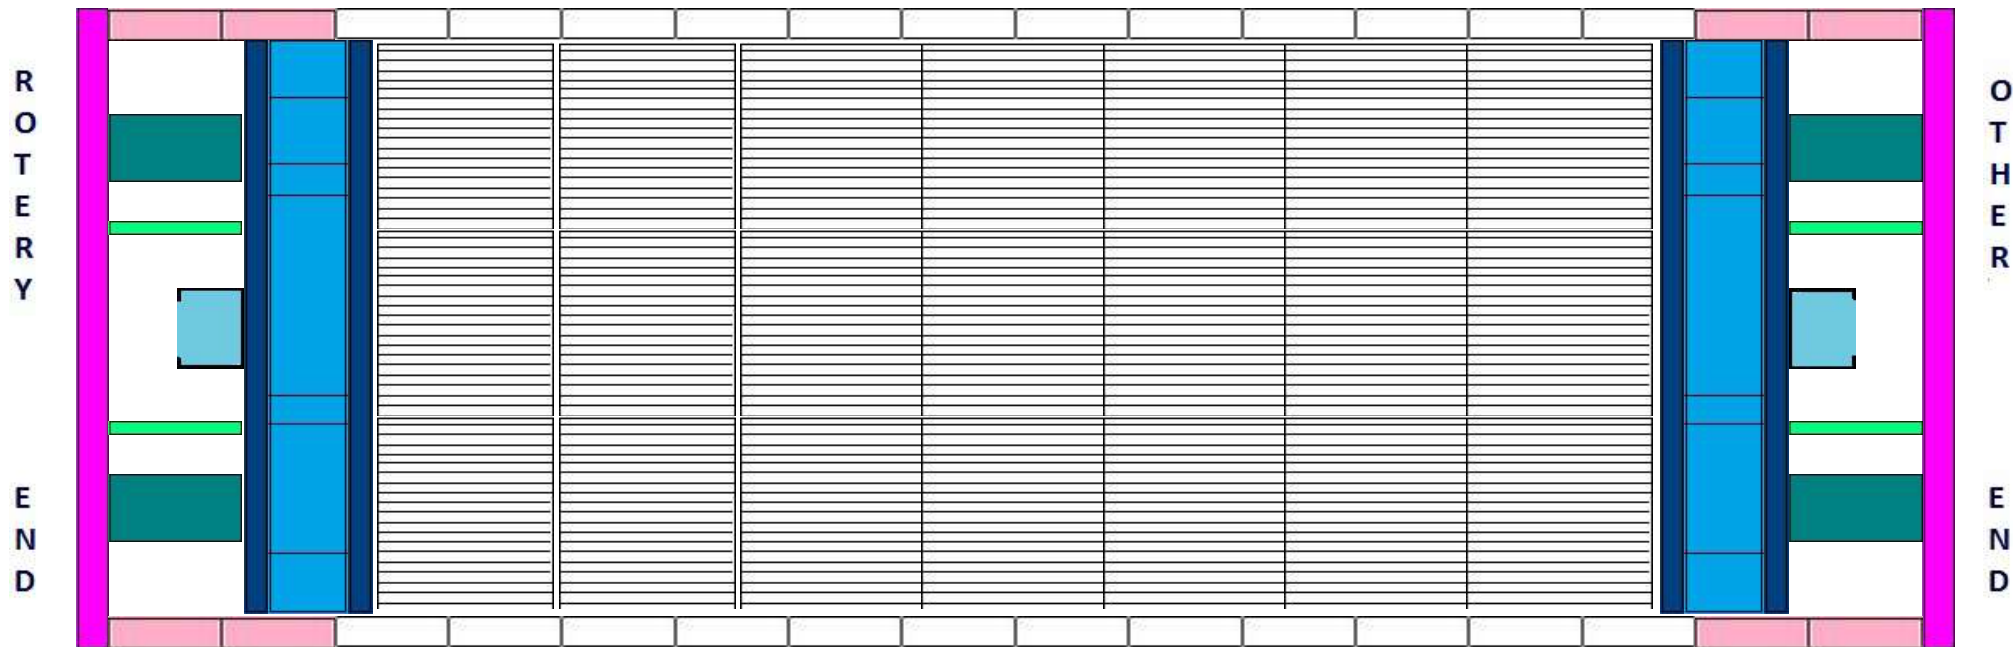

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	0	0%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4	25%		Body panel/patch		20%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 26-Sep-2019, Completion Date : 01-Oct-2019, Net Repair Days : 8, Total Man Hours : 712

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR128290


Type : VPH

Built Year : 2012

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

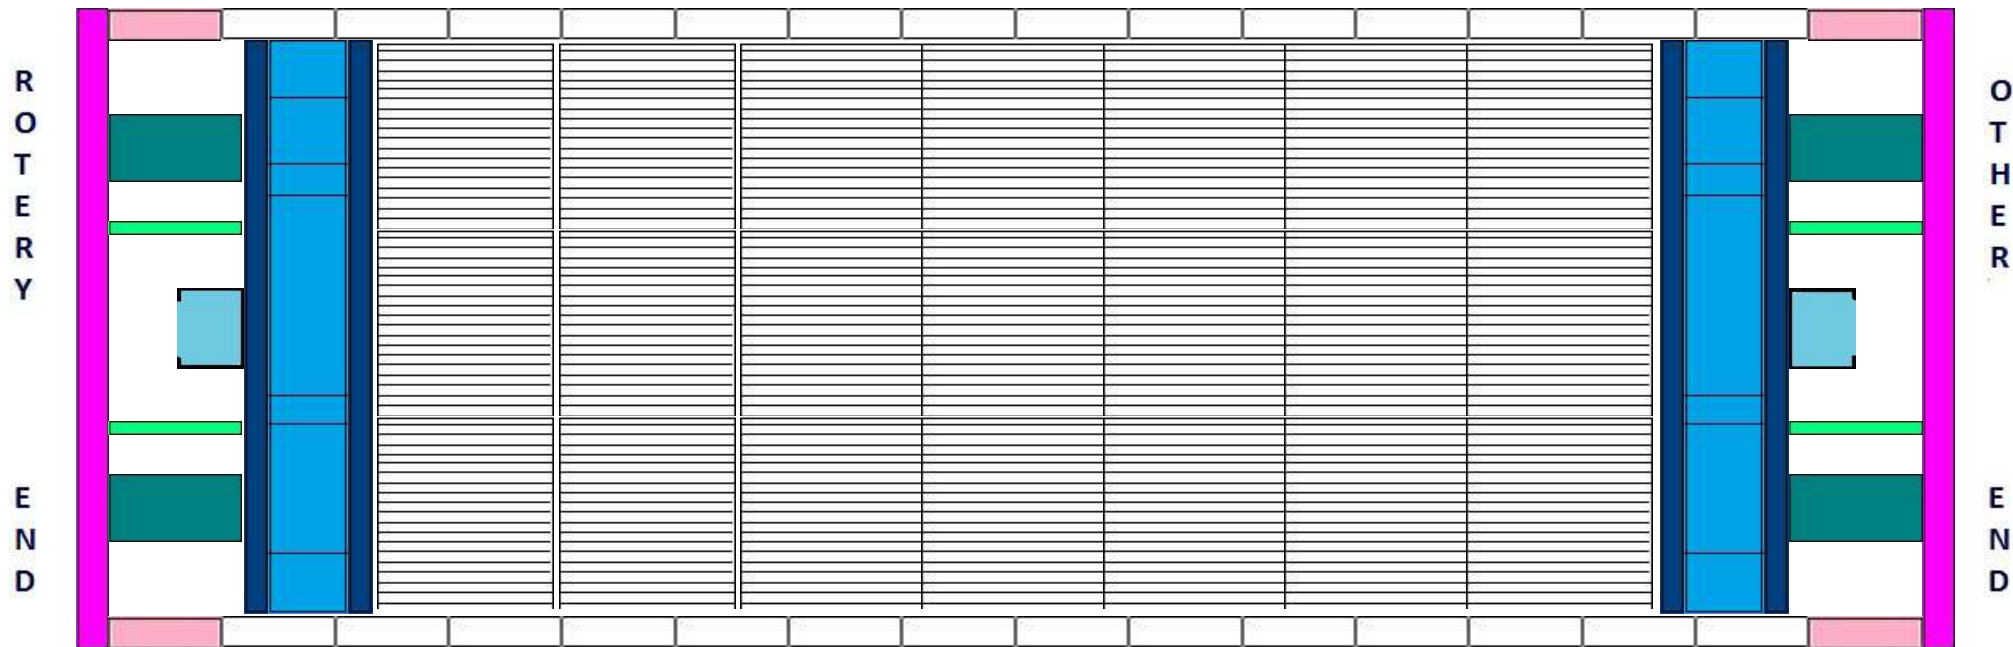

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Blue	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Green	Aux. Head stock	4	100%	Orange	Sole Bar	2	13%	Light Blue	Draft Gear Bracket	2	100%
Black	Trough floor	0	0%	Dark Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2	13%		Body panel/patch		20%		Door Top/Roof Patch		100%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 13-Sep-2019, Completion Date : 19-Sep-2019, Net Repair Days : 6, Total Man Hours : 0

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair


Coach No. :WR138340
Form No. F/BR/ICF/002

Type : VPH

Built Year : 2013

Make : RCF

Valid From: 02/04/2015

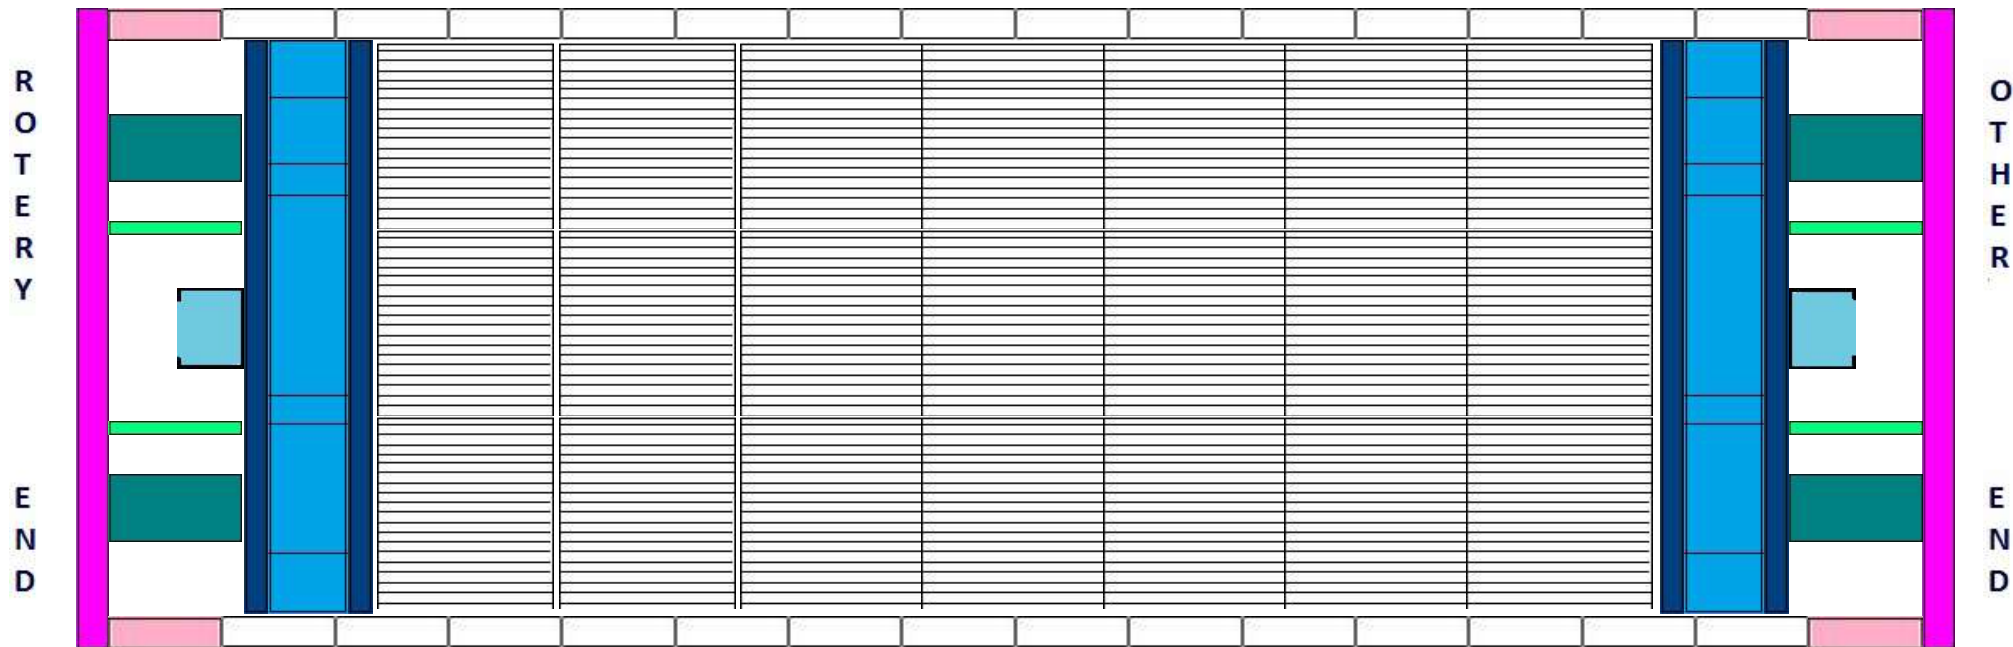

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Light Blue	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Light Blue	Sole Bar	2	13%	Dark Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	0	0%	Light Blue	Centre plate	2	100%	Dark Blue	SoleBar Stiffner	4	100%
	Bottom Wall Part	2	13%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 20-Sep-2019, Completion Date : 21-Sep-2019, Net Repair Days : 2, Total Man Hours : 428

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR064280


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

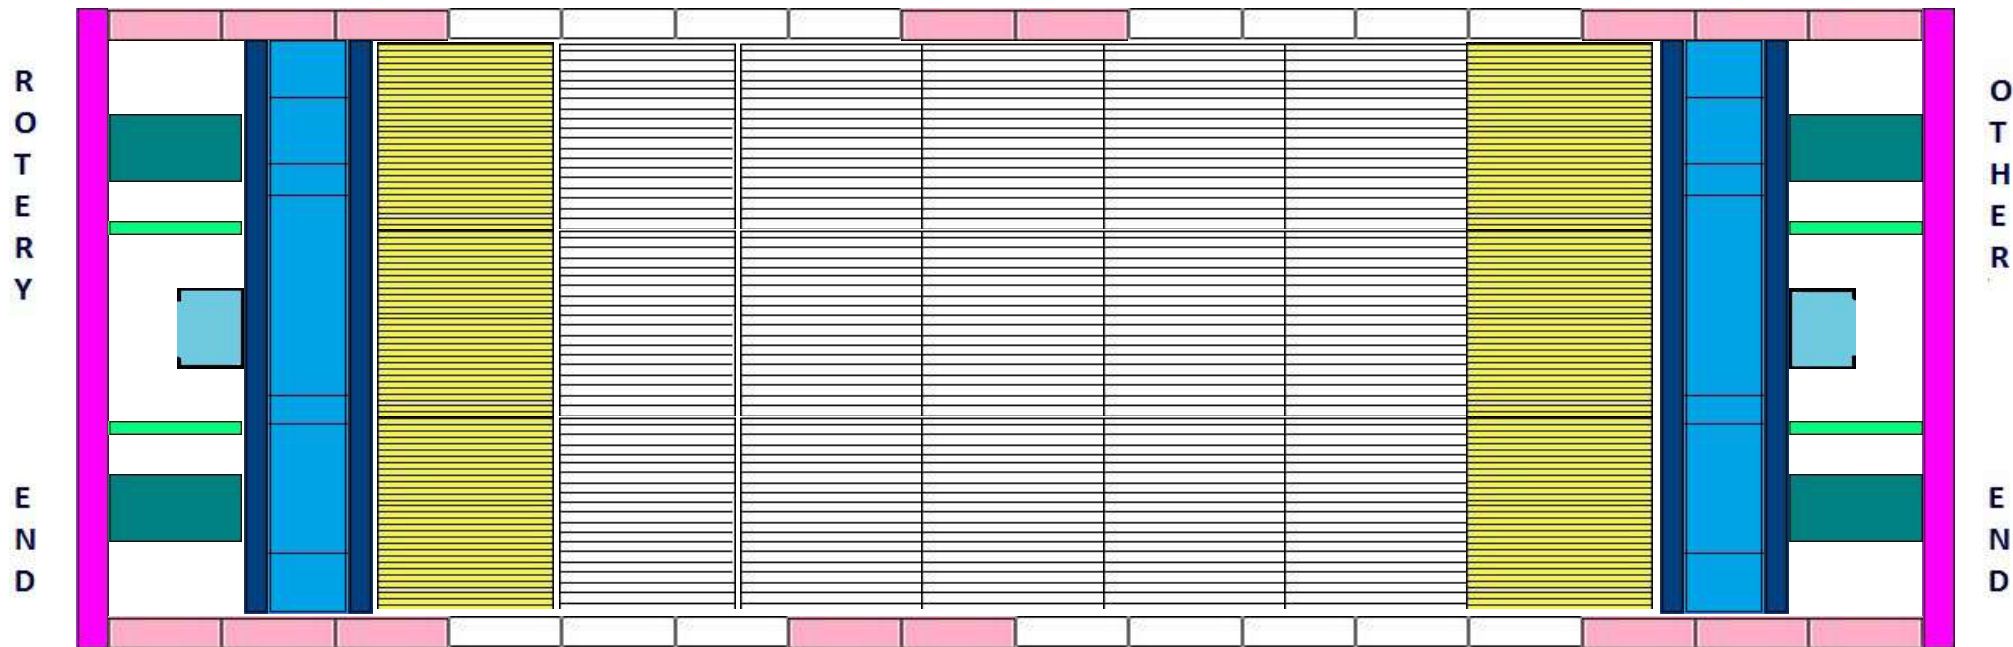

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	8	50%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8	50%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	35%		Window Bar	40	23%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 8, WEST : 0 Other End - EAST : -3, WEST : -2
Start Date : 04-Nov-2019, Completion Date : 14-Nov-2019, Net Repair Days : 10, Total Man Hours : 1064

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR088300


Type : VPH

Built Year : 2008

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

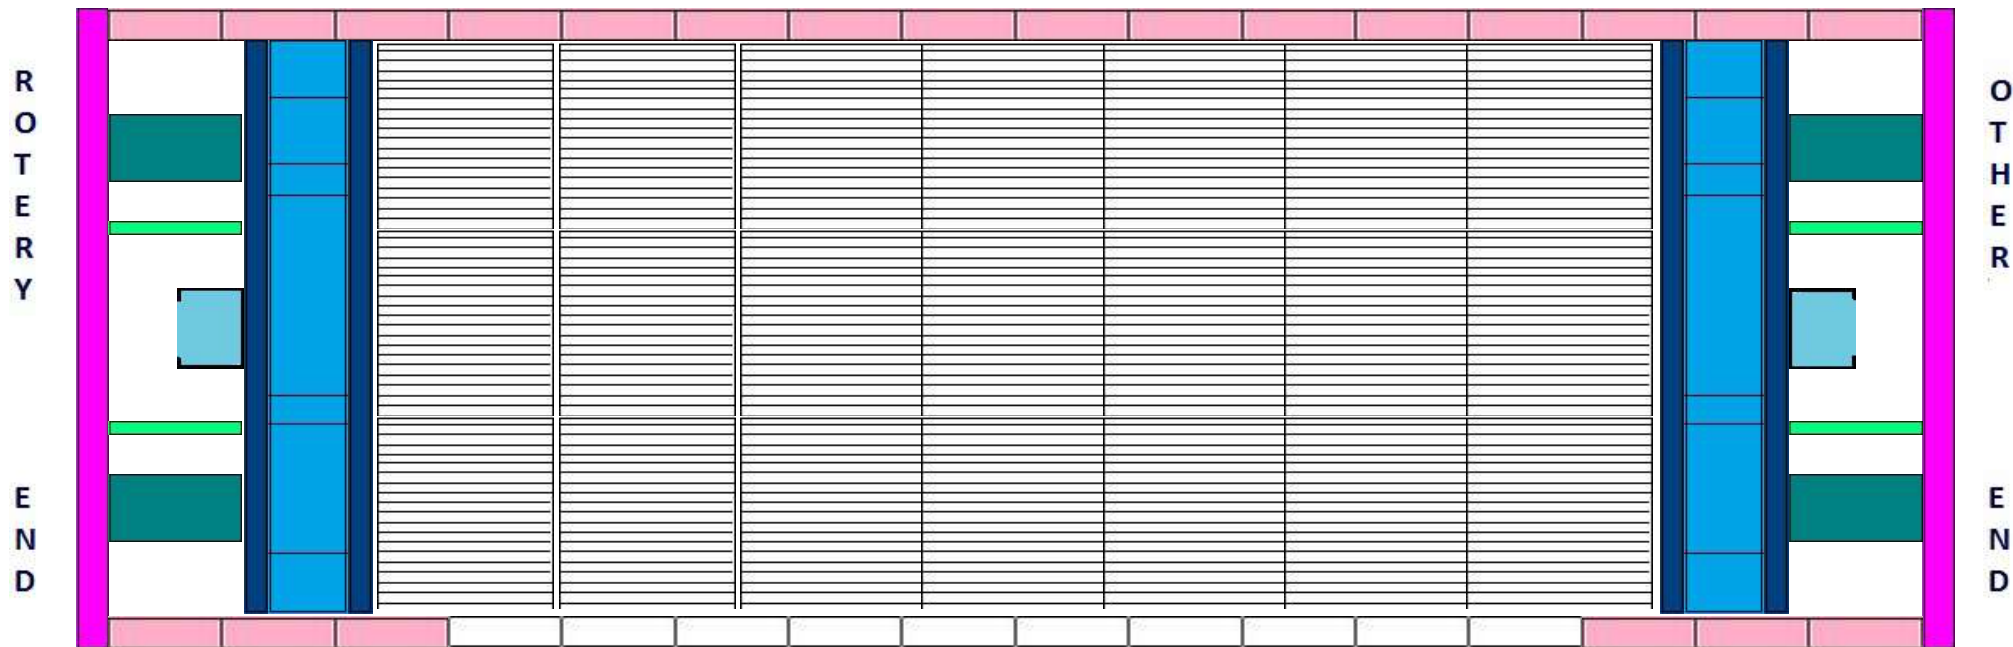

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	2	100%	Red	Centre Stiffner for Headstock	4	100%	Green	Floor Stiffner for Headstock	4	100%
Black	Aux. Head stock	4	100%	Yellow	Sole Bar	11	69%	Light Blue	Draft Gear Bracket	2	100%
Orange	Trough floor	0	0%	Dark Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	11	69%		Body panel/patch		20%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 01-Oct-2019, Completion Date : 04-Oct-2019, Net Repair Days : 4, Total Man Hours : 544

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WR062998


Type : WGSCN

Built Year : 2006

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

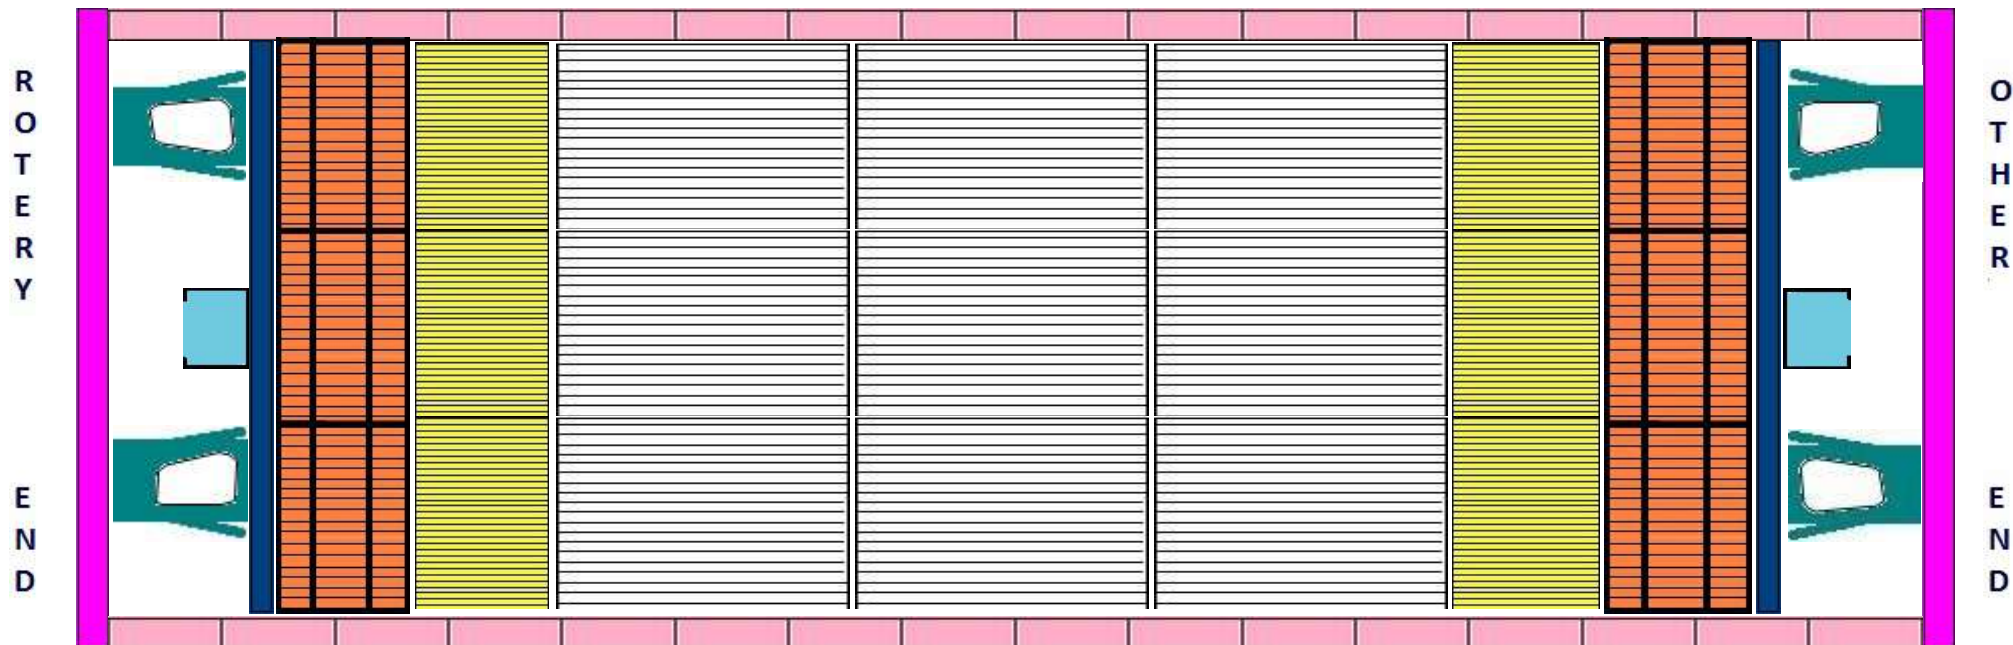

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	16	100%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	12	30%
	Window Bar	32	17%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	88	100%								

End Drooping: Rotary End - EAST : 8, WEST : 0 Other End - EAST : 5, WEST : 3
Start Date : 01-Jan-2020, Completion Date : 06-Jan-2020, Net Repair Days : 5, Total Man Hours : 1512

U S BAJPAI - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
------------------	--------------------	------------------------	------------------	-------------------------