

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC05057


Type : WGACCW

Built Year : 2005

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

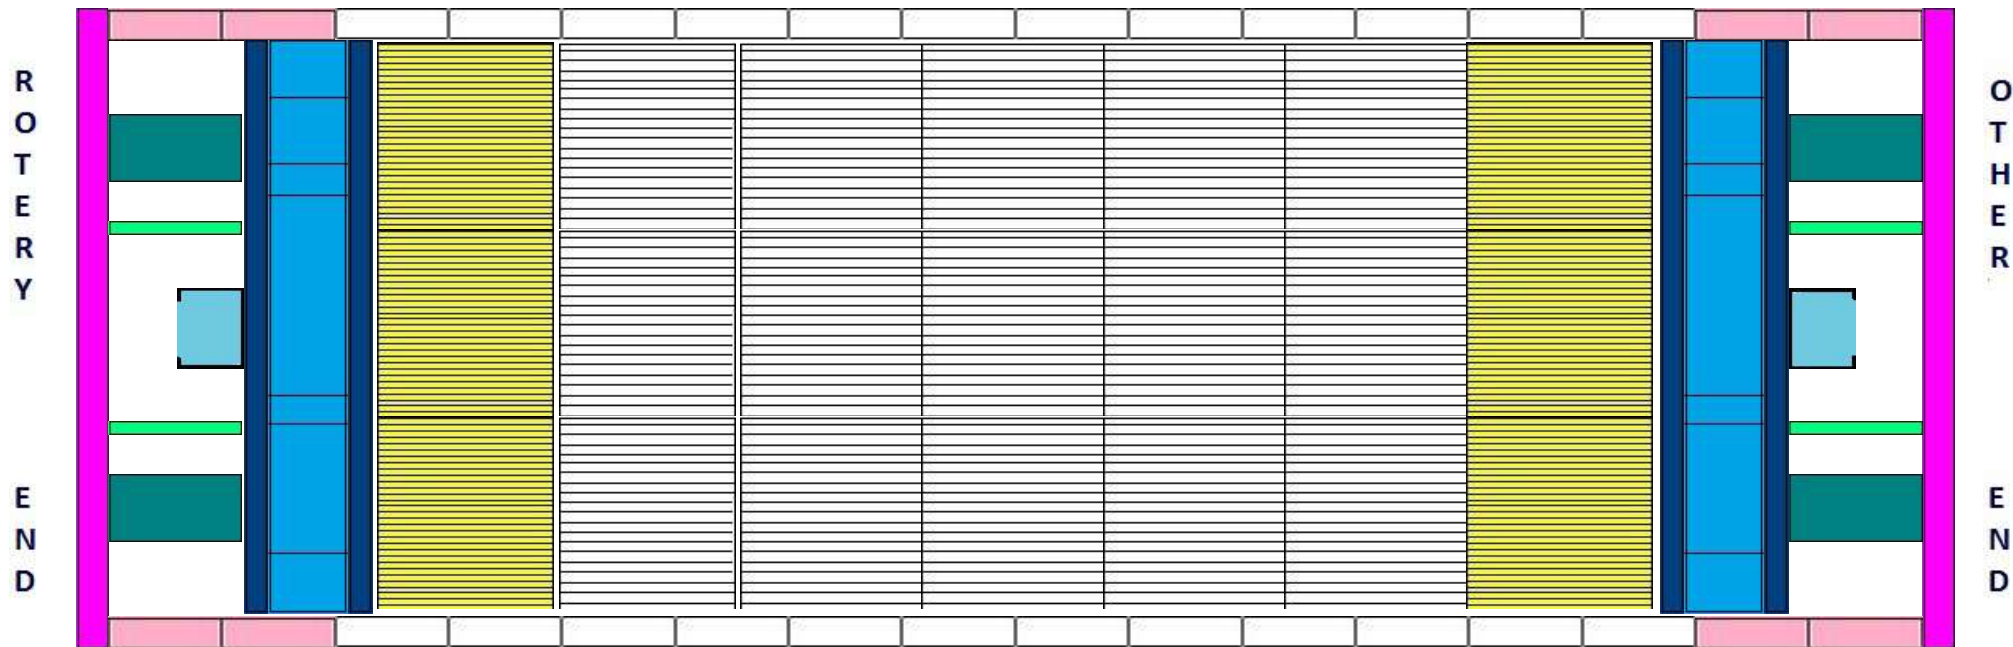

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4	25%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 4, WEST : 5 Other End - EAST : -8, WEST : -6
Start Date : 03-Jun-2019, Completion Date : 12-Jun-2019, Net Repair Days : 9, Total Man Hours : 1040

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06460


Type : GS

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

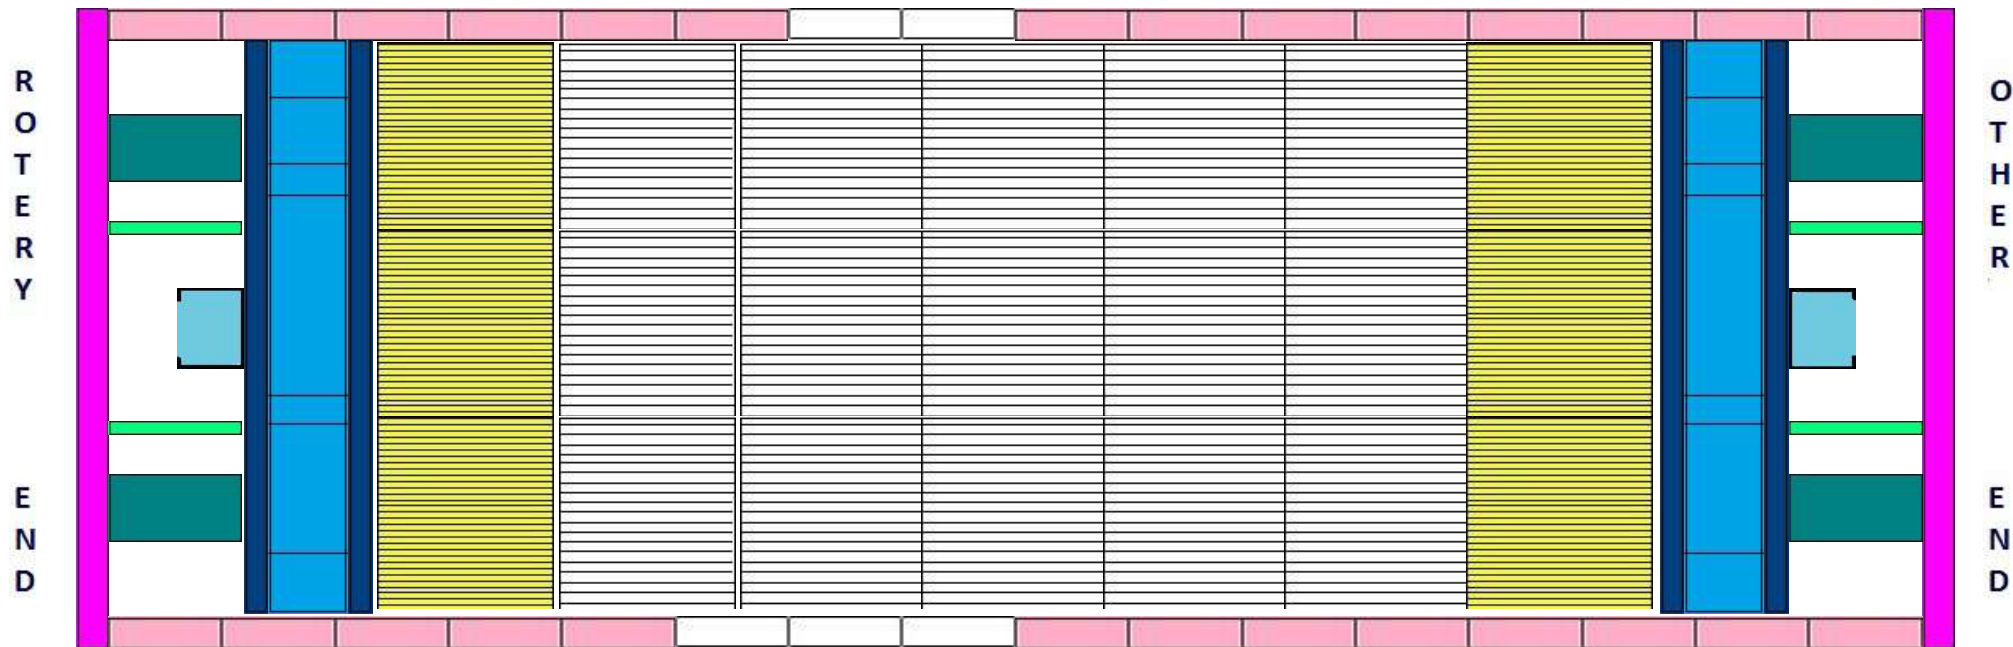

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	13.5	84%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	13.5	84%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -7, WEST : -5 Other End - EAST : 4, WEST : 3
Start Date : 22-Jul-2019, Completion Date : 27-Jul-2019, Net Repair Days : 6, Total Man Hours : 1420

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06710


Type : GSLRD

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

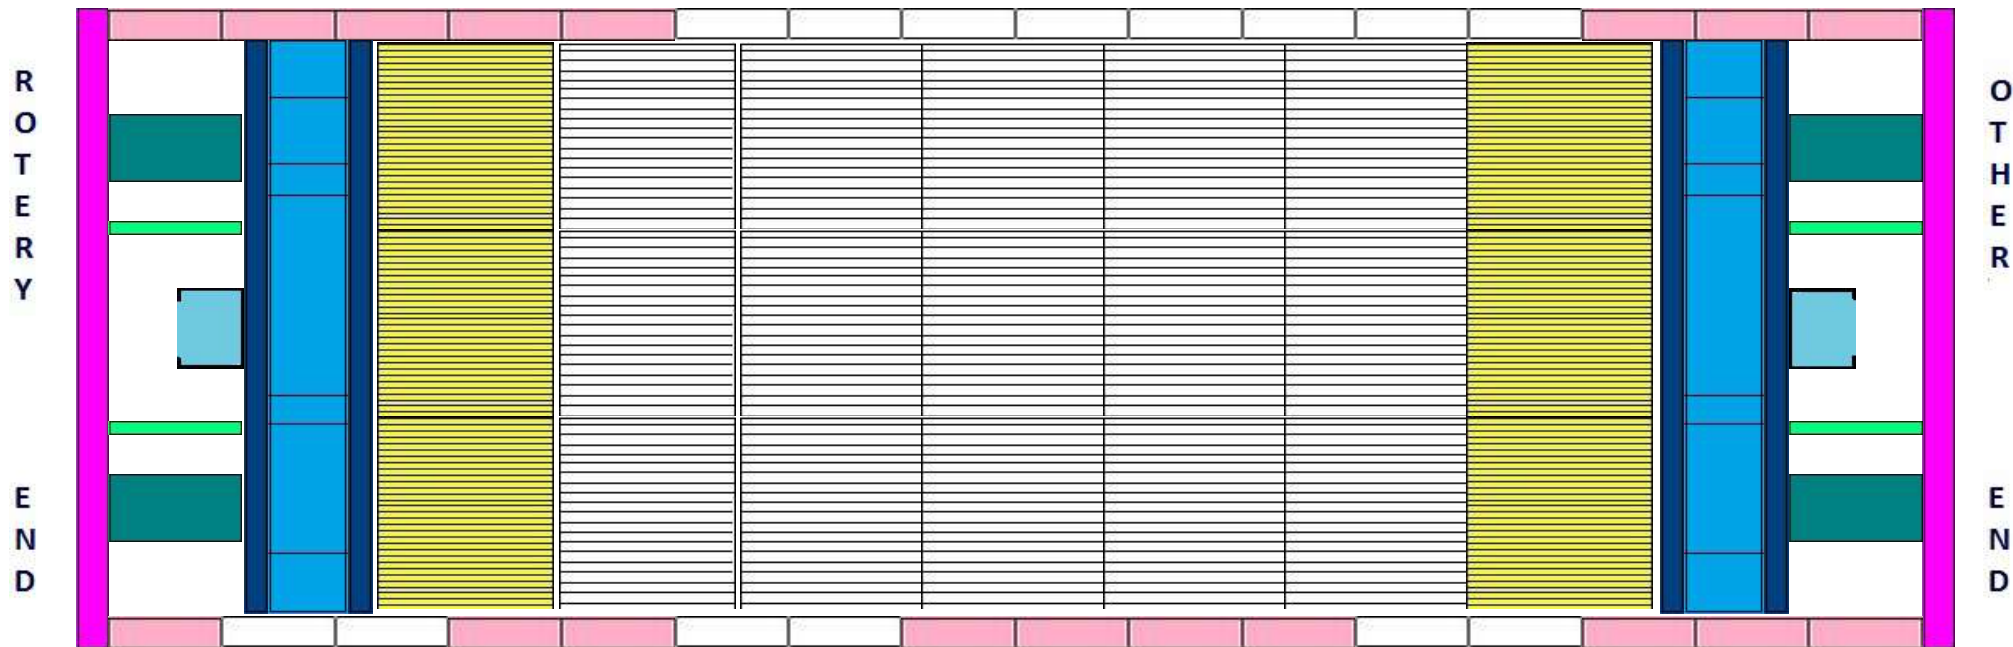

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	9	56%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	9	56%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	7	37%		Window Bar	10	12%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 2, WEST : 0 Other End - EAST : 2, WEST : 0
Start Date : 24-Jul-2019, Completion Date : 02-Aug-2019, Net Repair Days : 9, Total Man Hours : 1560

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06443


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

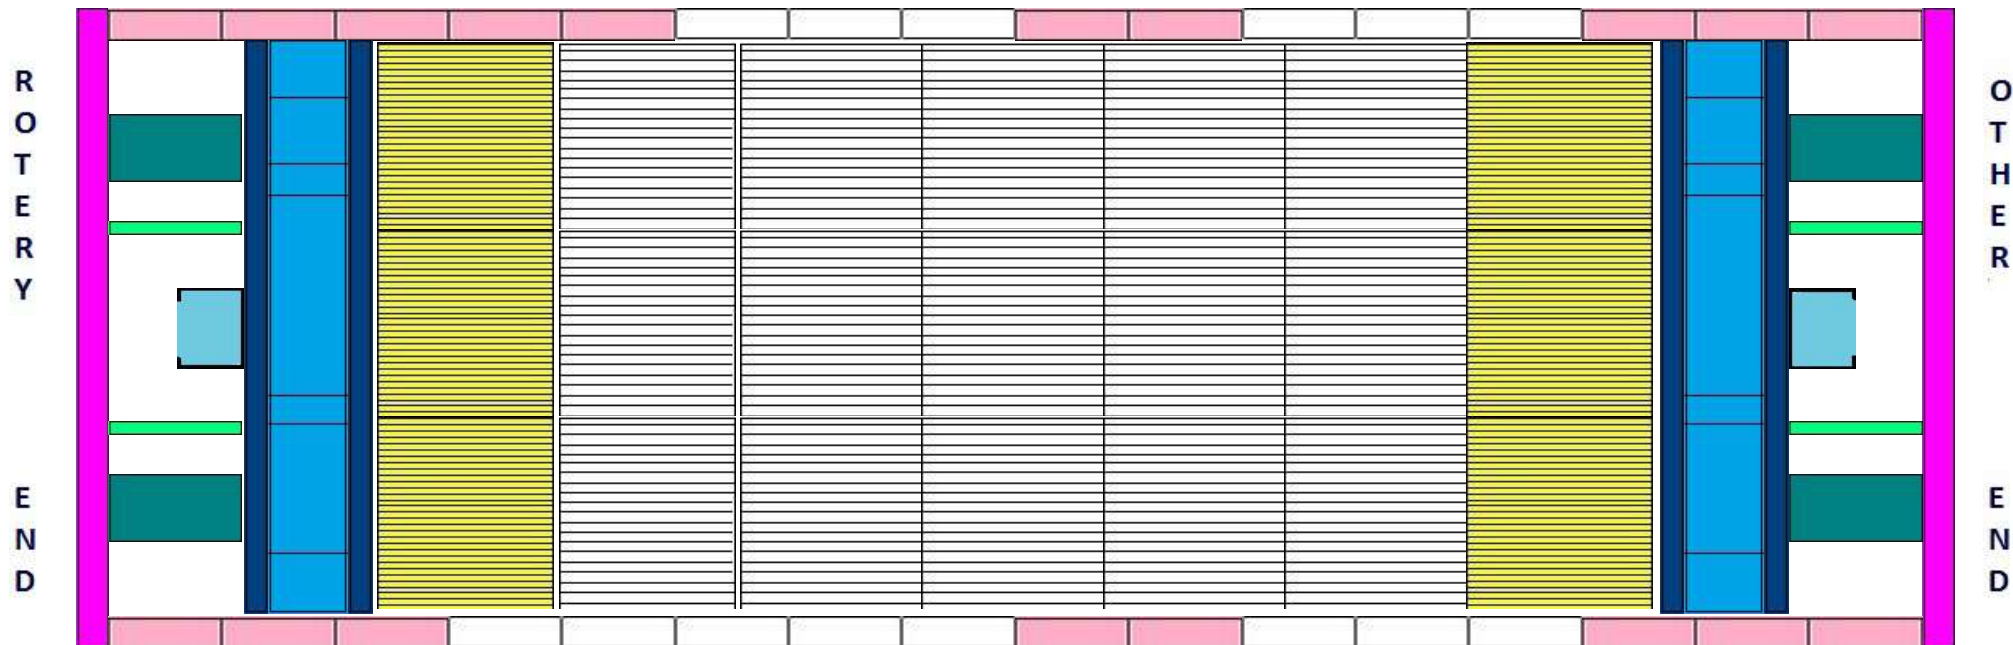

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	9	56%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	9	56%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -2, WEST : 0 Other End - EAST : -3, WEST : -4
Start Date : 30-Sep-2019, Completion Date : 07-Oct-2019, Net Repair Days : 7, Total Man Hours : 1344

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06711


Type : GSLRD

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

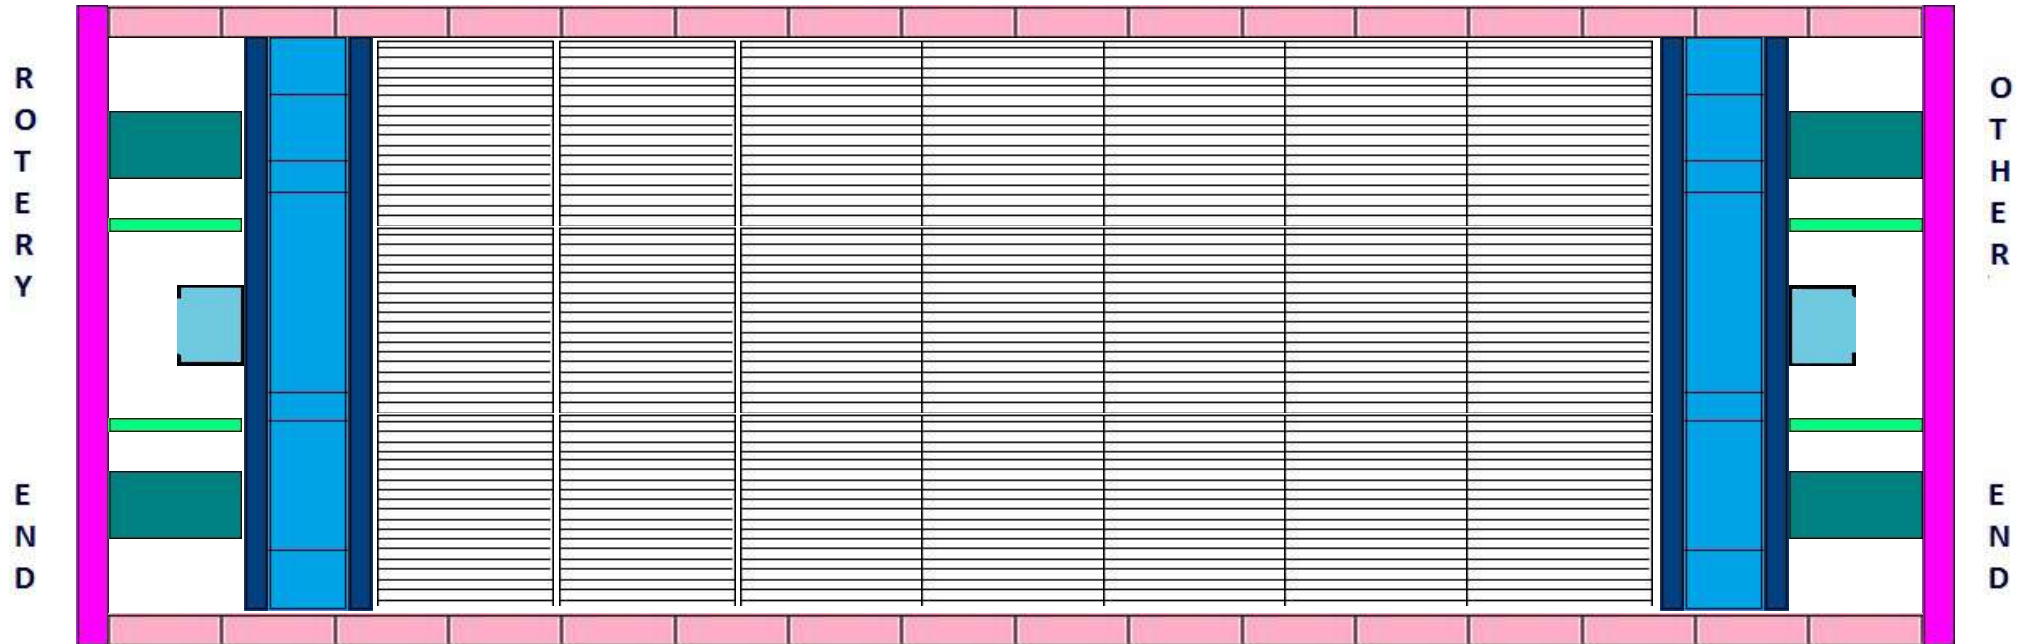

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	0	0%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	39%		Window Bar	24	14%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 2, WEST : -3 Other End - EAST : -4, WEST : -3
Start Date : 01-Oct-2019, Completion Date : 11-Oct-2019, Net Repair Days : 10, Total Man Hours : 1600

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06469


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

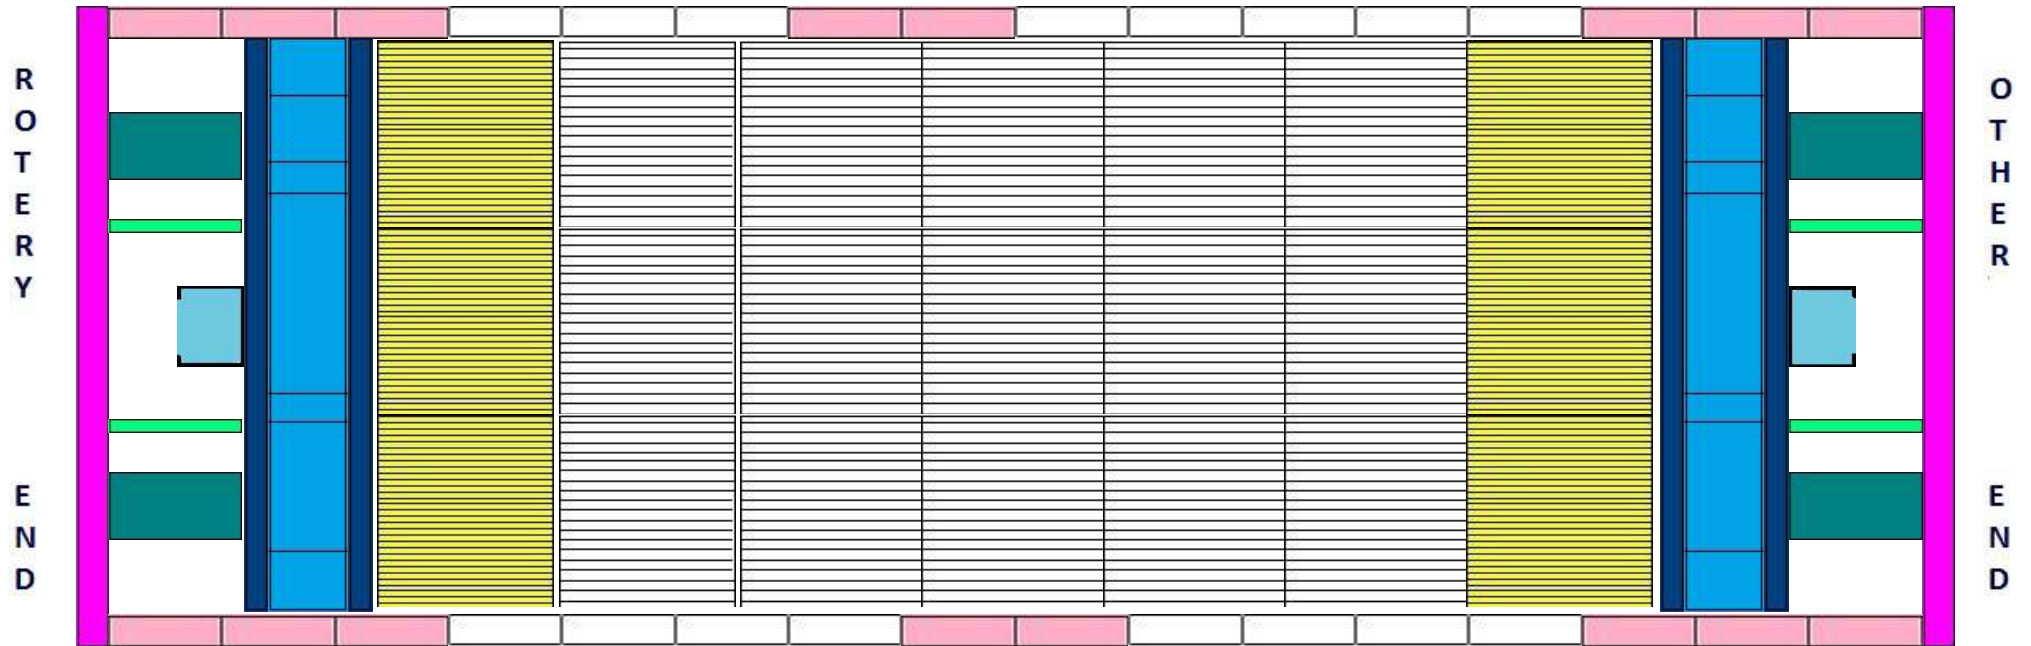

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	8	50%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8	50%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	24	60%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 3, WEST : 0 Other End - EAST : 10, WEST : 4
Start Date : 31-Oct-2019, Completion Date : 09-Nov-2019, Net Repair Days : 9, Total Man Hours : 1088

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC07420


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

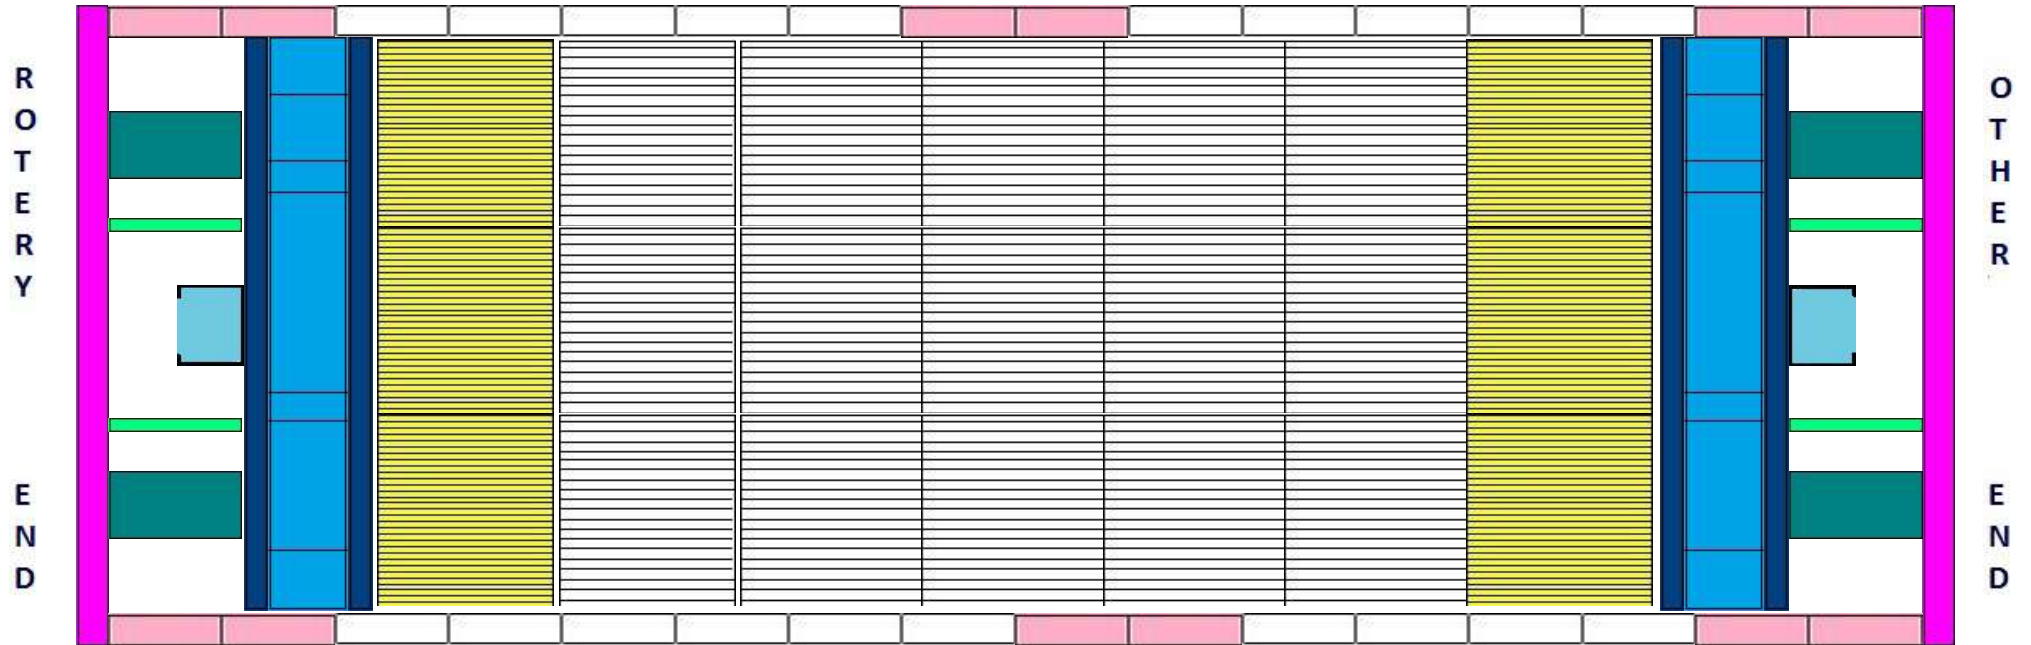

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	6	38%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	6	38%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	32	80%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : -3 Other End - EAST : -5, WEST : 0
Start Date : 16-Aug-2019, Completion Date : 21-Aug-2019, Net Repair Days : 5, Total Man Hours : 1332

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06221


Type : WGSCN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

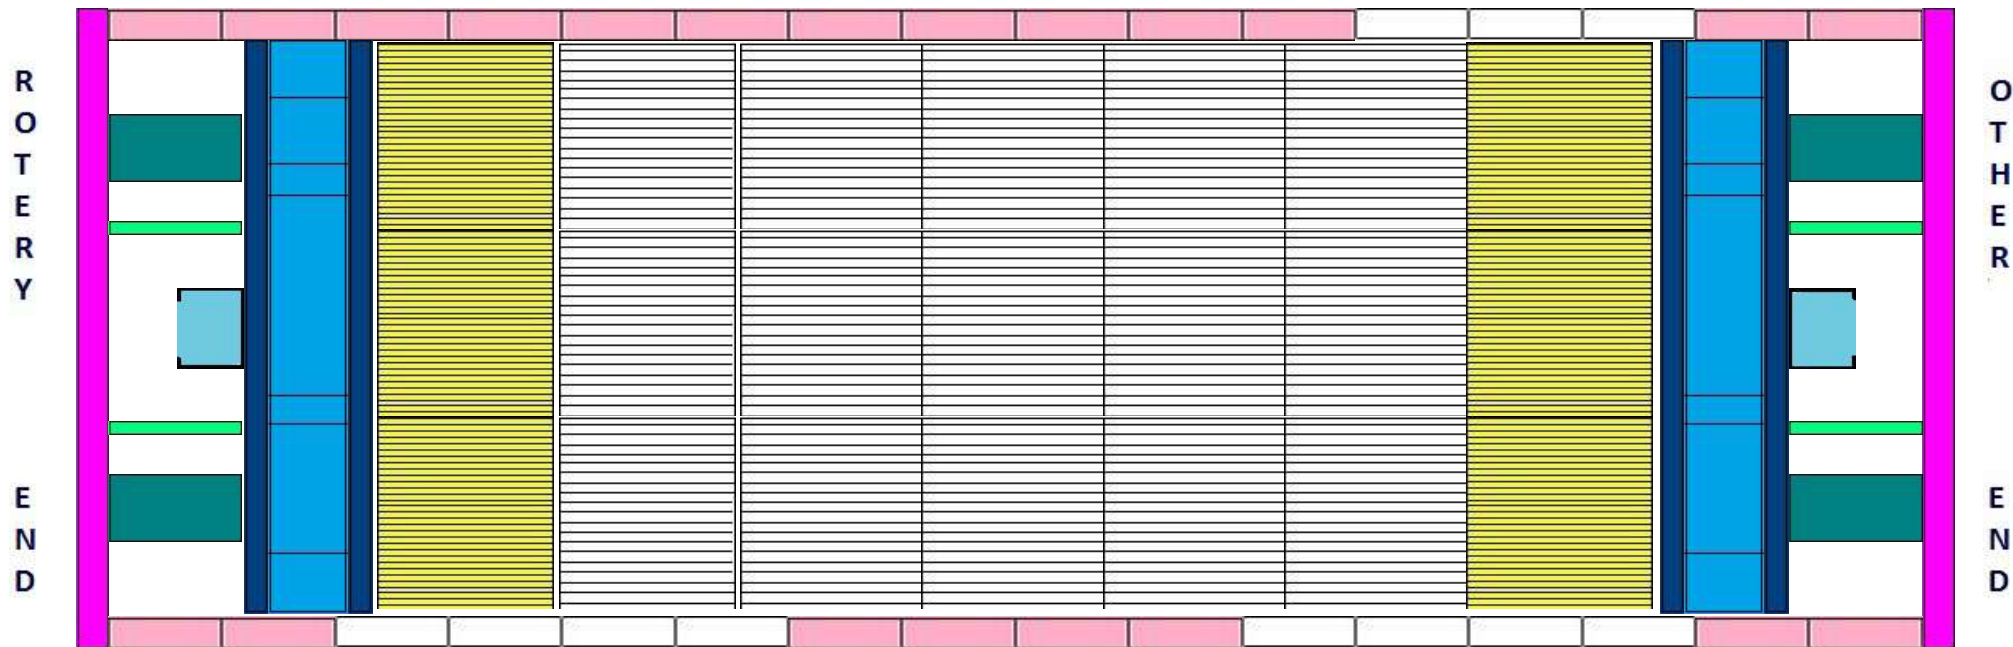

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	10.5	66%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	10.5	66%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	20	50%		Window Bar	40	22%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 26-Aug-2019, Completion Date : 31-Aug-2019, Net Repair Days : 6, Total Man Hours : 0

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06463


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

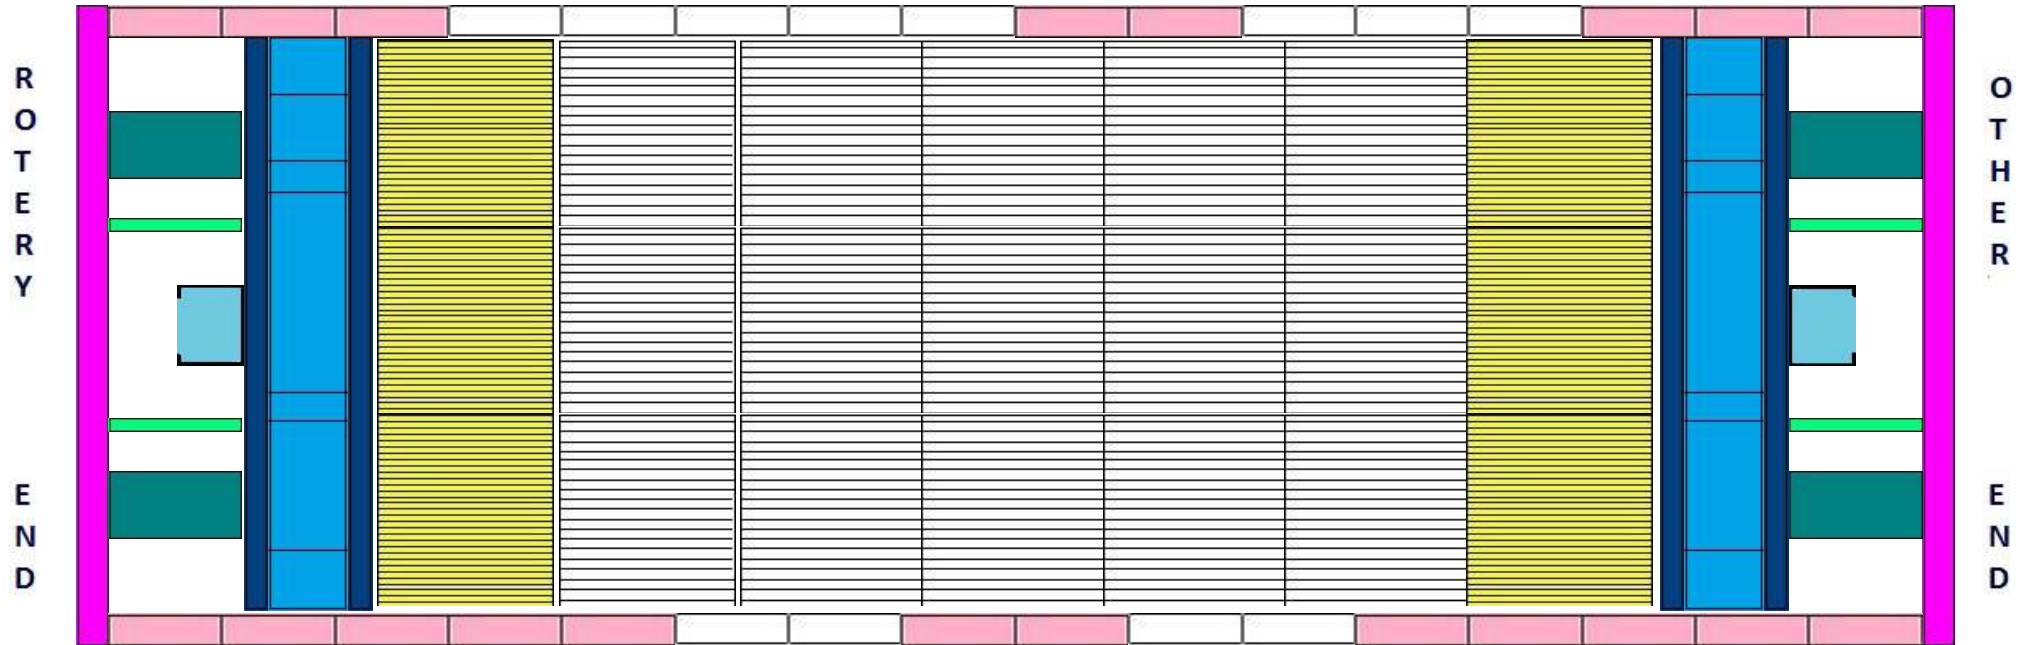

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	10	63%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	10	63%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	46	26%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -3, WEST : 2 Other End - EAST : 2, WEST : 3

Start Date : 28-Aug-2019, Completion Date : 03-Sep-2019, Net Repair Days : 6, Total Man Hours : 1394

HAMANT JADAV - JE	M L KOLI - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	---------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC04299


Type : WGSCN

Built Year : 2004

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

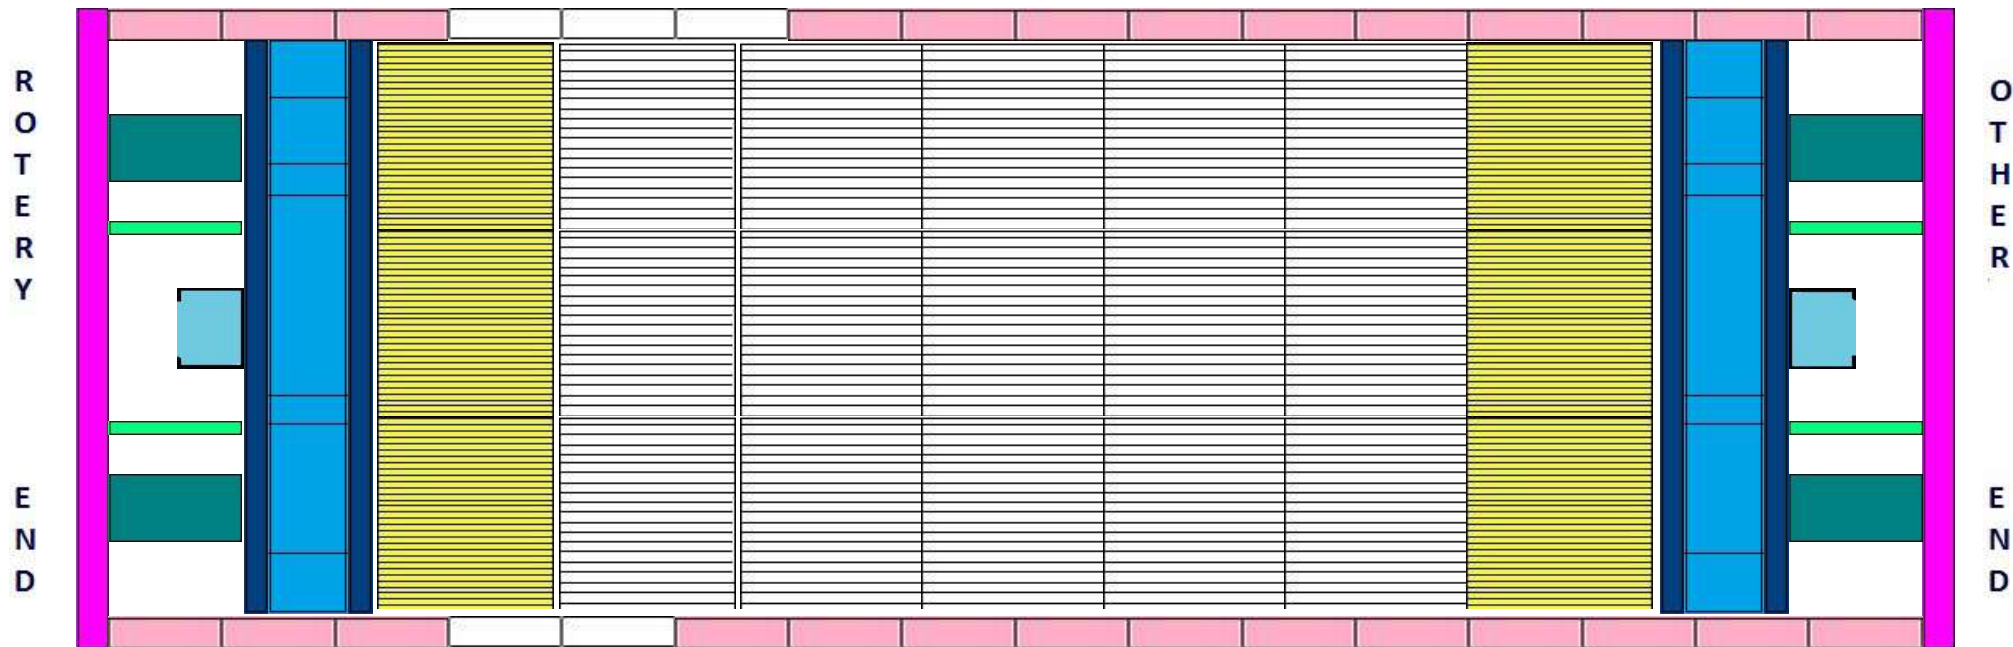

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	13.5	84%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	13.5	84%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	20	50%		Window Bar	40	22%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -6, WEST : 8 Other End - EAST : 2, WEST : 3

Start Date : 23-Aug-2019, Completion Date : 02-Sep-2019, Net Repair Days : 9, Total Man Hours : 1616

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06470


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

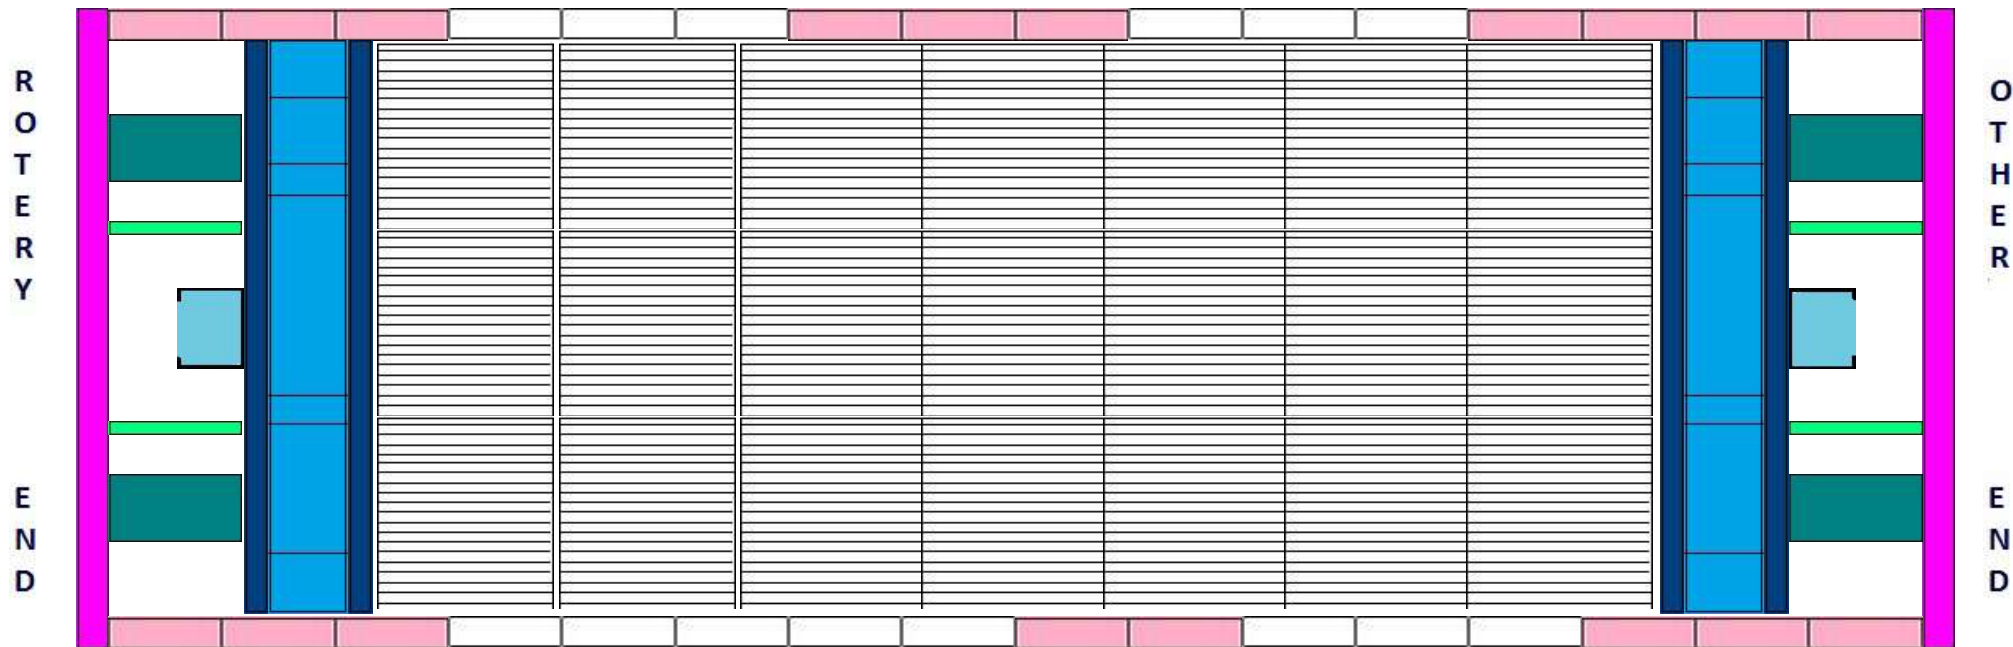

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	2	100%	Red	Centre Stiffner for Headstock	4	100%	Green	Floor Stiffner for Headstock	4	100%
Black	Aux. Head stock	4	100%	Yellow	Sole Bar	9	56%	Light Blue	Draft Gear Bracket	2	100%
Orange	Trough floor	0	0%	Dark Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	9	56%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	40	22%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 8, WEST : 2 Other End - EAST : -10, WEST : -8
Start Date : 17-Jul-2019, Completion Date : 24-Jul-2019, Net Repair Days : 7, Total Man Hours : 1200

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC05434


Type : GS

Built Year : 2005

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

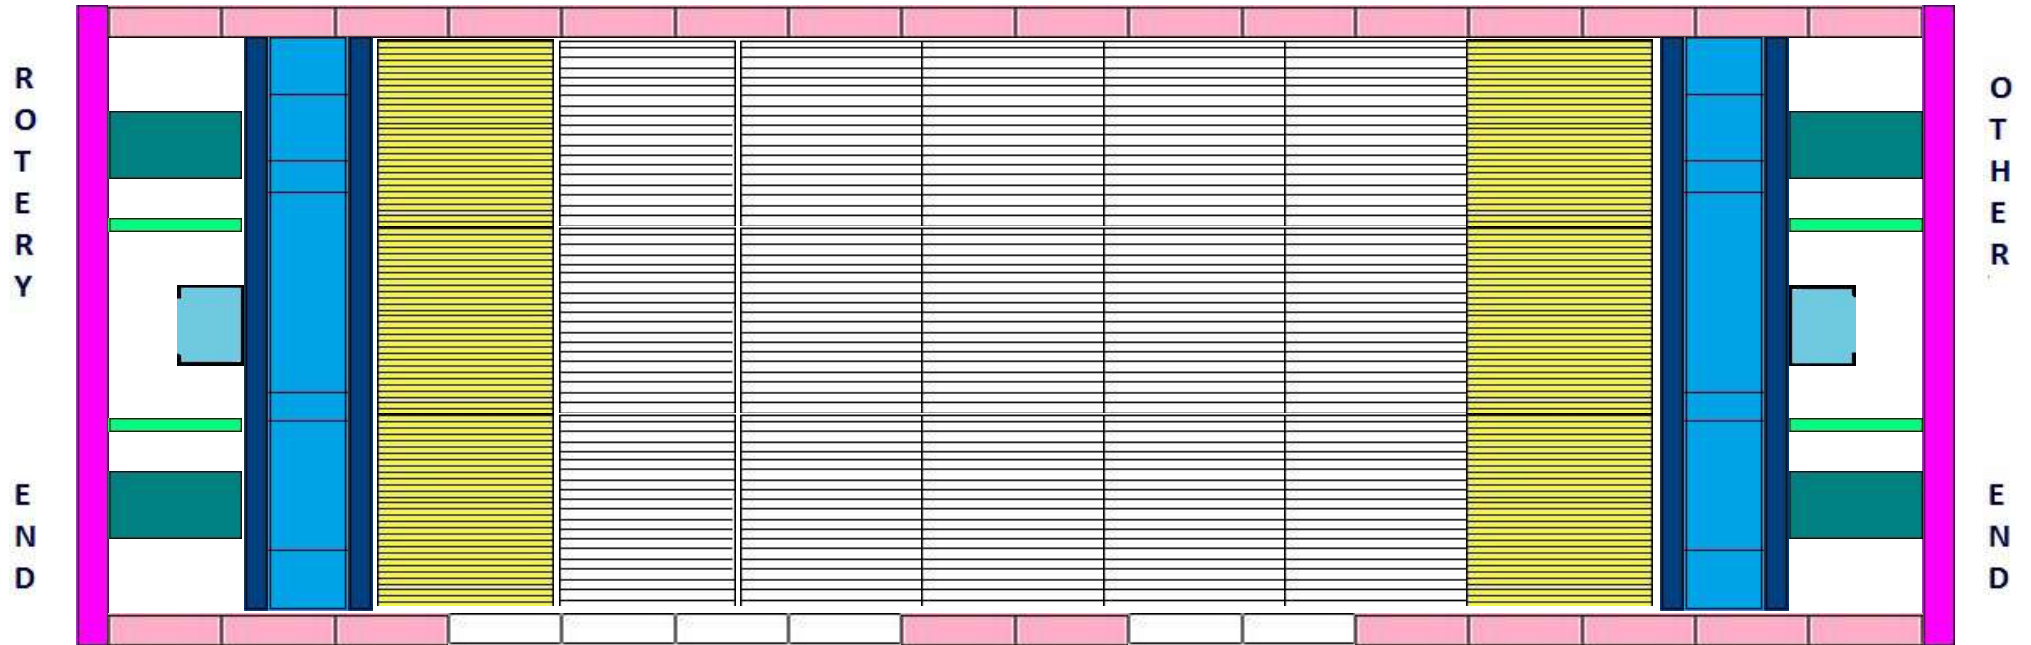

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	13	81%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	13	81%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : 4 Other End - EAST : -5, WEST : -4

Start Date : 06-Dec-2019, Completion Date : 12-Dec-2019, Net Repair Days : 6, Total Man Hours : 1820

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC05705


Type : GSLRD

Built Year : 2005

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

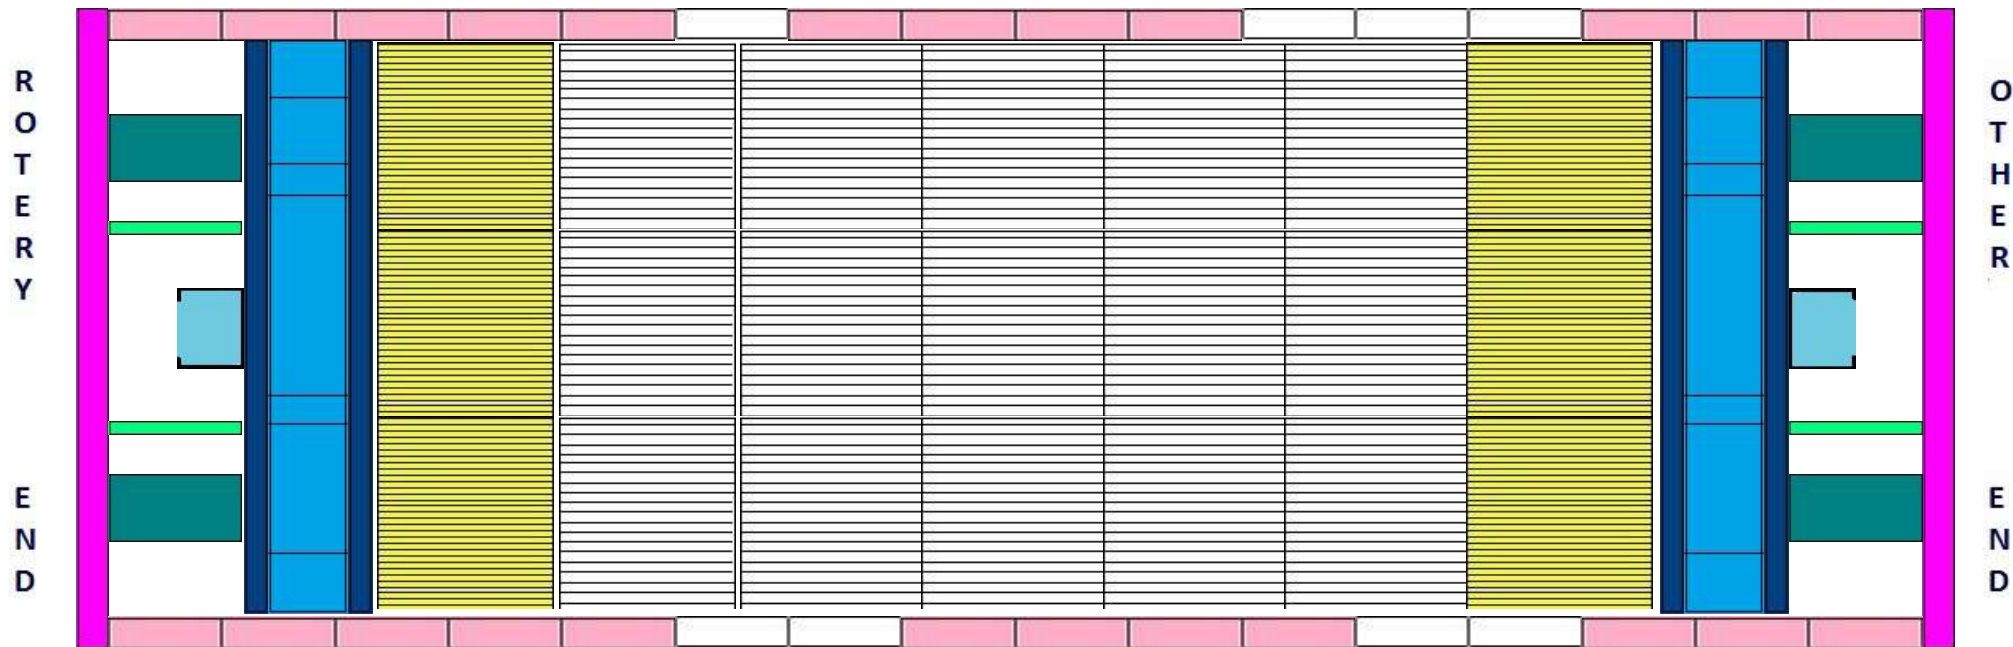

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	12	75%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	12	75%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	8	42%		Window Bar	14	17%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : 5 Other End - EAST : -10, WEST : -10
Start Date : 27-Jun-2019, Completion Date : 03-Jul-2019, Net Repair Days : 6, Total Man Hours : 1696

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC05053


Type : WGACCW

Built Year : 2005

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

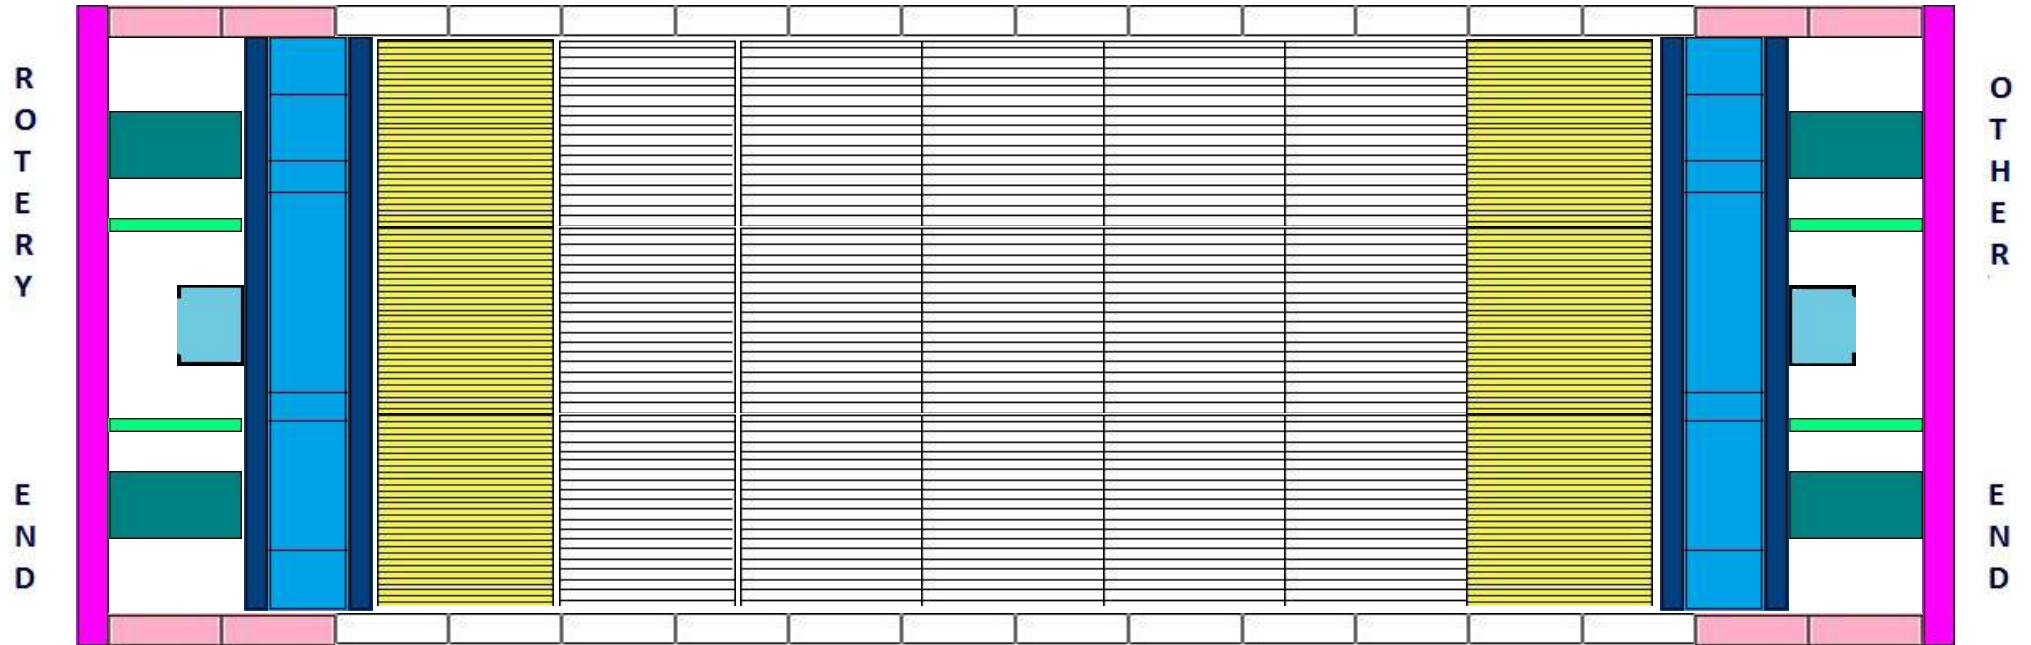

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4	25%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 2, WEST : 0 Other End - EAST : -10, WEST : -10
Start Date : 25-Jun-2019, Completion Date : 06-Jul-2019, Net Repair Days : 11, Total Man Hours : 1480

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC05280


Type : WGSCN

Built Year : 2005

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

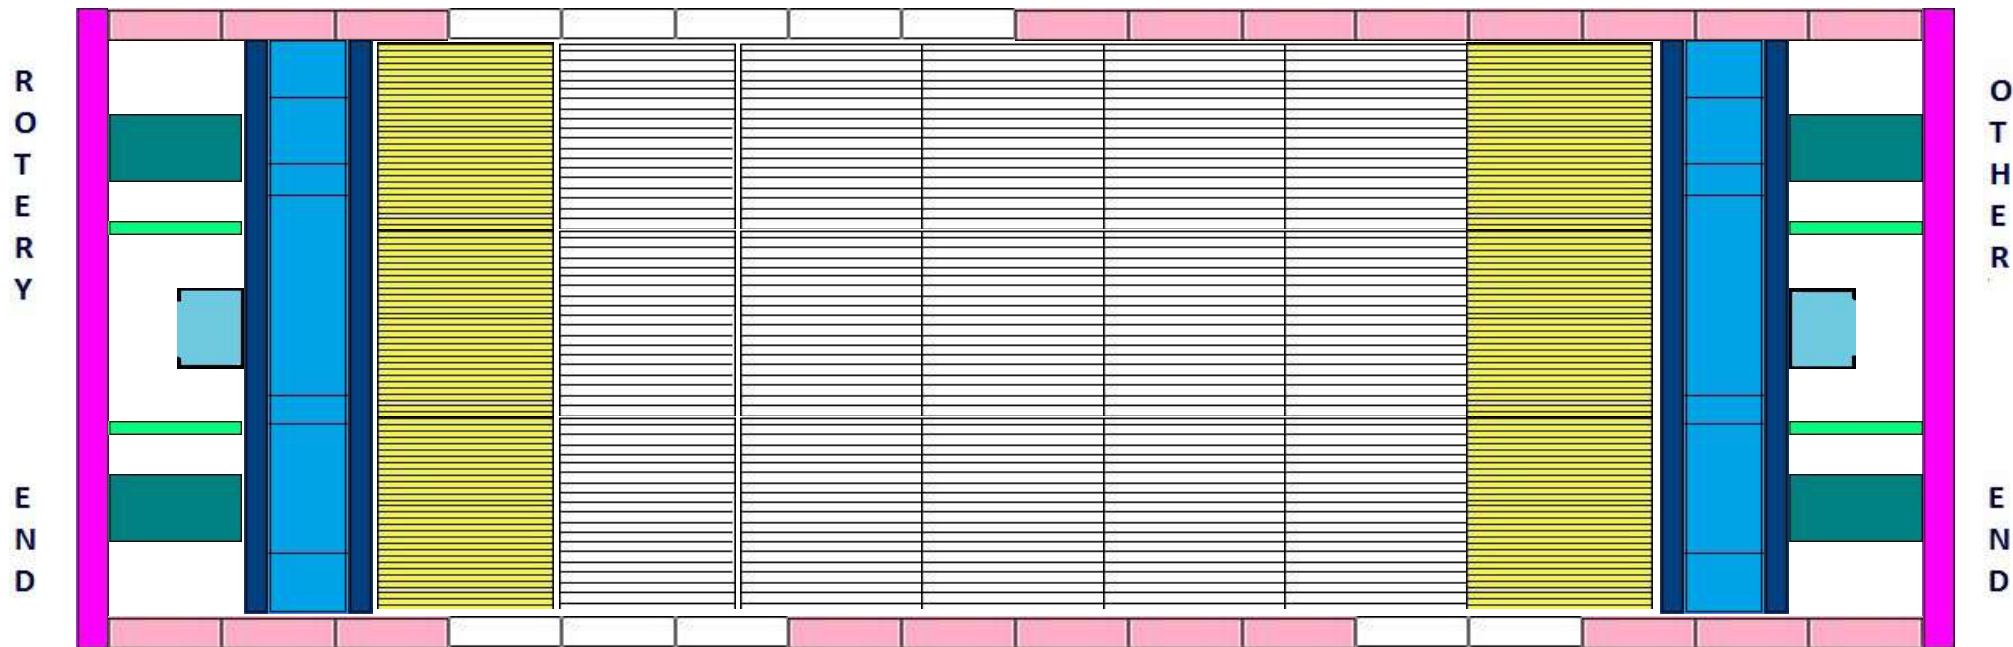

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	11	69%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	11	69%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	46	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 22-Aug-2019, Completion Date : 30-Aug-2019, Net Repair Days : 8, Total Man Hours : 0

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06223


Type : WGSCN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

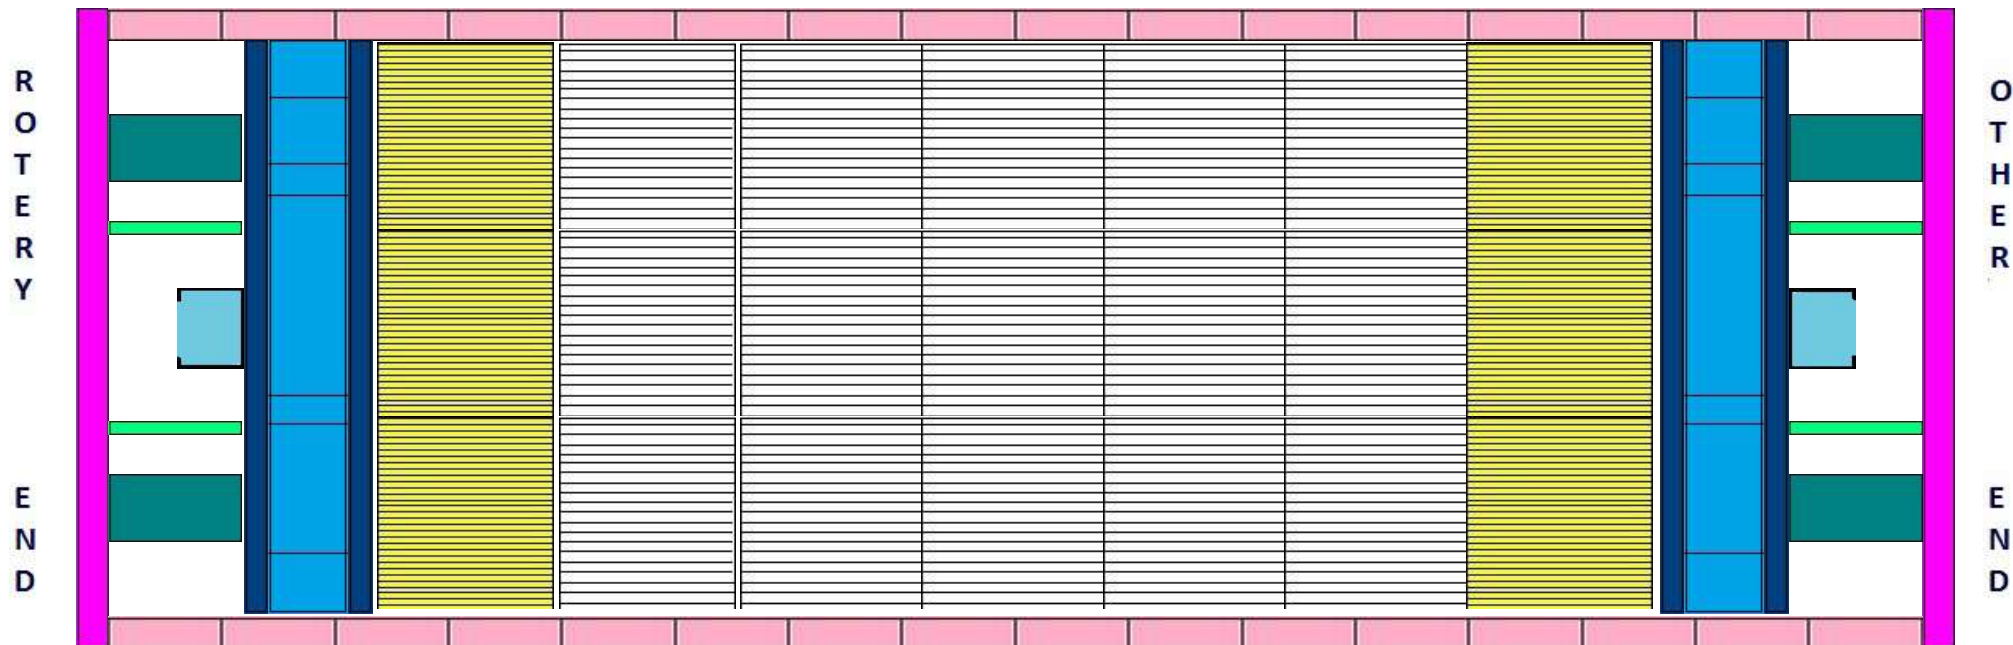

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Black	Aux. Head stock	4	100%	Yellow	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Orange	Trough floor	2	29%	Dark Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		100%
	Window Module		0%		Window Sill	40	100%		Window Bar	40	22%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 3, WEST : 6 Other End - EAST : 3, WEST : 3
Start Date : 22-Aug-2019, Completion Date : 28-Aug-2019, Net Repair Days : 6, Total Man Hours : 1680

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06439


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

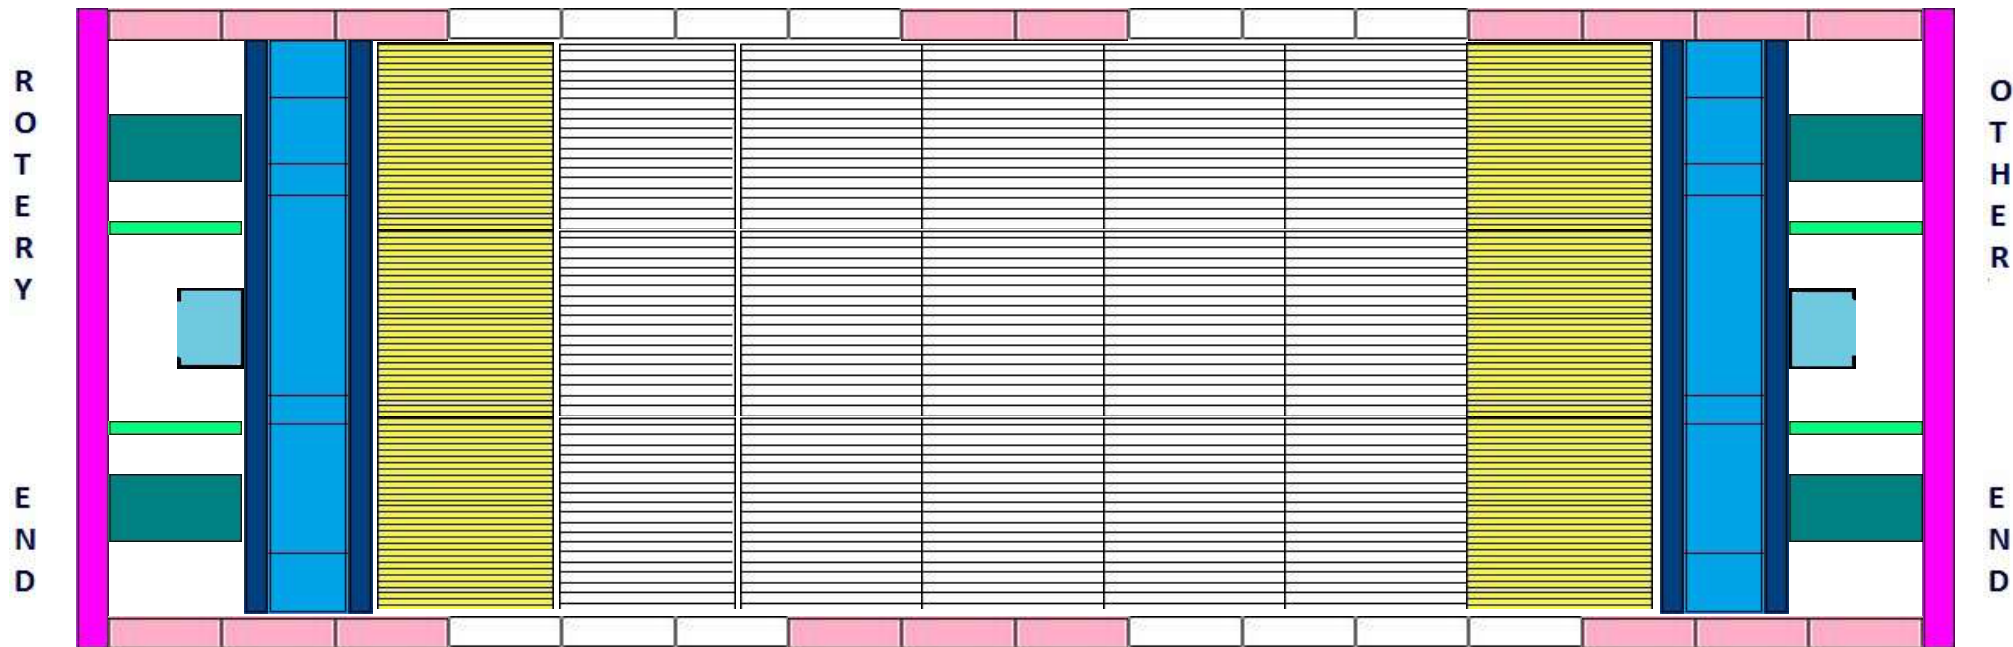

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	9	56%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	9	56%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	30	75%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : -5 Other End - EAST : 7, WEST : 5
Start Date : 24-Sep-2019, Completion Date : 03-Oct-2019, Net Repair Days : 9, Total Man Hours : 1292

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC05054


Type : WGACCW

Built Year : 2005

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

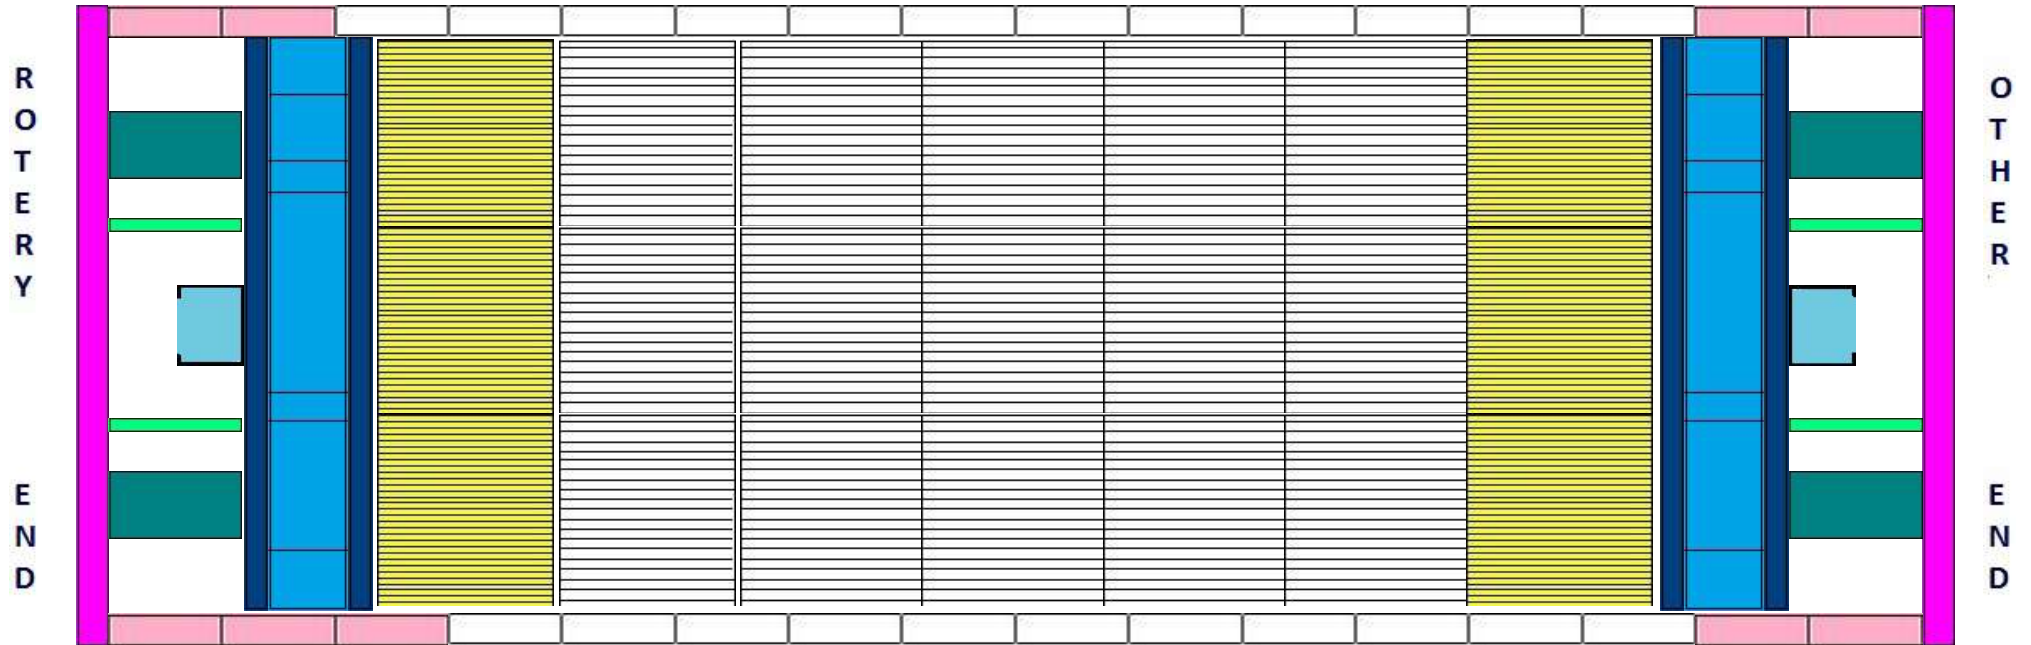

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	4.5	28%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4.5	28%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		3%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 4 Other End - EAST : -5, WEST : -8
Start Date : 04-Oct-2019, Completion Date : 18-Oct-2019, Net Repair Days : 13, Total Man Hours : 1584

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06235


Type : WGSCN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

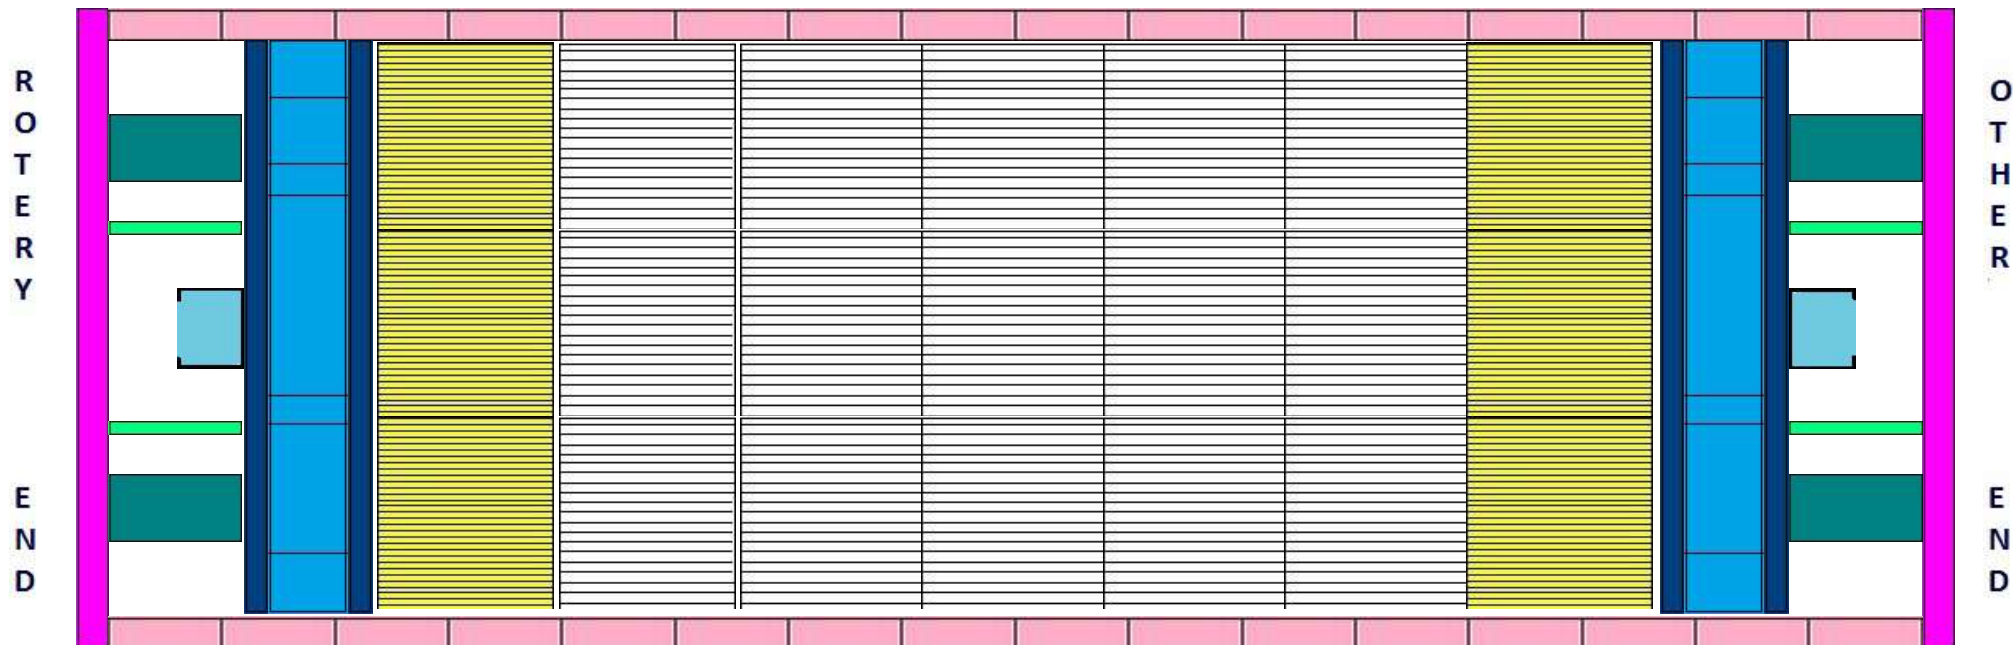

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Magenta	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Bright Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	7	18%		Window Bar	34	18%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : 8 Other End - EAST : -7, WEST : -7
Start Date : 05-Sep-2019, Completion Date : 13-Sep-2019, Net Repair Days : 8, Total Man Hours : 1584

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06441


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

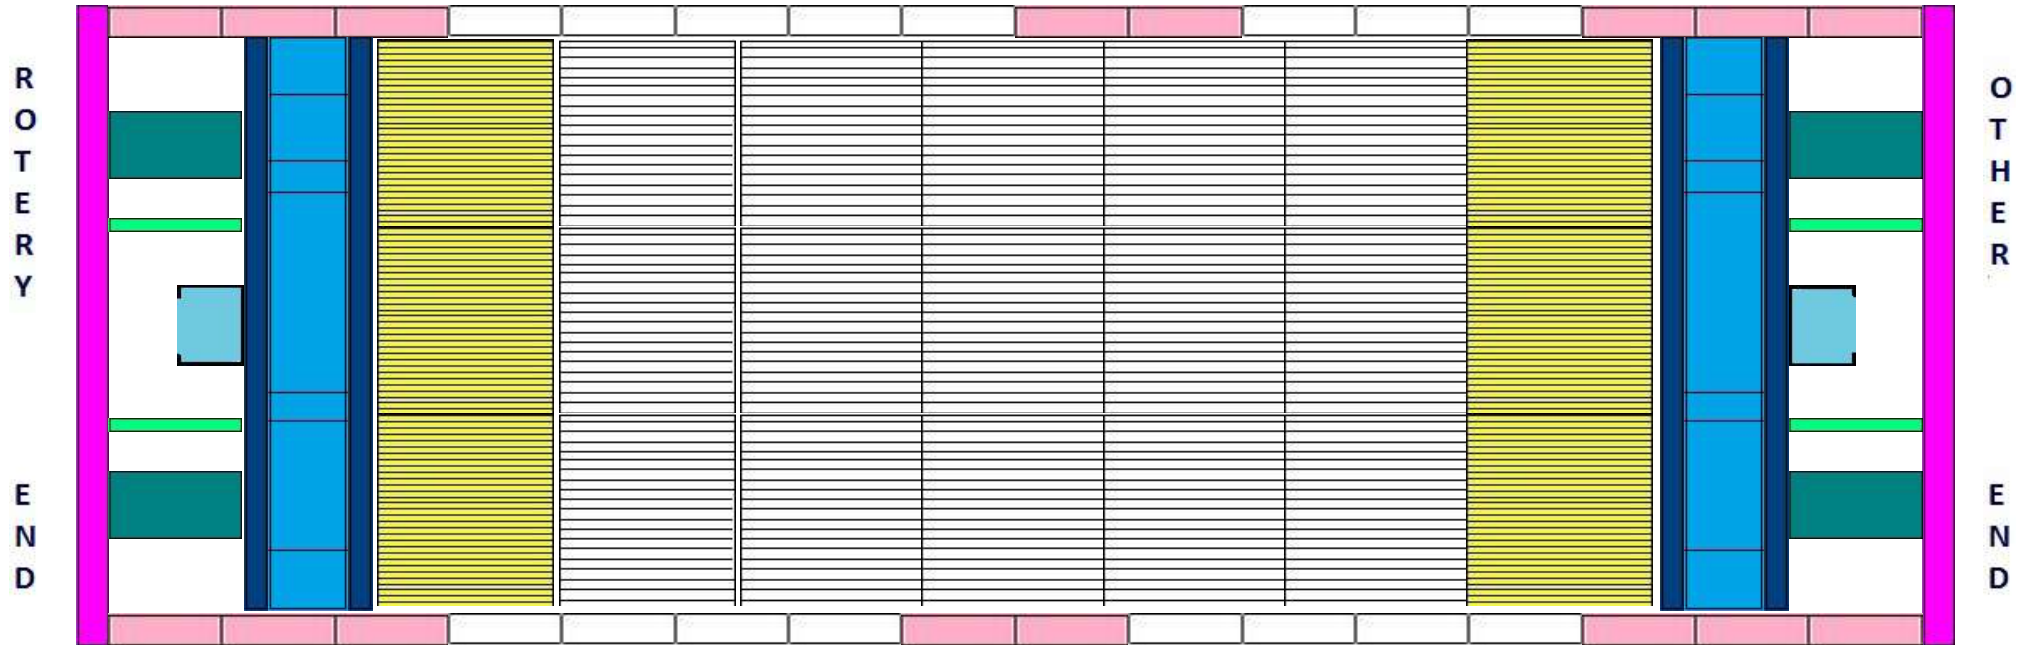

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	8	50%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8	50%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -4, WEST : -4 Other End - EAST : 0, WEST : -4
Start Date : 26-Jul-2019, Completion Date : 03-Aug-2019, Net Repair Days : 8, Total Man Hours : 1404

HAMANT JADAV - JE	M L KOLI - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	---------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC07421


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

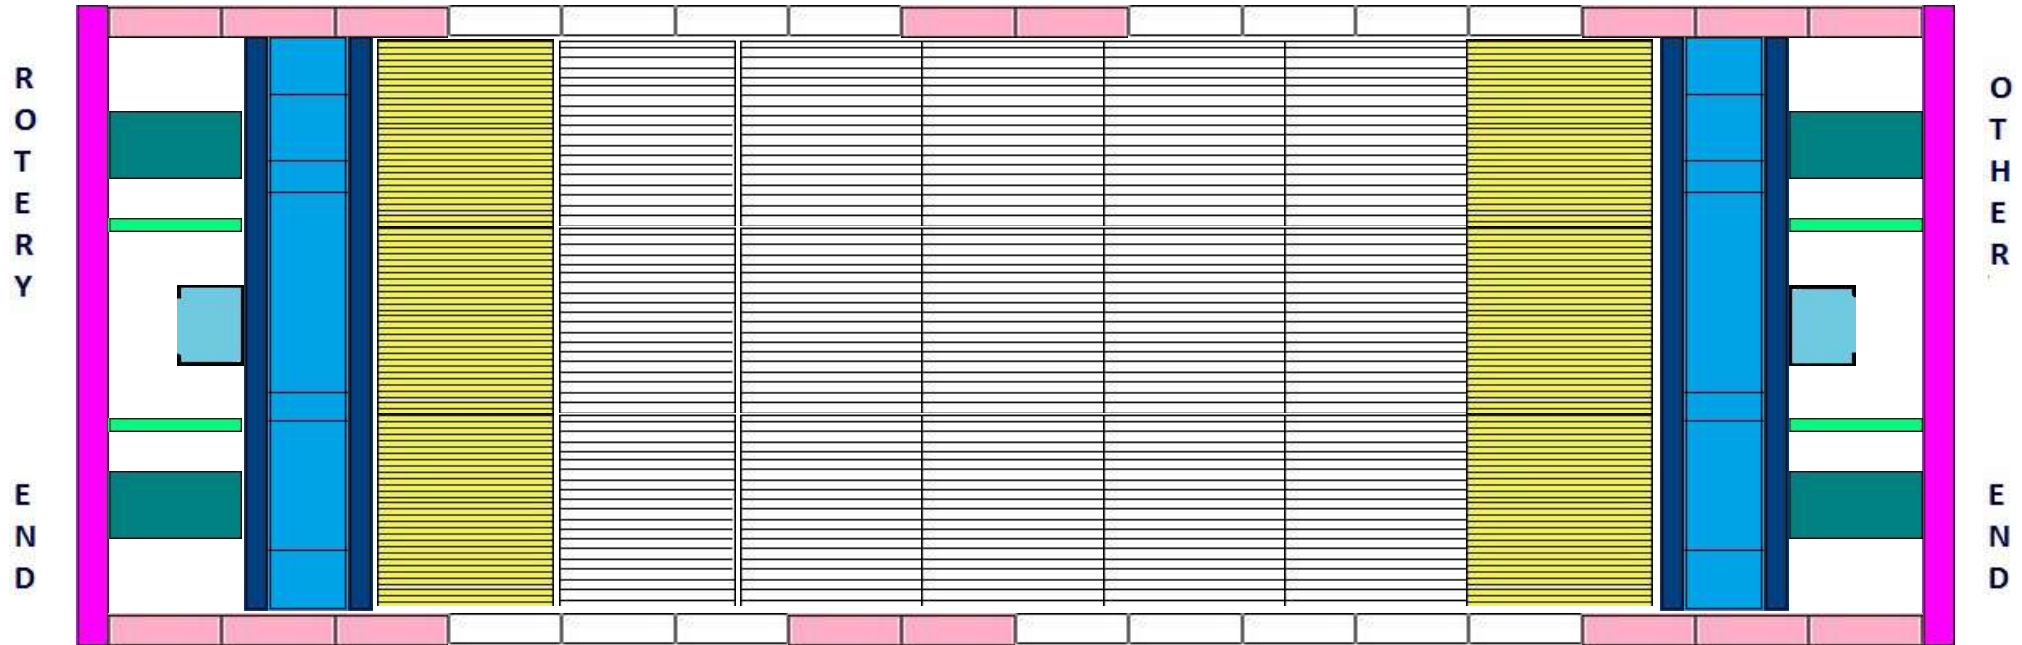

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	8	50%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8	50%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	32	80%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : -4 Other End - EAST : 0, WEST : -3
Start Date : 05-Aug-2019, Completion Date : 14-Aug-2019, Net Repair Days : 9, Total Man Hours : 1248

P N VISHWKARMA - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC05277


Type : WGSCN

Built Year : 2005

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

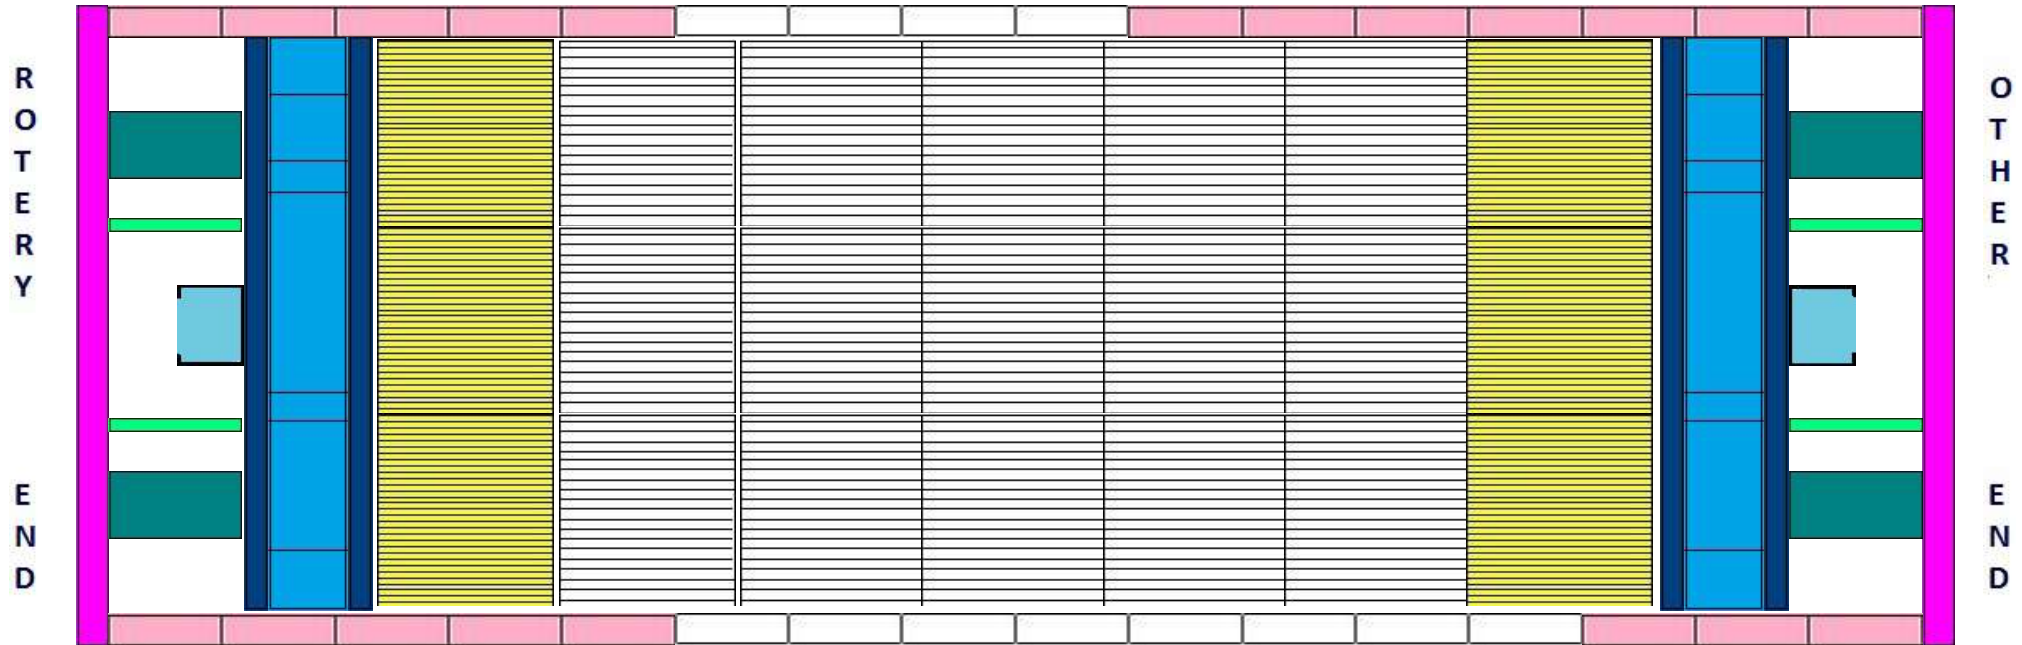

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	10	63%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	10	63%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	64	35%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -10, WEST : -10 Other End - EAST : 0, WEST : -5
Start Date : 06-Aug-2019, Completion Date : 19-Aug-2019, Net Repair Days : 12, Total Man Hours : 1608

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC07225


Type : WGSCN

Built Year : 2017

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

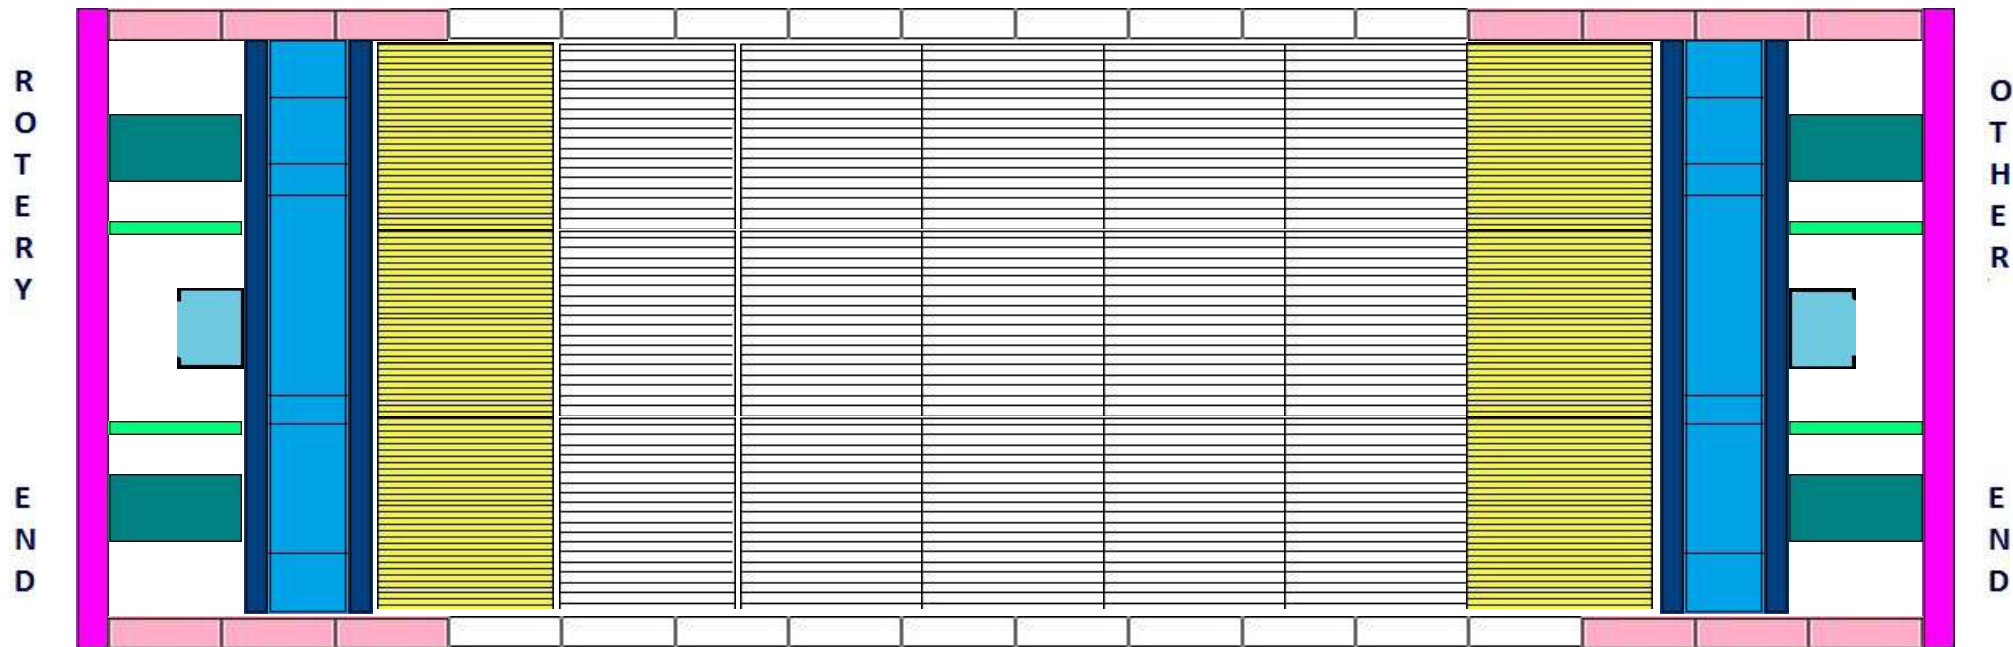

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	6.5	41%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	6.5	41%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	44	24%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : 6 Other End - EAST : 5, WEST : 3
Start Date : 31-Aug-2019, Completion Date : 05-Sep-2019, Net Repair Days : 5, Total Man Hours : 1298

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC04208


Type : WGSCN

Built Year : 2004

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

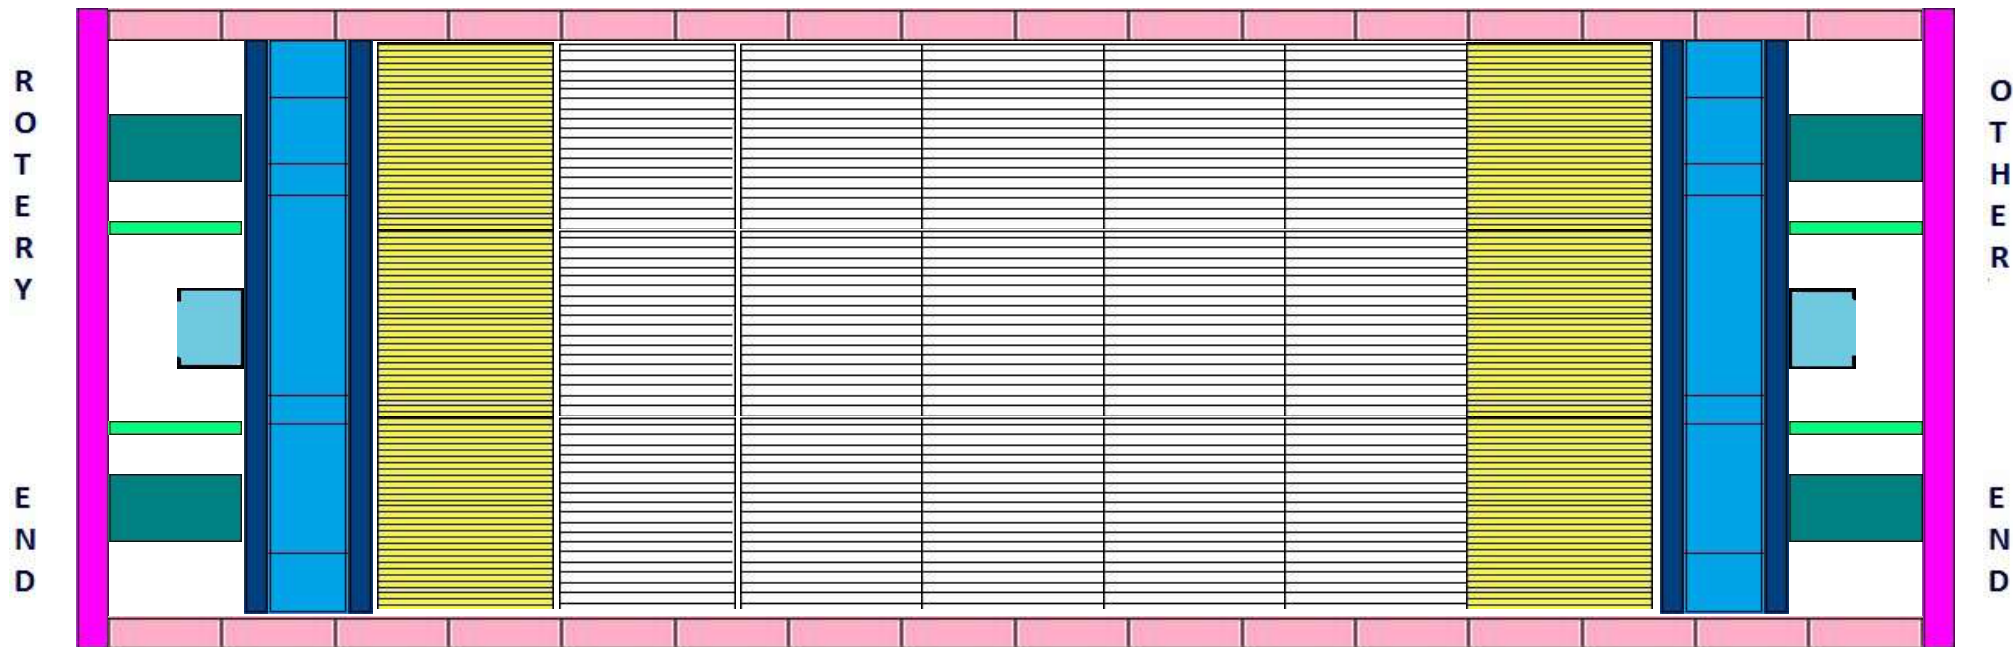

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Yellow	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	24	60%		Window Bar	42	23%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -2, WEST : 8 Other End - EAST : 3, WEST : -7

Start Date : 28-Aug-2019, Completion Date : 04-Sep-2019, Net Repair Days : 7, Total Man Hours : 1632

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06403


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

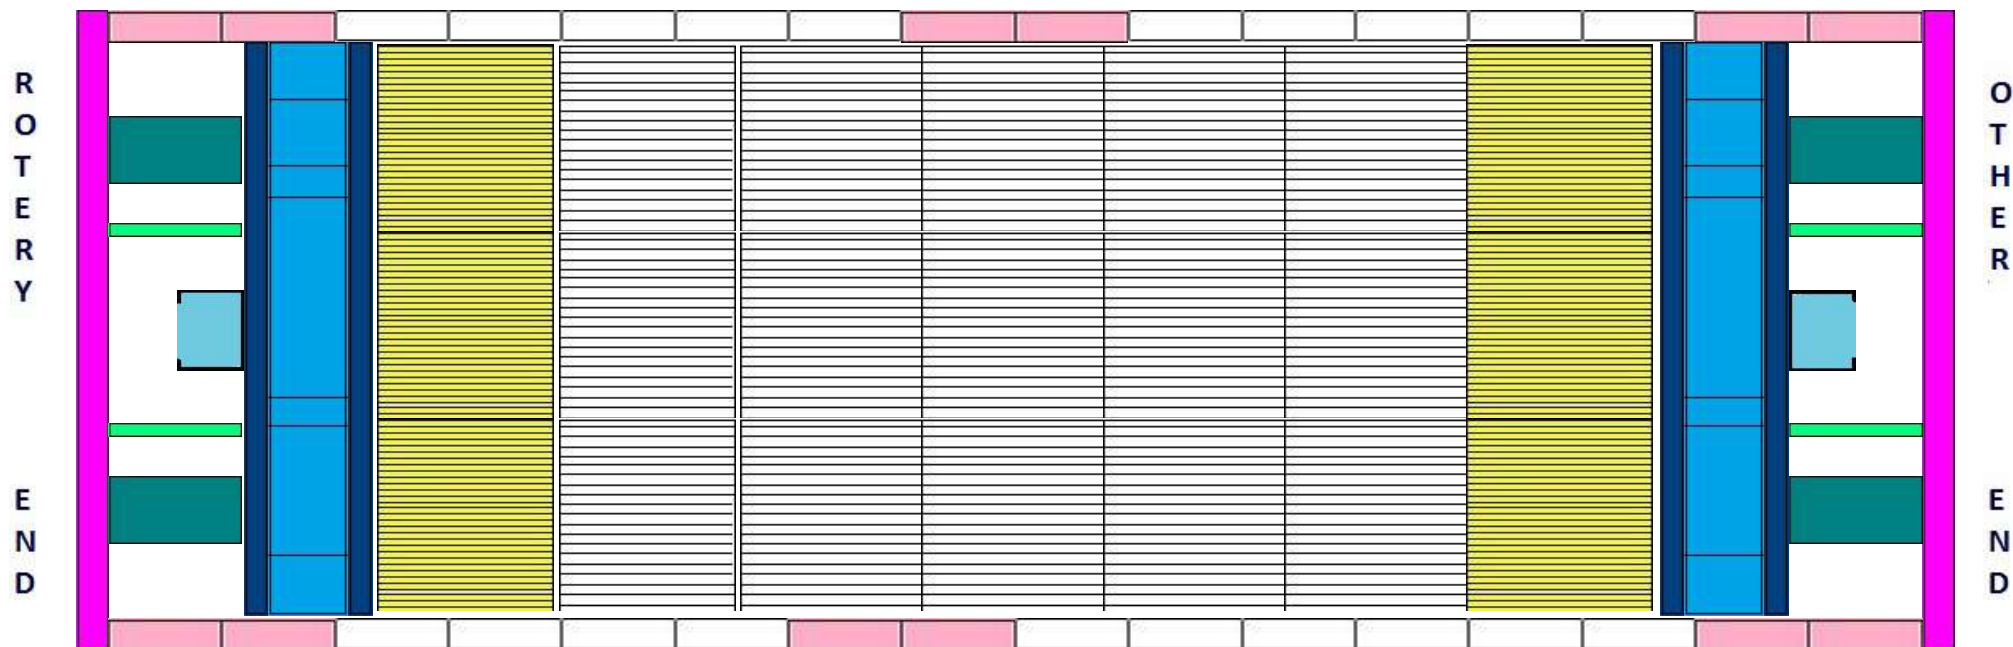

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	6	38%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	6	38%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	35%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 6, WEST : 0 Other End - EAST : 4, WEST : 0
Start Date : 27-Jul-2019, Completion Date : 03-Aug-2019, Net Repair Days : 7, Total Man Hours : 1192

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC07226


Type : WGSCN

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

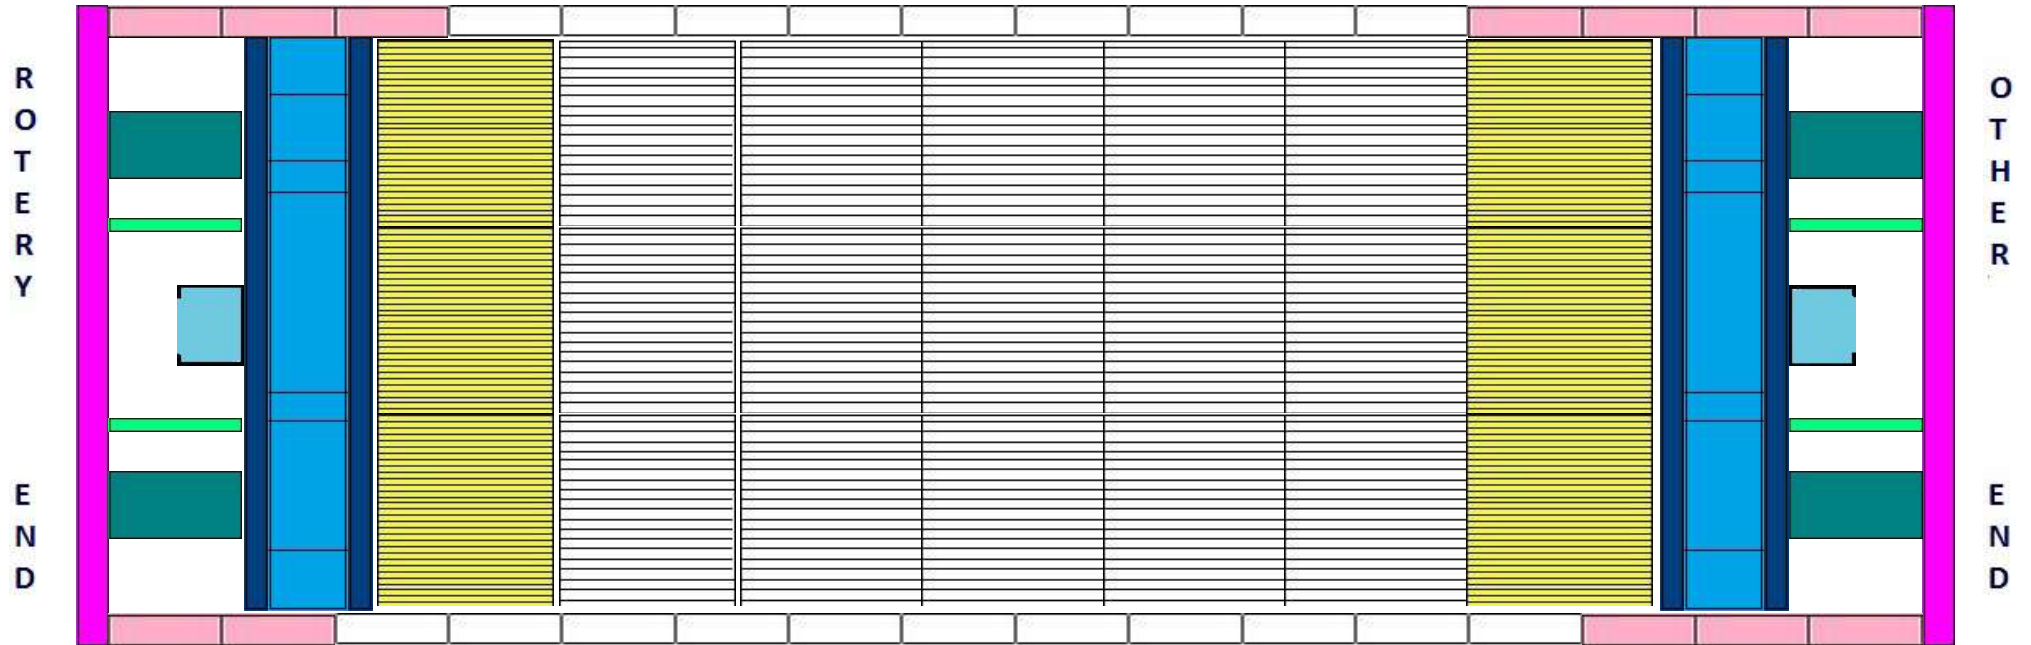

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	6	38%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	6	38%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	35%		Window Bar	44	24%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : -4 Other End - EAST : -3, WEST : -5
Start Date : 29-Jul-2019, Completion Date : 05-Aug-2019, Net Repair Days : 7, Total Man Hours : 1241

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06217


Type : WGSCN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

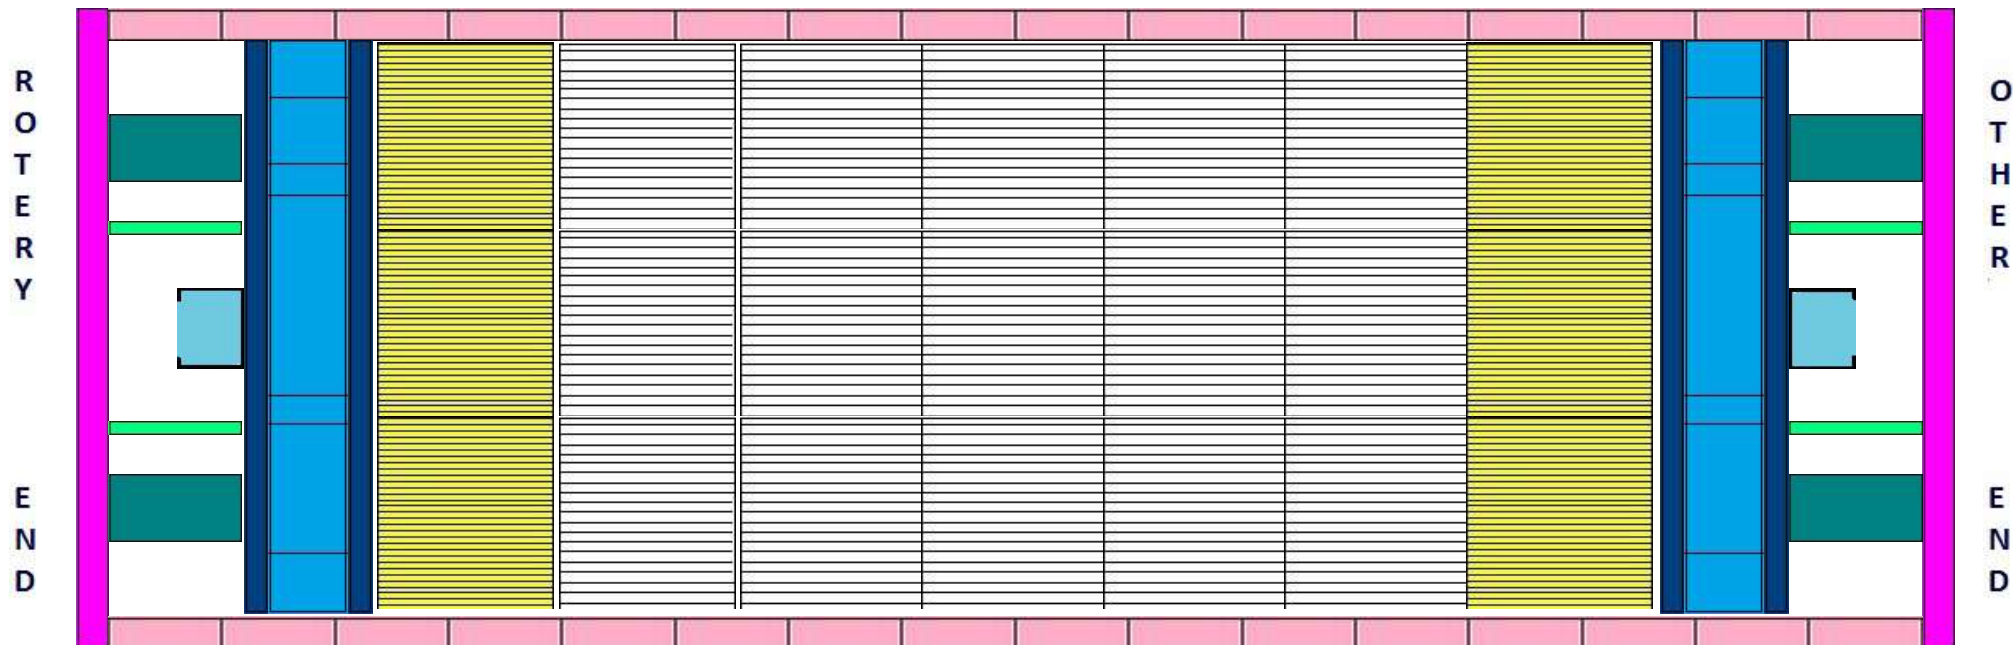

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	30	75%		Window Bar	40	22%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 2, WEST : 3 Other End - EAST : -2, WEST : 2
Start Date : 26-Jul-2019, Completion Date : 02-Aug-2019, Net Repair Days : 7, Total Man Hours : 1600

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC04256


Type : WGSCN

Built Year : 2004

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

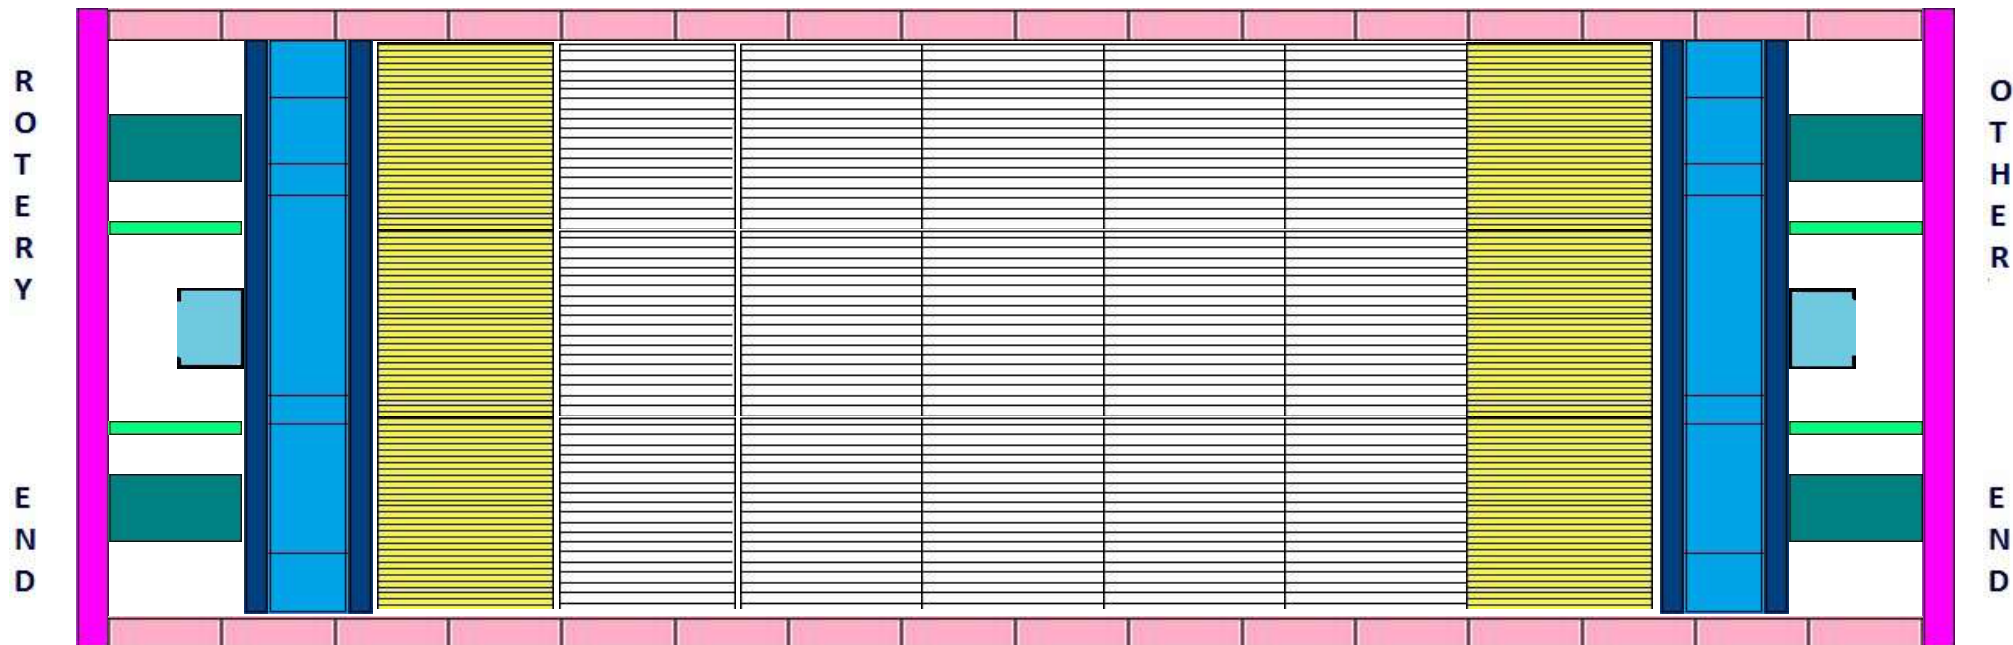

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	7	18%		Window Bar	34	18%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 3, WEST : 4 Other End - EAST : -2, WEST : -3
Start Date : 29-Jul-2019, Completion Date : 06-Aug-2019, Net Repair Days : 8, Total Man Hours : 1532

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC07228


Type : WGSCN

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

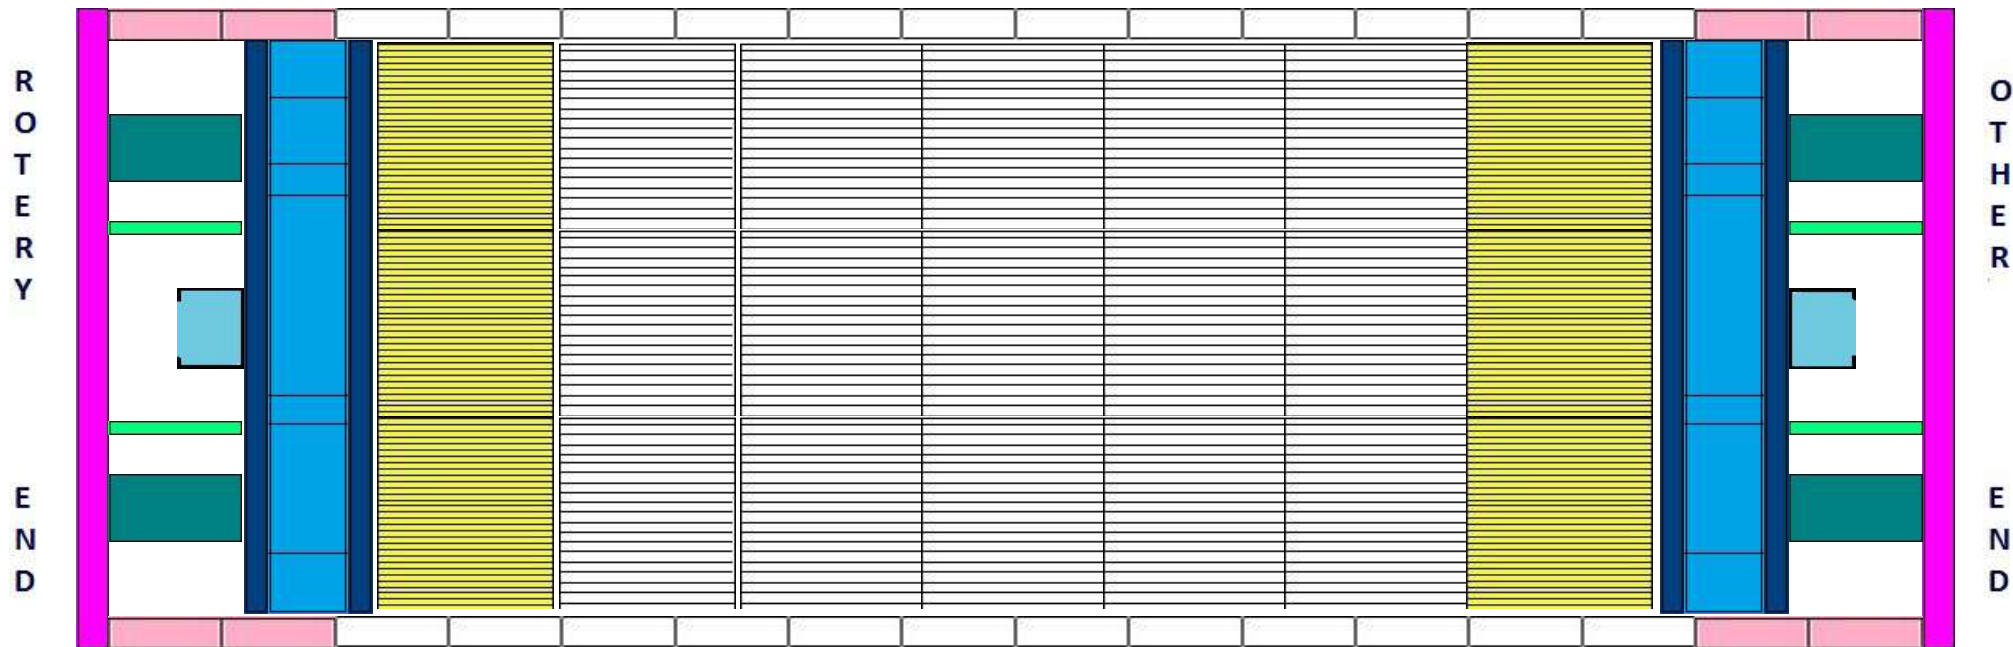

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4	25%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	35%		Window Bar	38	21%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 10, WEST : 0 Other End - EAST : -10, WEST : -10
Start Date : 29-Jul-2019, Completion Date : 03-Aug-2019, Net Repair Days : 6, Total Man Hours : 995

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC05274


Type : WGSCN

Built Year : 2005

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

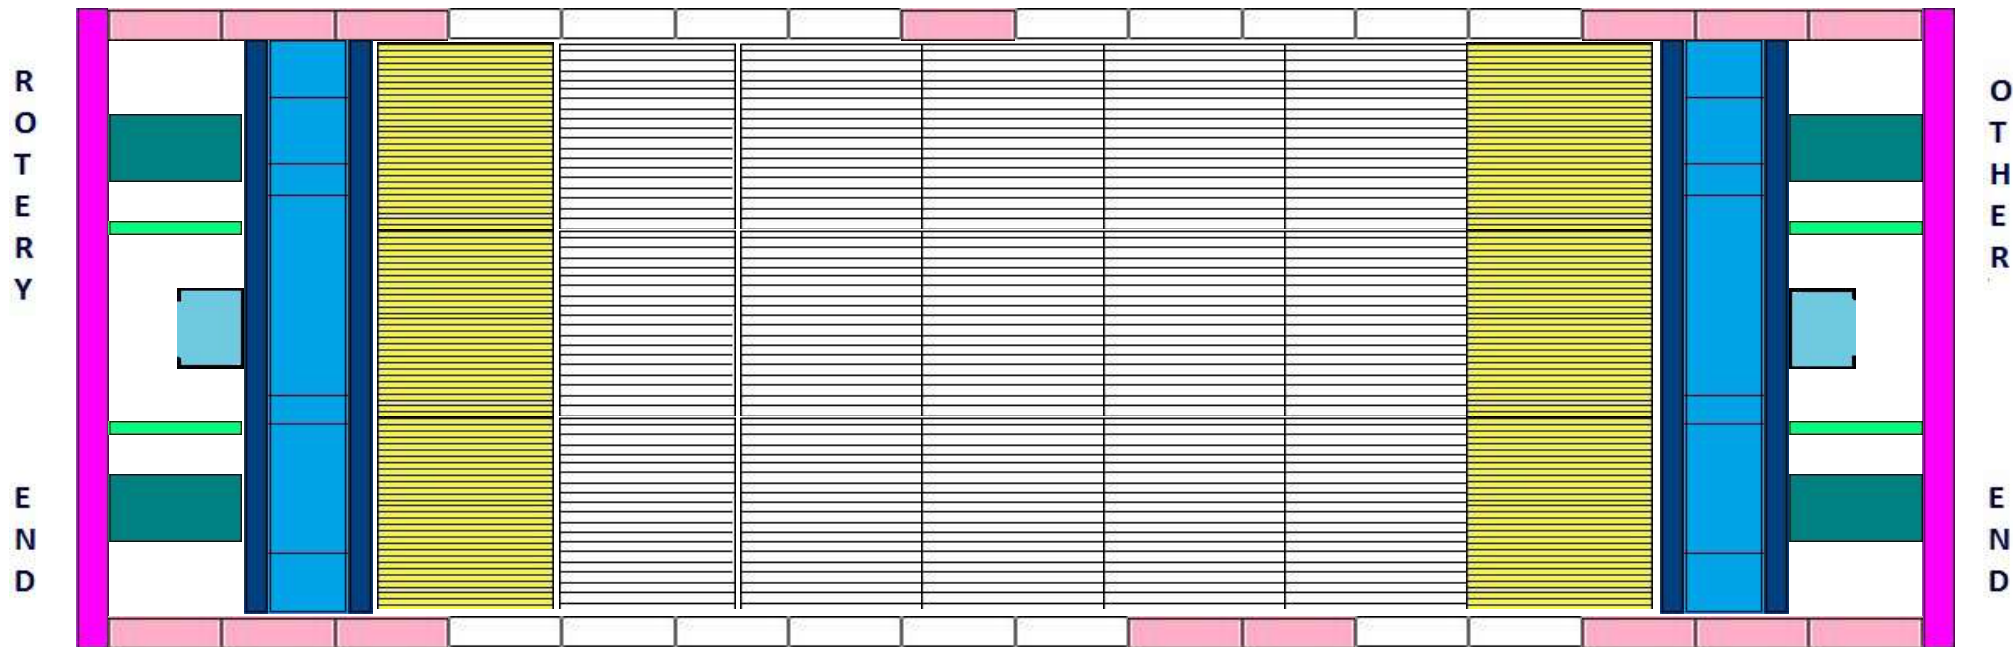

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Yellow	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	7.5	47%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	7.5	47%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	22	55%		Window Bar	44	24%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 3, WEST : 3 Other End - EAST : -2, WEST : -6
Start Date : 01-Aug-2019, Completion Date : 08-Aug-2019, Net Repair Days : 7, Total Man Hours : 1312

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC07219


Type : WGSCN

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

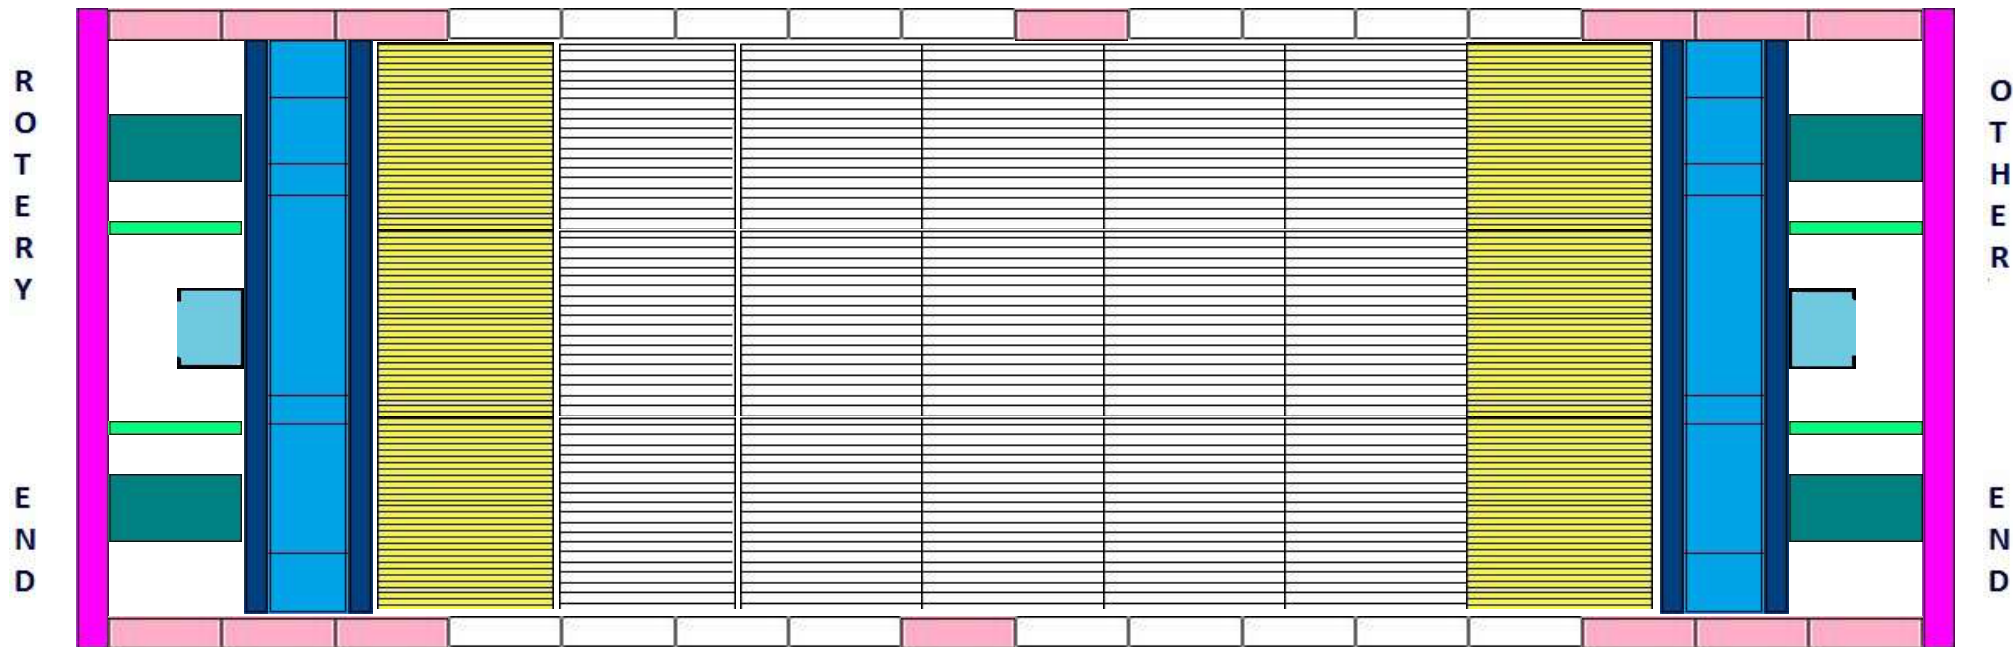

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	7	44%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	7	44%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	24	60%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -6, WEST : -5 Other End - EAST : -4, WEST : -4
Start Date : 30-Jul-2019, Completion Date : 09-Aug-2019, Net Repair Days : 10, Total Man Hours : 1080

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC04261


Type : WGSCN

Built Year : 2004

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

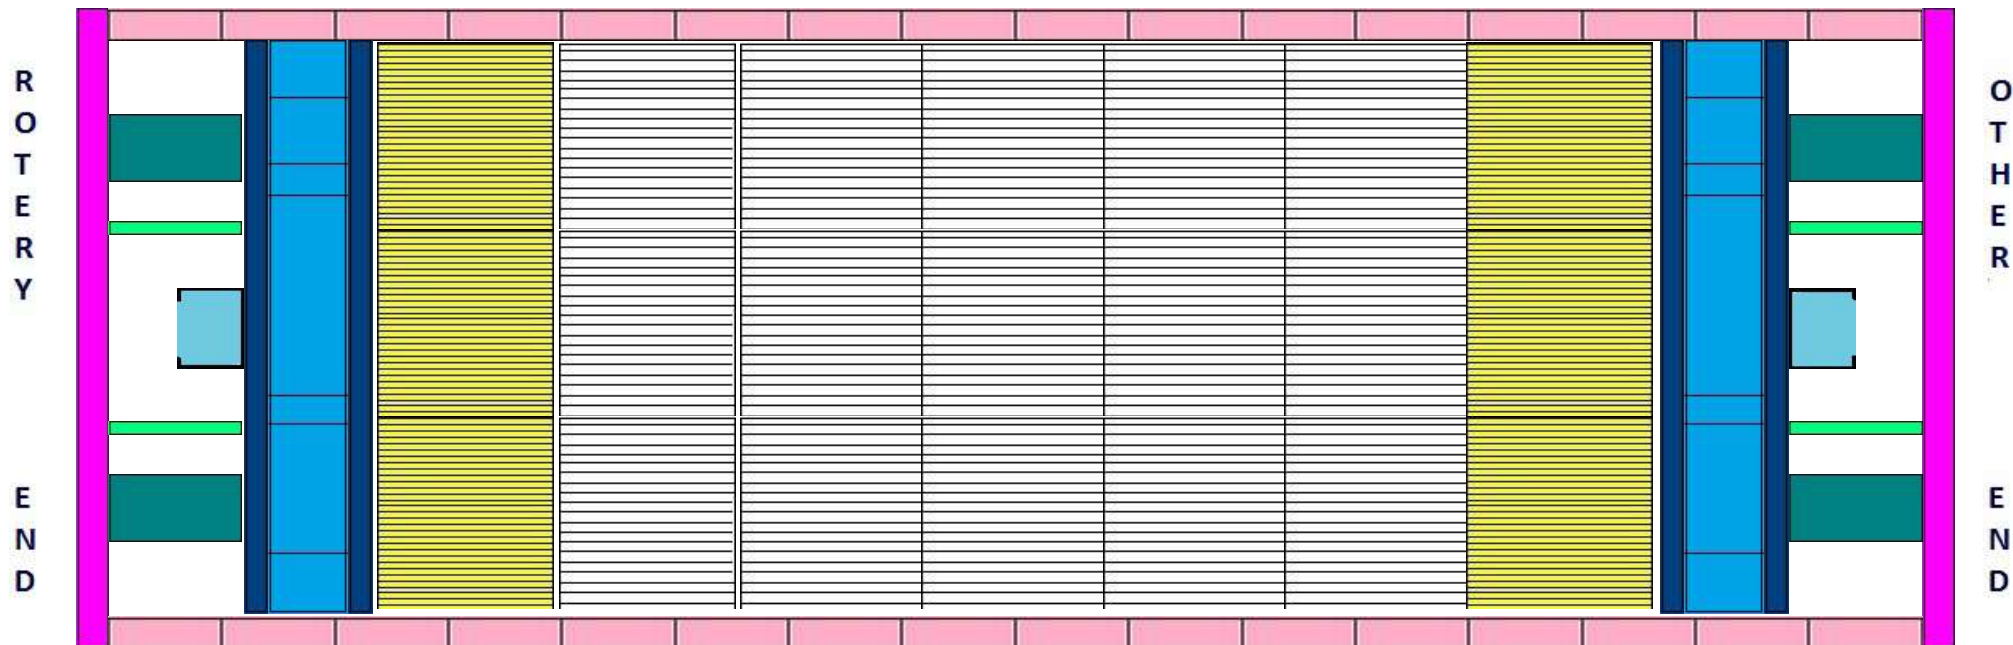

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	21	53%		Window Bar	42	23%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 3, WEST : 4 Other End - EAST : 4, WEST : 3
Start Date : 29-Jul-2019, Completion Date : 07-Aug-2019, Net Repair Days : 9, Total Man Hours : 1560

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06414


Type : GS

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

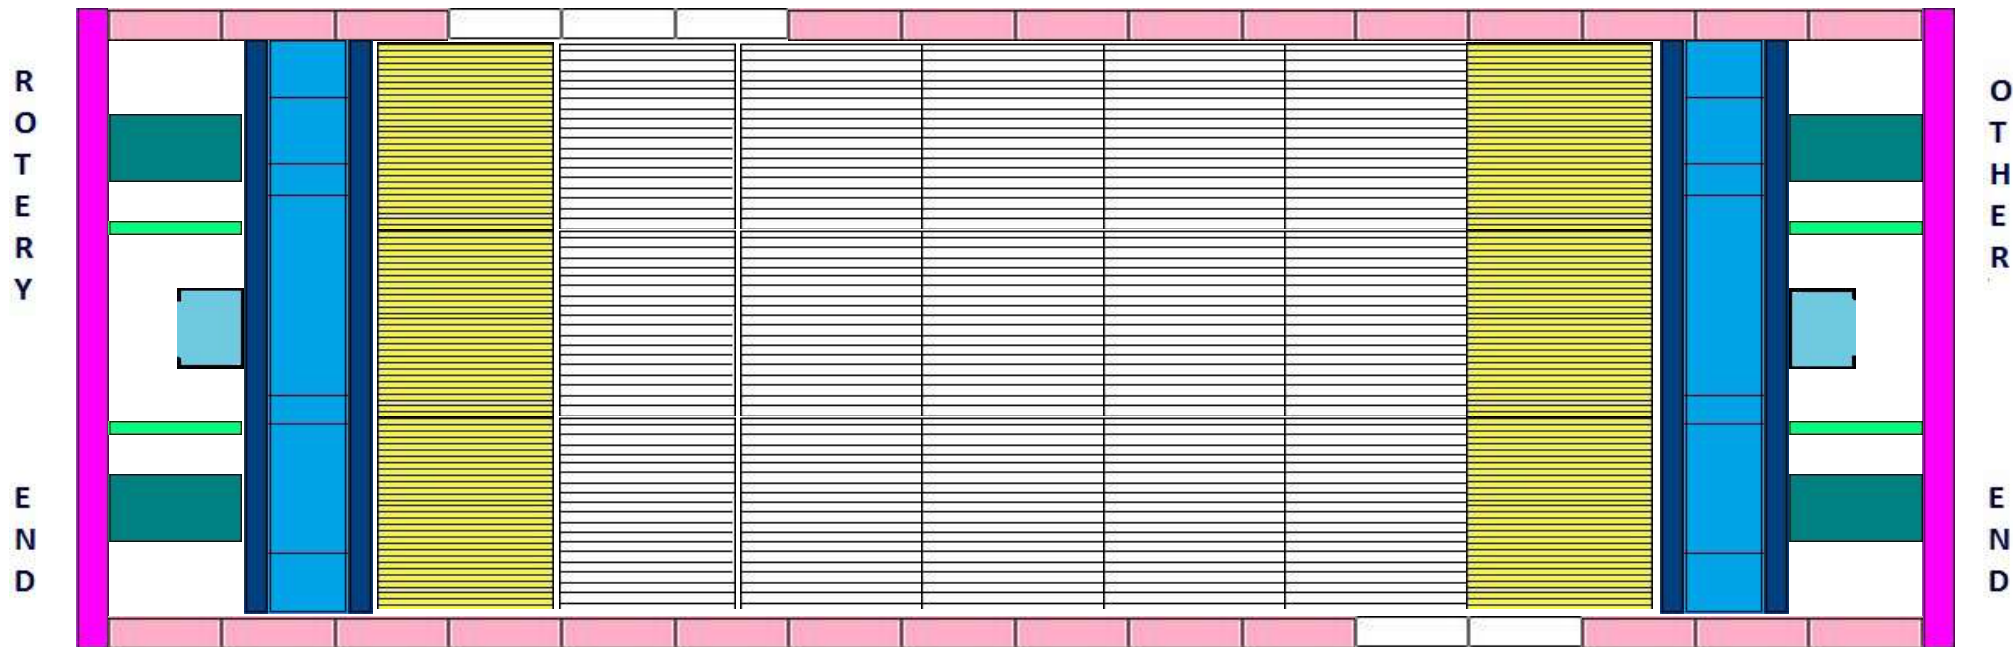

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	13.5	84%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	13.5	84%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	24	60%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 10, WEST : 5 Other End - EAST : -5, WEST : 0

Start Date : 01-Aug-2019, Completion Date : 07-Aug-2019, Net Repair Days : 6, Total Man Hours : 1373

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06465


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

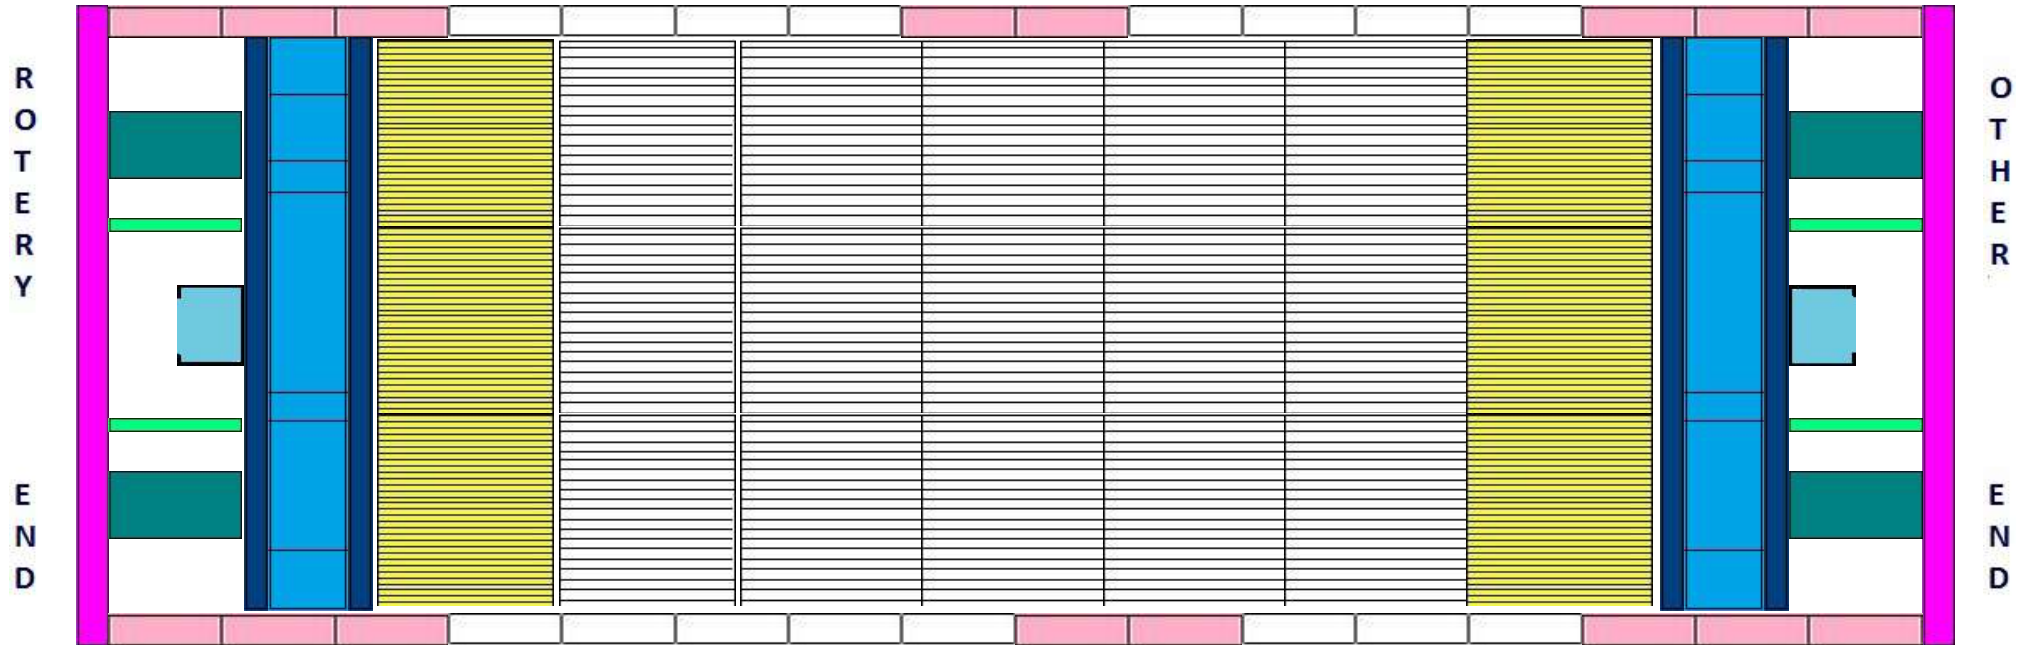

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	8	50%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8	50%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	37	93%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 3, WEST : 6 Other End - EAST : 3, WEST : 3
Start Date : 05-Aug-2019, Completion Date : 10-Aug-2019, Net Repair Days : 6, Total Man Hours : 1448

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06202


Type : CN

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

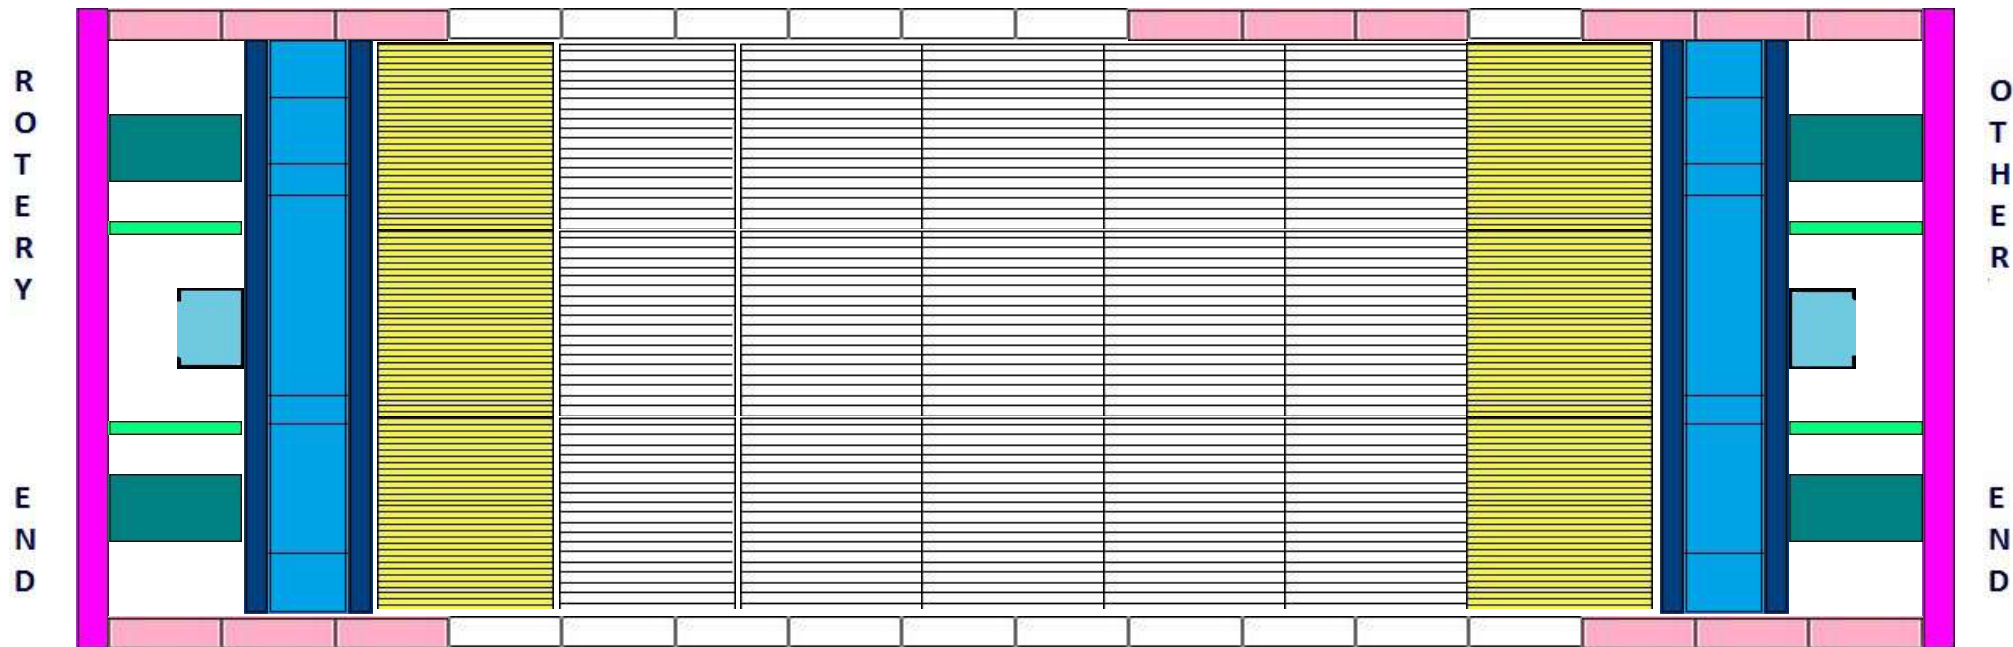

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	7.5	47%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	7.5	47%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	32	80%		Window Bar	40	22%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 20-Aug-2019, Completion Date : 26-Aug-2019, Net Repair Days : 6, Total Man Hours : 0

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC04244


Type : CN

Built Year : 2004

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

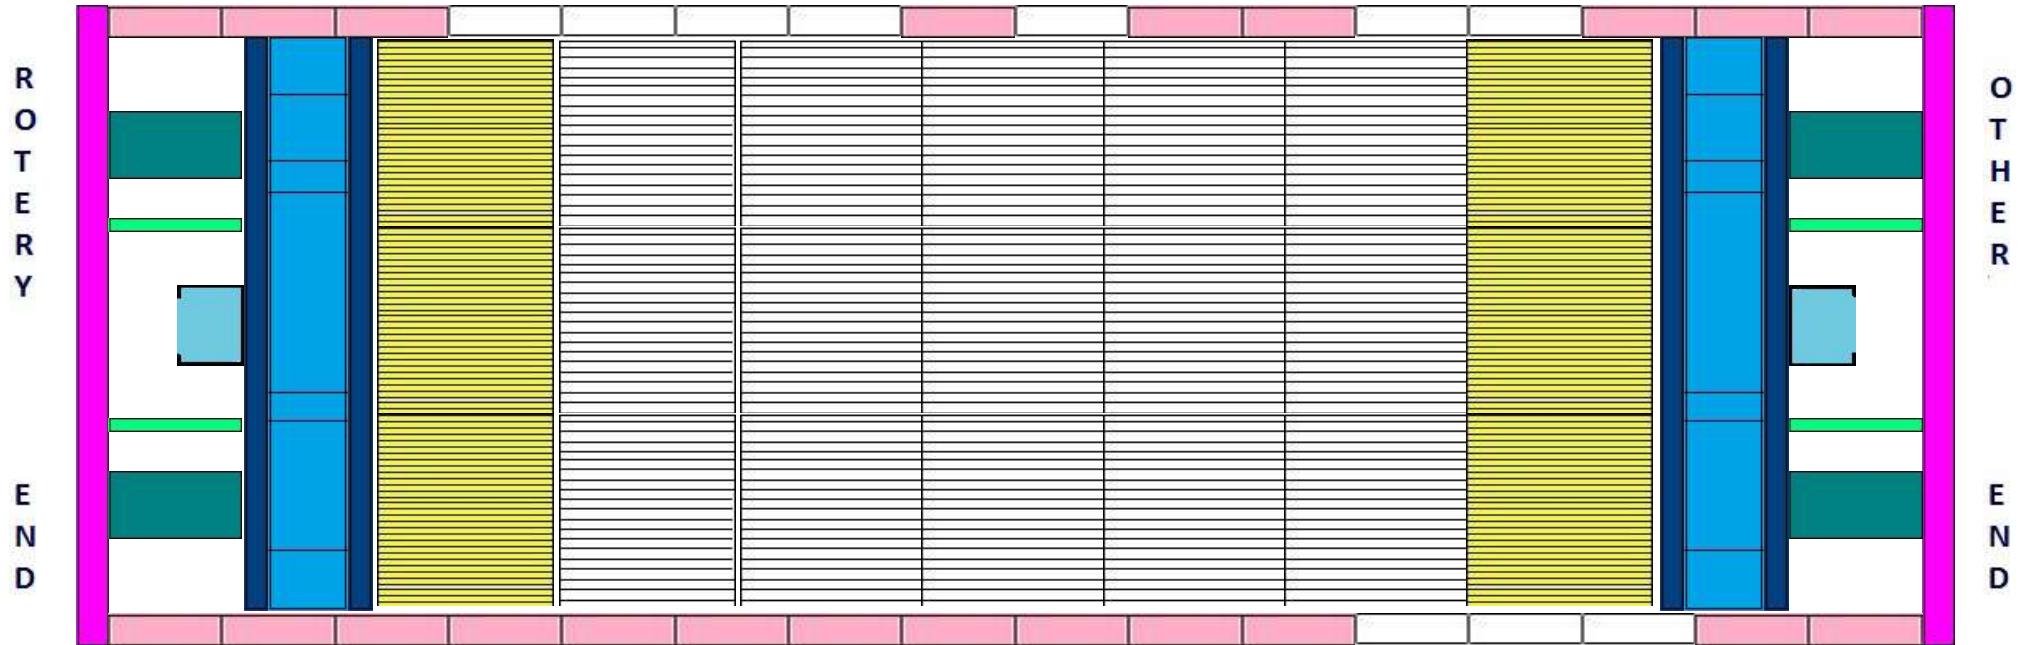

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	11	69%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	11	69%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	44	24%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 6, WEST : 8 Other End - EAST : -5, WEST : -4

Start Date : 10-Aug-2019, Completion Date : 20-Aug-2019, Net Repair Days : 9, Total Man Hours : 1512

K K TRIPATHI - SSE	H R KANNOJE - SSE	PANKAJ KU SINGH - JE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	----------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC05217


Type : WGSCN

Built Year : 2005

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

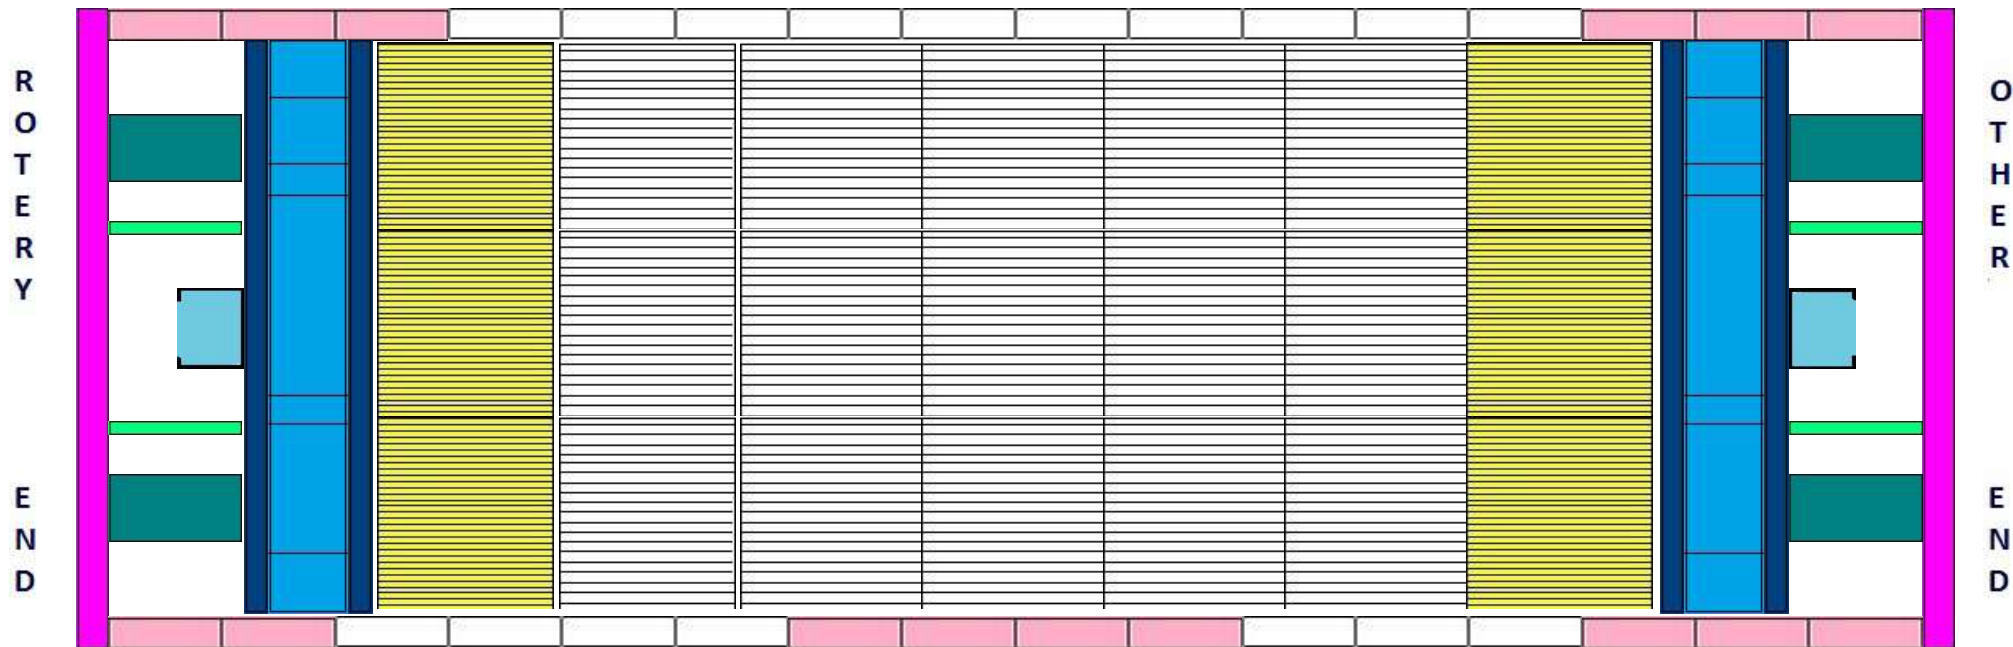

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	7.5	47%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	7.5	47%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	32	80%		Window Bar	42	23%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 7, WEST : 3 Other End - EAST : 3, WEST : -4

Start Date : 28-Aug-2019, Completion Date : 03-Sep-2019, Net Repair Days : 6, Total Man Hours : 1256

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06242


Type : WGSCN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

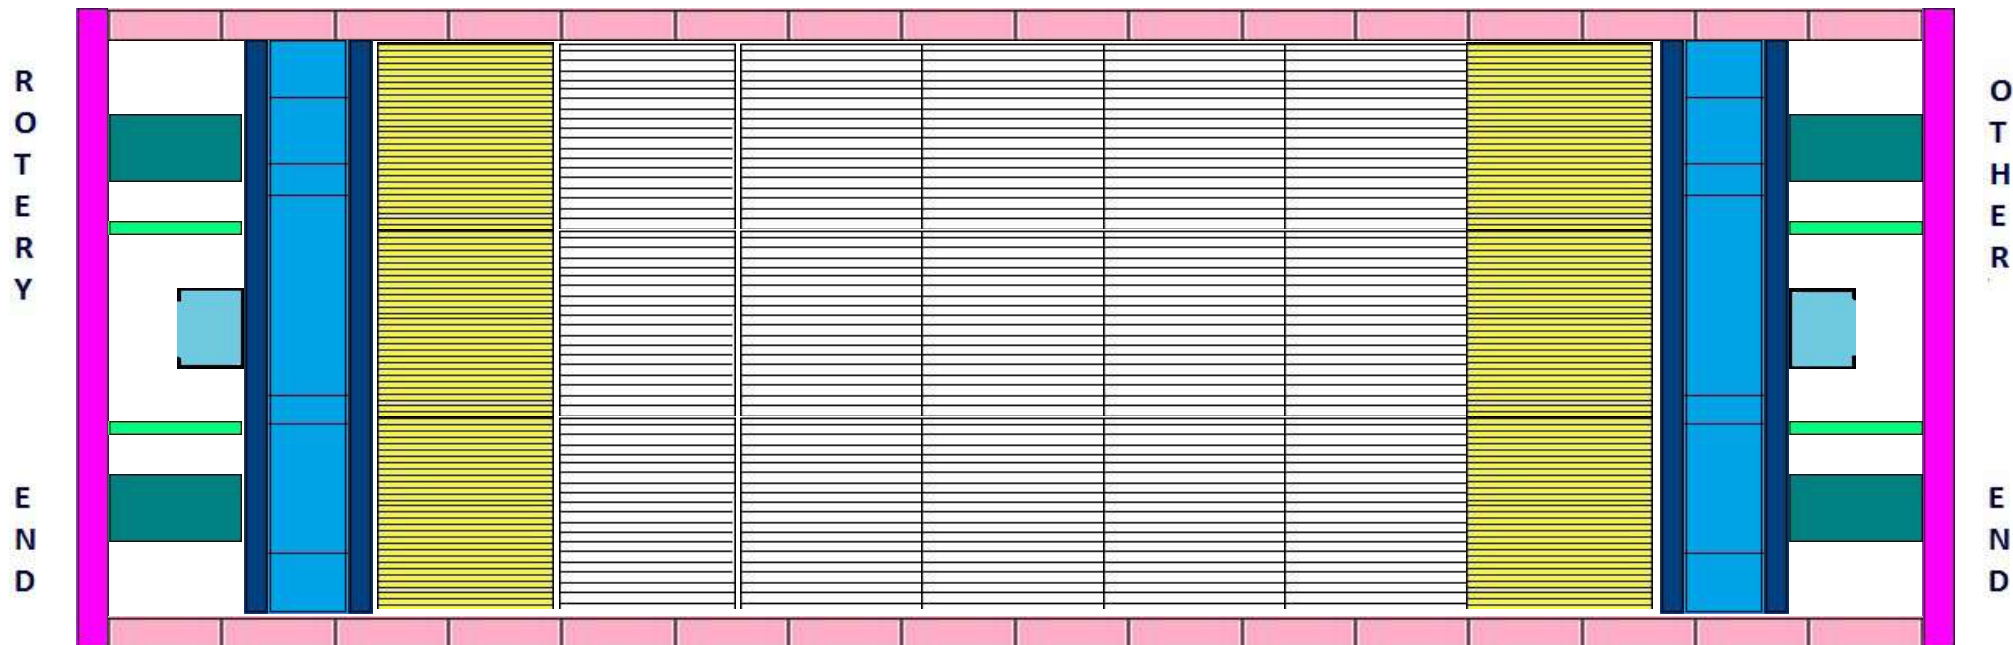

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Blue	Aux. Head stock	4	100%	Yellow	Sole Bar	16	100%	Blue	Draft Gear Bracket	2	100%
Red	Trough floor	2	29%	Red	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	28	15%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 6, WEST : 2 Other End - EAST : 8, WEST : 6
Start Date : 19-Dec-2019, Completion Date : 01-Jan-2020, Net Repair Days : 12, Total Man Hours : 1216

ANASTA PRASAD - JE	MOHD. JAFER QURASHI - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	--------------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06226


Type : WGSCN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

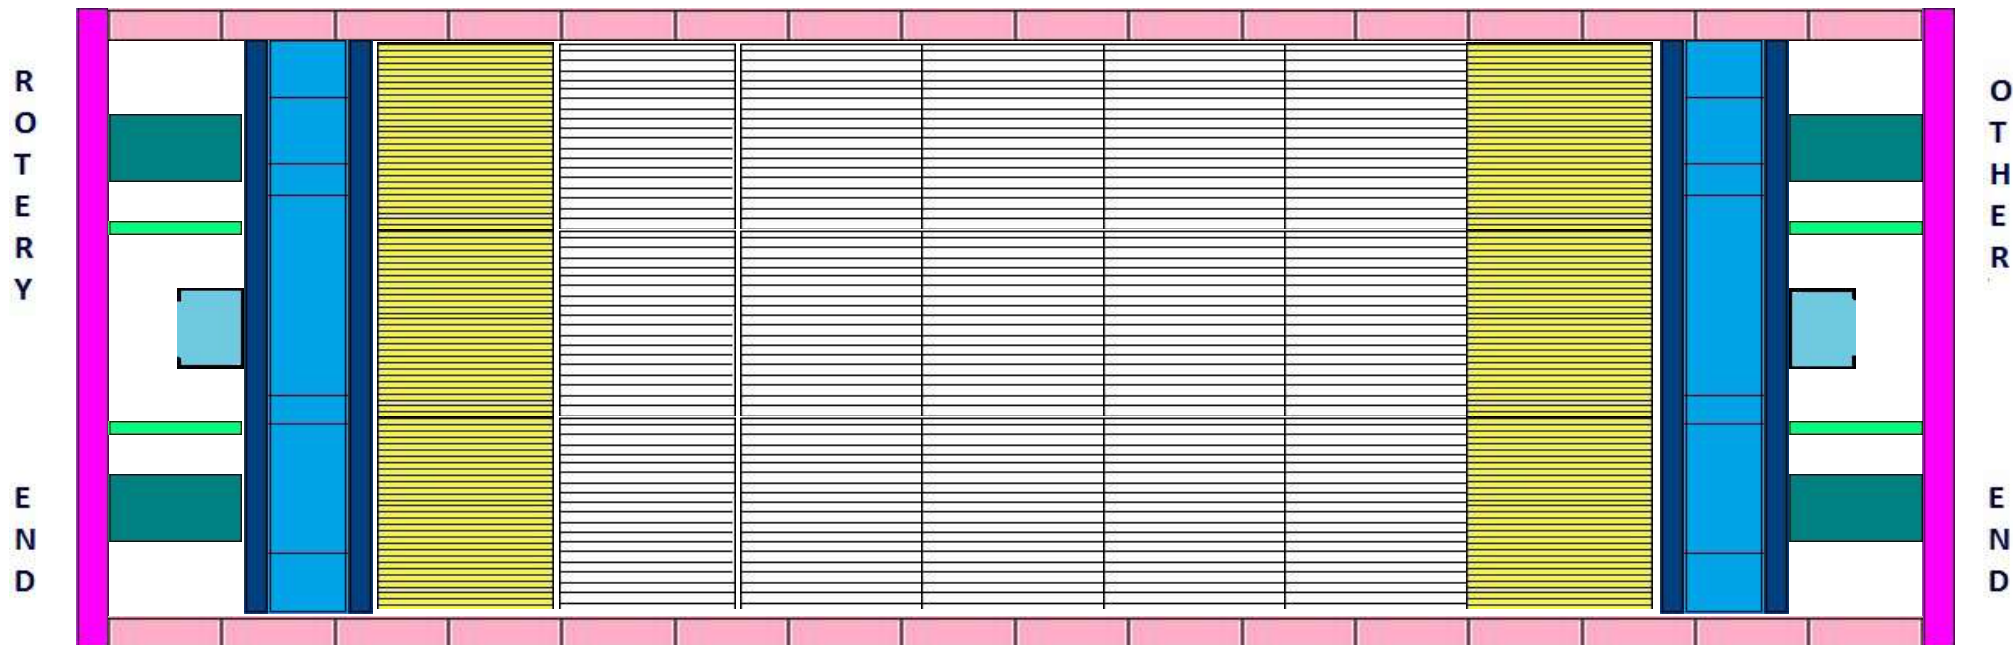

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	35%		Window Bar	40	100%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 2, WEST : 6 Other End - EAST : 5, WEST : 6
Start Date : 23-Dec-2019, Completion Date : 02-Jan-2020, Net Repair Days : 10, Total Man Hours : 1344

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	--------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : EC06230


Type : WGSCN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

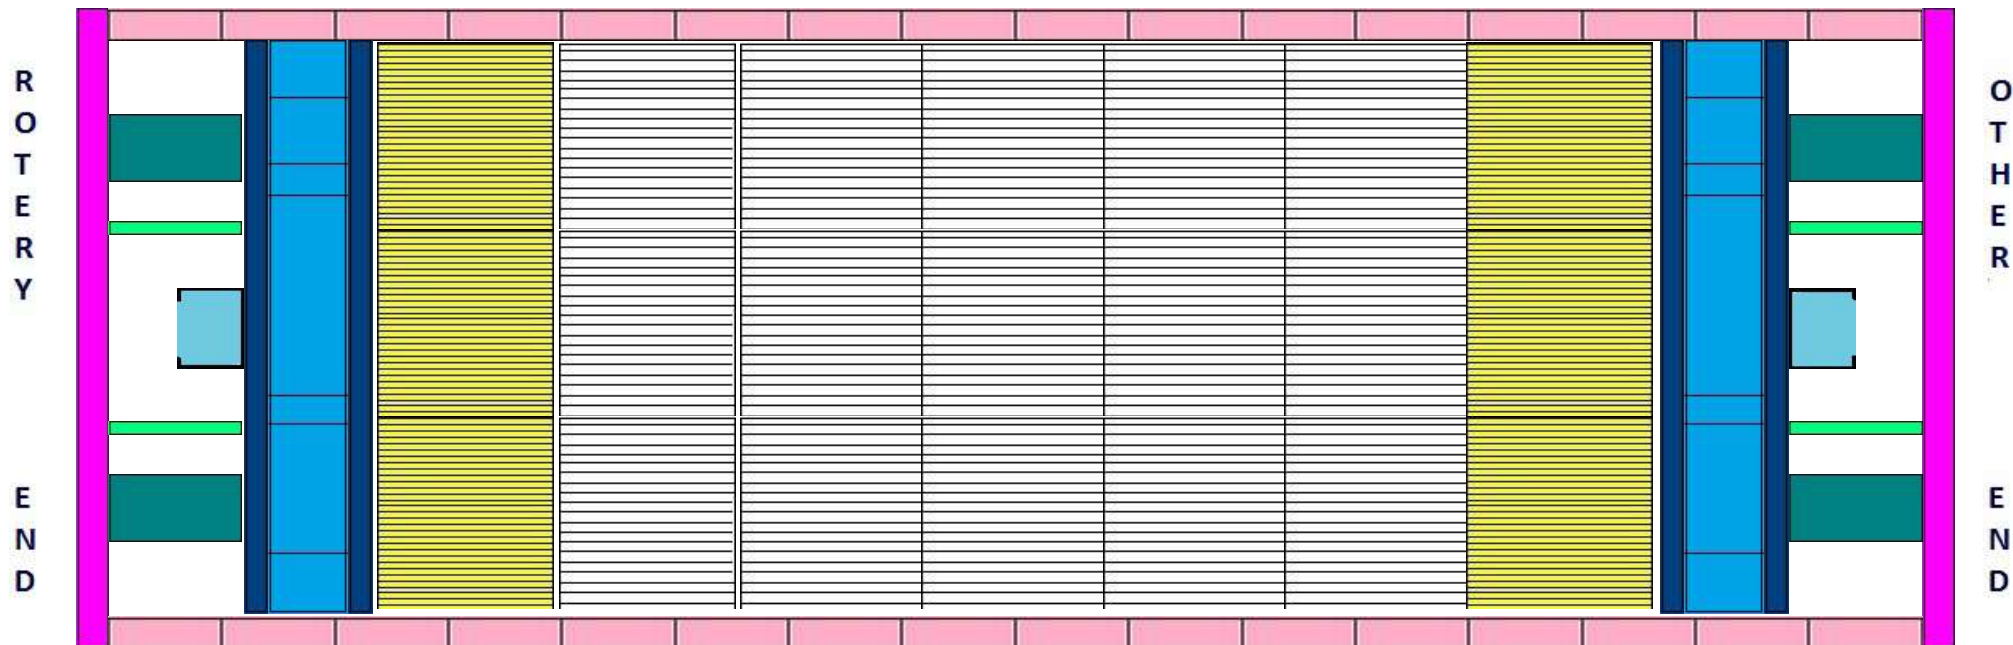

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	18	45%		Window Bar	48	26%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -3, WEST : -7 Other End - EAST : -2, WEST : 2
Start Date : 28-Dec-2019, Completion Date : 06-Jan-2020, Net Repair Days : 8, Total Man Hours : 880

MOHD. JAFER QURASHI - JE	ANASTA PRASAD - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------------	--------------------	------------------	----------------------------	-------------------------