

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04708


Type : SLRD

Built Year : 2004

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

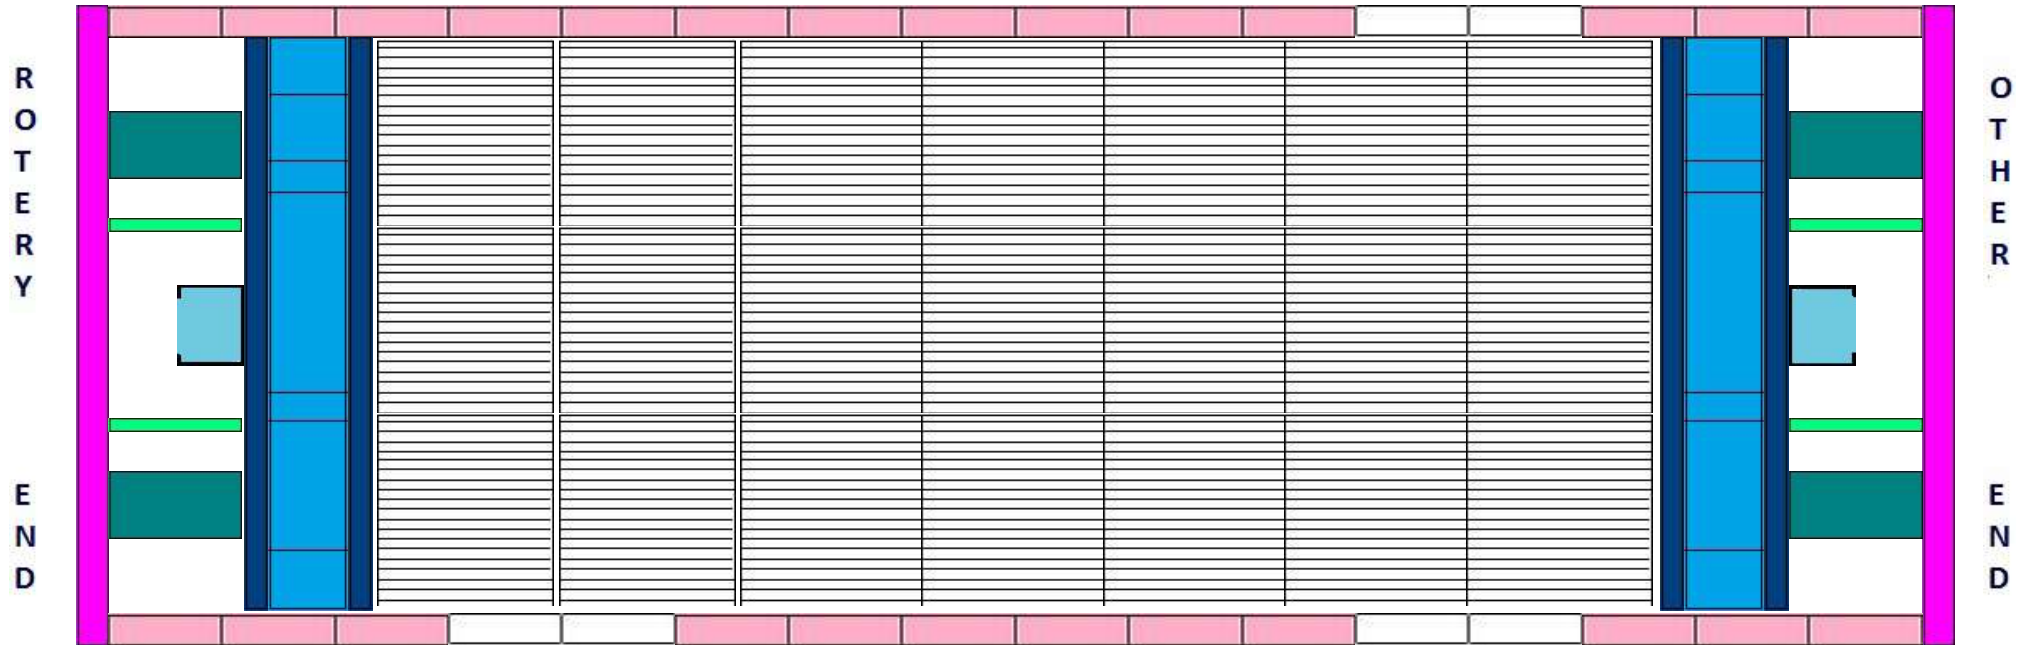

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	13	81%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	0	0%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	13	81%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	8	42%		Window Bar	12	14%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : -4 Other End - EAST : -6, WEST : -3
Start Date : 29-Apr-2019, Completion Date : 08-May-2019, Net Repair Days : 9, Total Man Hours : 0

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC08708


Type : GSLRD

Built Year : 2008

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

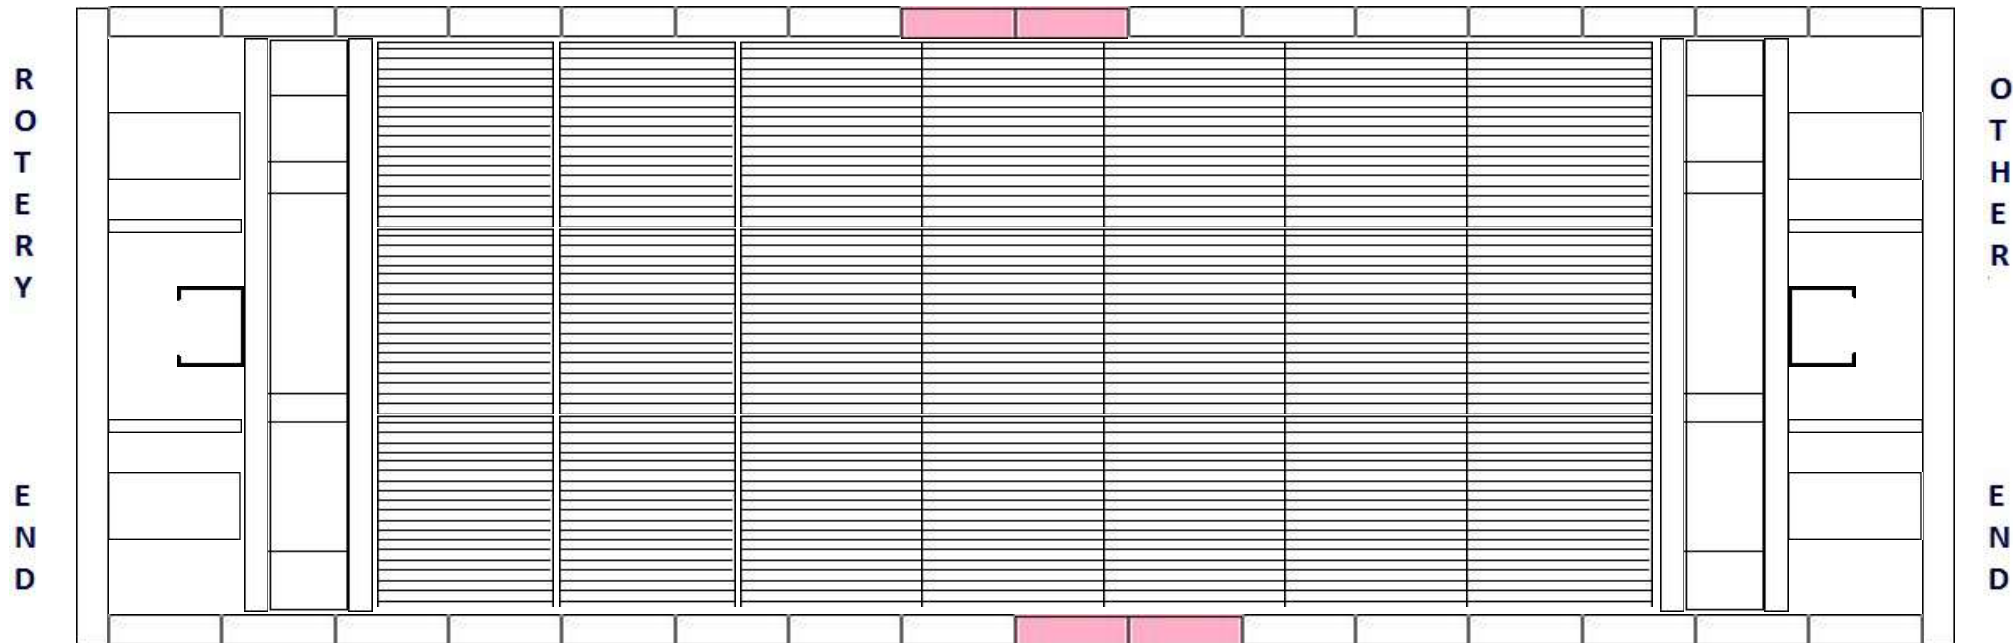

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	2	13%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2	13%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 15-Jun-2019, Completion Date : 19-Jun-2019, Net Repair Days : 4, Total Man Hours : 460

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07707


Type : GSRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

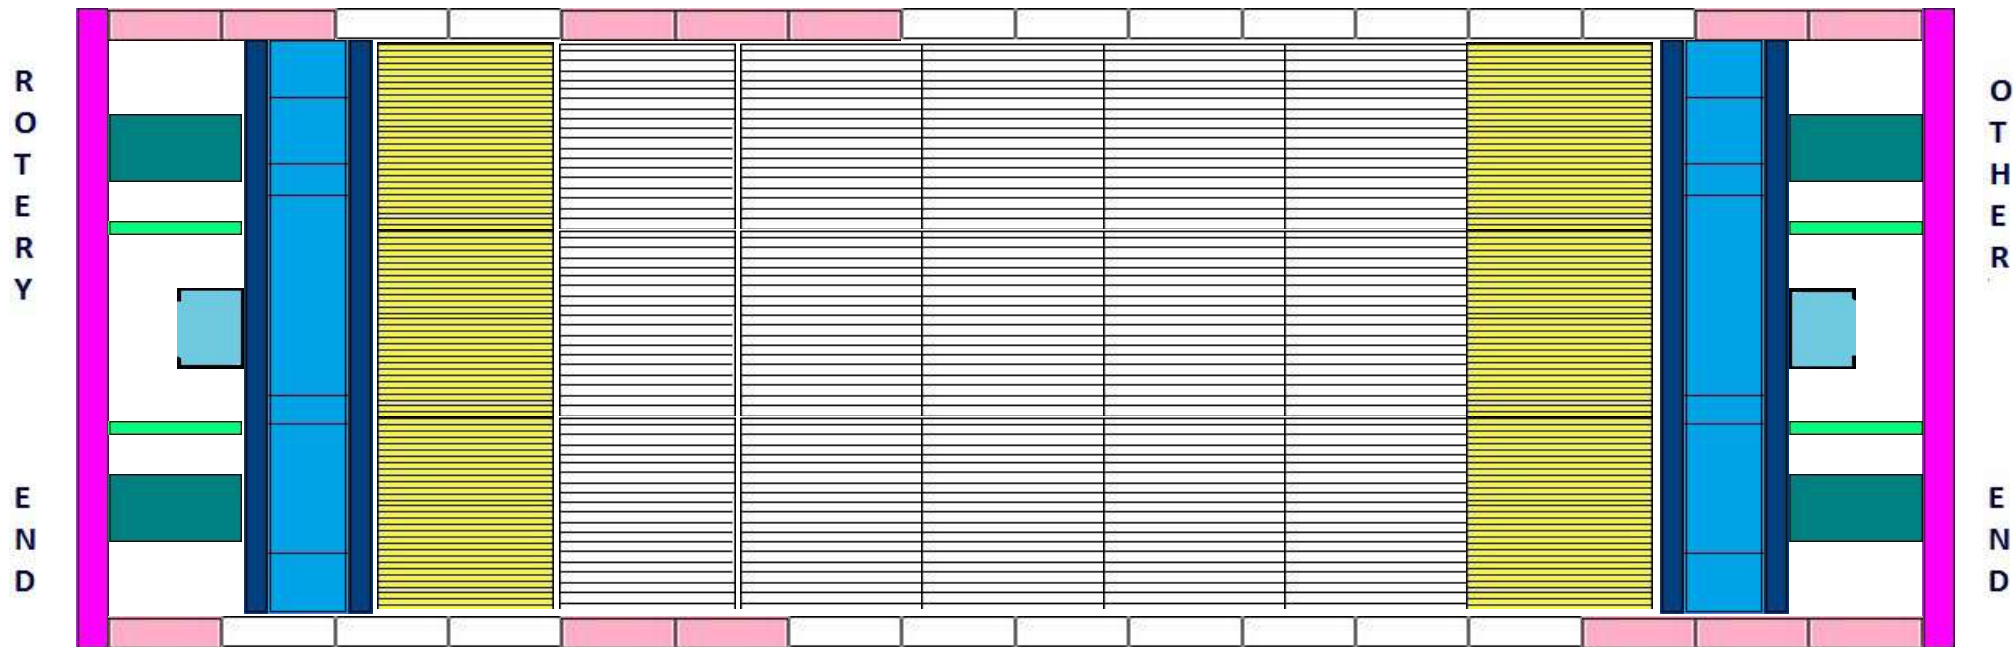

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	6.5	41%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	6.5	41%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	10	53%		Window Bar	16	19%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 4, WEST : 0 Other End - EAST : -2, WEST : -5
Start Date : 28-Jun-2019, Completion Date : 06-Jul-2019, Net Repair Days : 8, Total Man Hours : 976

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC12153


Type : WGSCZAC

Built Year : 2012

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

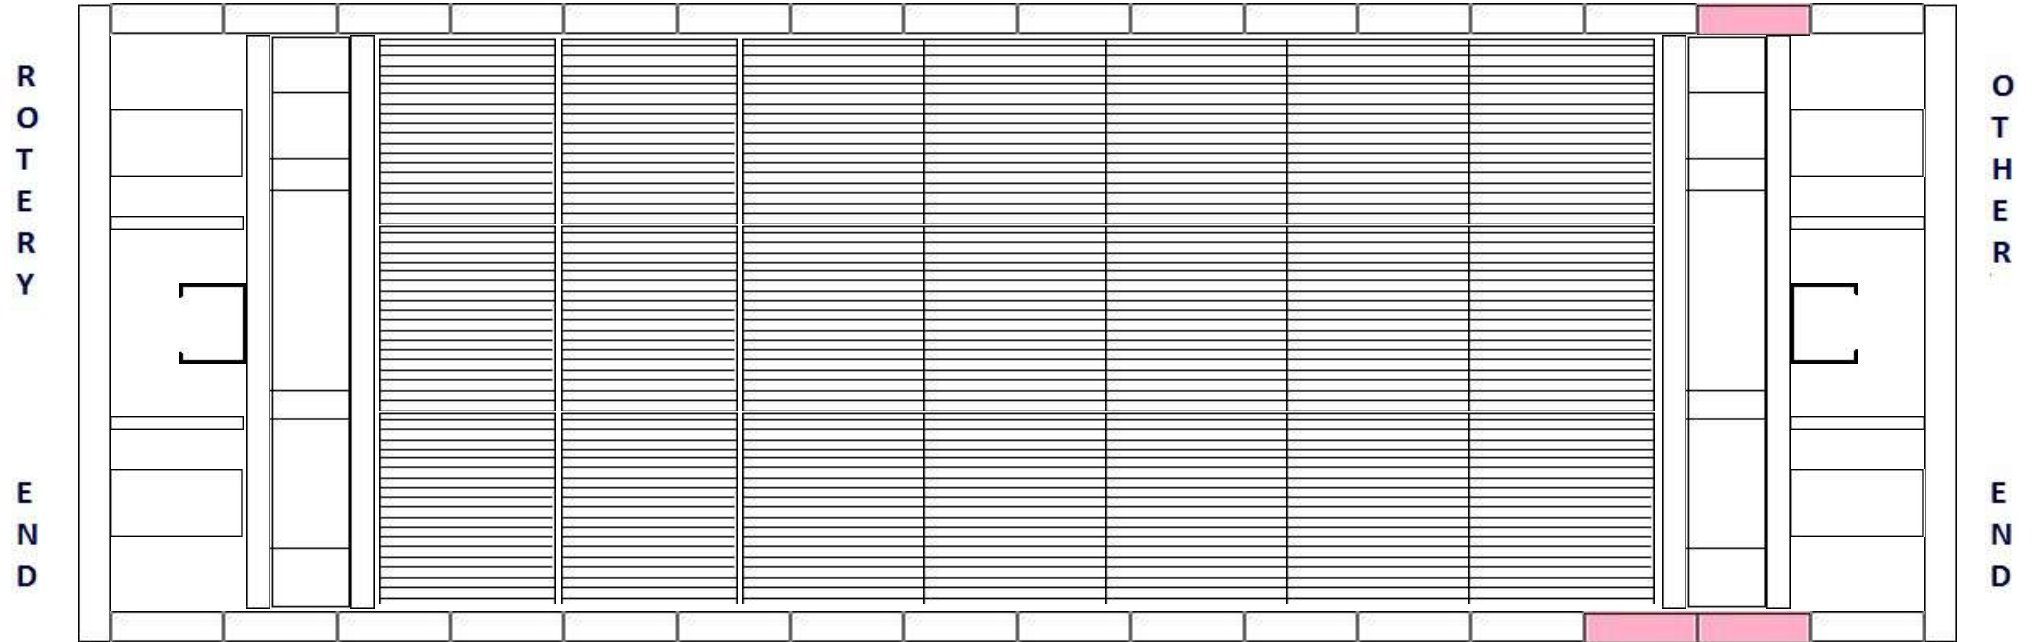

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	1.5	9%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	1.5	9%		Body panel/patch		30%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 31-Jul-2019, Completion Date : 03-Aug-2019, Net Repair Days : 4, Total Man Hours : 240

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07712


Type : GSRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

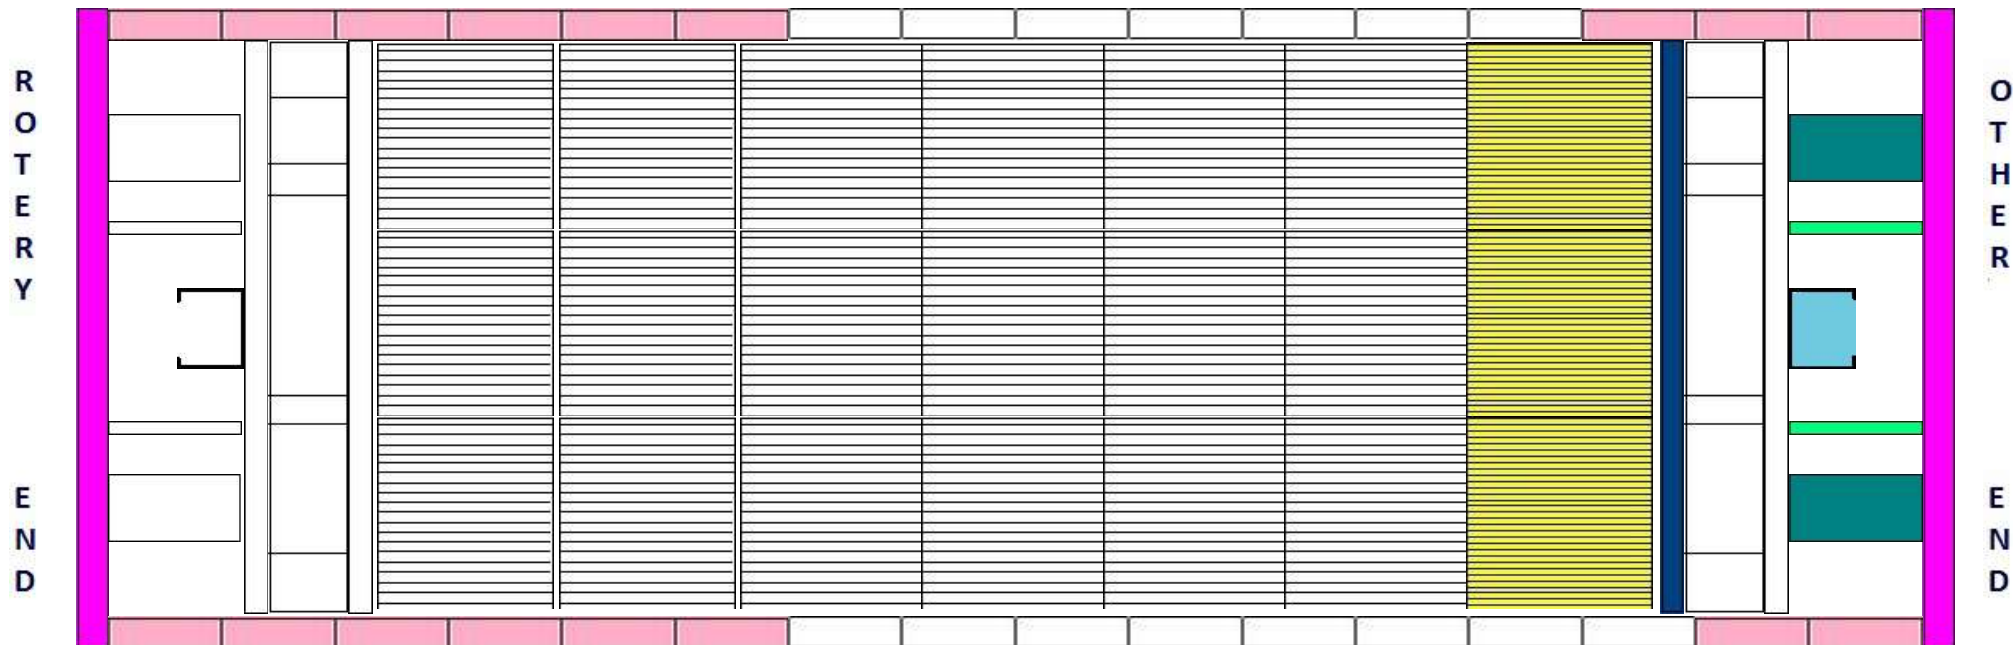

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	2	50%	Yellow	Floor Stiffner for Headstock	2	50%
Dark Blue	Aux. Head stock	2	50%	Pink	Sole Bar	8.5	53%	Light Blue	Draft Gear Bracket	1	50%
Yellow	Trough floor	1	14%	Light Blue	Centre plate	1	50%		SoleBar Stiffner	4	100%
	Bottom Wall Part	8.5	53%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	39%		Window Bar	34	20%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 14-Aug-2019, Completion Date : 23-Aug-2019, Net Repair Days : 9, Total Man Hours : 0

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07210


Type : WGSCN

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

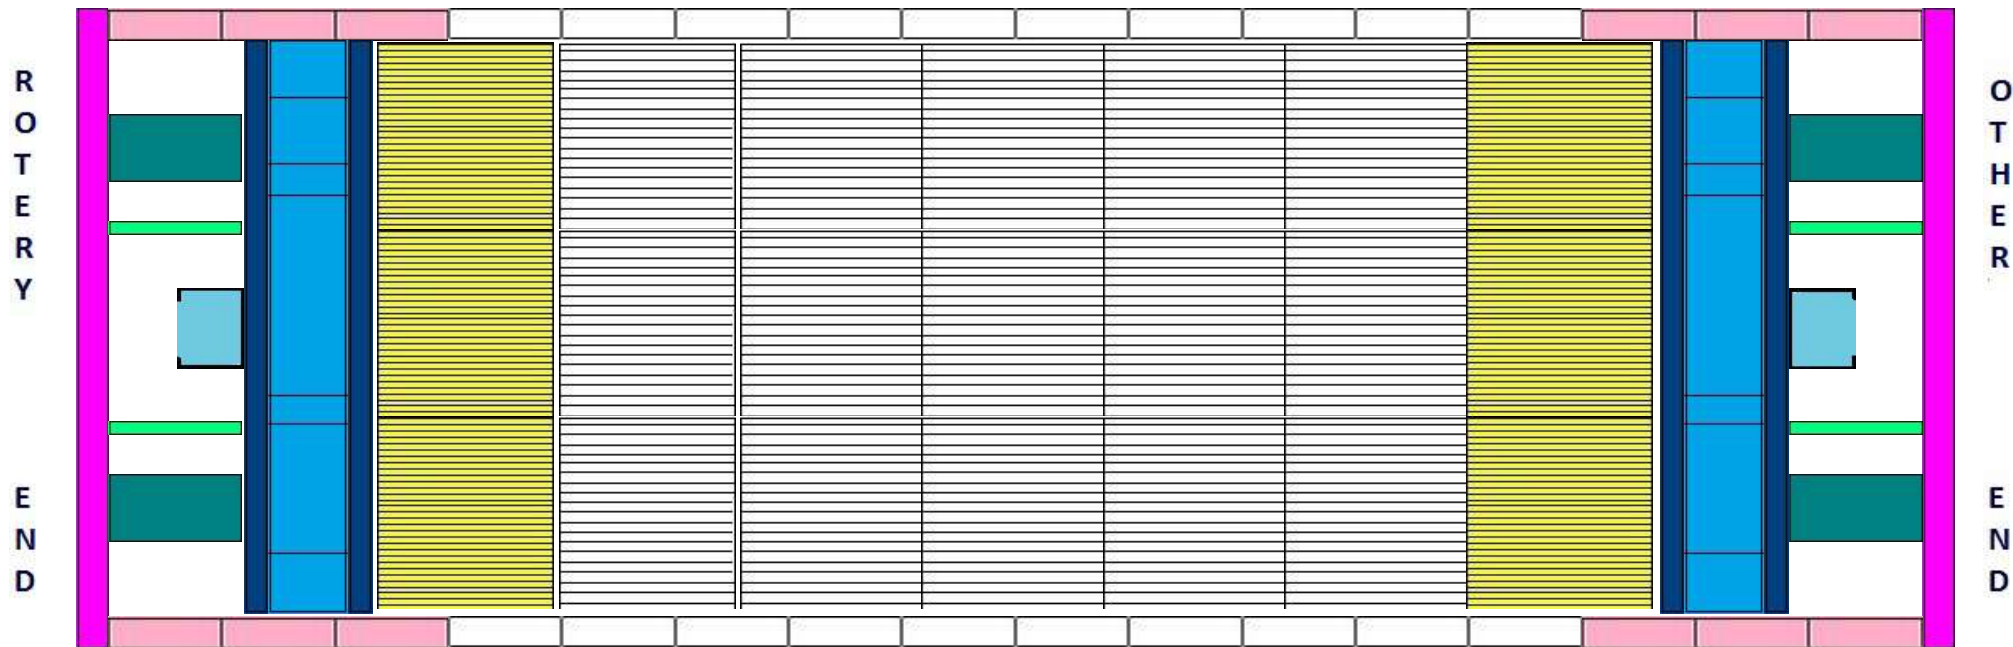

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	6	38%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	6	38%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	24	60%		Window Bar	44	24%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 14-Aug-2019, Completion Date : 22-Aug-2019, Net Repair Days : 8, Total Man Hours : 0

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC15701


Type : GSLRD

Built Year : 2015

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

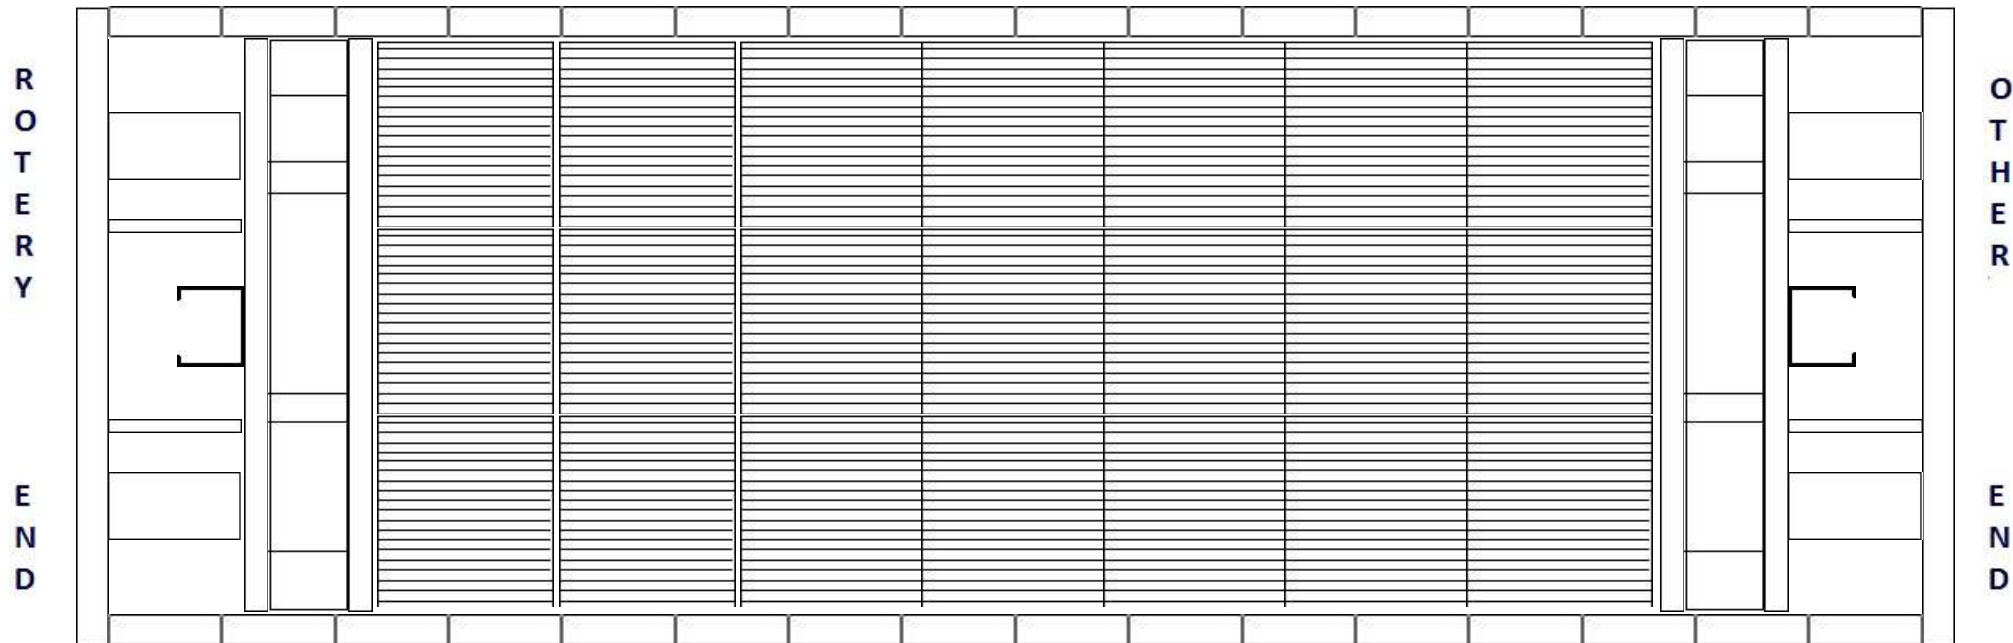

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	0	0%	Red	Centre Stiffner for Headstock	0	0%	Green	Floor Stiffner for Headstock	0	0%
Black	Aux. Head stock	0	0%	Pink	Sole Bar	0	0%	Light Blue	Draft Gear Bracket	0	0%
Yellow	Trough floor	0	0%	Light Blue	Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 28-Aug-2019, Completion Date : 02-Sep-2019, Net Repair Days : 5, Total Man Hours : 344

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC06423


Type : GS

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

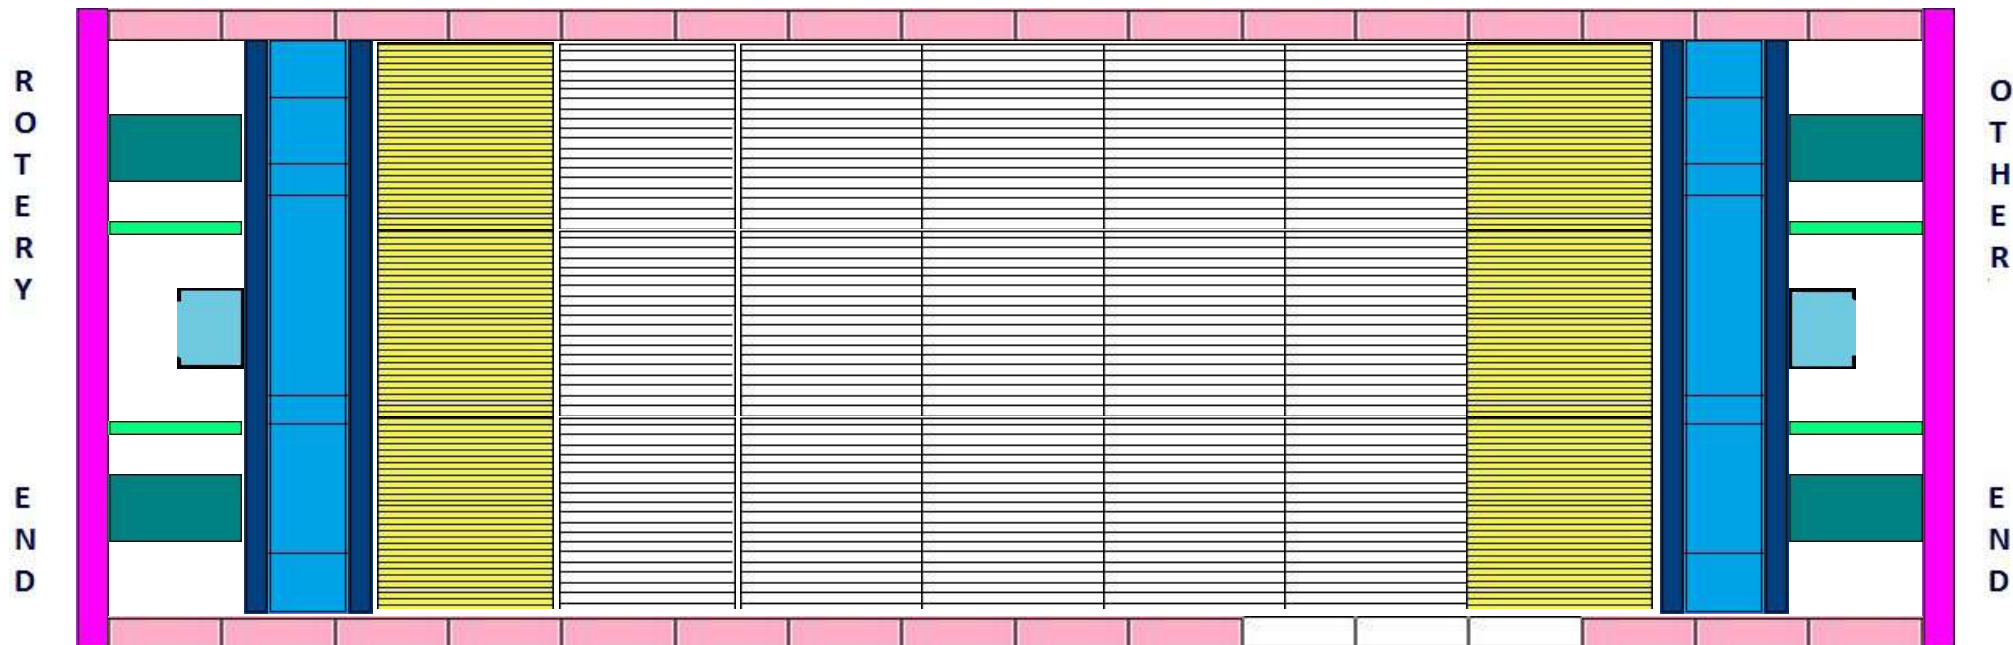

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	14.5	91%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	14.5	91%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : -3 Other End - EAST : -5, WEST : -4
Start Date : 24-Aug-2019, Completion Date : 30-Aug-2019, Net Repair Days : 6, Total Man Hours : 1588

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07417


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

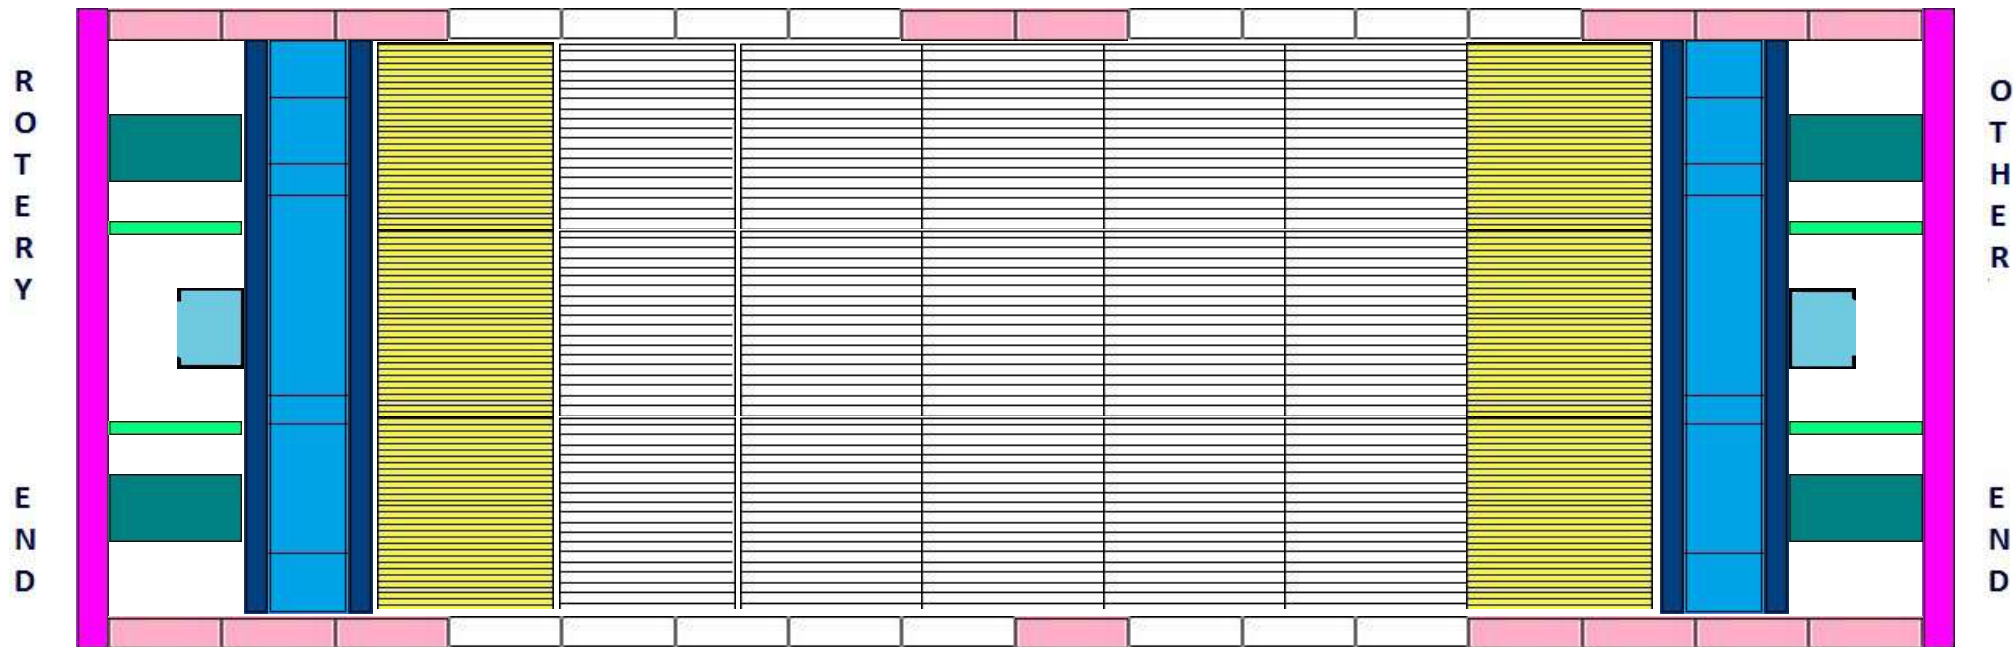

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	8	50%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8	50%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -6, WEST : 5 Other End - EAST : -3, WEST : -4
Start Date : 21-Oct-2019, Completion Date : 26-Oct-2019, Net Repair Days : 6, Total Man Hours : 1192

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC05401


Type : GS

Built Year : 2005

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

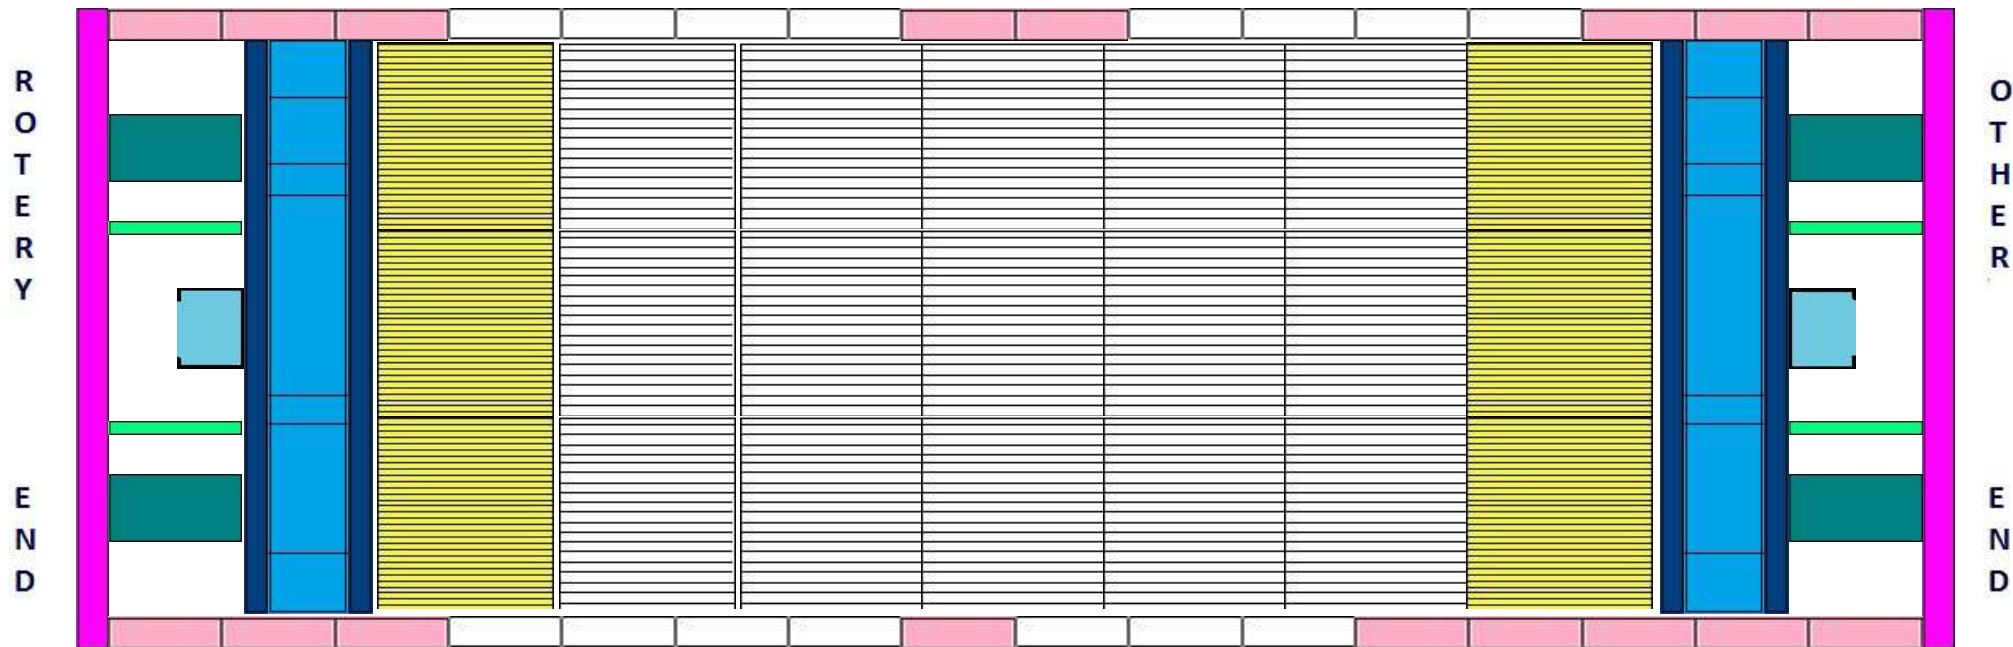

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	9	56%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	9	56%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	21	53%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -3, WEST : 2 Other End - EAST : 0, WEST : -2
Start Date : 06-Nov-2019, Completion Date : 15-Nov-2019, Net Repair Days : 9, Total Man Hours : 968

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC11603


Type : WGSCZ

Built Year : 2011

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

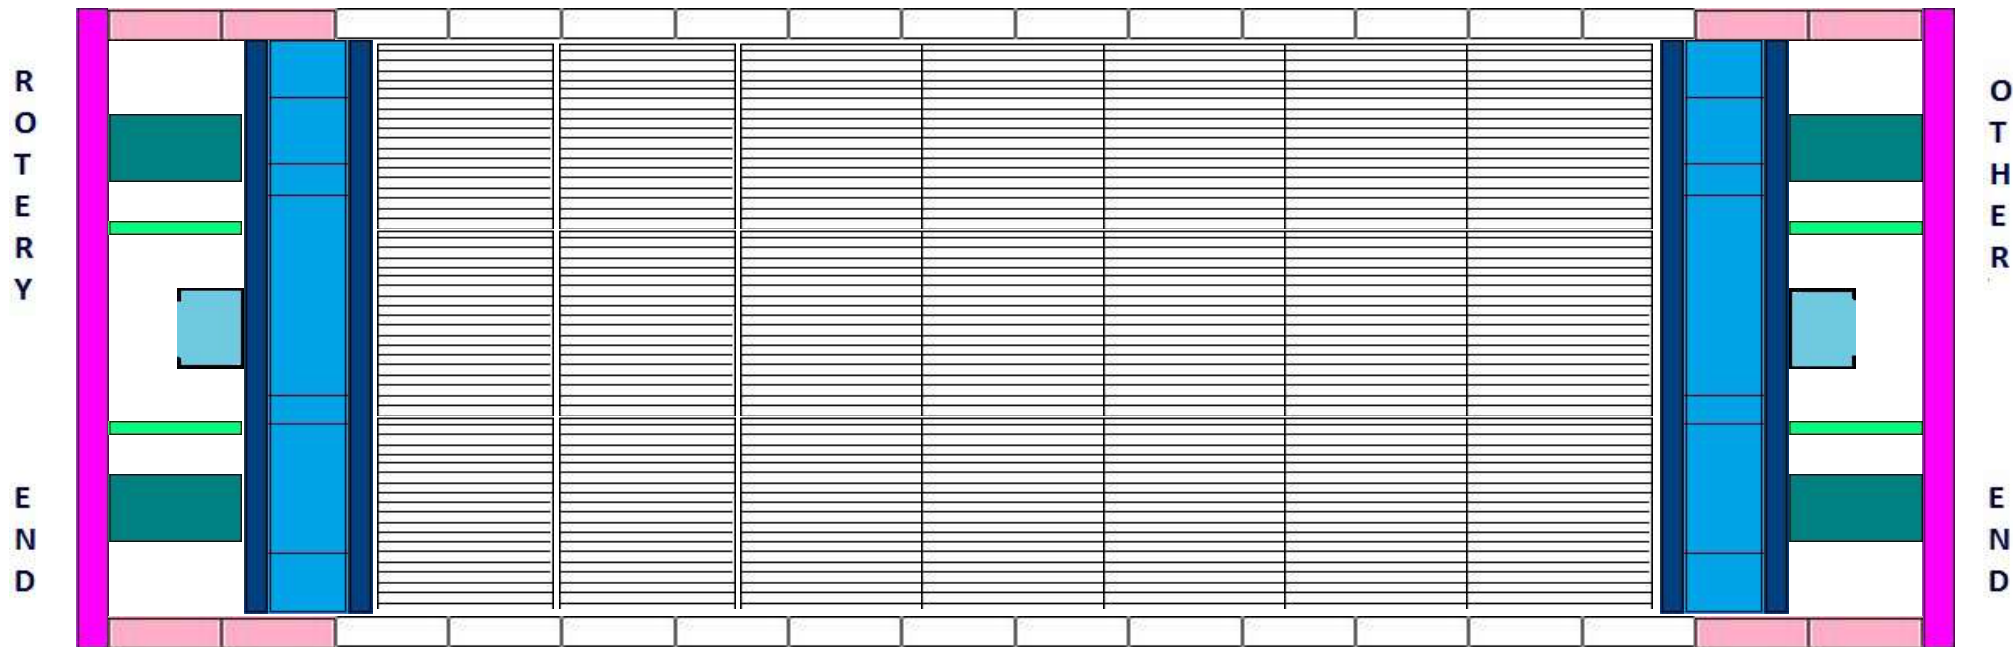

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	0	0%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4	25%		Body panel/patch		0%		Door Top/Roof Patch		100%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -6, WEST : -4 Other End - EAST : 0, WEST : 0
Start Date : 11-Oct-2019, Completion Date : 16-Oct-2019, Net Repair Days : 5, Total Man Hours : 208

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07422


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

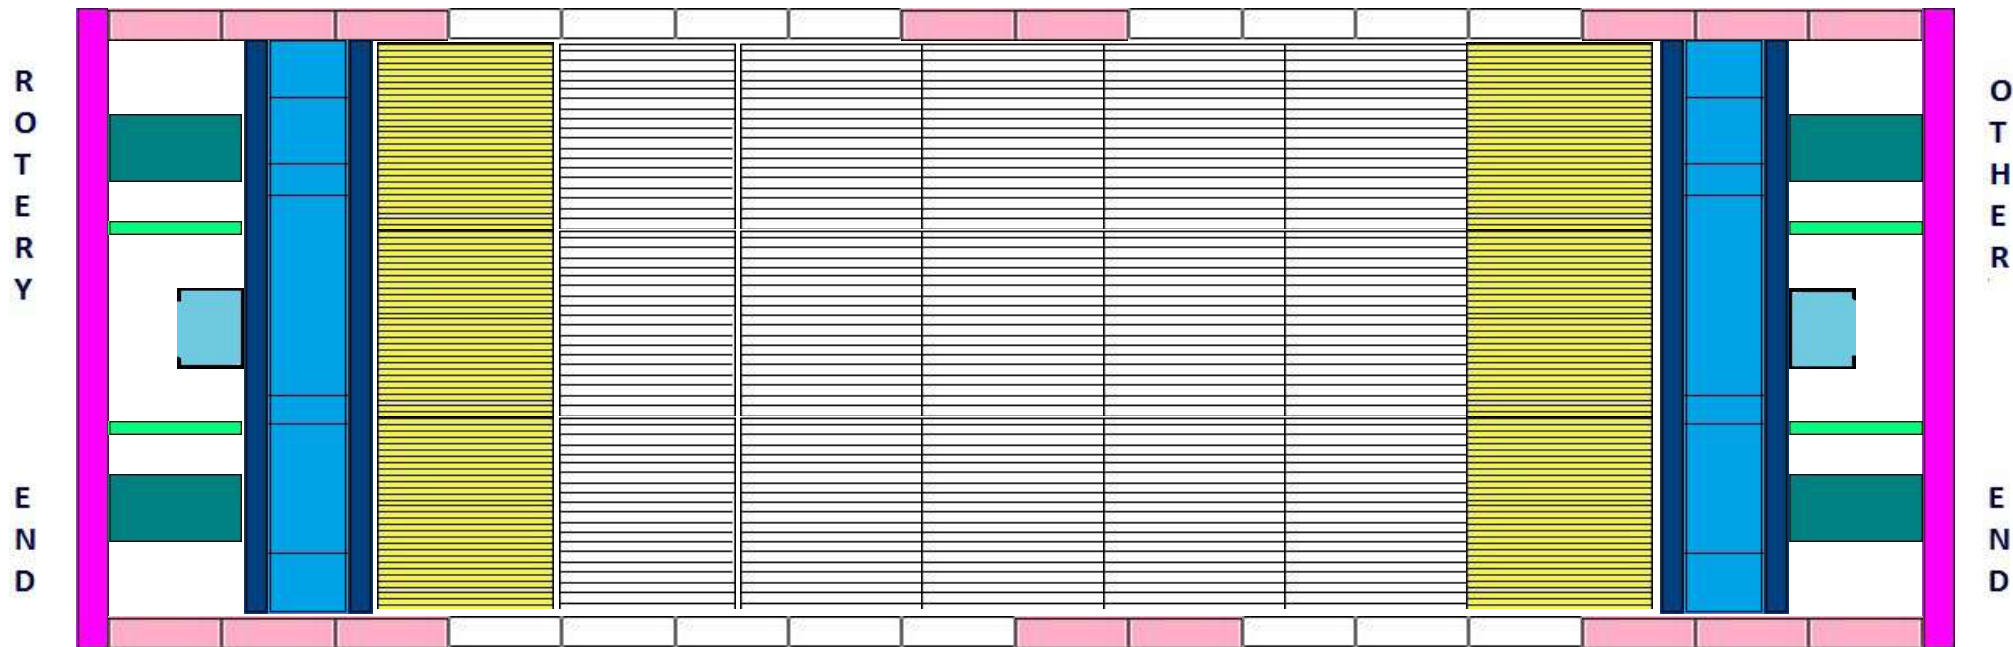

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	8	50%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	8	50%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -9, WEST : -7 Other End - EAST : 4, WEST : 6
Start Date : 01-Jan-2020, Completion Date : 10-Jan-2020, Net Repair Days : 9, Total Man Hours : 839

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07414


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

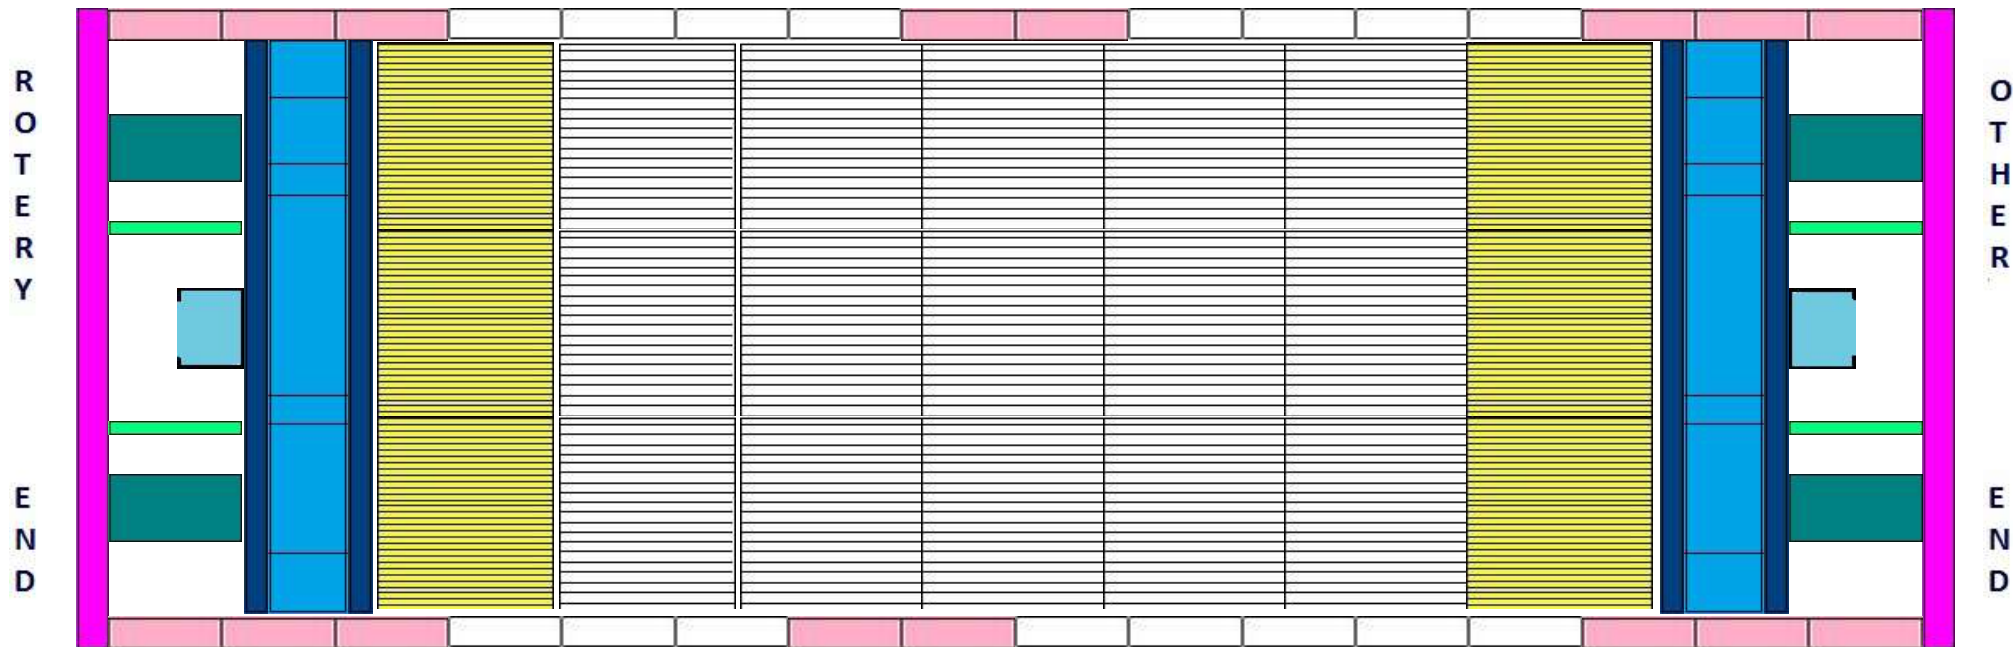

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	8	50%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8	50%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	32	80%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 4, WEST : -1 Other End - EAST : 5, WEST : 3
Start Date : 03-Jan-2020, Completion Date : 11-Jan-2020, Net Repair Days : 8, Total Man Hours : 688

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC08402


Type : GS

Built Year : 2008

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

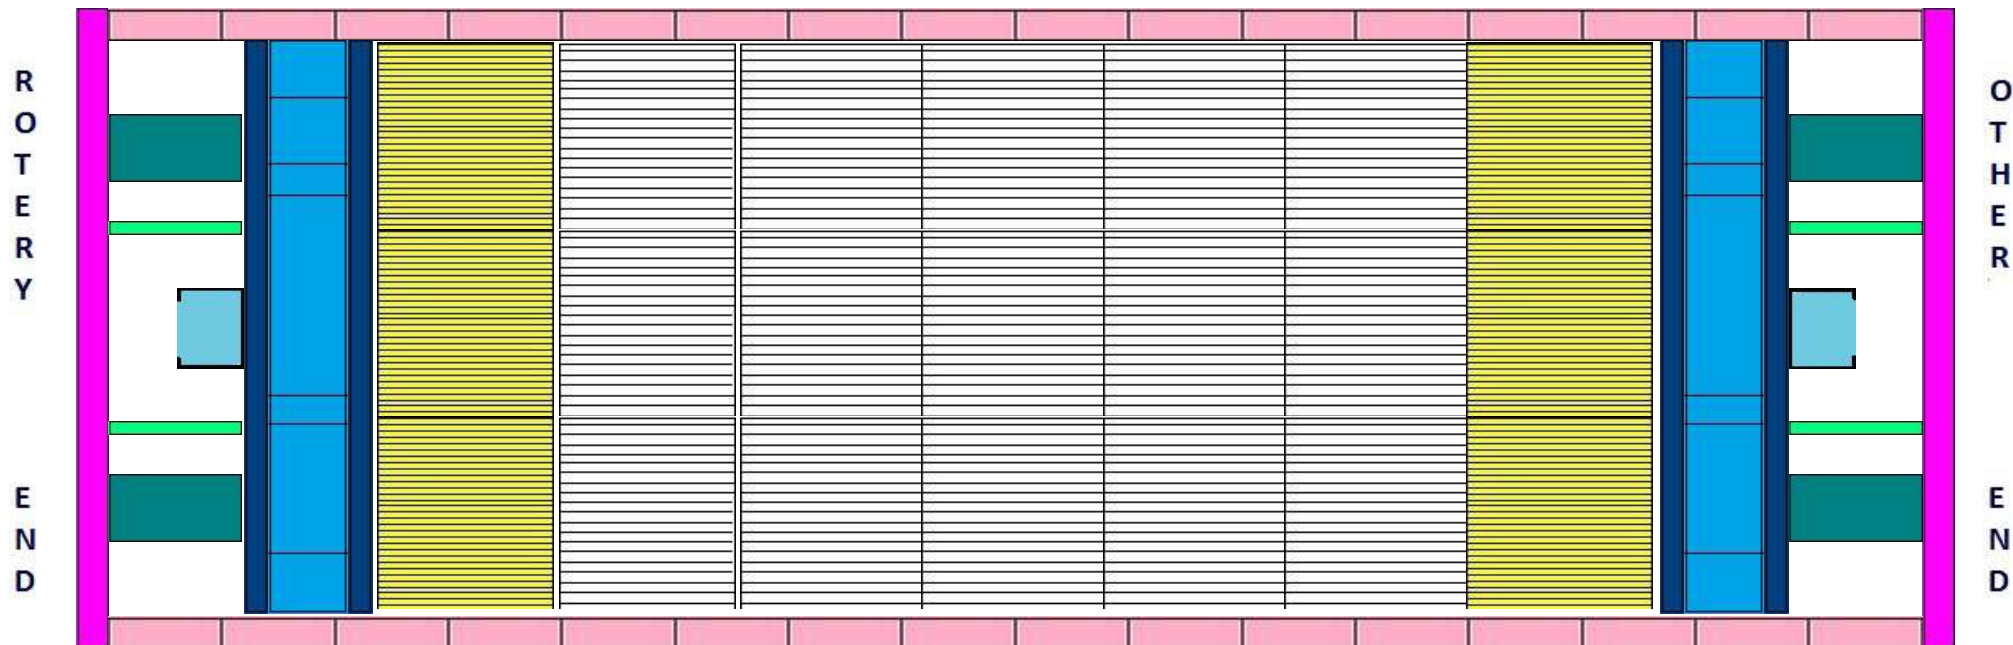

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Yellow	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 01-Feb-2020, Completion Date : 08-Feb-2020, Net Repair Days : 7, Total Man Hours : 0

P N VISHWKARMA - SSE	T R LARRE - JE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	----------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC13703


Type : GSLRD

Built Year : 2013

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

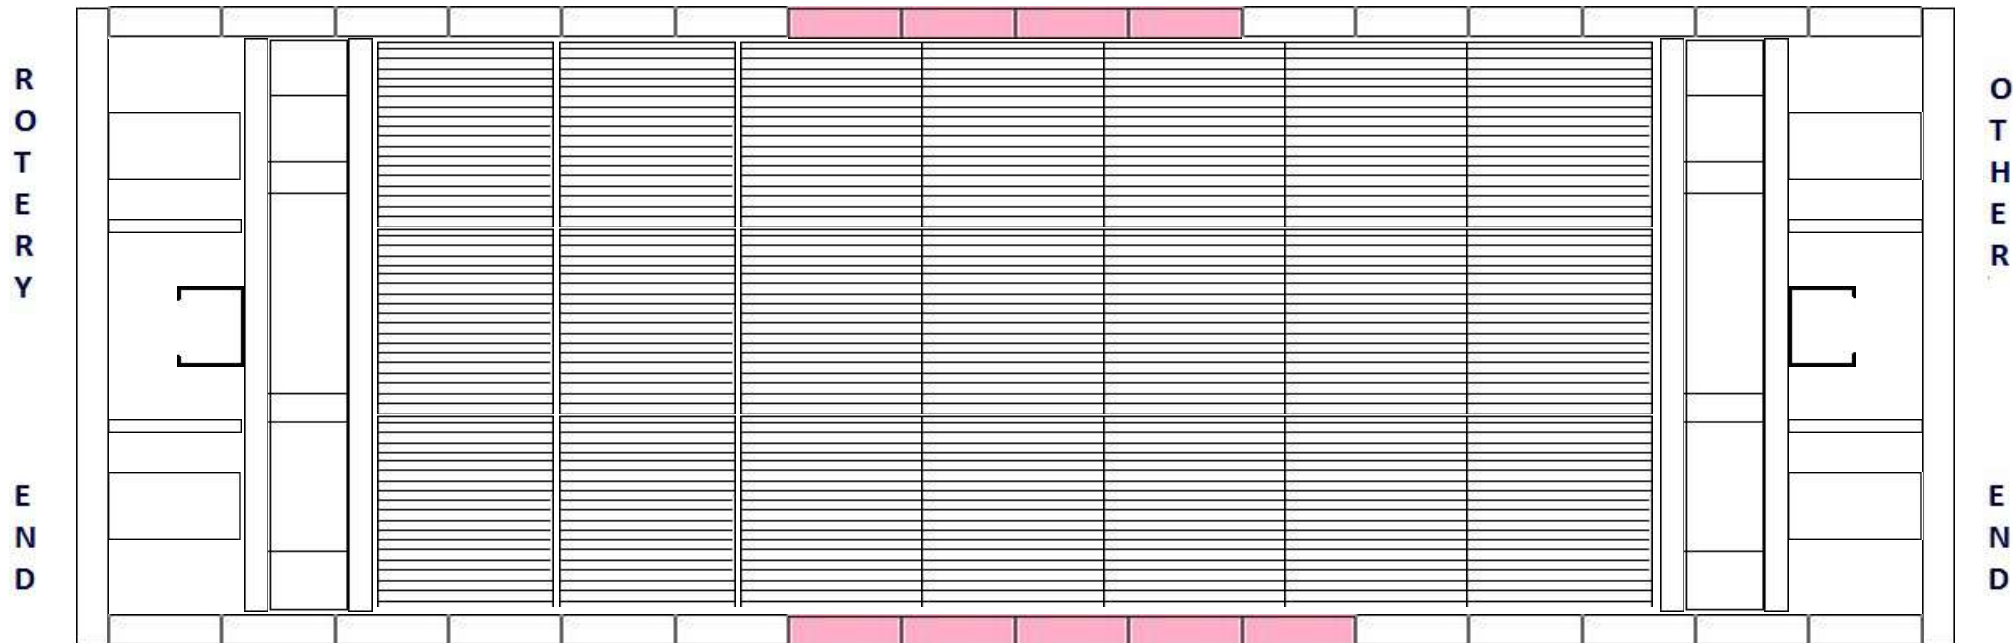

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	4.5	28%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4.5	28%		Body panel/patch		0%		Door Top/Roof Patch		100%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 10-Jan-2020, Completion Date : 20-Jan-2020, Net Repair Days : 9, Total Man Hours : 0

HAMANT JADAV - JE	PANKAJ DAMARE - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	--------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC03401


Type : GS

Built Year : 2003

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

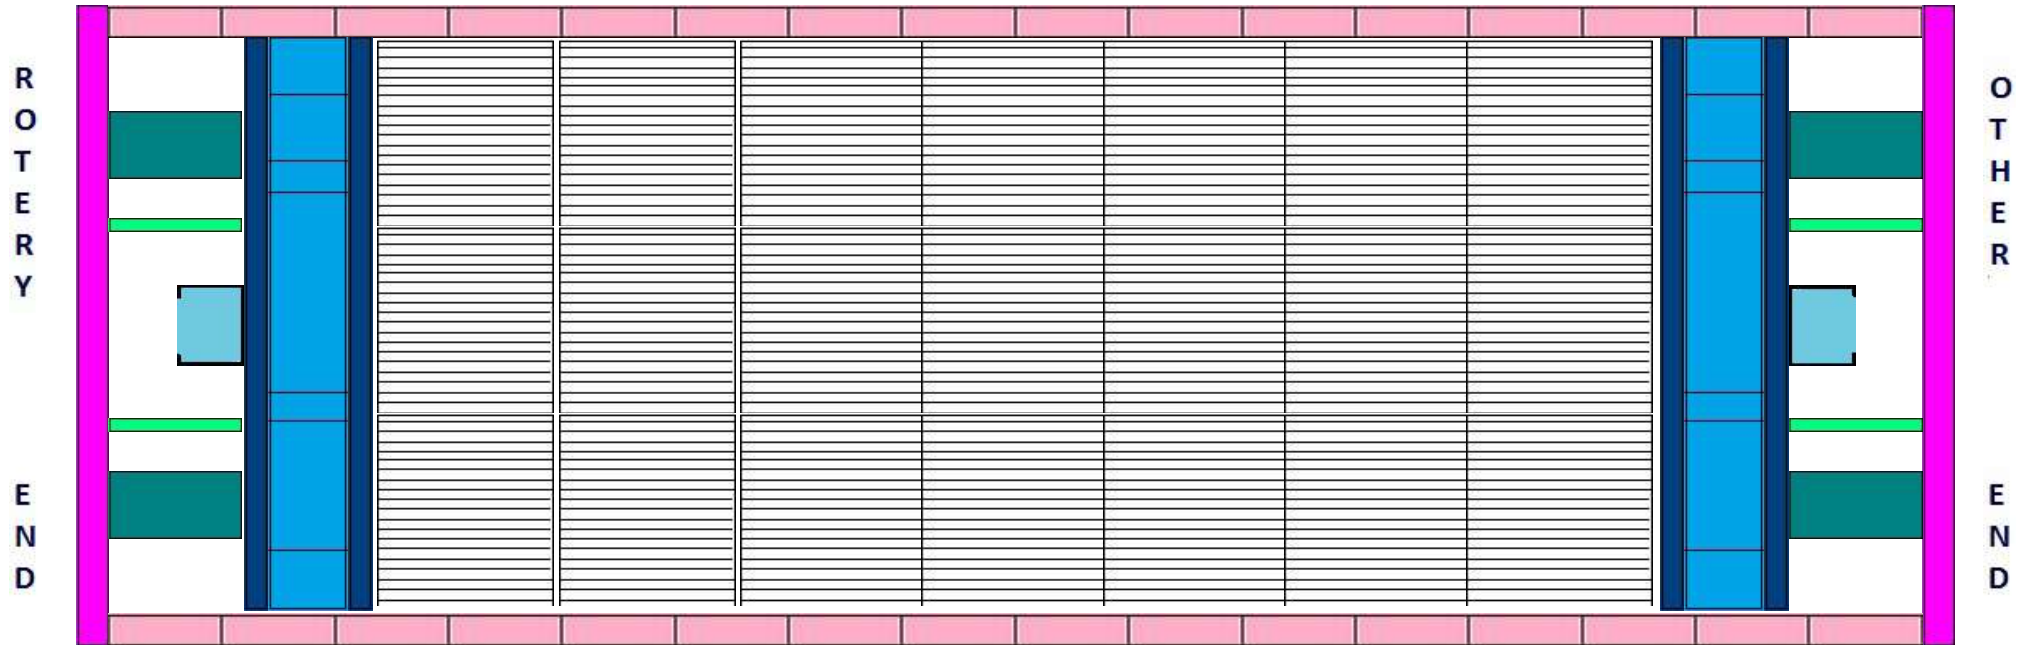

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Yellow	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	0	0%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	52	29%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -8, WEST : -6 Other End - EAST : -6, WEST : -8
Start Date : 04-Apr-2019, Completion Date : 11-Apr-2019, Net Repair Days : 7, Total Man Hours : 1500

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC03406


Type : GS

Built Year : 2003

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

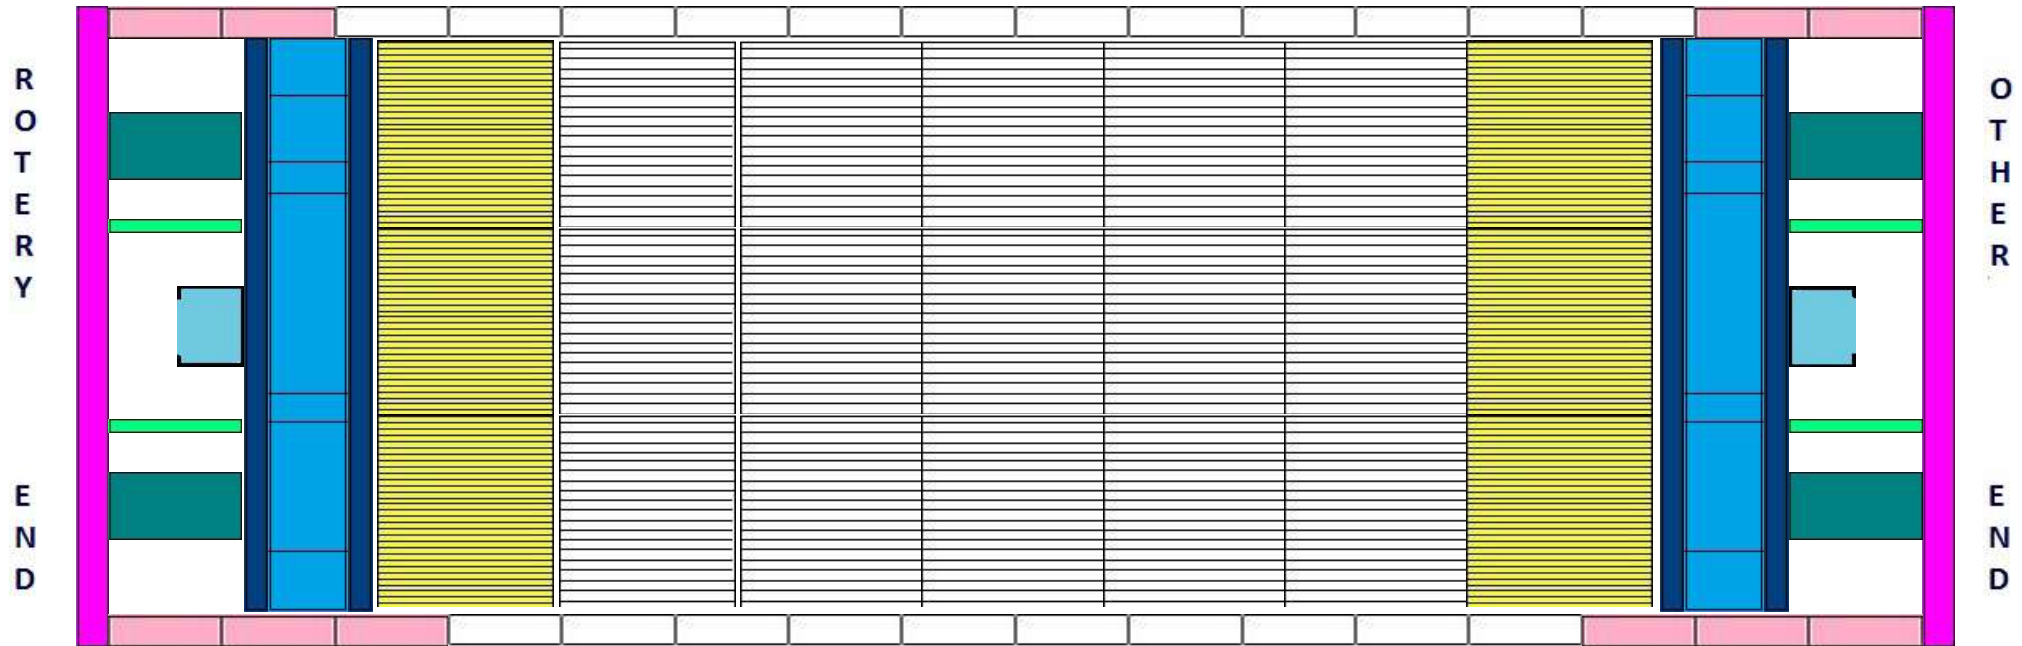

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Black	Aux. Head stock	4	100%	Yellow	Sole Bar	5	31%	Grey	Draft Gear Bracket	2	100%
Orange	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	67%
	Bottom Wall Part	5	31%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	32	80%		Window Bar	52	29%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 6, WEST : 6 Other End - EAST : 5, WEST : 5
Start Date : 10-Apr-2019, Completion Date : 18-Apr-2019, Net Repair Days : 8, Total Man Hours : 1168

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04256


Type : CN

Built Year : 2004

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

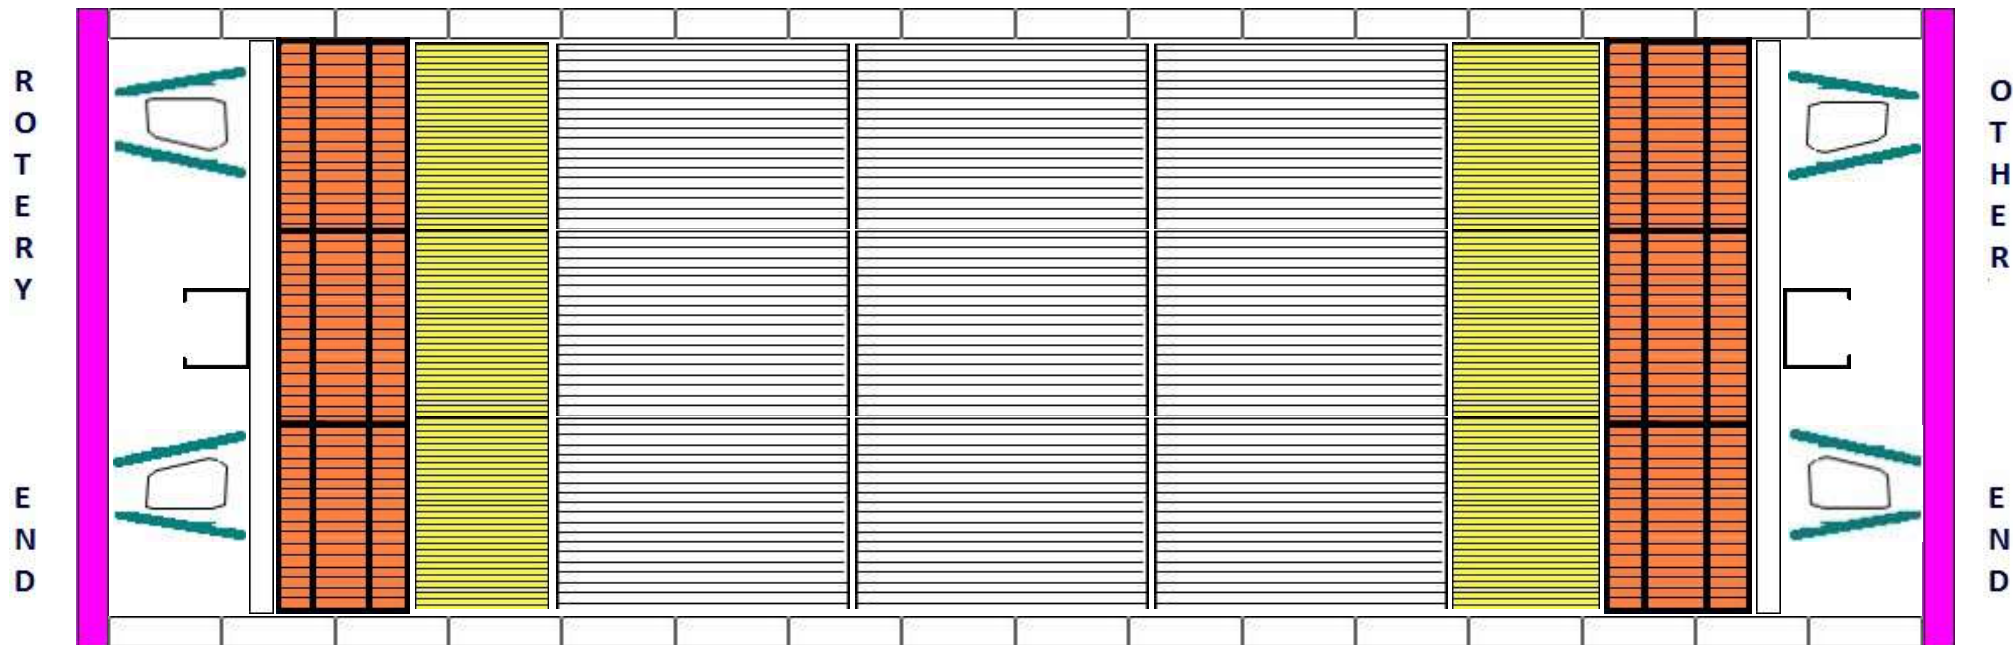

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	2	40%		Bottom Wall Part	0	0%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	5	13%
	Window Bar	10	5%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	0	100%								

End Drooping: Rotary End - EAST : -6, WEST : -10 Other End - EAST : -8, WEST : -10
Start Date : 20-Apr-2019, Completion Date : 24-Apr-2019, Net Repair Days : 4, Total Man Hours : 792

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
--------------------	-------------------	------------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04213


Type : CN

Built Year : 2004

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

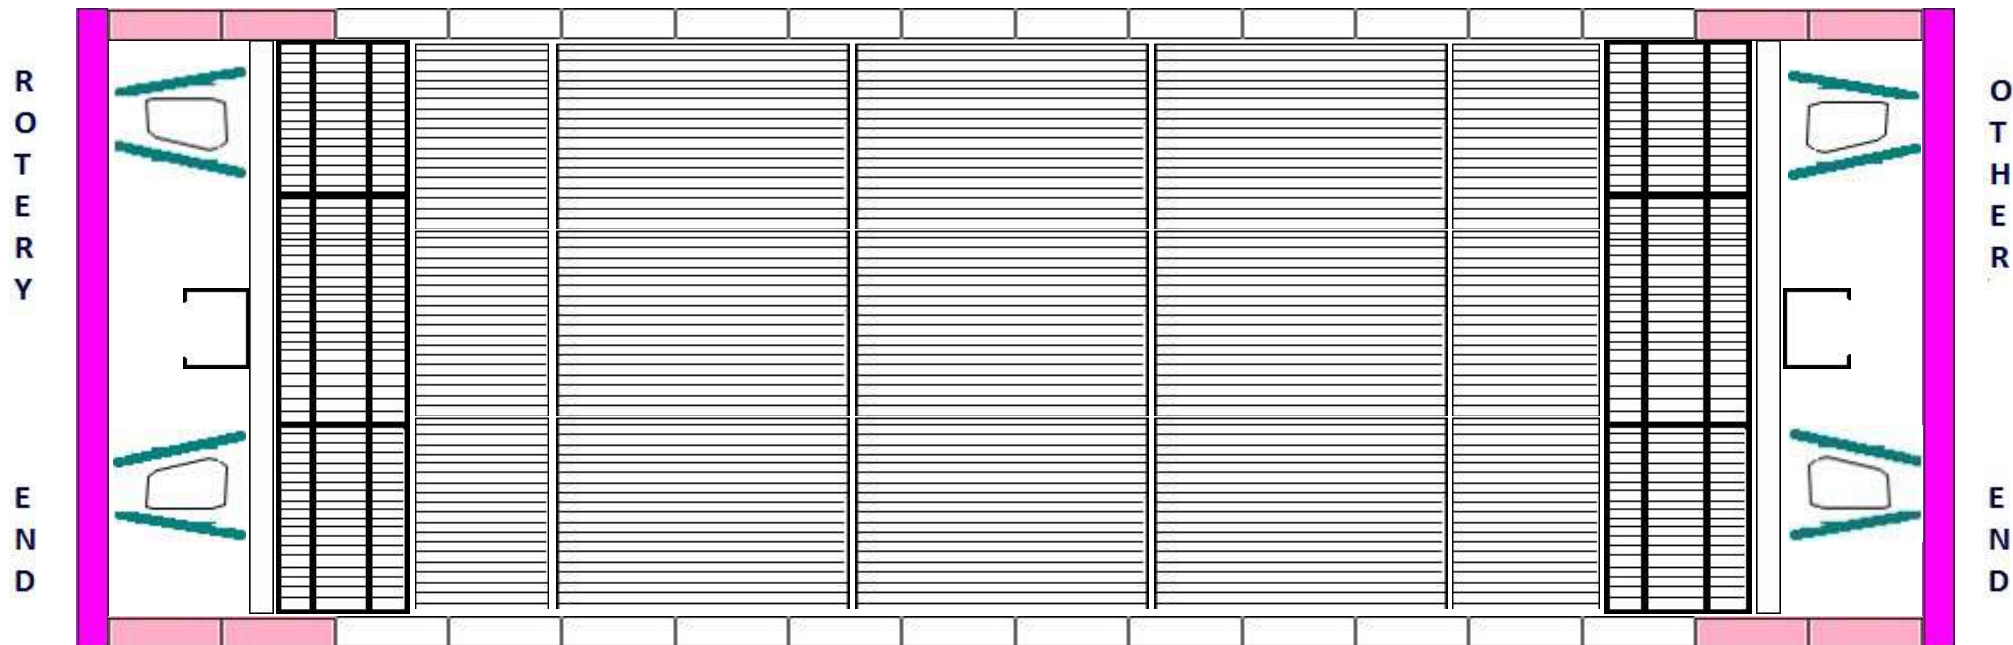

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Diagonal	4	100%		Logitudinal Channel Structure	0	0%
	Aux. Head stock	0	0%		Sole Bar	4	25%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	4	10%
	Window Bar	10	5%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : -8, WEST : -5 Other End - EAST : -4, WEST : -7
Start Date : 08-May-2019, Completion Date : 15-May-2019, Net Repair Days : 7, Total Man Hours : 568

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	ARUN SINGH - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
-----------------------	------------------	------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC06409


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

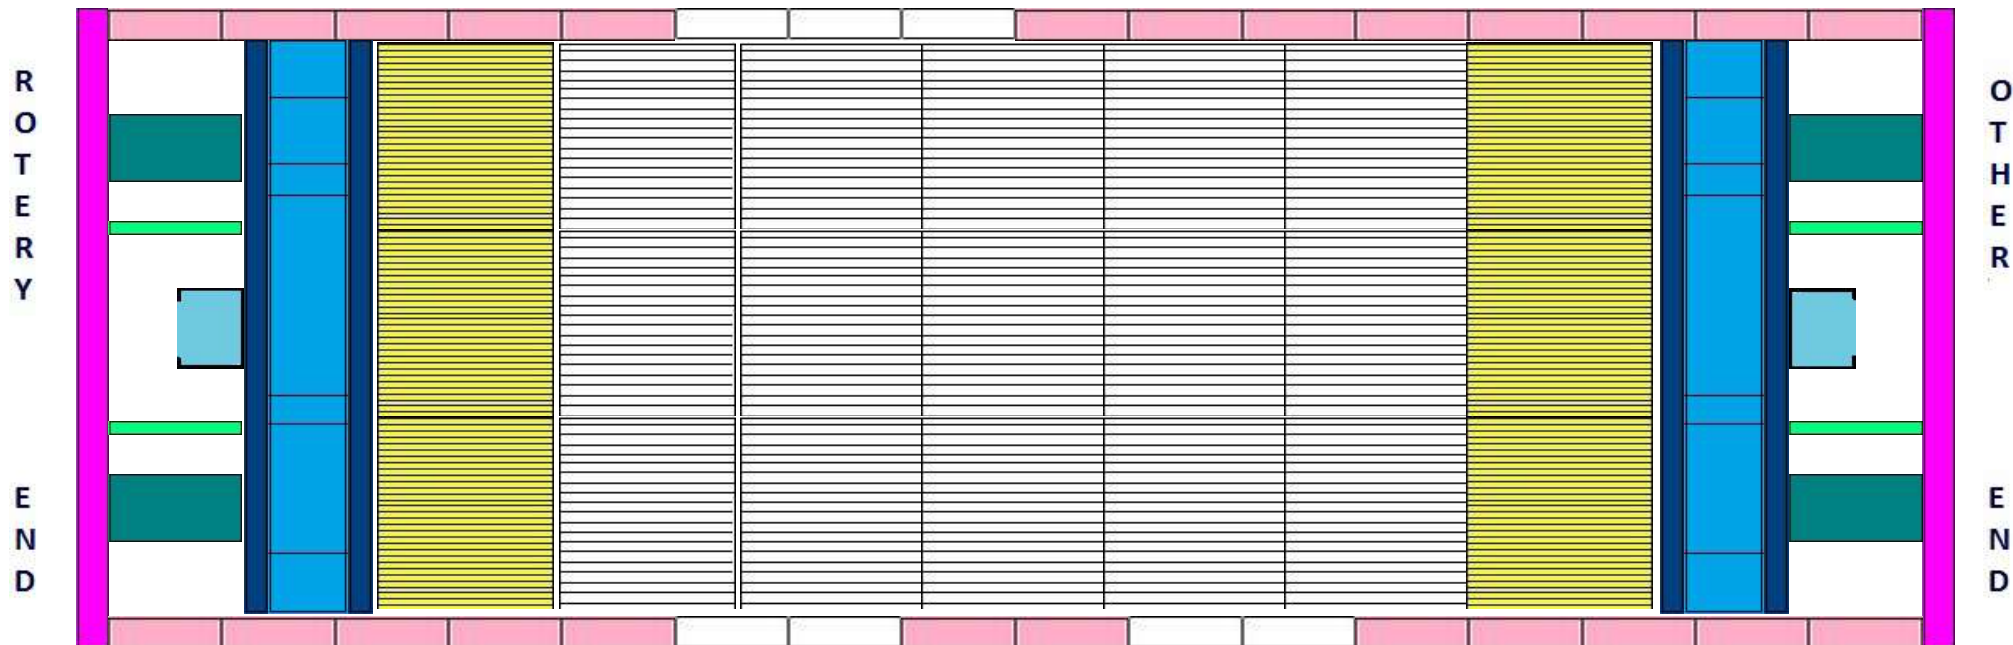

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	12.5	78%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	12.5	78%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	35%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -2, WEST : -3 Other End - EAST : 6, WEST : -2
Start Date : 31-Dec-2019, Completion Date : 09-Jan-2020, Net Repair Days : 9, Total Man Hours : 945

PANKAJ DAMARE - JE	HAMANT JADAV - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC06101


Type : WGACCN

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

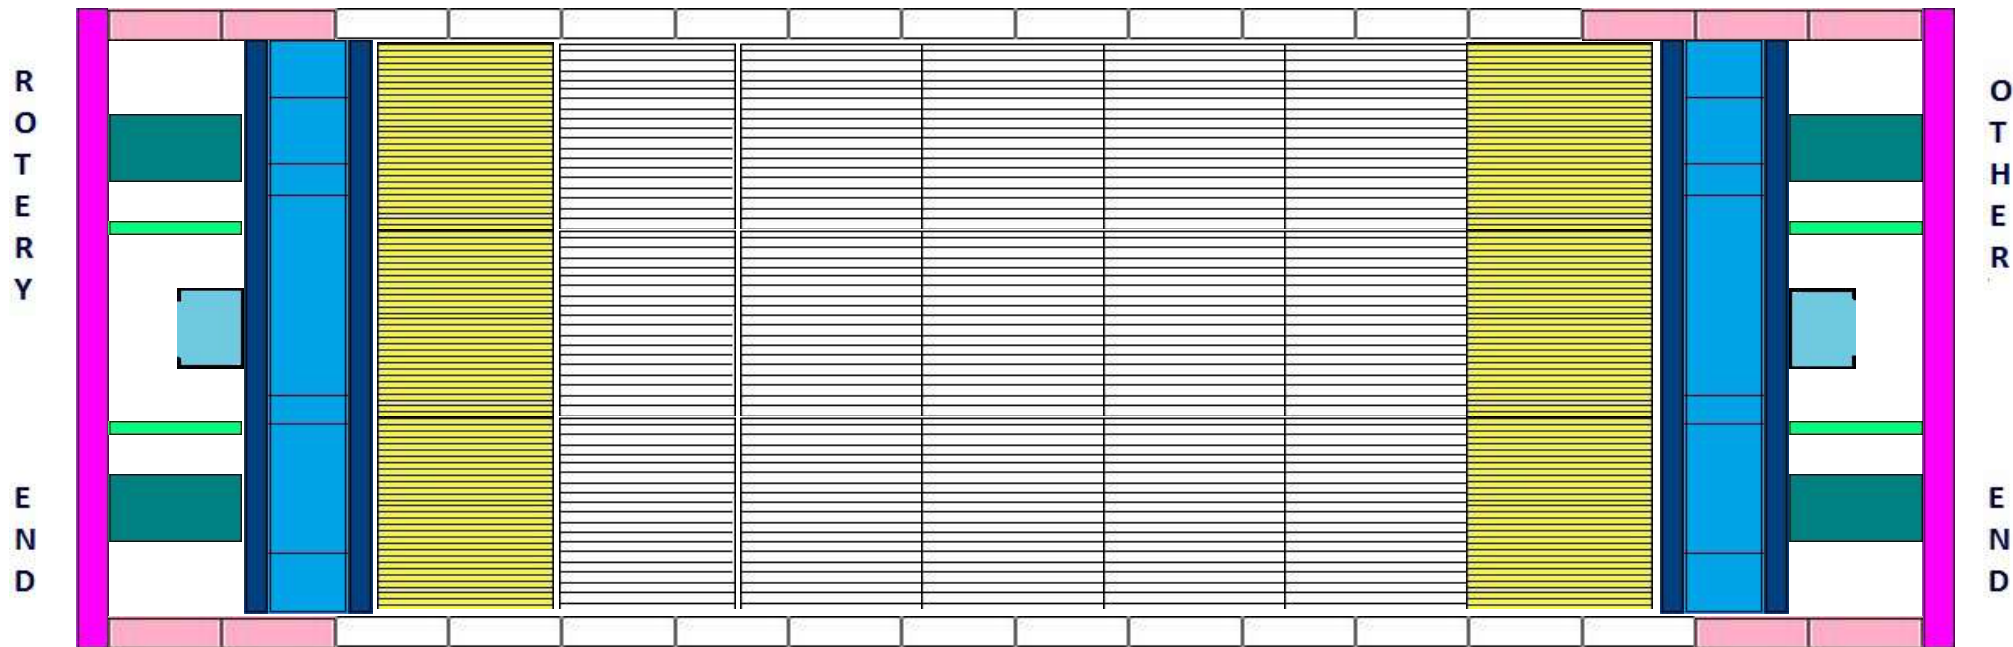

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Blue	Aux. Head stock	4	100%	Yellow	Sole Bar	4.5	28%	Blue	Draft Gear Bracket	2	100%
Red	Trough floor	2	29%	Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4.5	28%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : 10 Other End - EAST : -10, WEST : -10
Start Date : 29-Jun-2019, Completion Date : 08-Jul-2019, Net Repair Days : 8, Total Man Hours : 1172

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC06102


Type : WGACCN

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

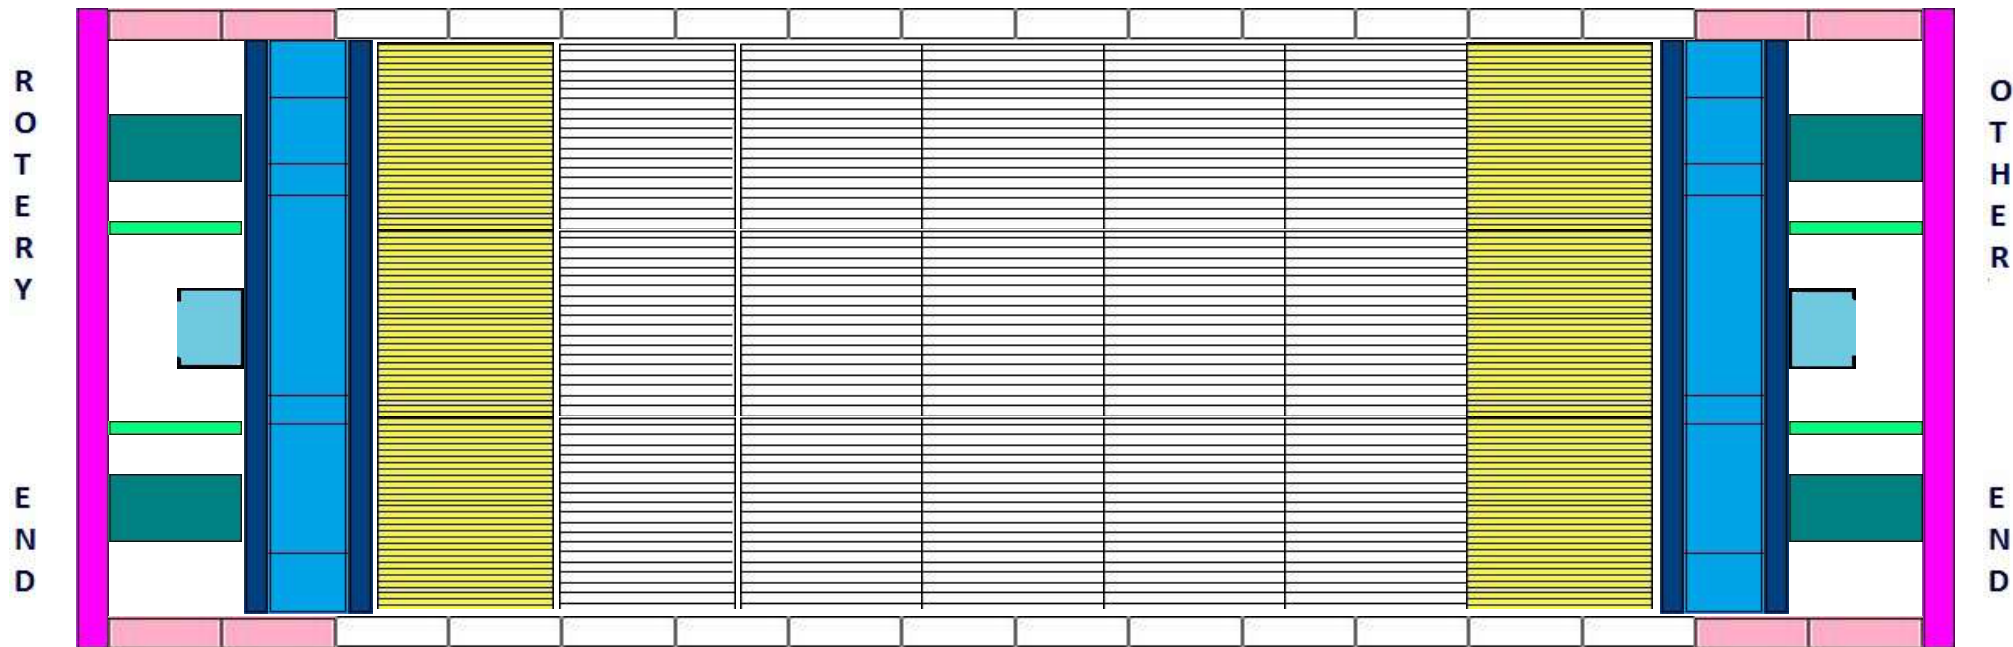

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	4	25%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4	25%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 3, WEST : 0 Other End - EAST : 0, WEST : 5
Start Date : 04-Jun-2019, Completion Date : 13-Jun-2019, Net Repair Days : 9, Total Man Hours : 1048

HAMANT JADAV - JE	M L KOLI - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	---------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC06103


Type : WGACCN

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

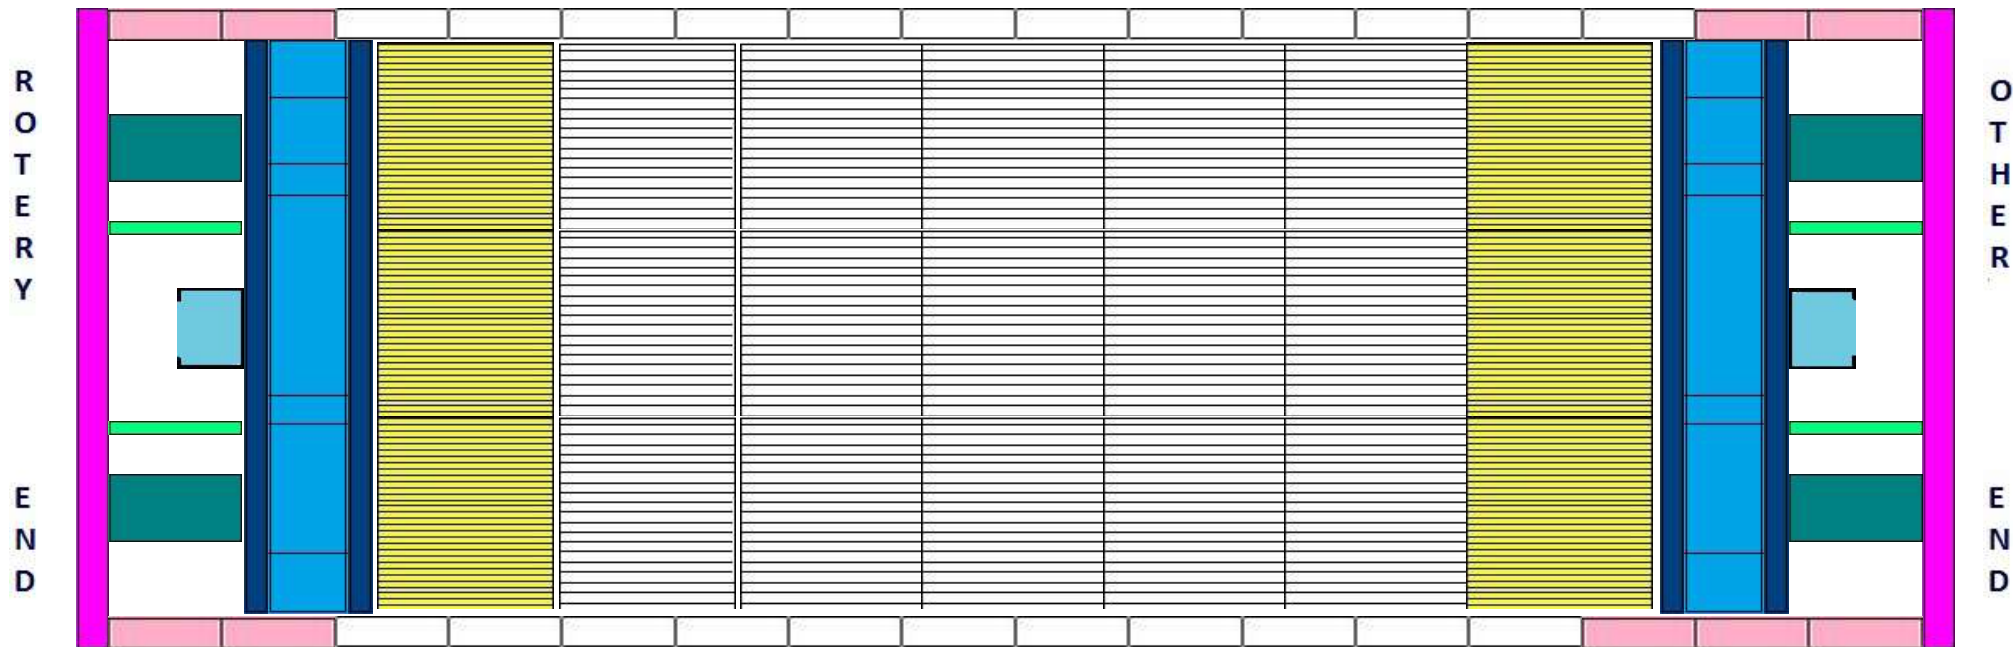

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Blue	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Green	Aux. Head stock	4	100%	Yellow	Sole Bar	4.5	28%	Blue	Draft Gear Bracket	2	100%
Red	Trough floor	2	29%	Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4.5	28%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -4, WEST : 0 Other End - EAST : 2, WEST : 4

Start Date : 04-Dec-2019, Completion Date : 11-Dec-2019, Net Repair Days : 7, Total Man Hours : 1184

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC06104


Type : WGACCN

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

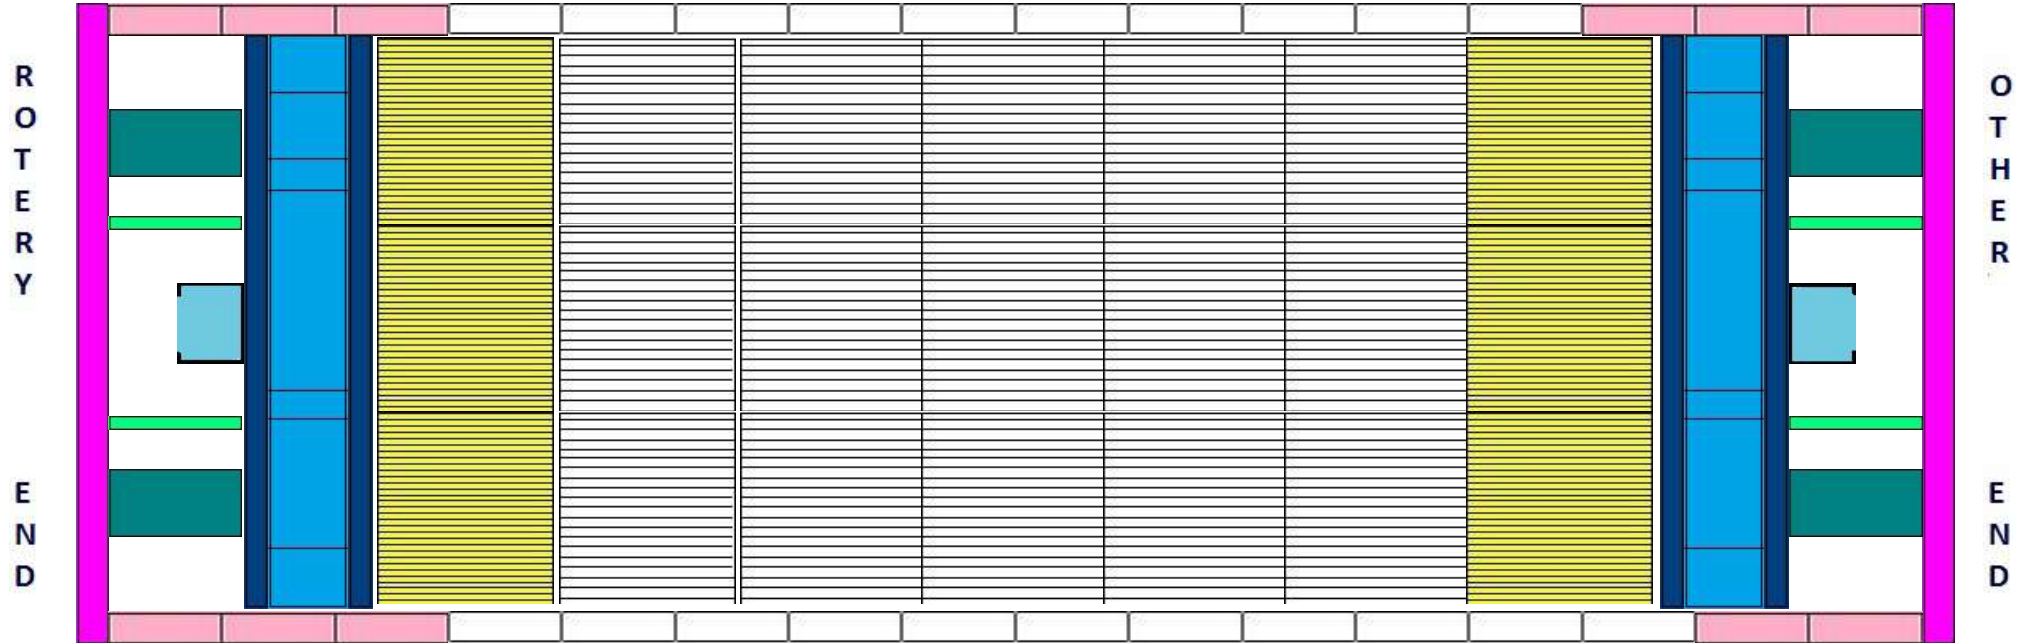

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
 	Headstock Beam	2	100%	 	Centre Stiffner for Headstock	4	100%	 	Floor Stiffner for Headstock	4	100%
 	Aux. Head stock	4	100%	 	Sole Bar	5.5	34%	 	Draft Gear Bracket	2	100%
 	Trough floor	2	29%	 	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	5.5	34%		Body panel/patch		100%		Door Top/Roof Patch		100%
	Window Module		2%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -10, WEST : -8 Other End - EAST : 6, WEST : 4
Start Date : 11-Jul-2019, Completion Date : 17-Jul-2019, Net Repair Days : 6, Total Man Hours : 1242

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC06203


Type : WGSCN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

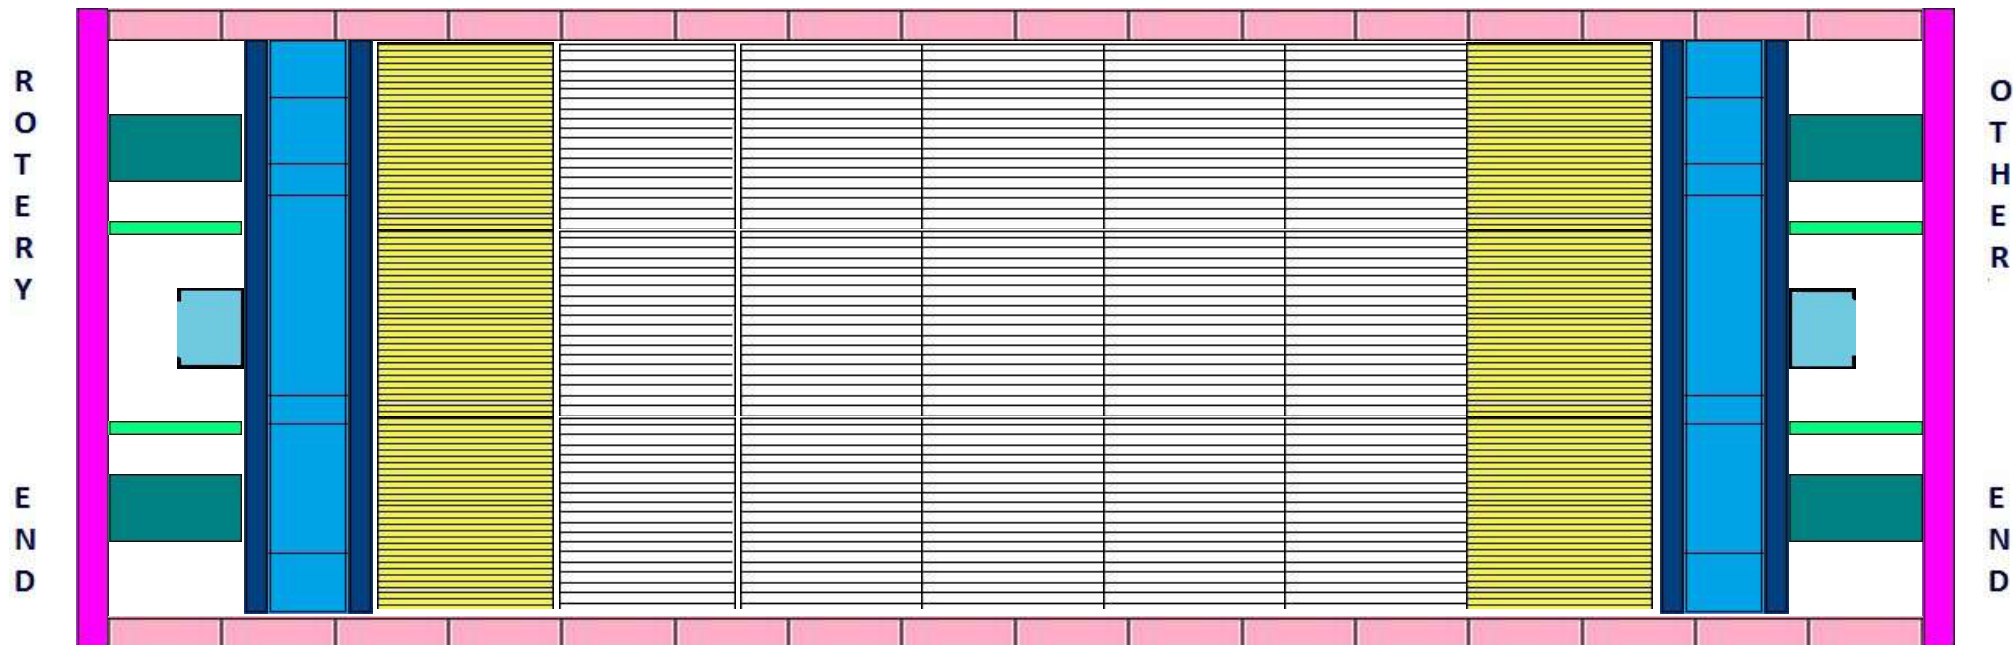

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		10%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	24	60%		Window Bar	42	23%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -6, WEST : 0 Other End - EAST : 11, WEST : 5
Start Date : 26-Aug-2019, Completion Date : 03-Sep-2019, Net Repair Days : 8, Total Man Hours : 1783

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC06205


Type : WGSCN

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

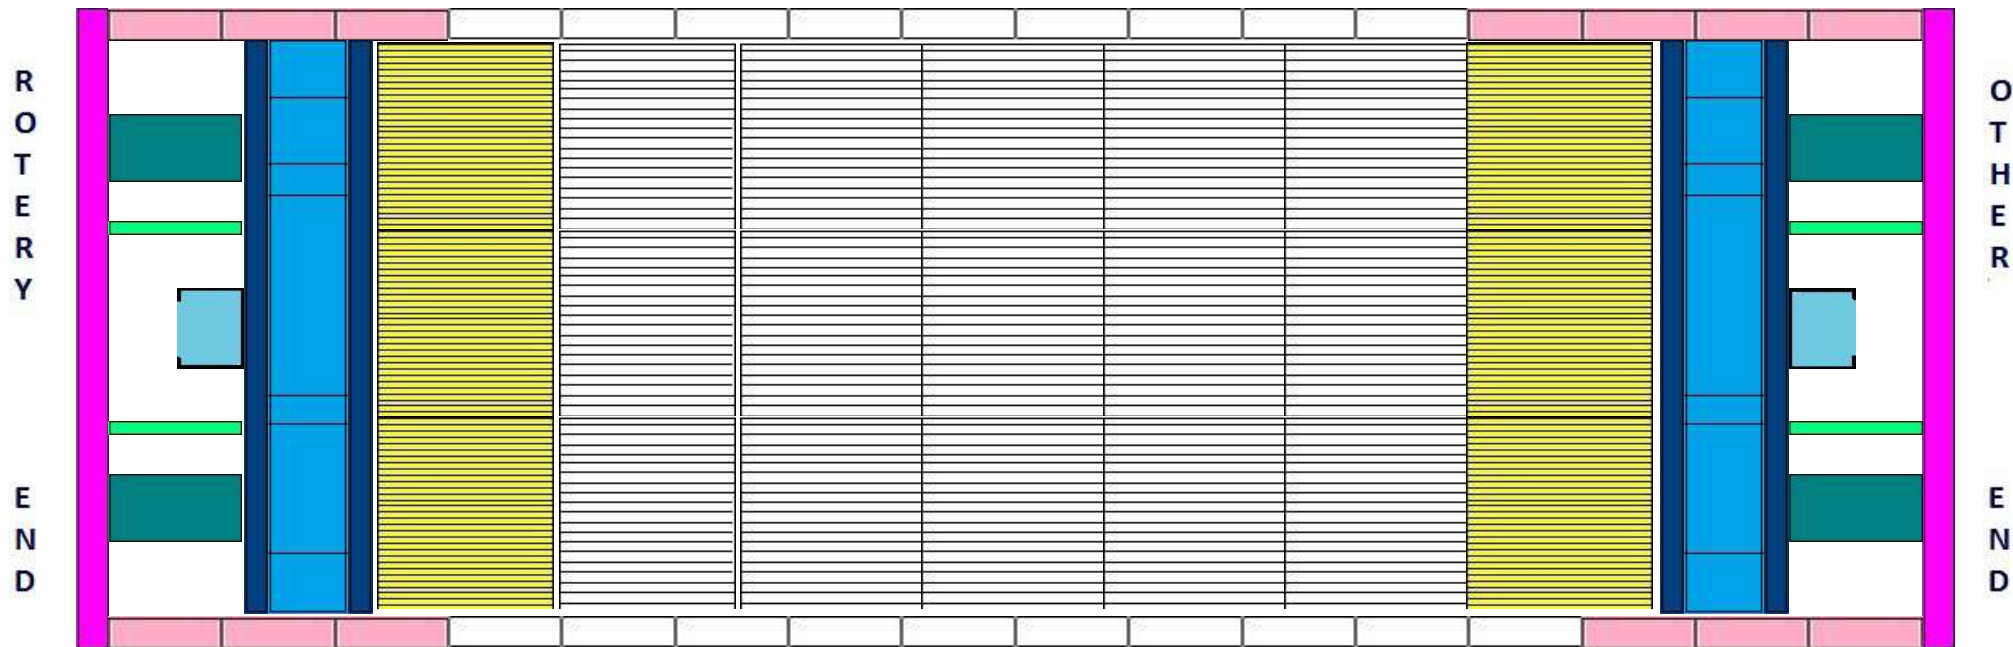

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	6.5	41%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	6.5	41%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	44	24%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 6, WEST : 4 Other End - EAST : 9, WEST : 5
Start Date : 27-Jun-2019, Completion Date : 05-Jul-2019, Net Repair Days : 8, Total Man Hours : 1588

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC06408


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

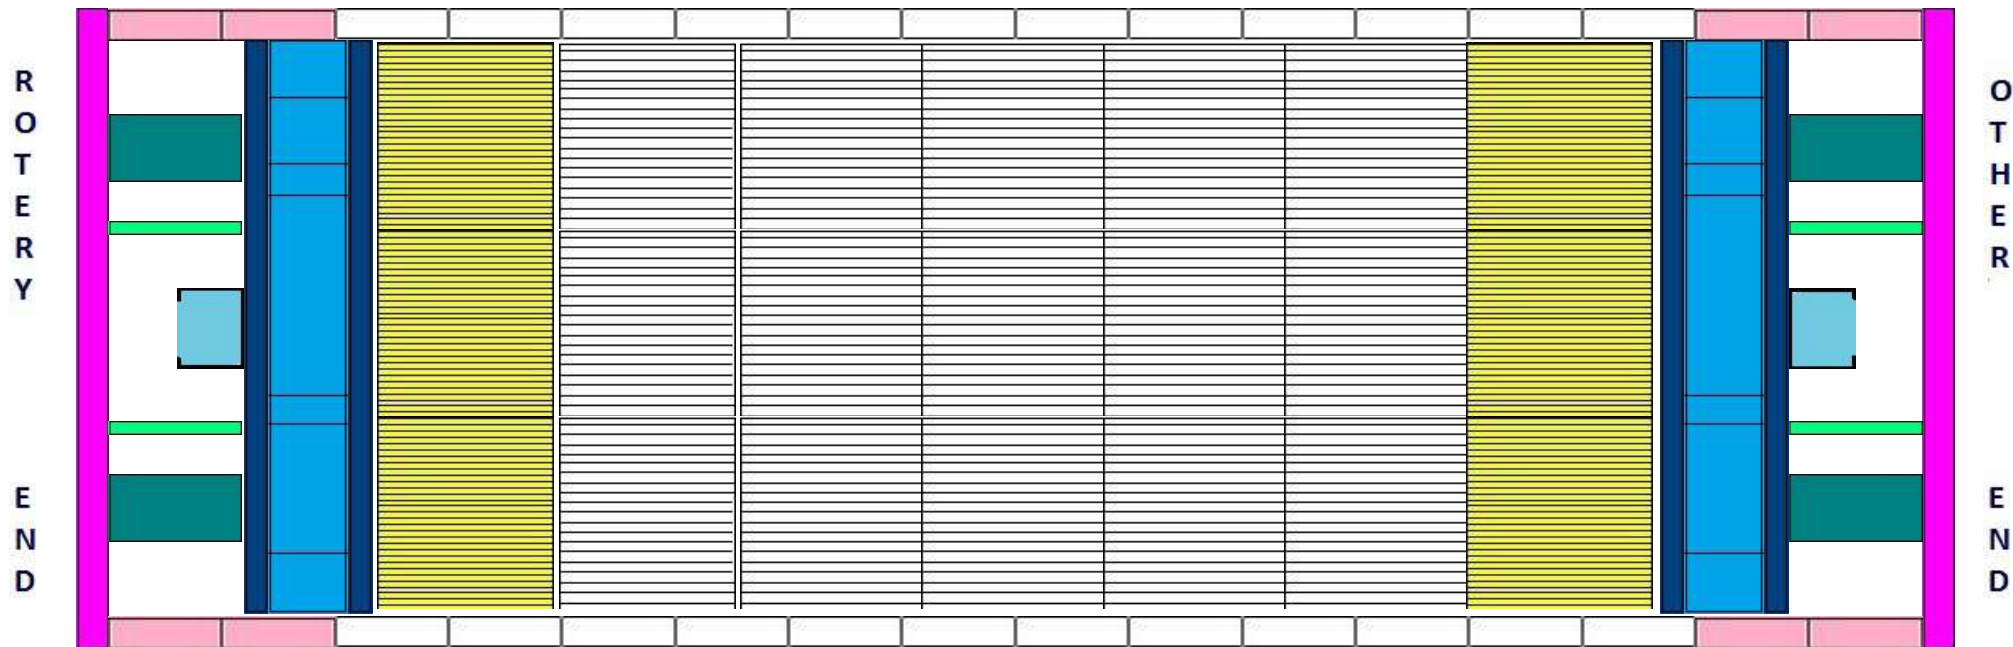

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
 	Headstock Beam	2	100%	 	Centre Stiffner for Headstock	4	100%	 	Floor Stiffner for Headstock	4	100%
 	Aux. Head stock	4	100%	 	Sole Bar	4	25%	 	Draft Gear Bracket	2	100%
 	Trough floor	2	29%	 	Centre plate	2	100%		SoleBar Stiffner	4	67%
	Bottom Wall Part	4	25%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	46	26%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 6, WEST : 4 Other End - EAST : 3, WEST : 4
Start Date : 16-Oct-2019, Completion Date : 24-Oct-2019, Net Repair Days : 8, Total Man Hours : 1104

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC06411


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

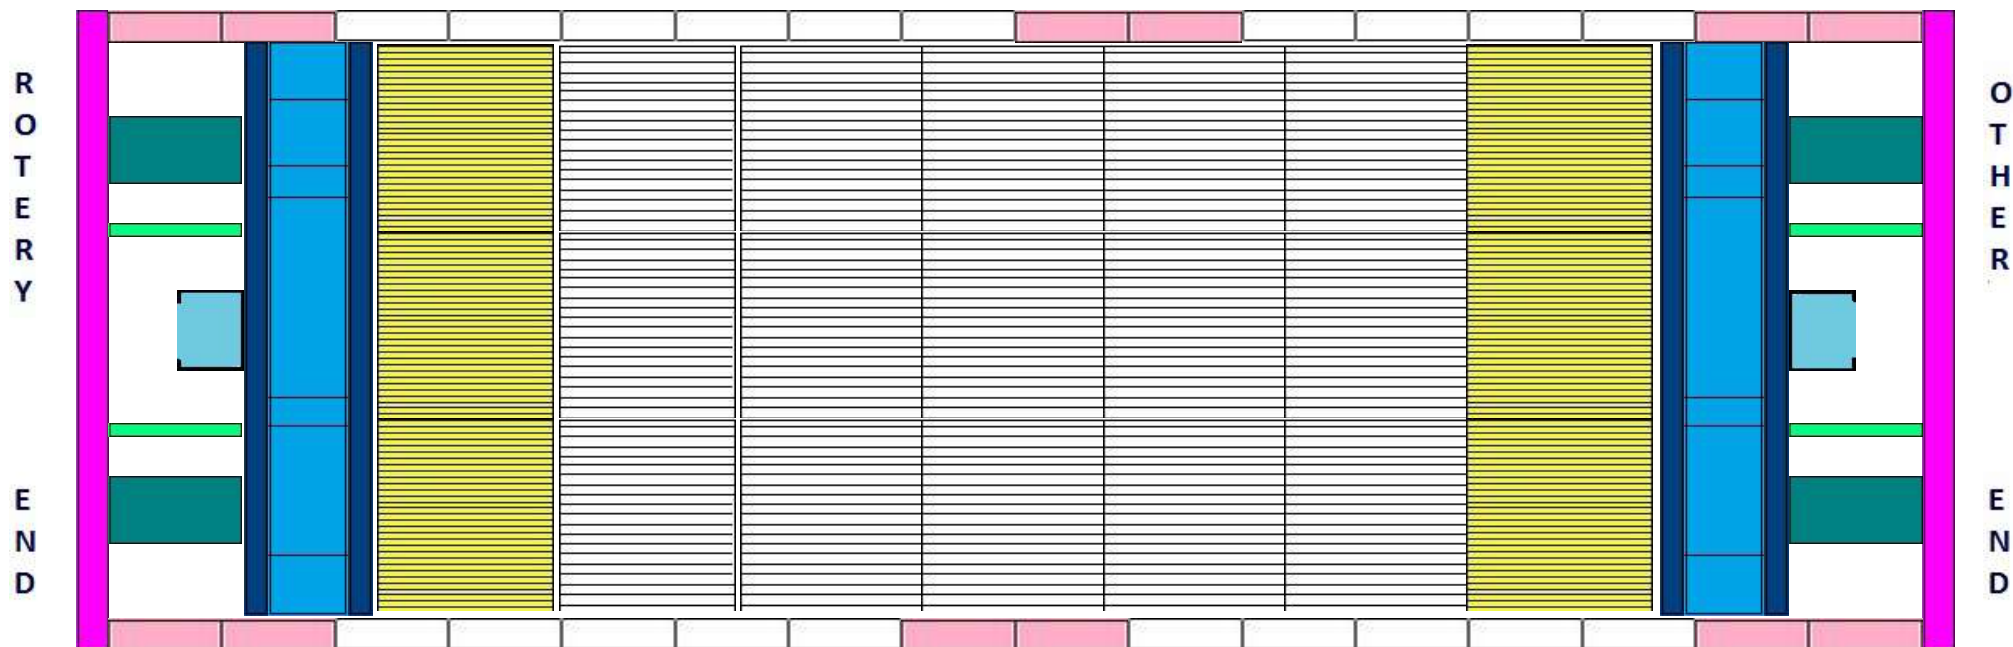

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	6	38%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	6	38%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 3, WEST : 4 Other End - EAST : -2, WEST : -3
Start Date : 22-Aug-2019, Completion Date : 27-Aug-2019, Net Repair Days : 5, Total Man Hours : 1358

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC06420


Type : GS

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

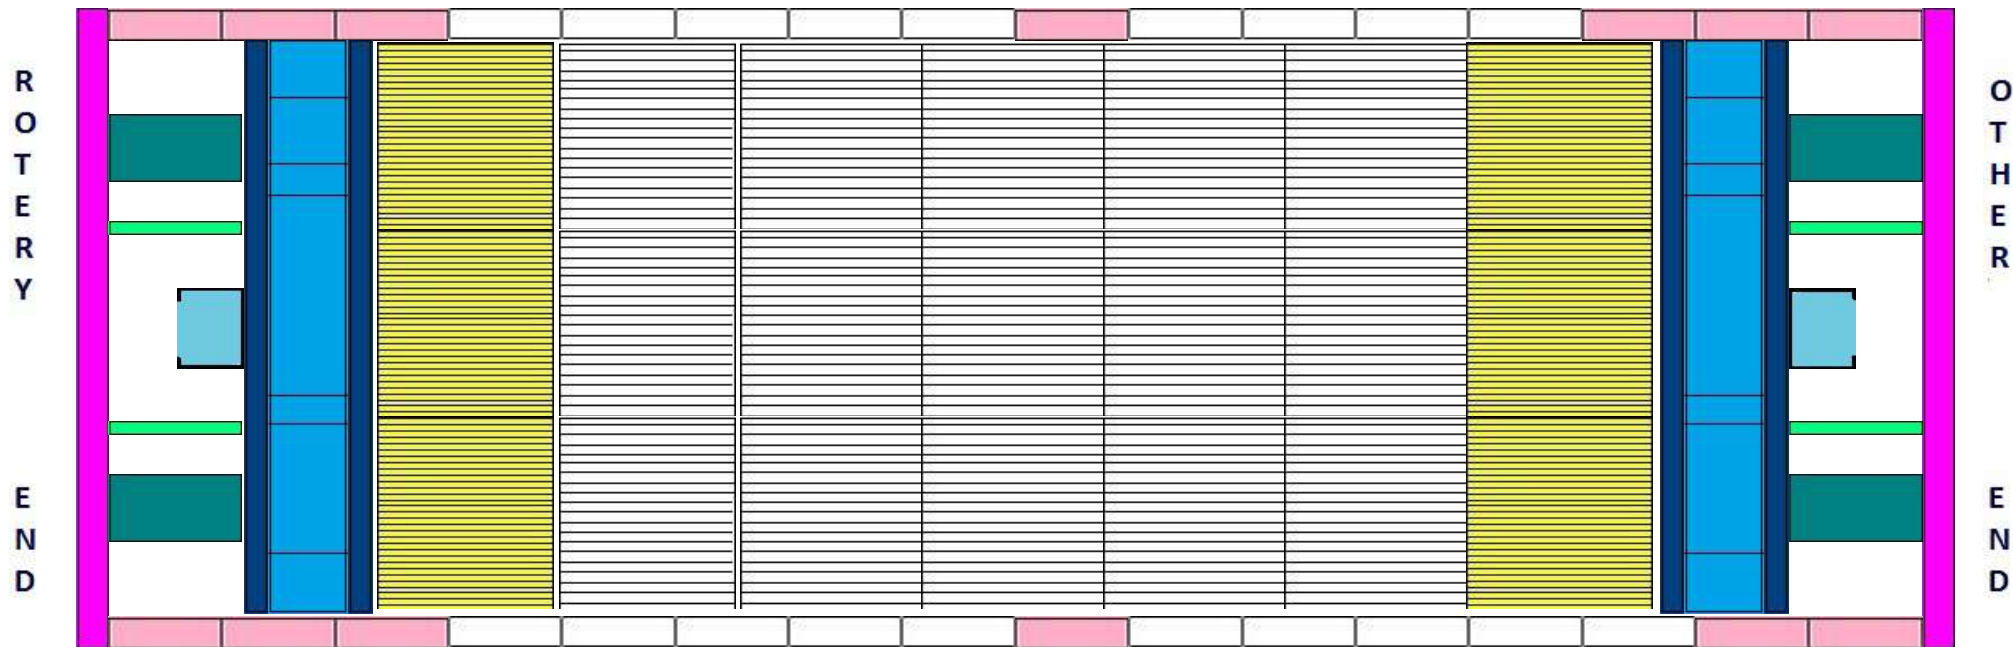

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	7.5	47%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	7.5	47%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	29%		Window Bar	46	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : -3 Other End - EAST : -3, WEST : 0

Start Date : 26-Aug-2019, Completion Date : 30-Aug-2019, Net Repair Days : 5, Total Man Hours : 1302

HAMANT JADAV - JE	M L KOLI - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	---------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07002


Type : WG FAC

Built Year : 2007

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

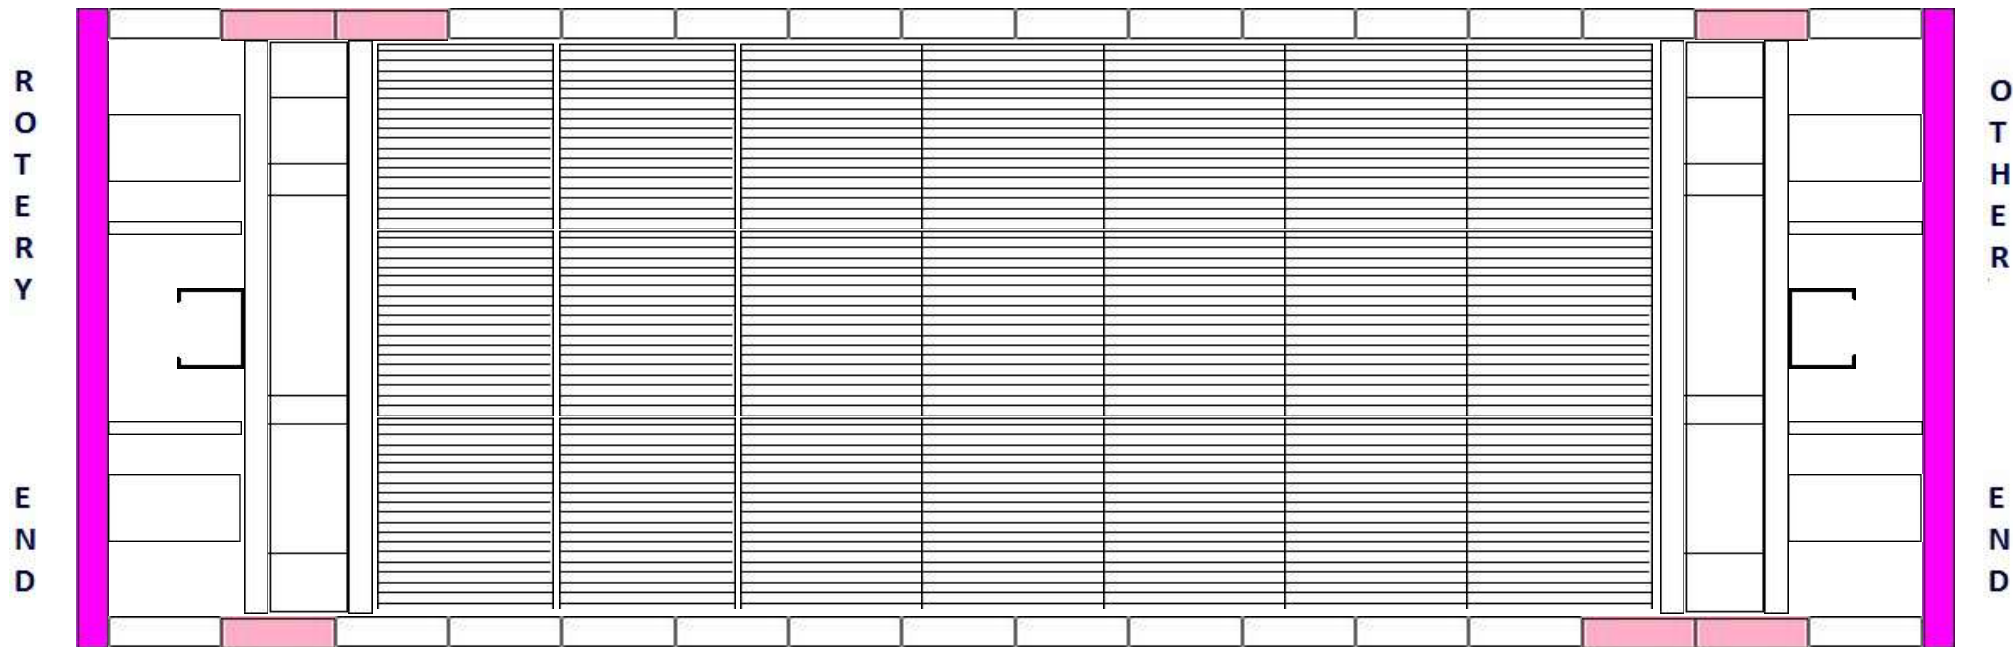

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	3	19%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	3	19%		Body panel/patch		100%		Door Top/Roof Patch		100%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -4, WEST : 0 Other End - EAST : -3, WEST : 0
Start Date : 19-Jun-2019, Completion Date : 25-Jun-2019, Net Repair Days : 6, Total Man Hours : 988

HAMANT JADAV - JE	M L KOLI - JE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	---------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07216


Type : WGSCN

Built Year : 08

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

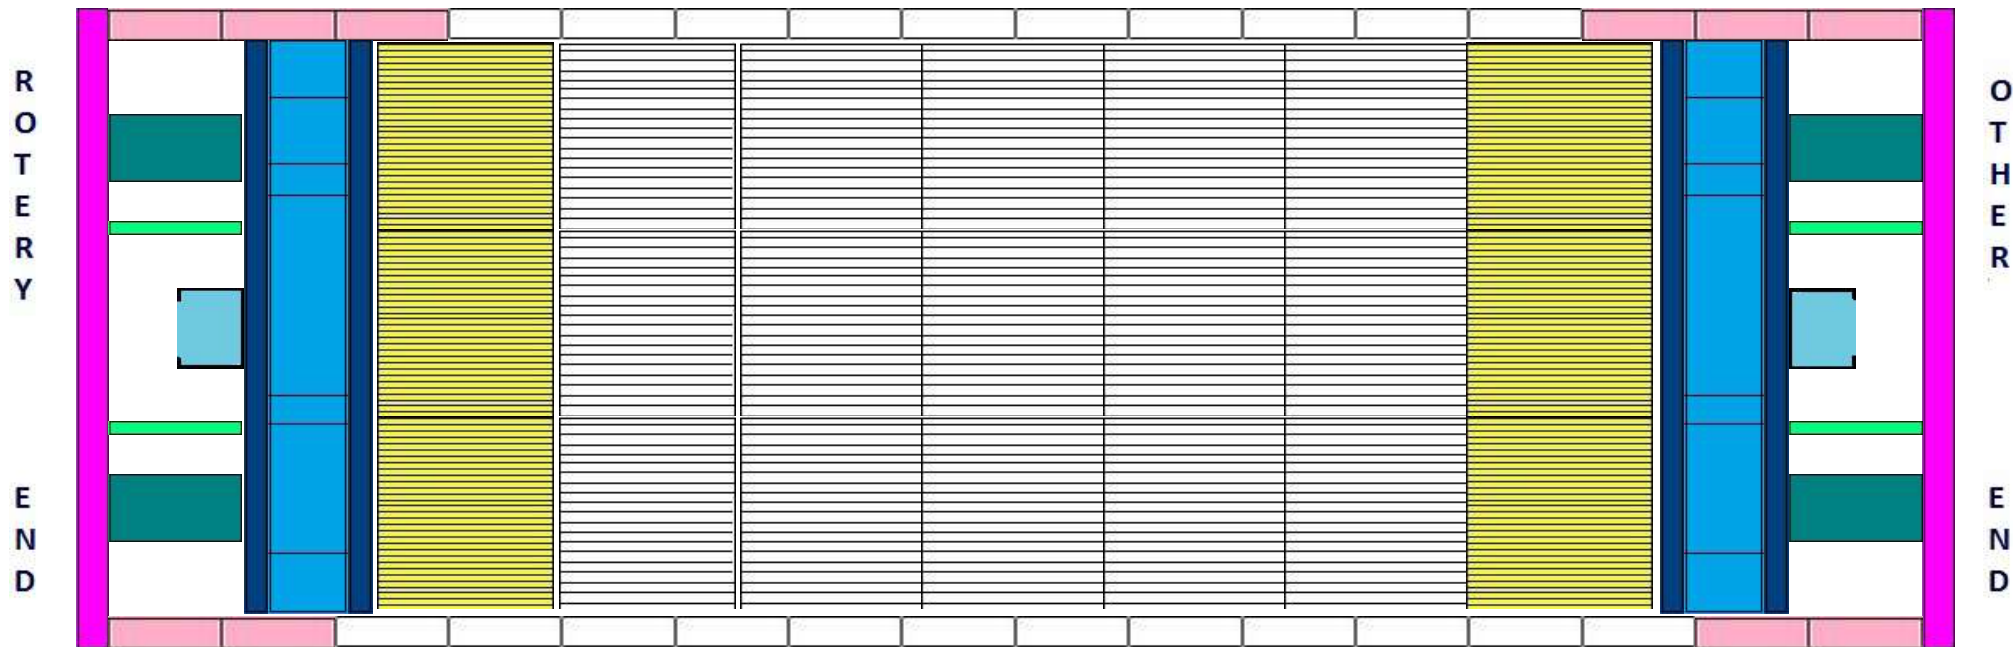

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Blue	Aux. Head stock	4	100%	Yellow	Sole Bar	5	31%	Blue	Draft Gear Bracket	2	100%
Red	Trough floor	2	29%	Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	5	31%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	44	24%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 3, WEST : 2 Other End - EAST : 5, WEST : -3
Start Date : 07-Oct-2019, Completion Date : 12-Oct-2019, Net Repair Days : 6, Total Man Hours : 1084

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07401


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

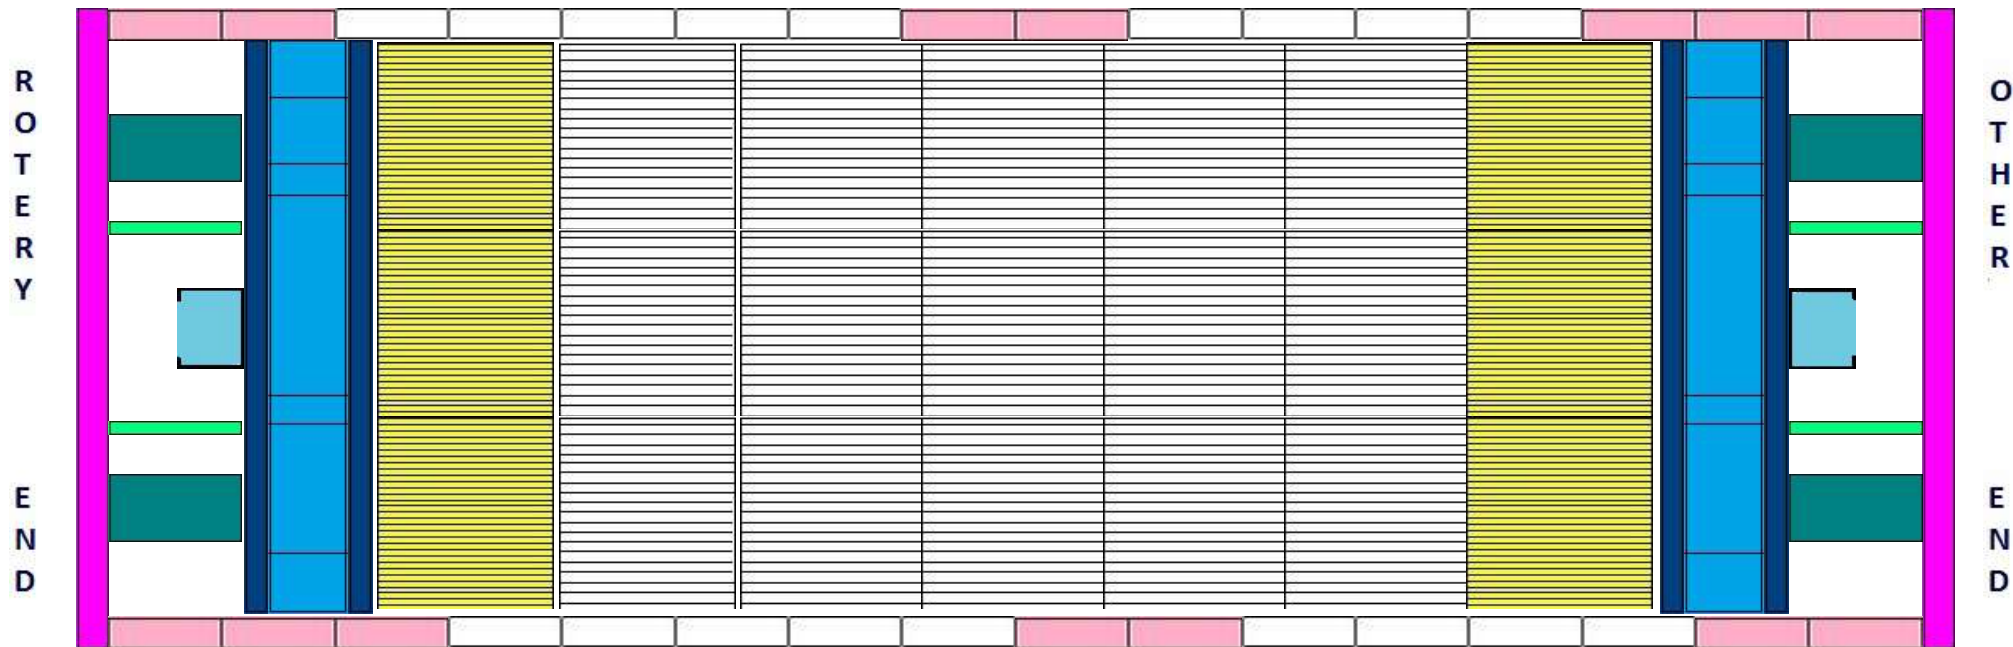

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Light Blue	Sole Bar	7	44%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	7	44%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	18	45%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -6, WEST : 0 Other End - EAST : -2, WEST : -8
Start Date : 26-Jun-2019, Completion Date : 04-Jul-2019, Net Repair Days : 8, Total Man Hours : 1296

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	--------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07402


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

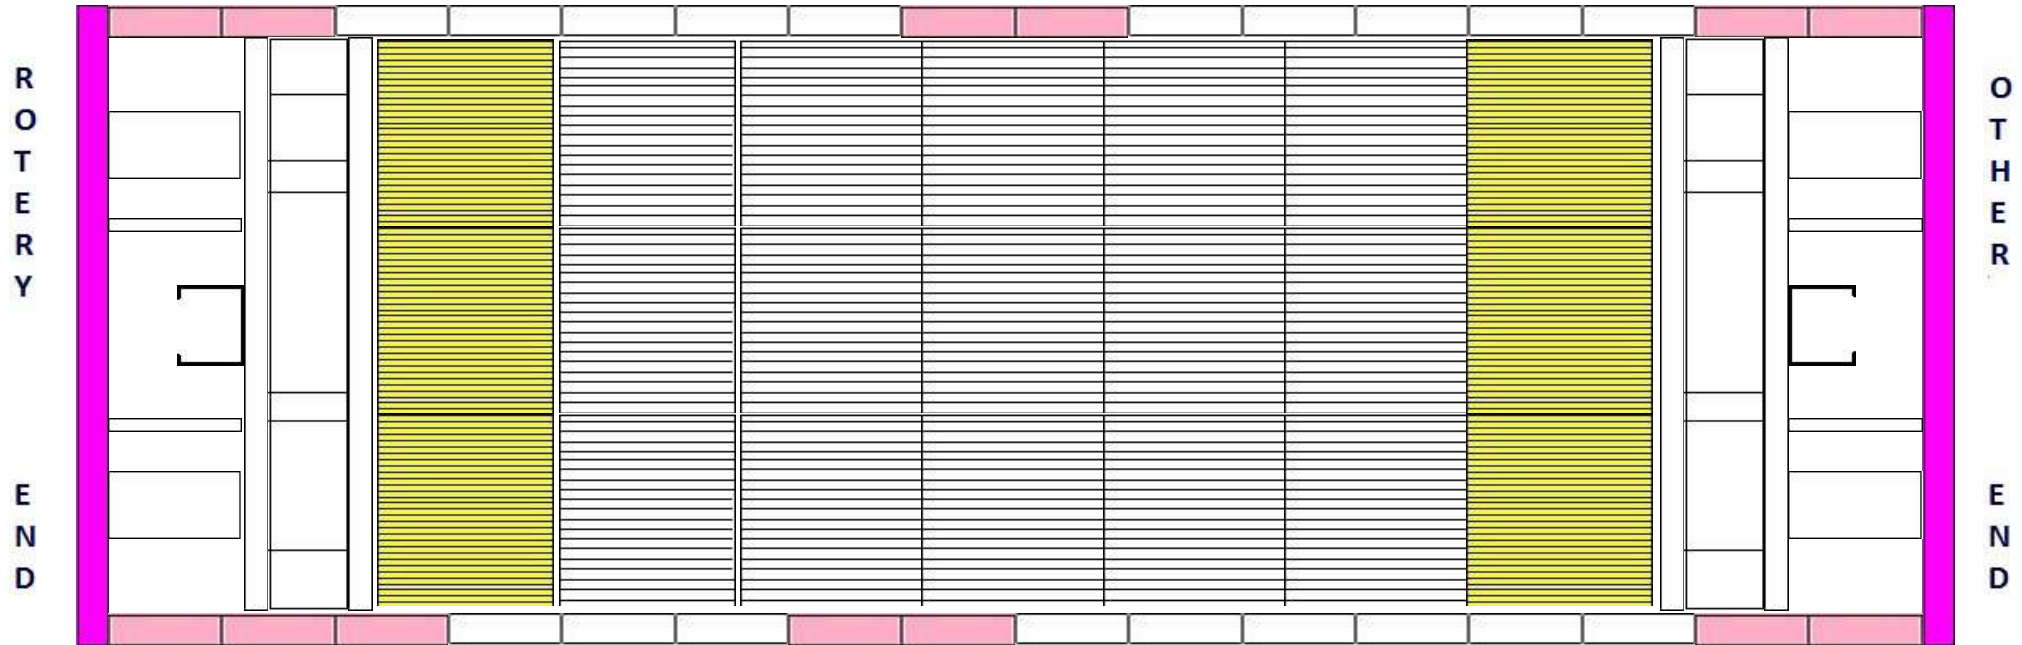

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	6.5	41%		Draft Gear Bracket	0	0%
	Trough floor	2	29%		Centre plate	0	0%		SoleBar Stiffner	6	100%
	Bottom Wall Part	6.5	41%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : 3 Other End - EAST : -8, WEST : -5
Start Date : 13-May-2019, Completion Date : 21-May-2019, Net Repair Days : 8, Total Man Hours : 904

K K DEHARIA - JE	ANASTA PRASAD - JE	ARUN SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07403


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

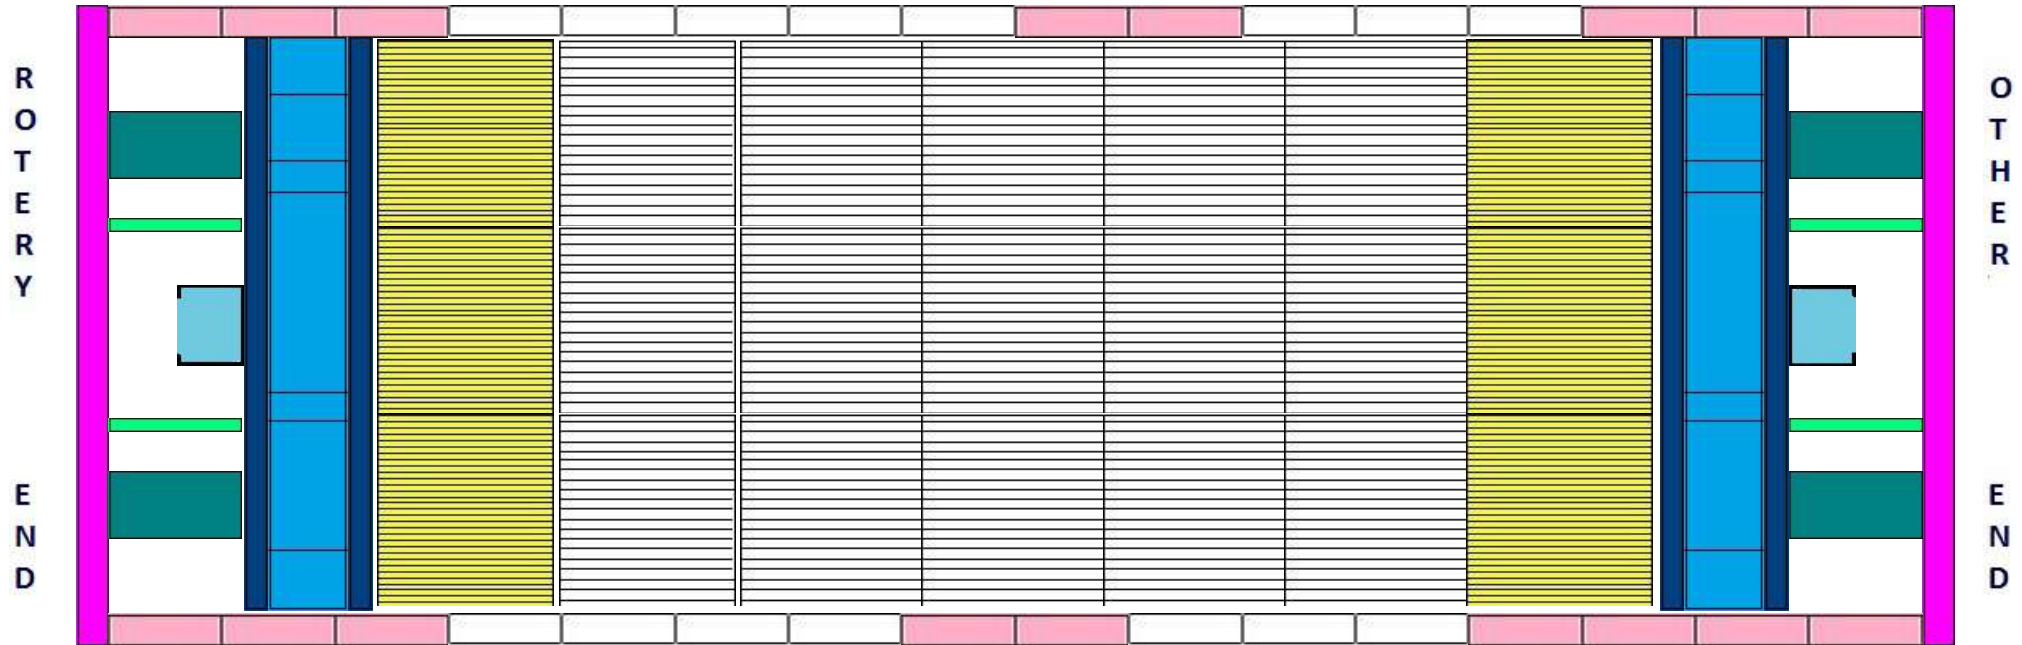

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	8.5	53%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8.5	53%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	18	45%		Window Bar	40	22%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -10, WEST : -7 Other End - EAST : 0, WEST : 5
Start Date : 08-Apr-2019, Completion Date : 13-Apr-2019, Net Repair Days : 6, Total Man Hours : 1162

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC90999


Type : RA

Built Year : 1990

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

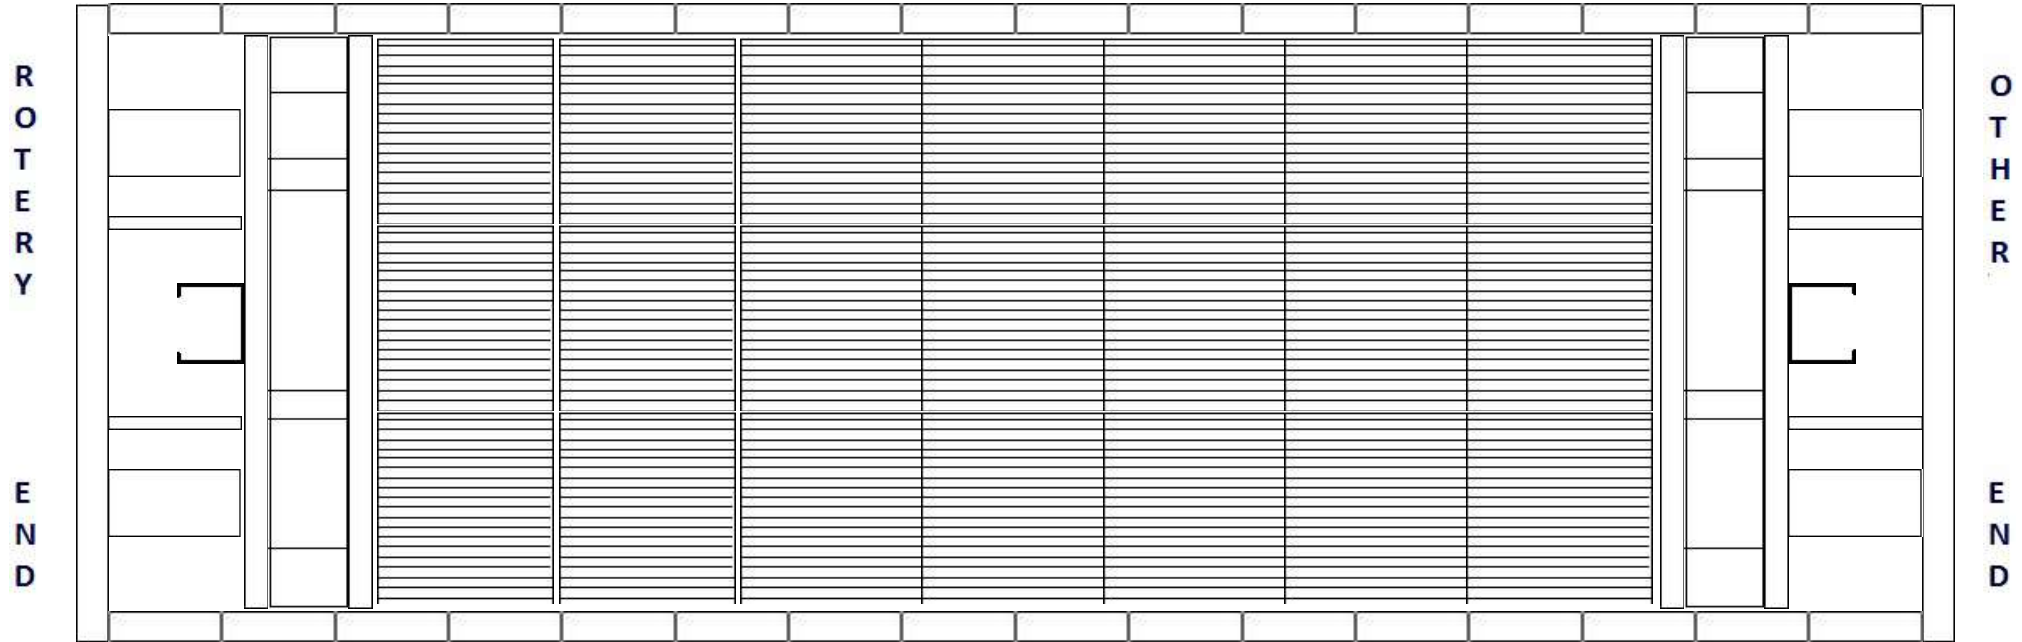

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		0%		Door Top/Roof Patch		100%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 19-Sep-2019, Completion Date : 23-Sep-2019, Net Repair Days : 4, Total Man Hours : 120

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC06414


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

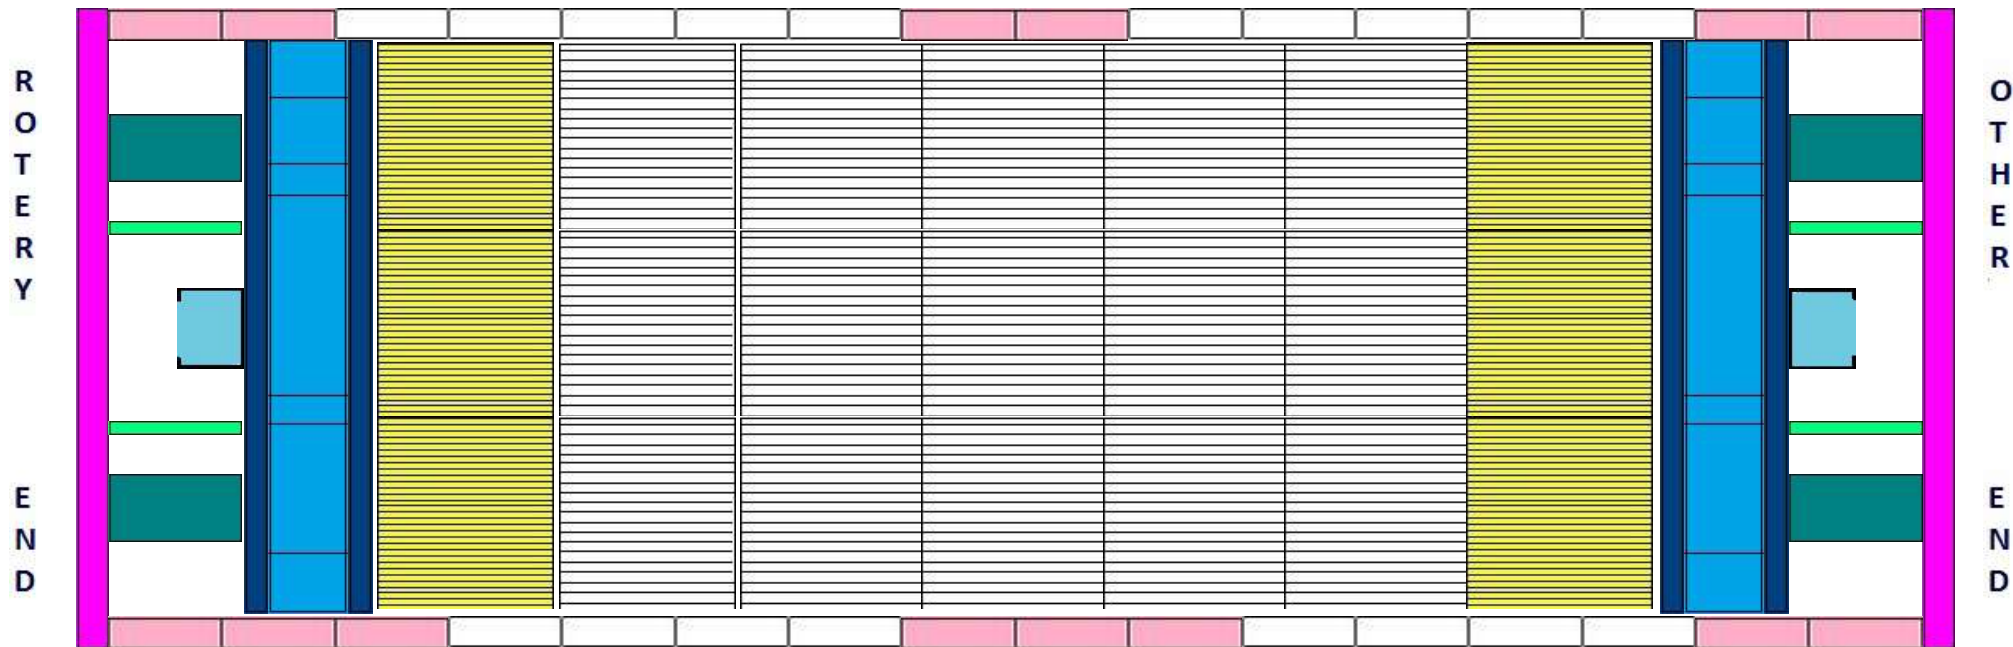

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	7	44%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	7	44%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	29	73%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 3 Other End - EAST : 2, WEST : 6
Start Date : 09-May-2019, Completion Date : 20-May-2019, Net Repair Days : 10, Total Man Hours : 0

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	--------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04247


Type : WGSCN

Built Year : 2004

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

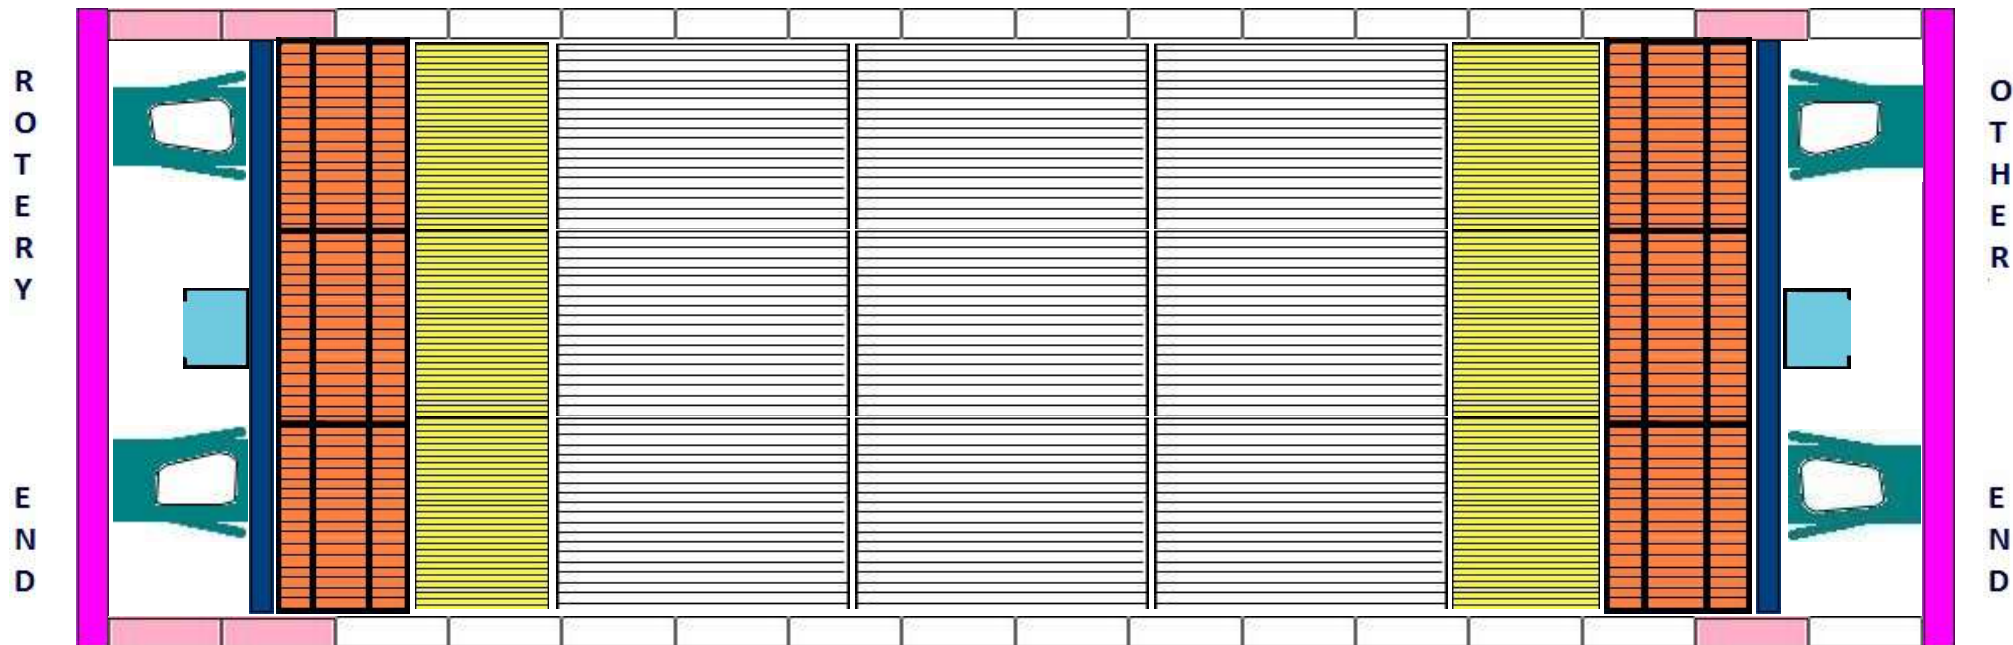

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	3	19%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	3	19%		Body panel/patch		0%
	Door Top/Roof Patch		100%		Seat Bracket Rail		0%		Window Sill	0	0%
	Window Bar	6	3%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	17	100%								

End Drooping: Rotary End - EAST : -8, WEST : -6 Other End - EAST : -9, WEST : -7
Start Date : 16-May-2019, Completion Date : 24-May-2019, Net Repair Days : 8, Total Man Hours : 912

K K DEHARIA - JE	ANASTA PRASAD - JE	ARUN SINGH - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
------------------	--------------------	------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC10427


Type : GS

Built Year : 2010

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

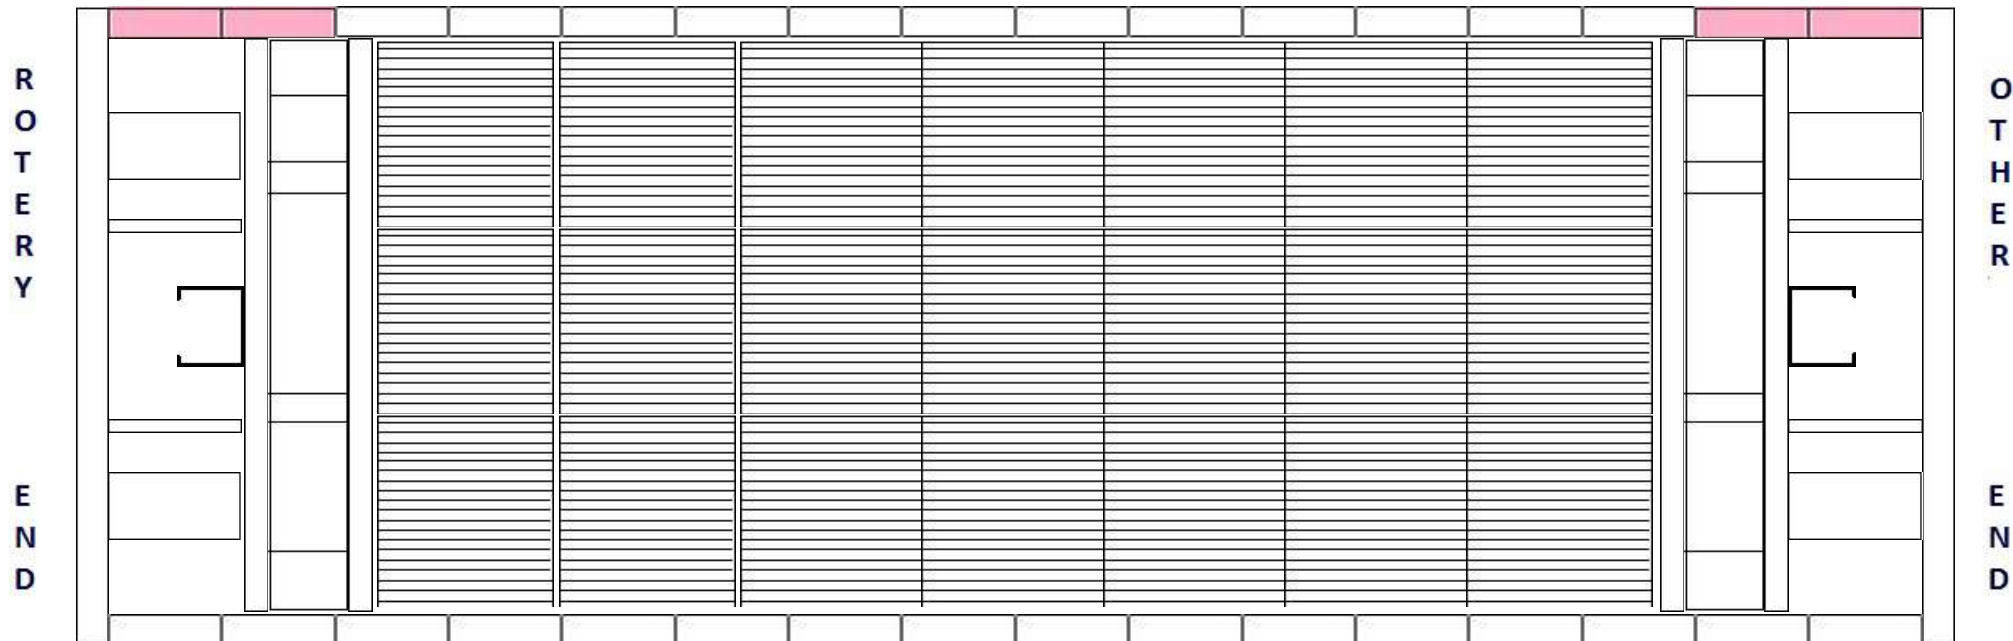

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	2	13%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2	13%		Body panel/patch		30%		Door Top/Roof Patch		100%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 16-Aug-2019, Completion Date : 19-Aug-2019, Net Repair Days : 3, Total Man Hours : 472

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC15705


Type : SLRD

Built Year : 2015

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

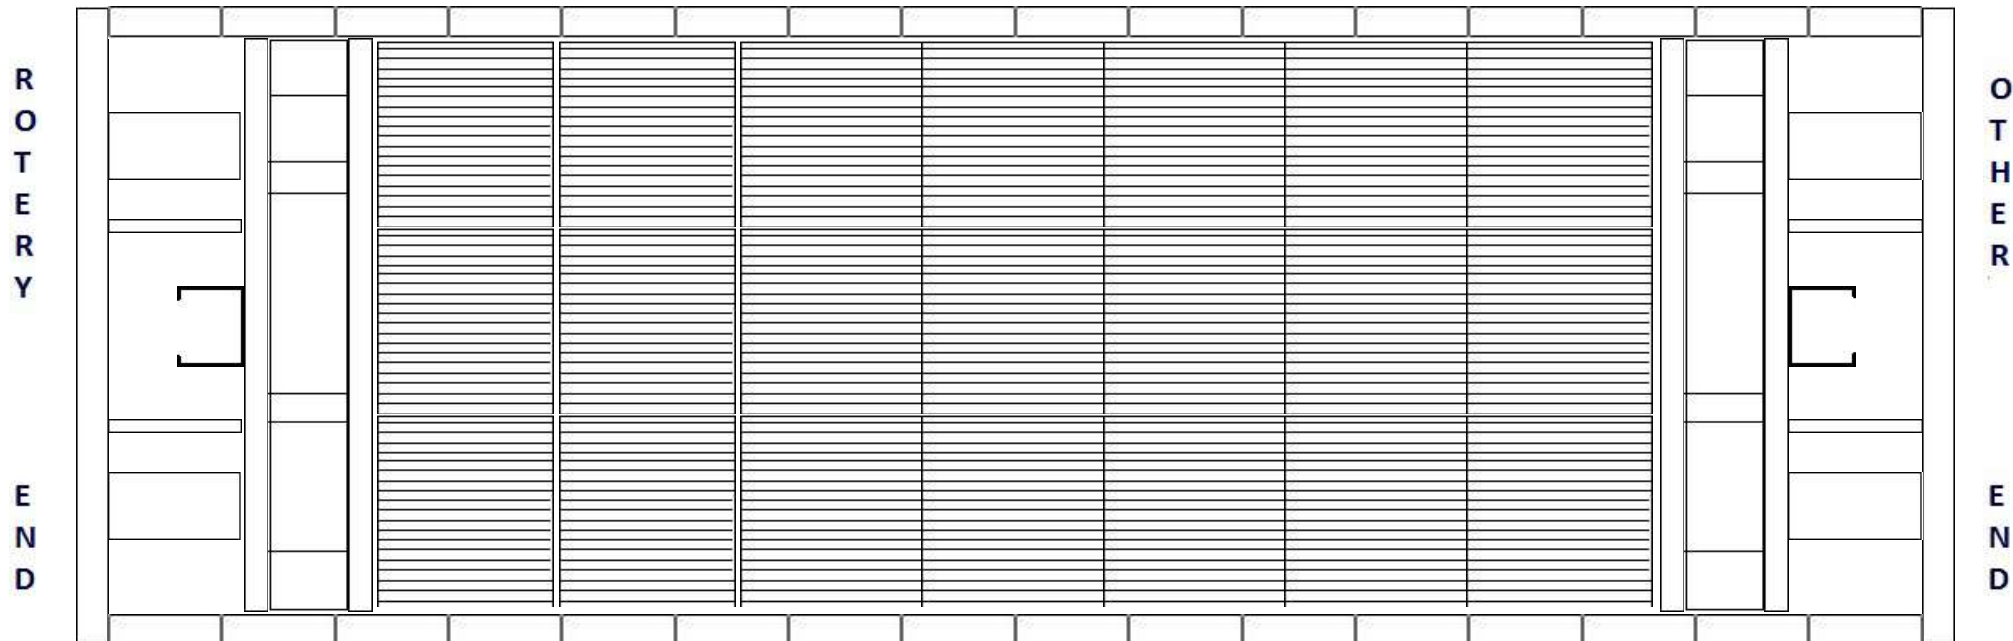

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		0%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 17-Aug-2019, Completion Date : 21-Aug-2019, Net Repair Days : 4, Total Man Hours : 0

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC13951


Type : WGSCZACJ

Built Year : 2013

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

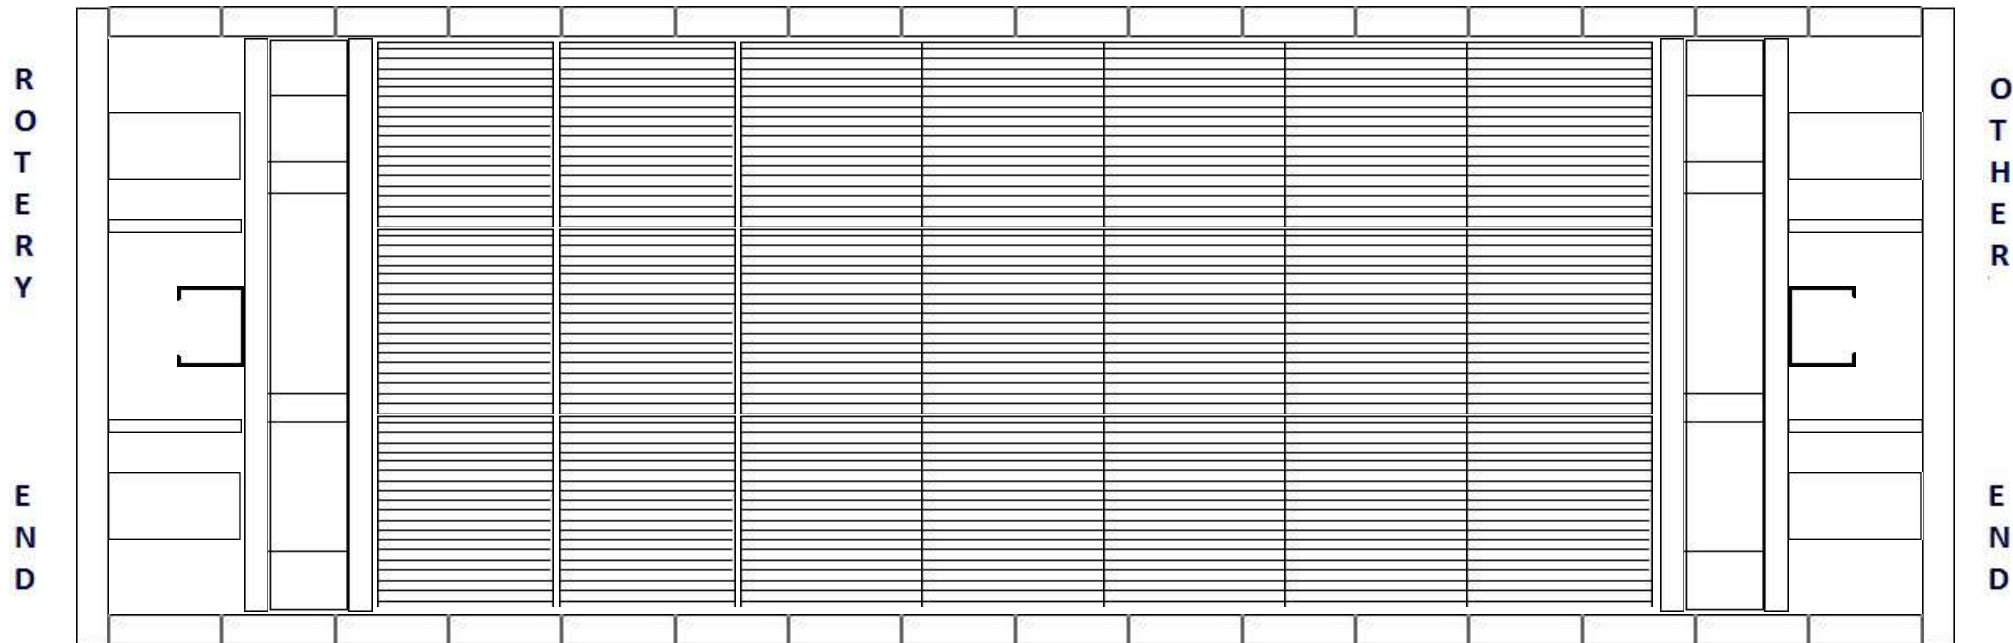

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	0	0%	Red	Centre Stiffner for Headstock	0	0%	Green	Floor Stiffner for Headstock	0	0%
Black	Aux. Head stock	0	0%	Purple	Sole Bar	0	0%	Orange	Draft Gear Bracket	0	0%
Yellow	Trough floor	0	0%	Cyan	Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		0%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 24-Aug-2019, Completion Date : 27-Aug-2019, Net Repair Days : 3, Total Man Hours : 0

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC13952


Type : WGSCZACJ

Built Year : 2013

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

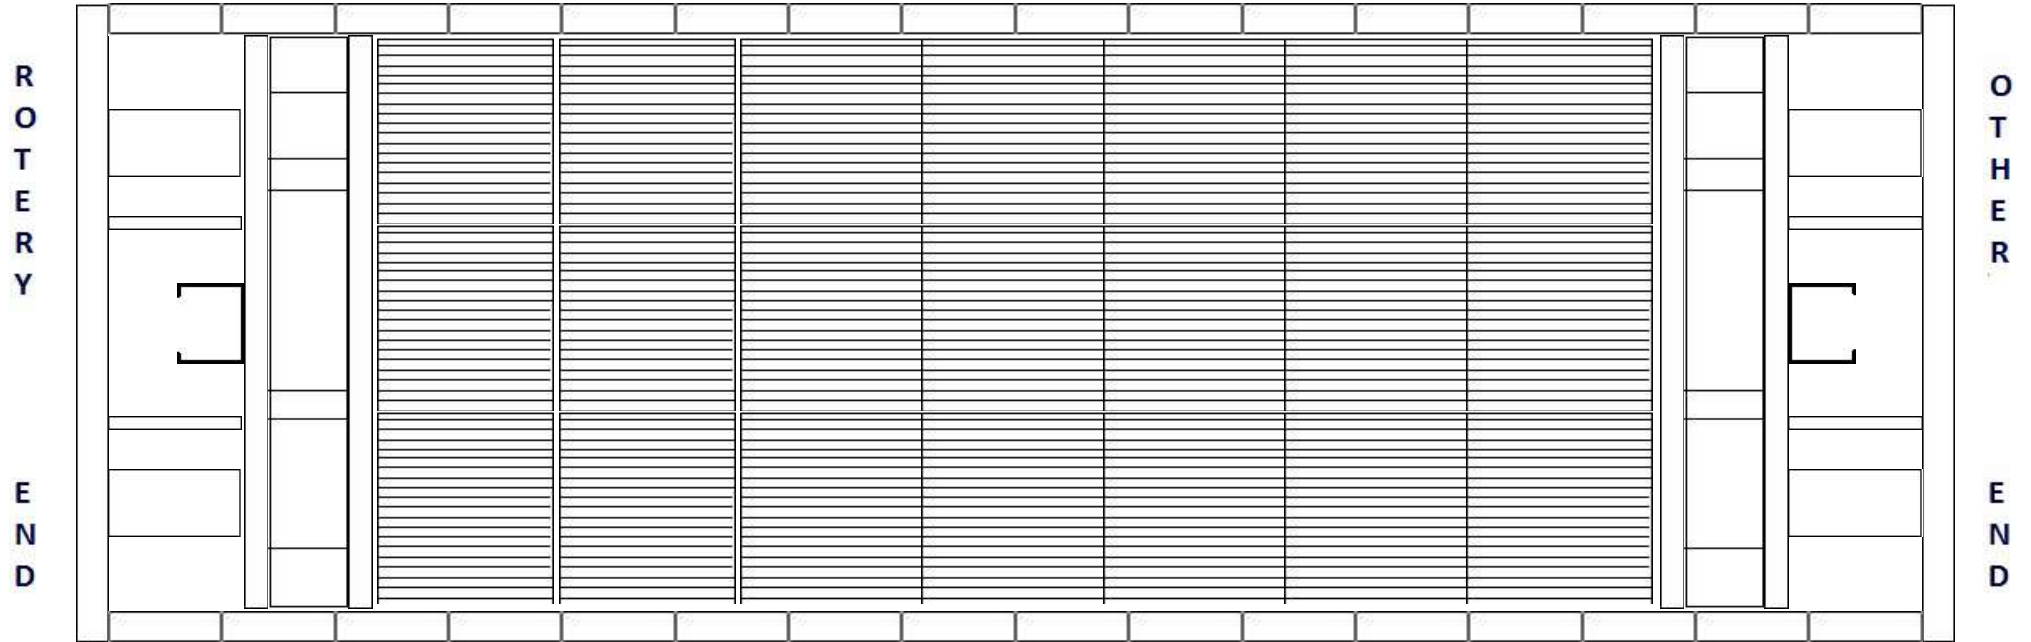

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		25%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 21-Aug-2019, Completion Date : 23-Aug-2019, Net Repair Days : 3, Total Man Hours : 150

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07202


Type : WGSCN

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

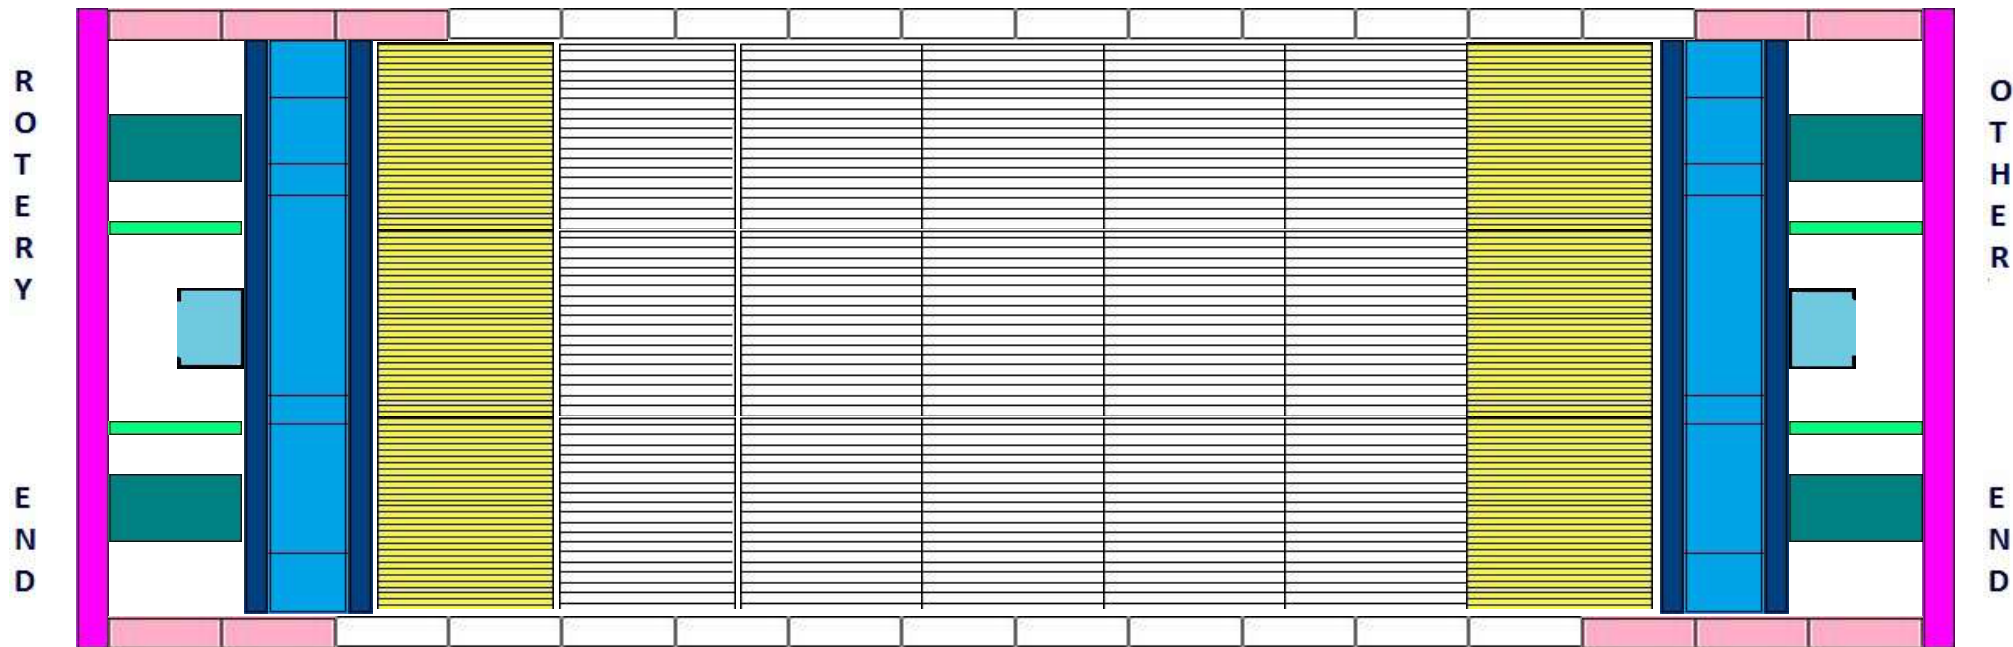

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	5	31%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	5	31%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	35%		Window Bar	78	42%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 6, WEST : -3 Other End - EAST : -5, WEST : -2
Start Date : 22-Aug-2019, Completion Date : 27-Aug-2019, Net Repair Days : 5, Total Man Hours : 1144

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC10605


Type : WGSCZ

Built Year : 2010

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

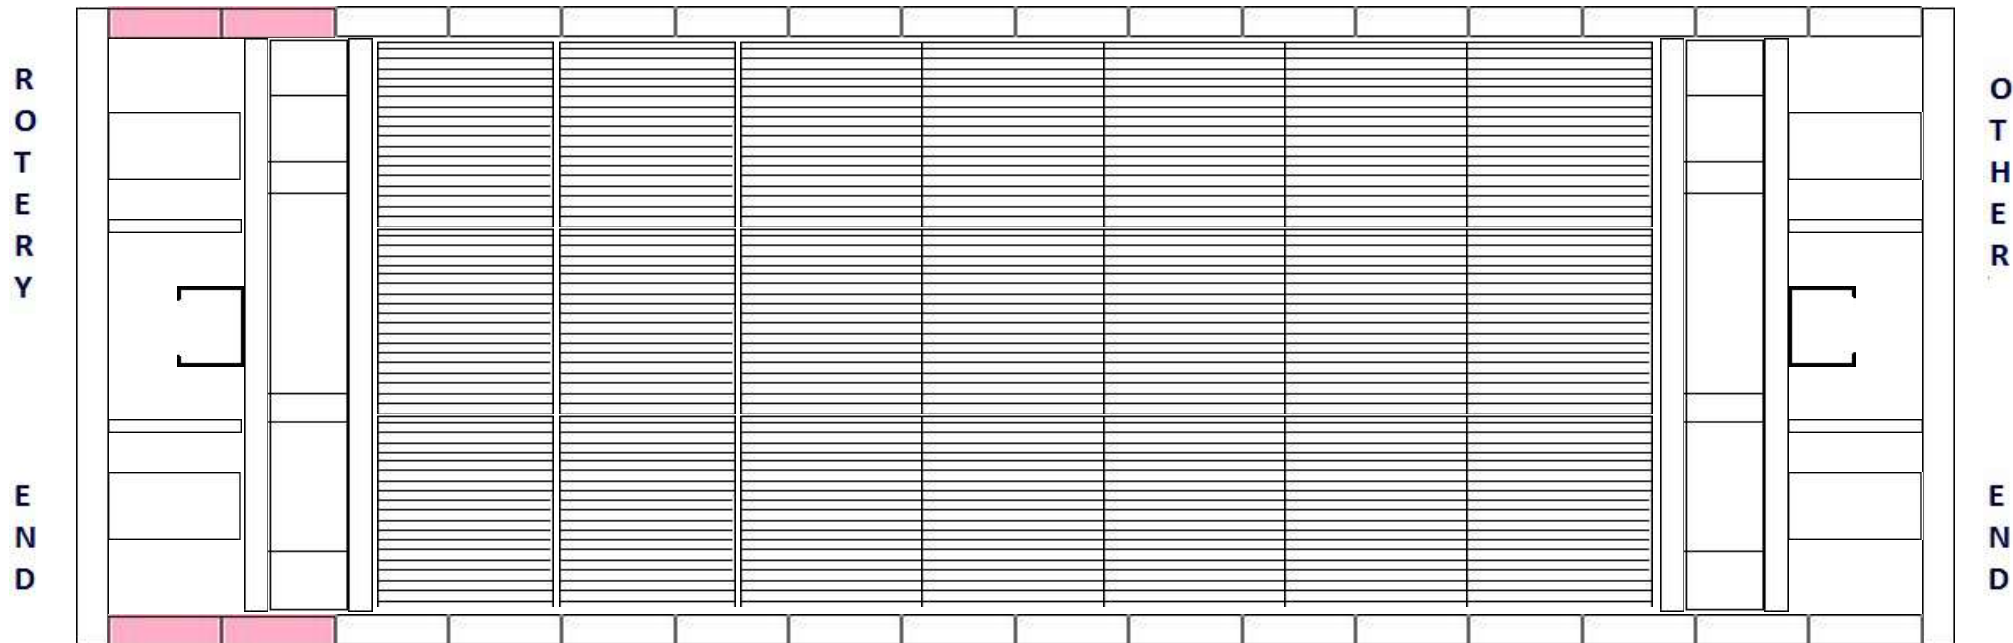

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	2	13%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2	13%		Body panel/patch		0%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 28-Aug-2019, Completion Date : 02-Sep-2019, Net Repair Days : 5, Total Man Hours : 576

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04209


Type : WGSCN

Built Year : 2004

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

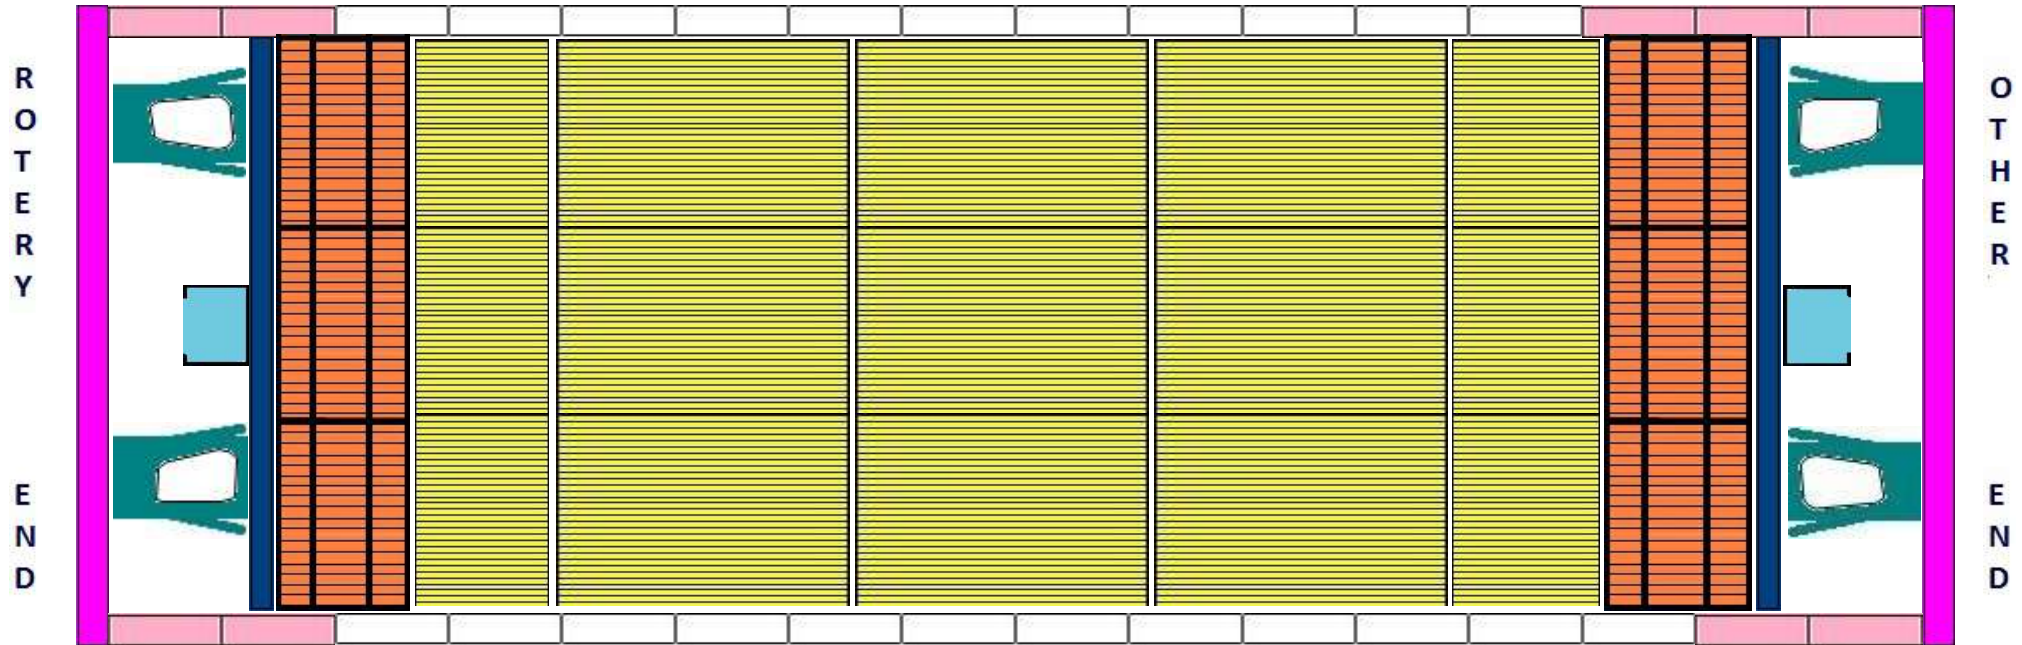

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4.5	28%		Draft Gear Bracket	2	100%
	Trough floor	7	100%		Bottom Wall Part	4.5	28%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	10	25%
	Window Bar	22	12%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	25	100%								

End Drooping: Rotary End - EAST : 3, WEST : 5 Other End - EAST : 7, WEST : 8
Start Date : 27-Jun-2019, Completion Date : 06-Jul-2019, Net Repair Days : 9, Total Man Hours : 1388

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
---------------	-------------------	-----------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC08707


Type : GSLRD

Built Year : 2008

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

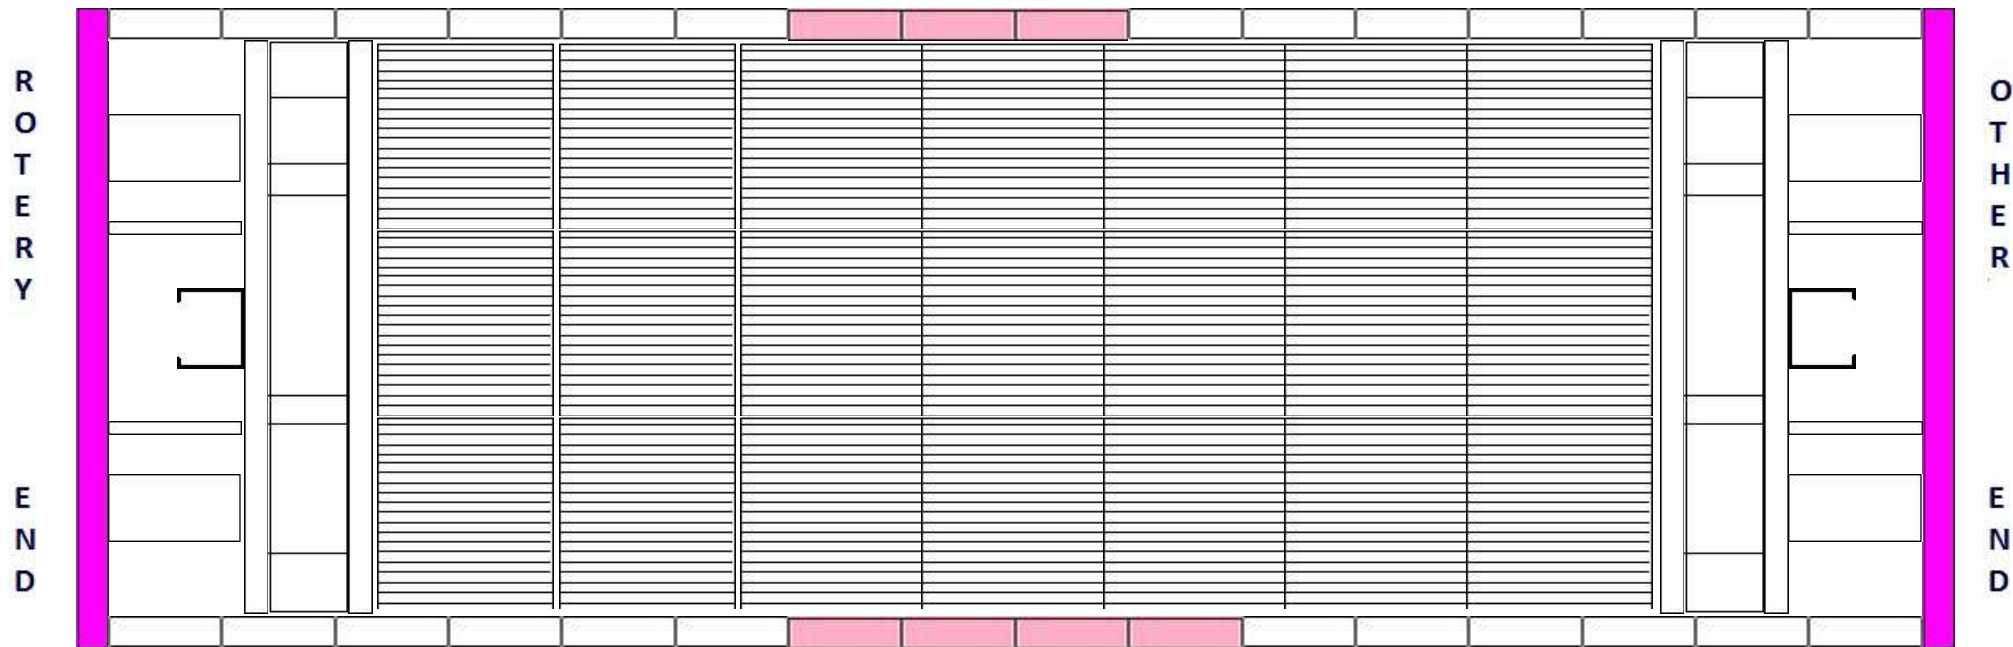

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	3.5	22%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	3.5	22%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : -3 Other End - EAST : -6, WEST : -2
Start Date : 17-Jun-2019, Completion Date : 22-Jun-2019, Net Repair Days : 6, Total Man Hours : 464

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07003


Type : WGFAC

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

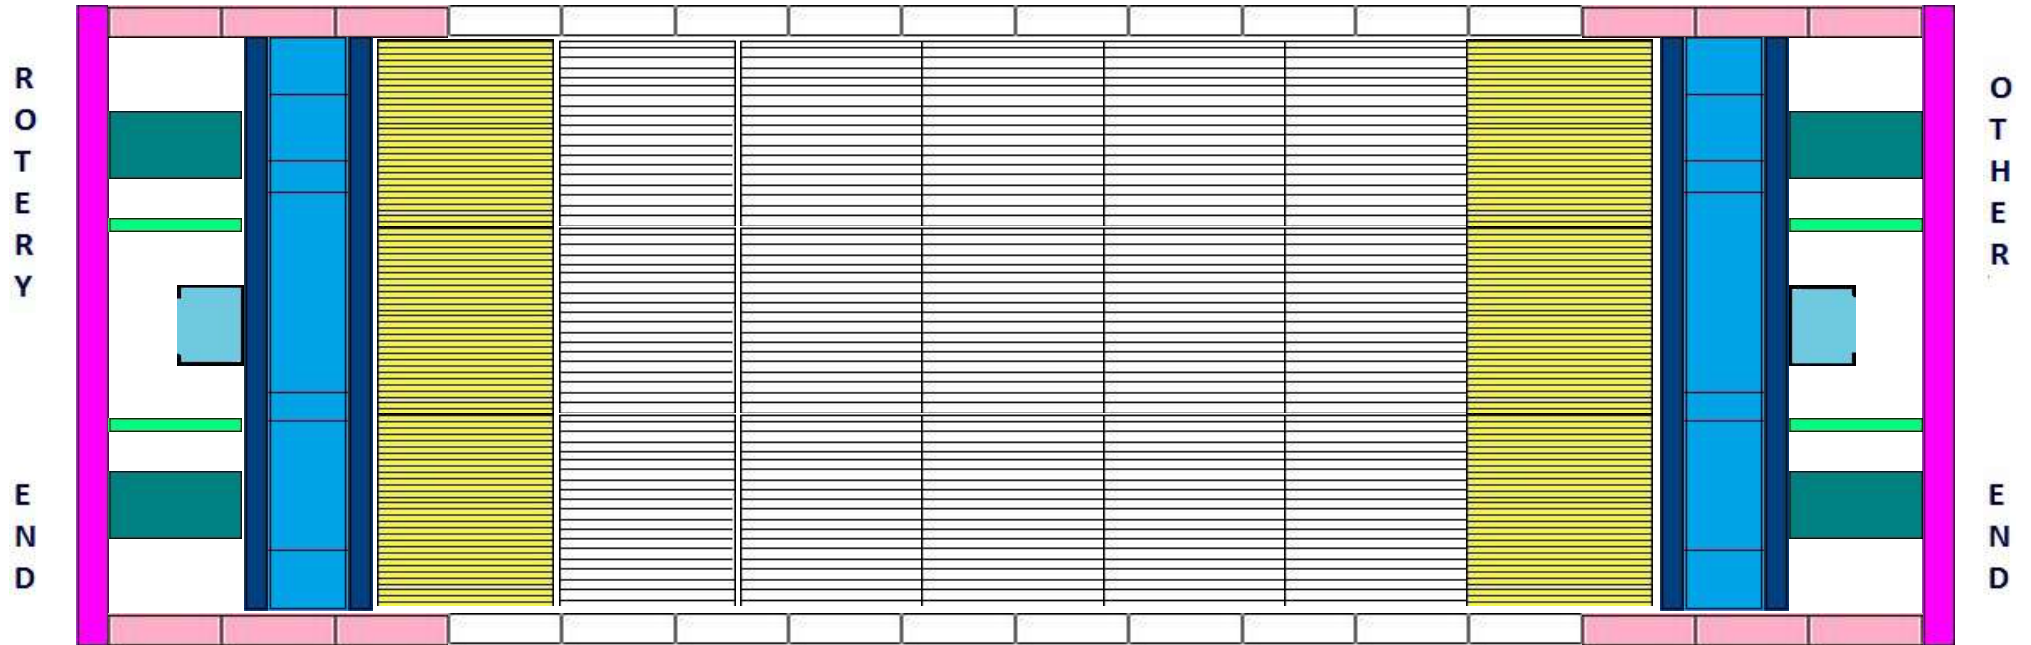

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	6	38%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	6	38%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		4%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 4, WEST : 2 Other End - EAST : 0, WEST : 3
Start Date : 06-Nov-2019, Completion Date : 15-Nov-2019, Net Repair Days : 9, Total Man Hours : 1040

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC12609


Type : WGSCZ

Built Year : 2012

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

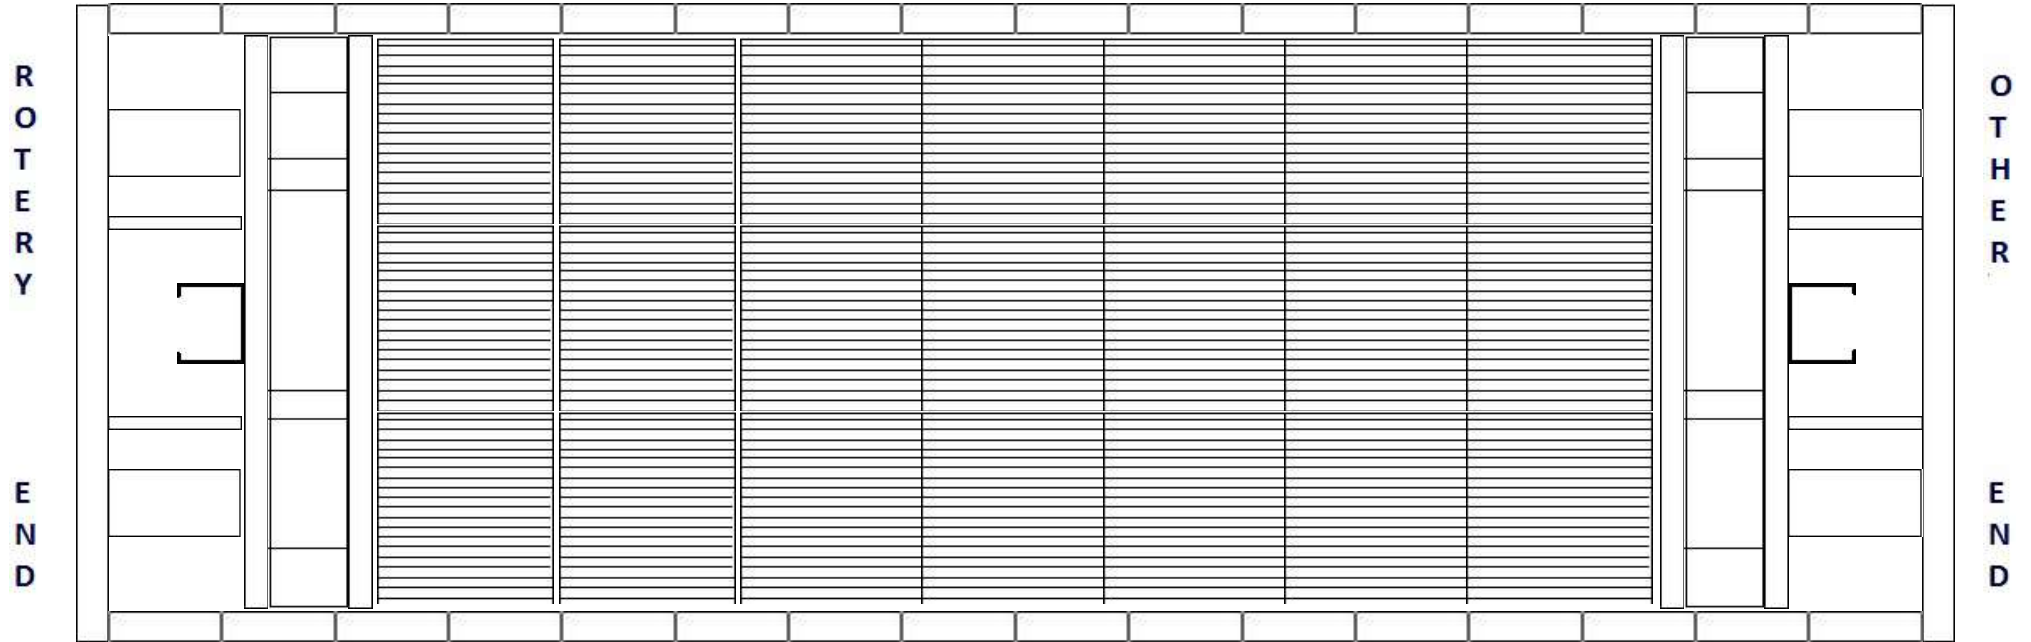

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		0%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 31-Jul-2019, Completion Date : 03-Aug-2019, Net Repair Days : 4, Total Man Hours : 56

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04703


Type : GSLRD

Built Year : 2004

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

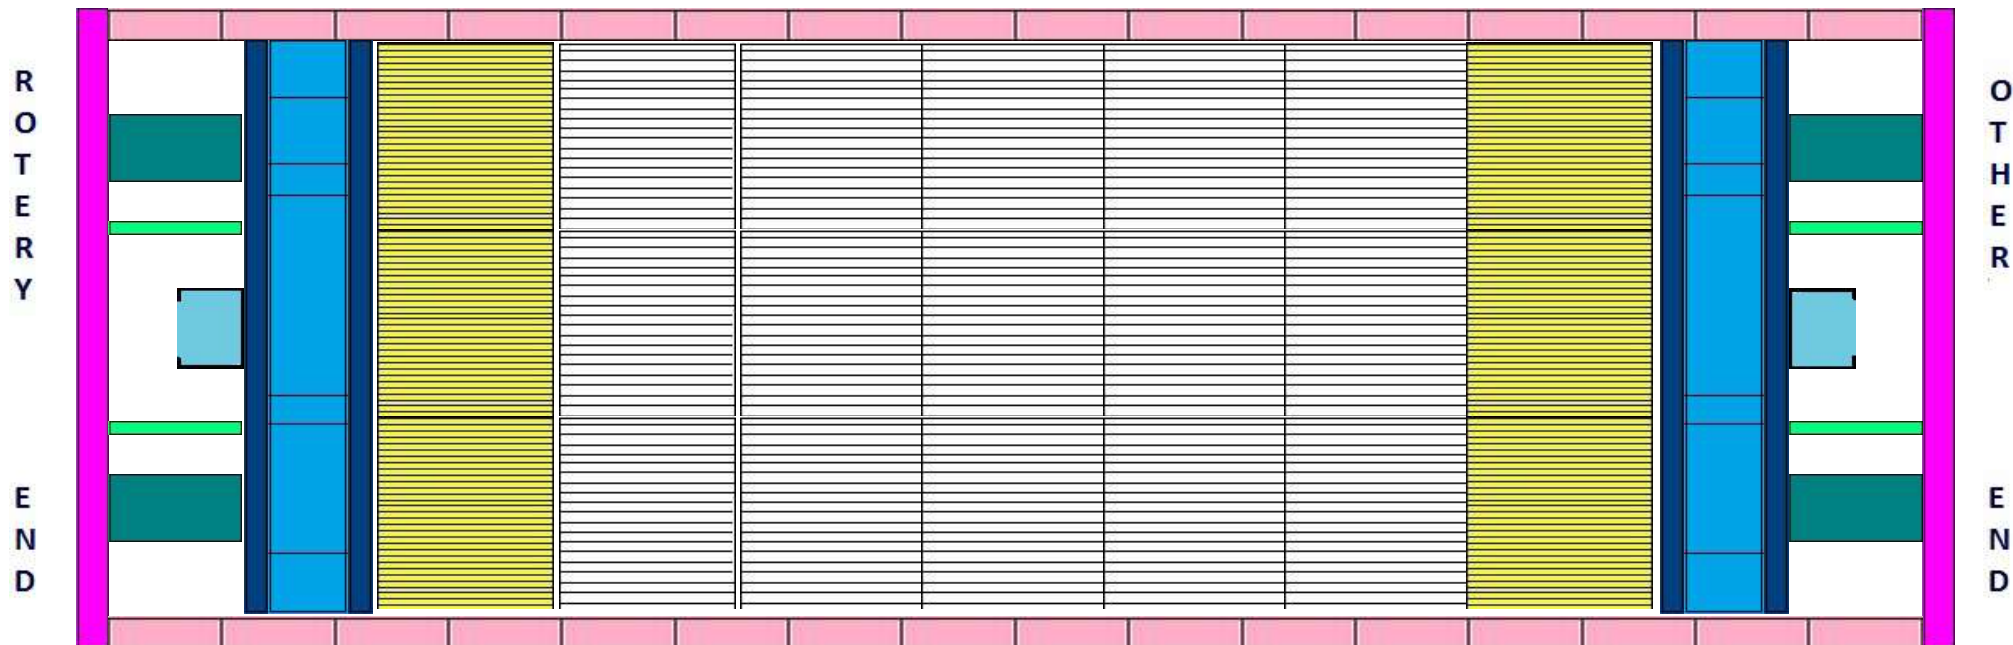

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	8	42%		Window Bar	12	7%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 10, WEST : 8 Other End - EAST : -10, WEST : -10
Start Date : 28-Jun-2019, Completion Date : 09-Jul-2019, Net Repair Days : 10, Total Man Hours : 1068

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04259


Type : CN

Built Year : 2004

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

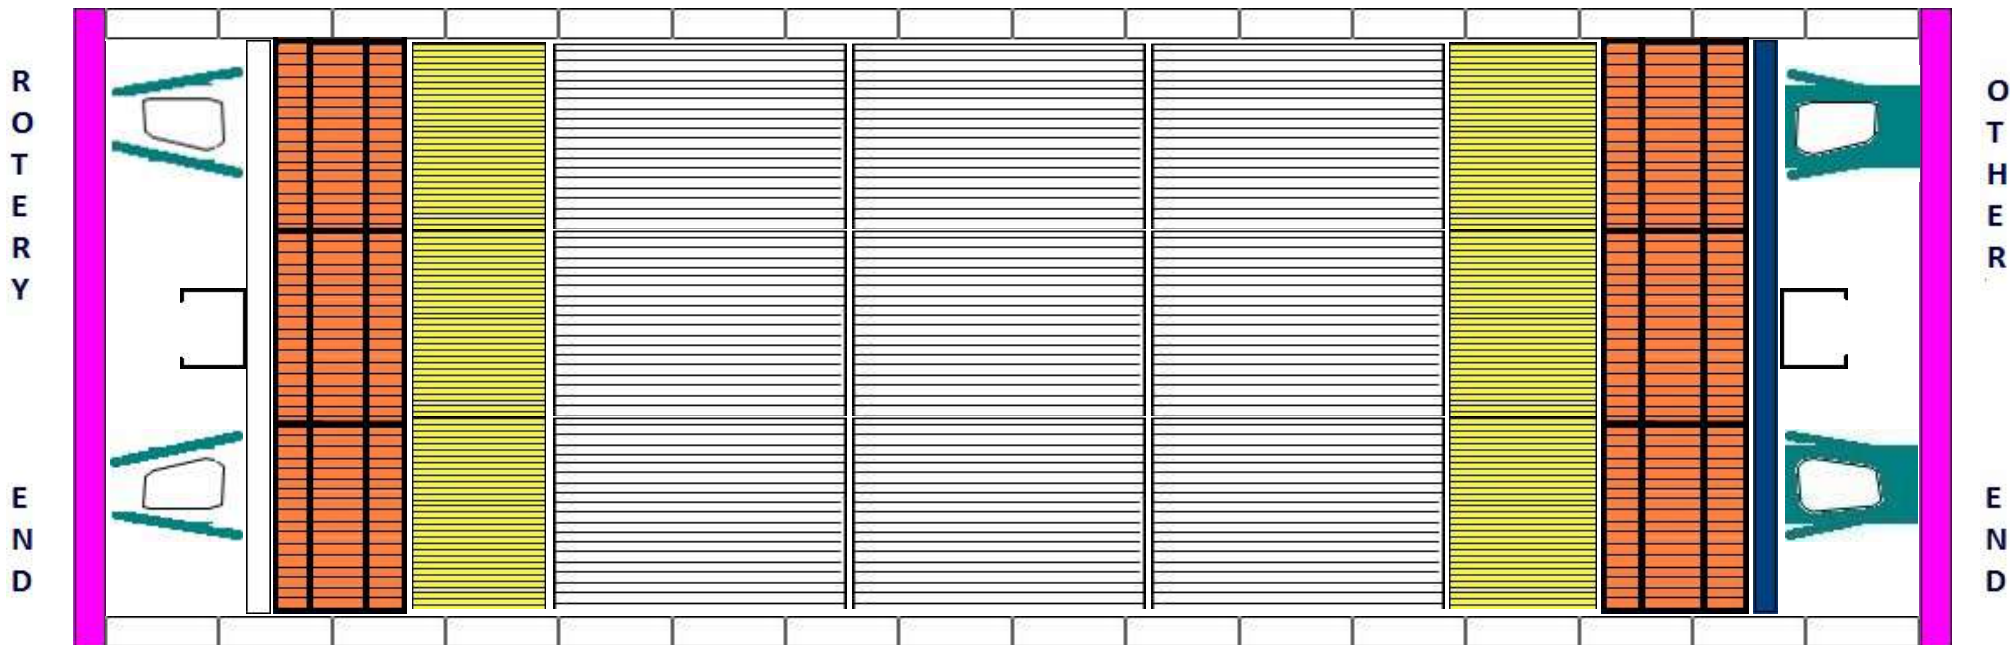

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	1	50%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	1	50%		Sole Bar	0	0%		Draft Gear Bracket	1	50%
	Trough floor	2	40%		Bottom Wall Part	0	0%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	0	0%
	Window Bar	0	0%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	0	100%								

End Drooping: Rotary End - EAST : -8, WEST : -7 Other End - EAST : -5, WEST : -5
Start Date : 15-Apr-2019, Completion Date : 23-Apr-2019, Net Repair Days : 8, Total Man Hours : 832

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	S K SHARMA - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
---------------------	----------------------	------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04253


Type : CN

Built Year : 2004

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

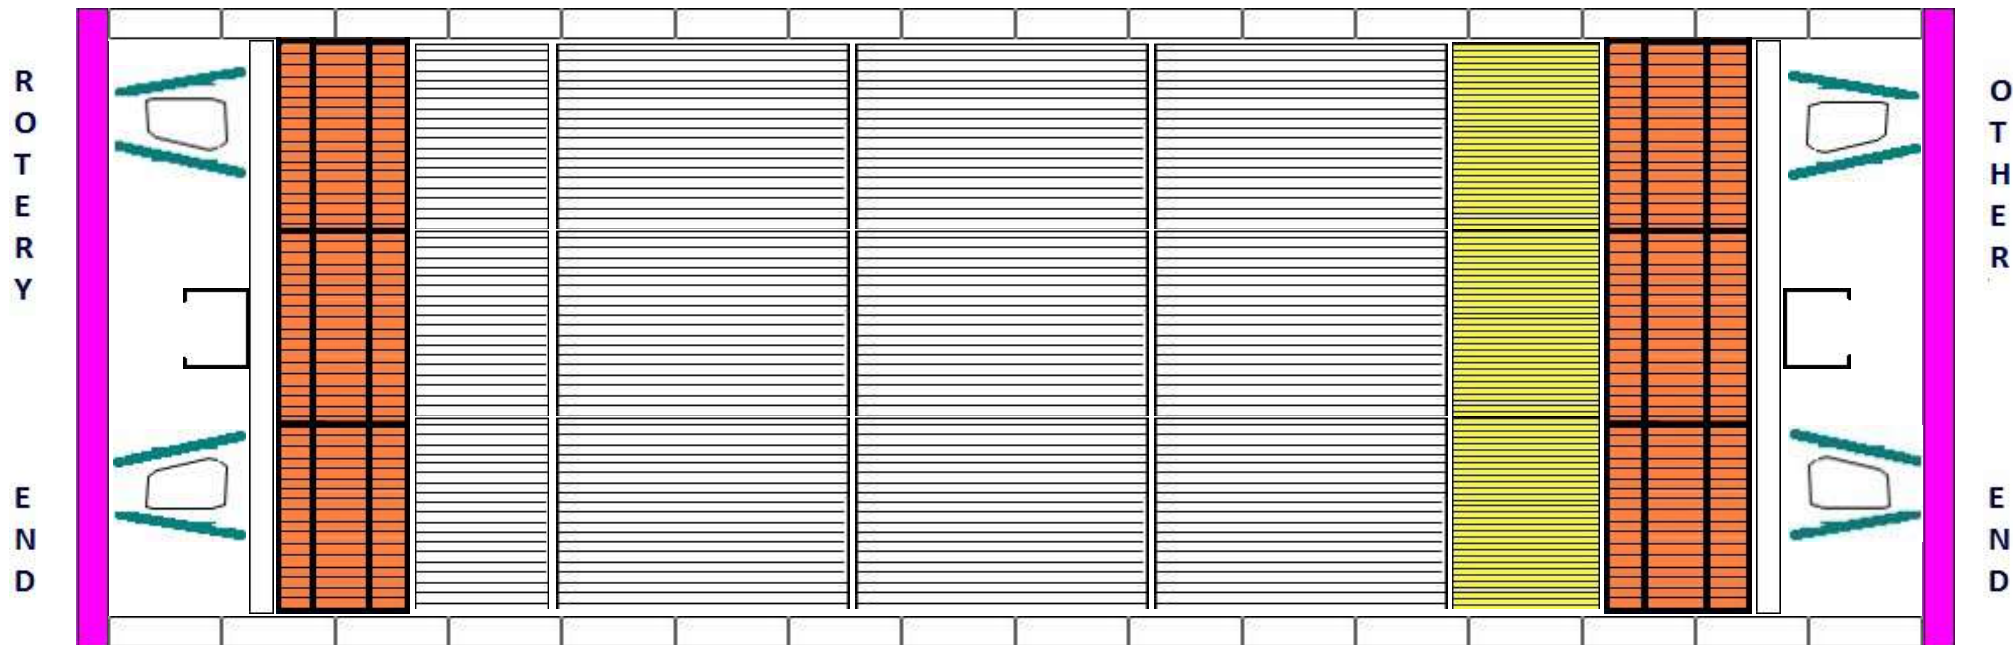

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	1	20%		Bottom Wall Part	0	0%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	8	20%
	Window Bar	10	5%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	0	100%								

End Drooping: Rotary End - EAST : -10, WEST : -7 Other End - EAST : -10, WEST : -5
Start Date : 10-Apr-2019, Completion Date : 18-Apr-2019, Net Repair Days : 8, Total Man Hours : 740

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
-----------------------	------------------	--------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC10429


Type : GS

Built Year : 2010

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

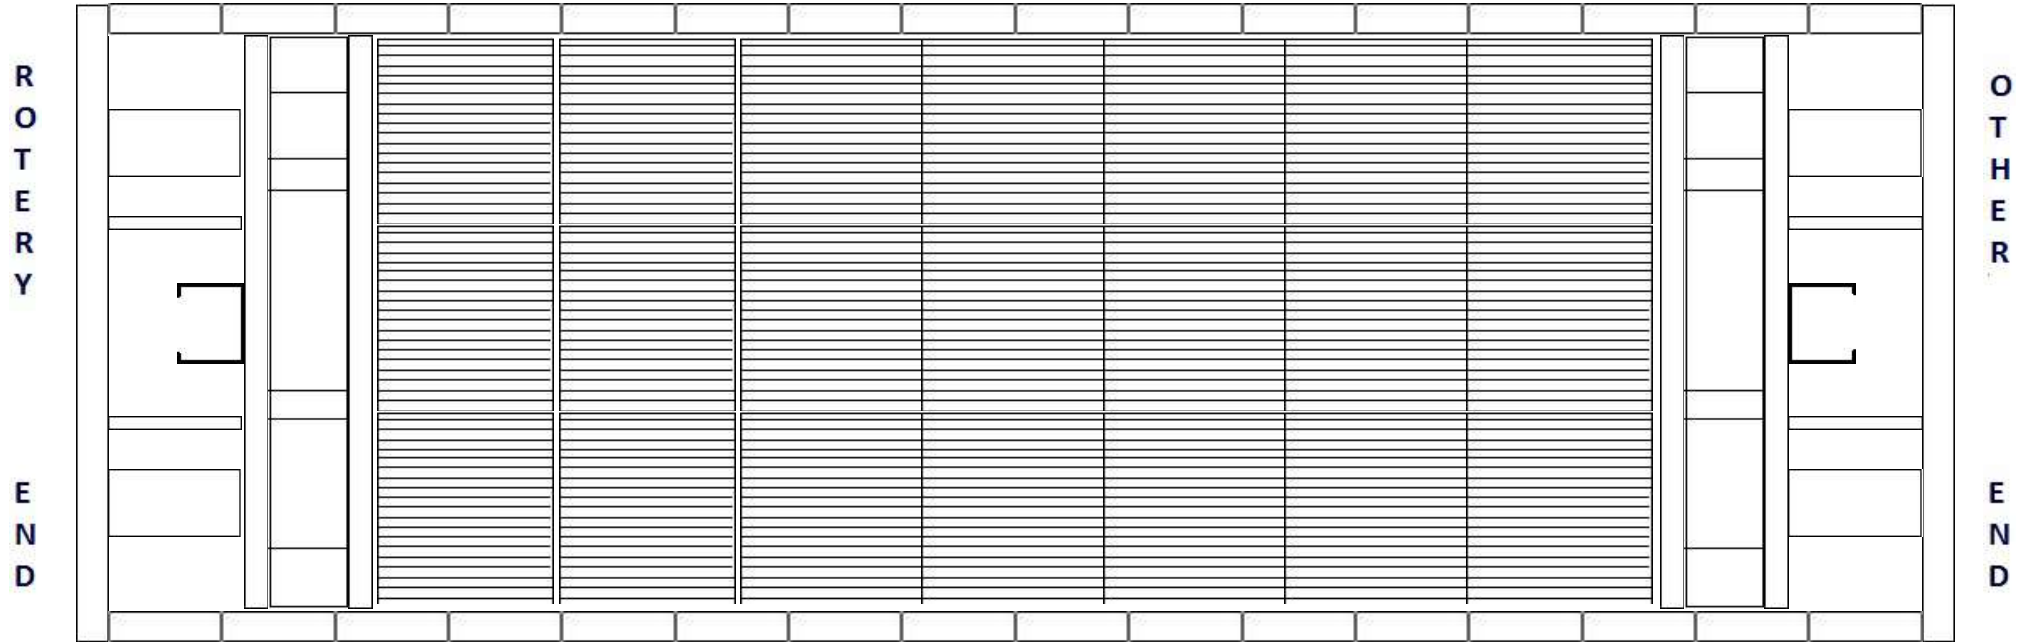

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		0%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 30-Aug-2019, Completion Date : 02-Sep-2019, Net Repair Days : 3, Total Man Hours : 472

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC12605


Type : WGSCZ

Built Year : 2012

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

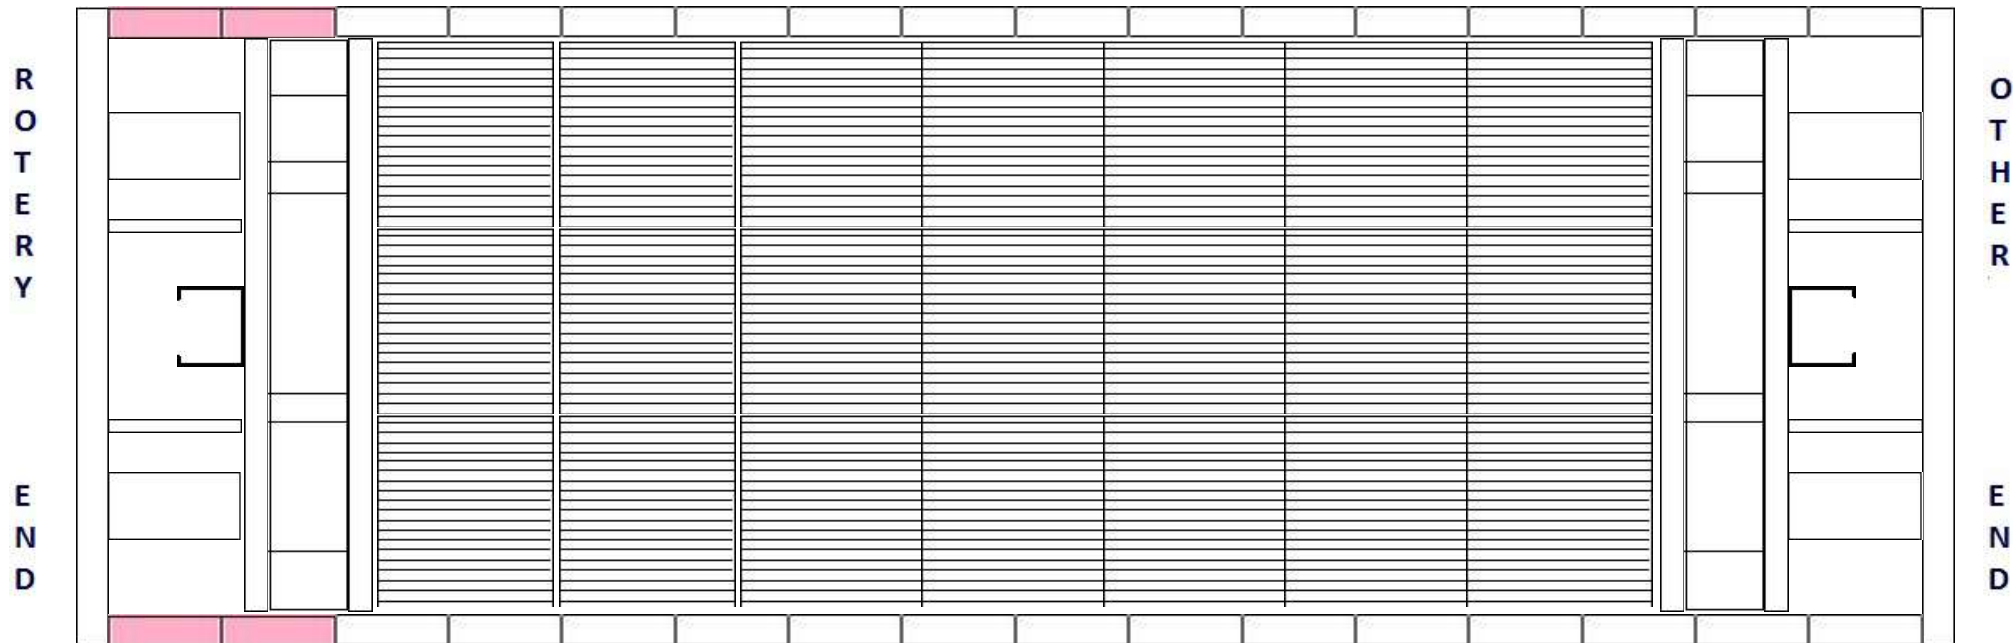

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	2	13%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2	13%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 24-Aug-2019, Completion Date : 27-Aug-2019, Net Repair Days : 3, Total Man Hours : 516

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	--------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07714


Type : GSRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

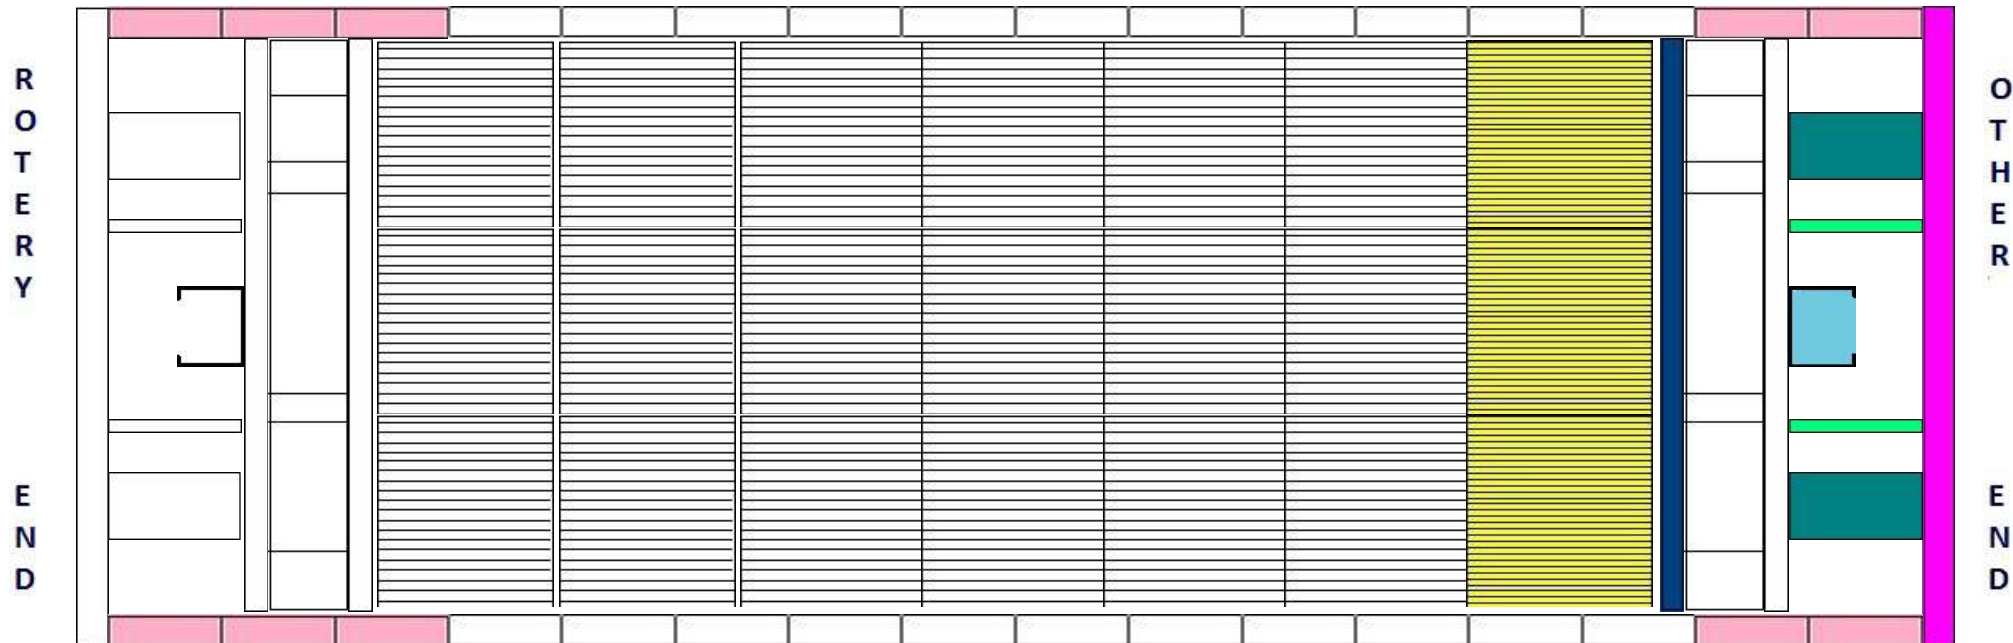

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	1	50%		Centre Stiffner for Headstock	2	50%		Floor Stiffner for Headstock	2	50%
	Aux. Head stock	2	50%		Sole Bar	5	31%		Draft Gear Bracket	1	50%
	Trough floor	1	14%		Centre plate	1	50%		SoleBar Stiffner	4	100%
	Bottom Wall Part	5	31%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	7	37%		Window Bar	20	24%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 3, WEST : 0
Start Date : 27-Aug-2019, Completion Date : 02-Sep-2019, Net Repair Days : 6, Total Man Hours : 792

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07704


Type : GSRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

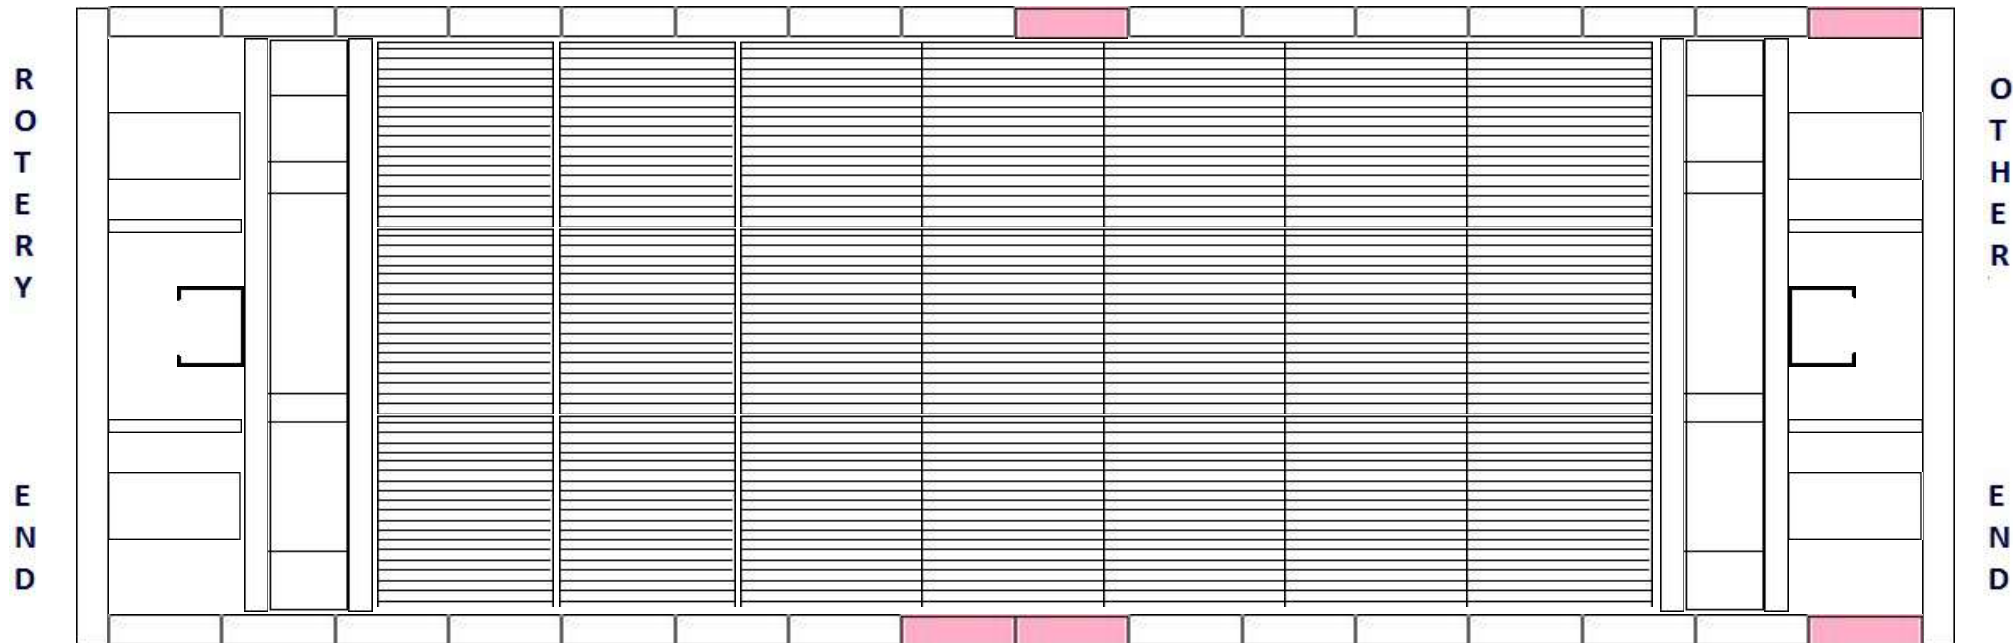

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	2.5	16%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2.5	16%		Body panel/patch		30%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	7	18%		Window Bar	84	49%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 19-Aug-2019, Completion Date : 21-Aug-2019, Net Repair Days : 3, Total Man Hours : 448

HAMANT JADAV - JE	M L KOLI - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	---------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07711


Type : GSRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

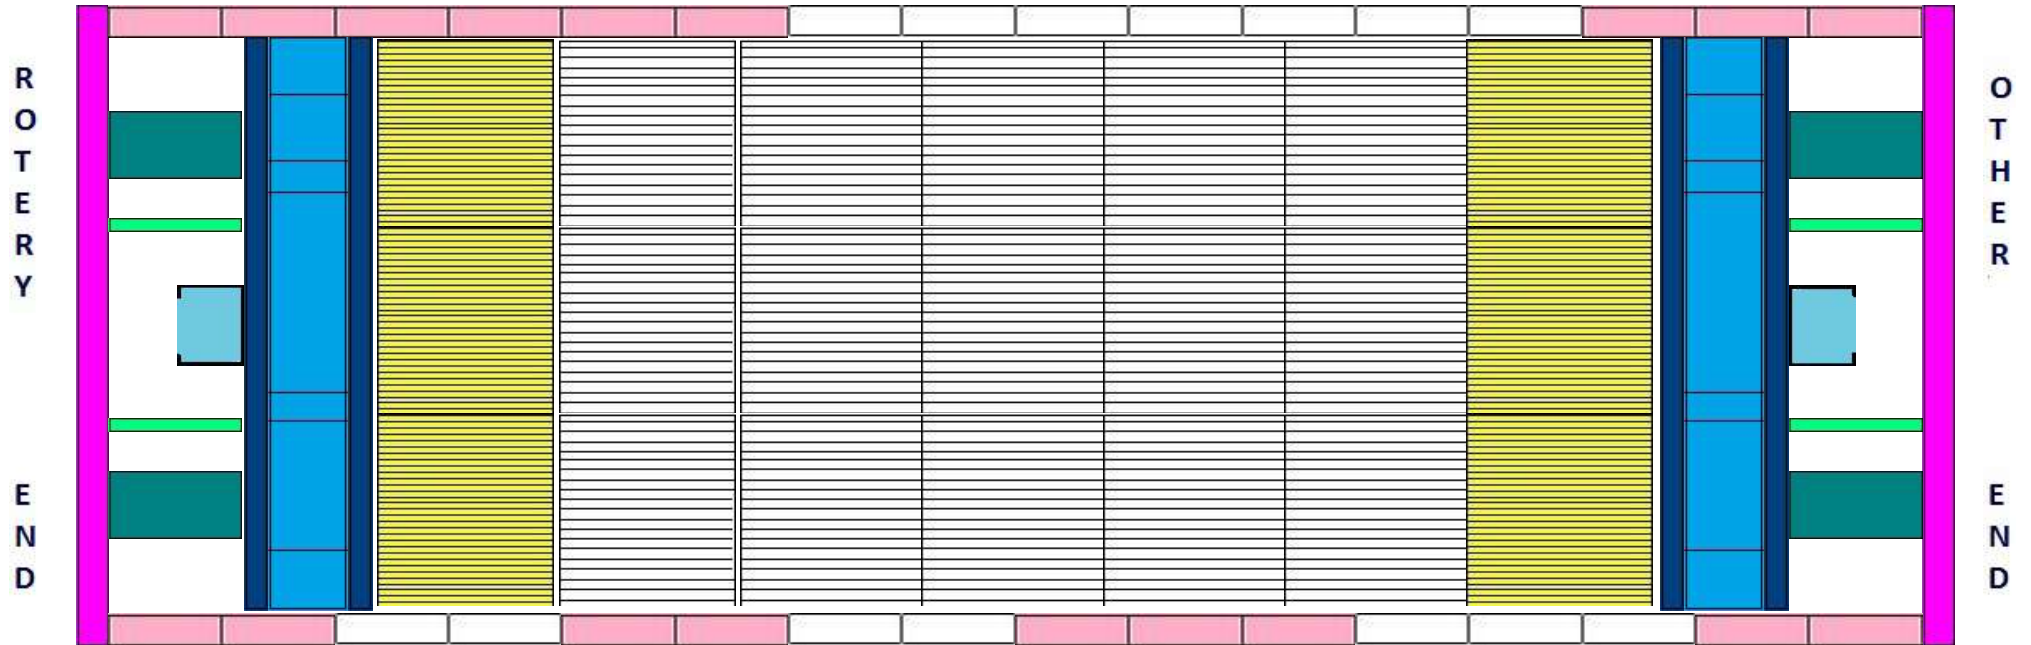

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Bright Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	9	56%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	9	56%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	20	50%		Window Bar	46	26%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 10, WEST : 10 Other End - EAST : -10, WEST : -8
Start Date : 28-Jun-2019, Completion Date : 06-Jul-2019, Net Repair Days : 8, Total Man Hours : 1404

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07411


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

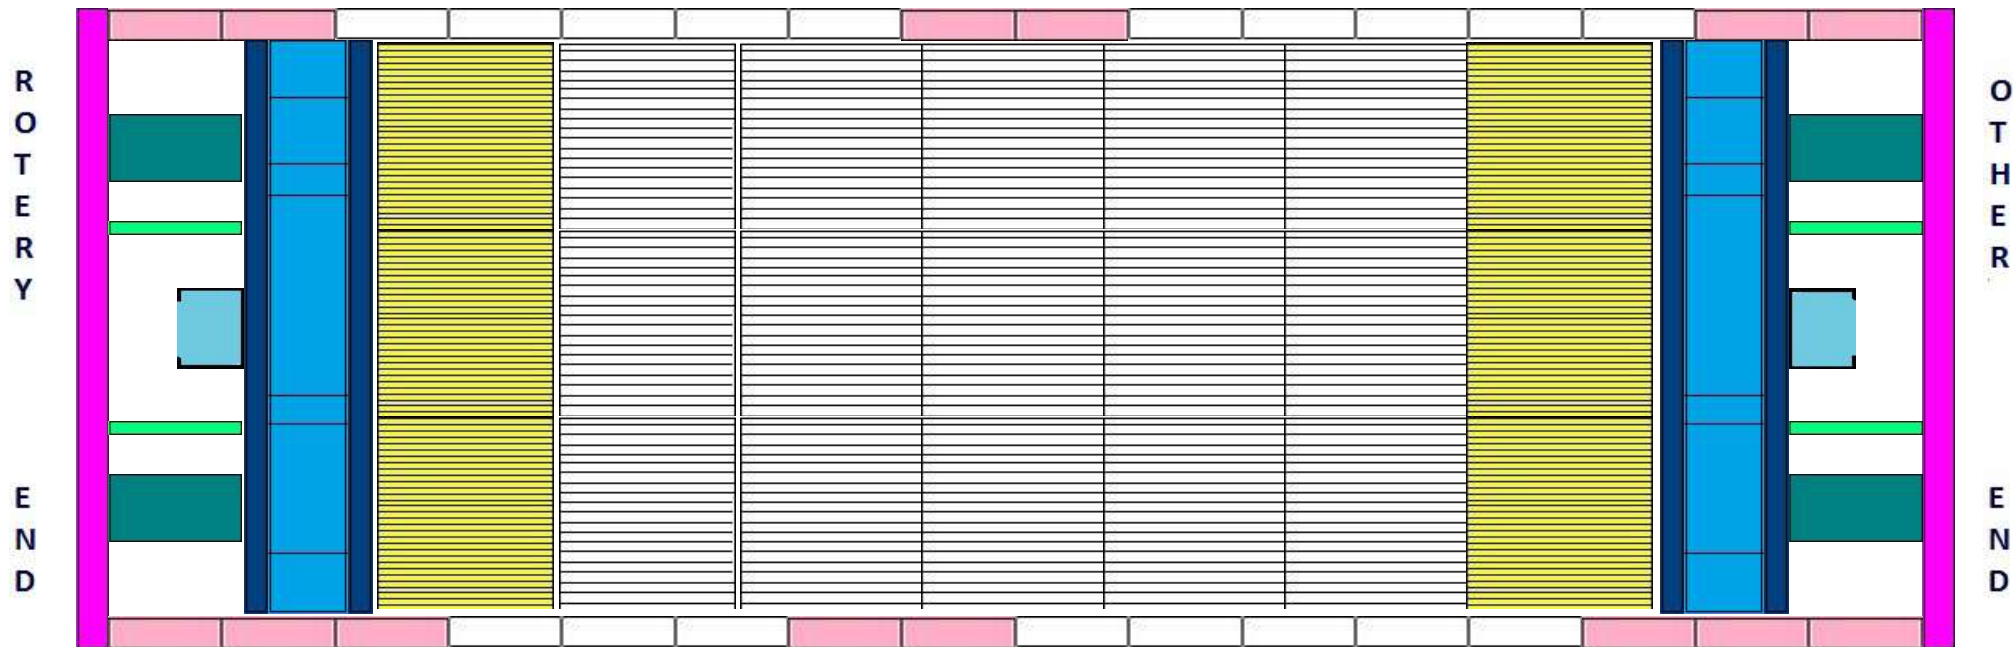

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	7	44%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	7	44%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	35%		Window Bar	40	23%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 24-Dec-2019, Completion Date : 01-Jan-2020, Net Repair Days : 8, Total Man Hours : 744

K K TRIPATHI - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC12710


Type : GSLRD

Built Year : 2012

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

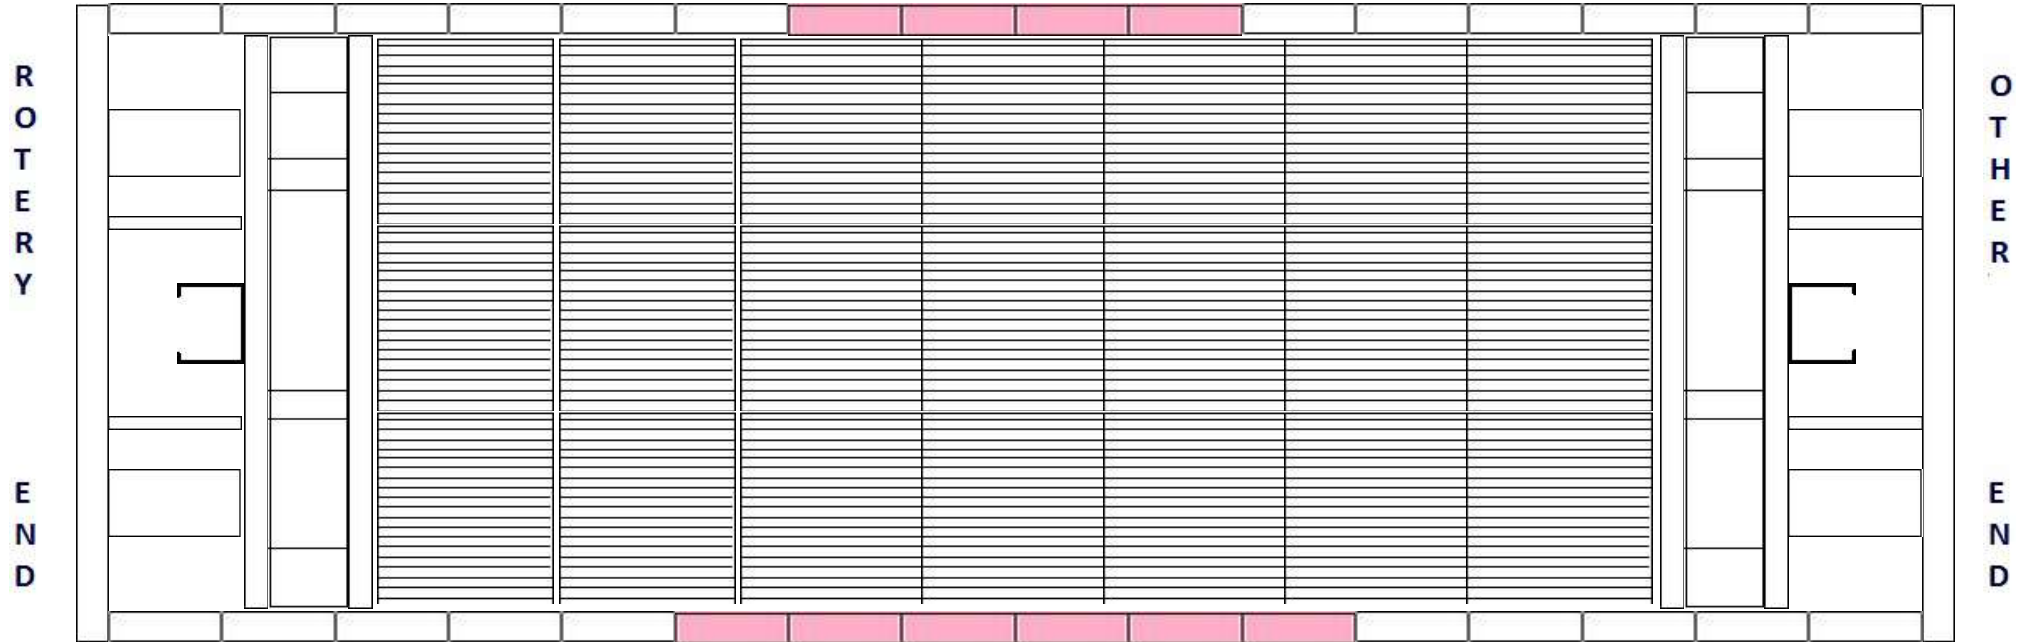

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	0	0%	Red	Centre Stiffner for Headstock	0	0%	Green	Floor Stiffner for Headstock	0	0%
Black	Aux. Head stock	0	0%	Pink	Sole Bar	5	31%	Light Blue	Draft Gear Bracket	0	0%
Yellow	Trough floor	0	0%	Light Blue	Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	5	31%		Body panel/patch		30%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 03-Feb-2020, Completion Date : 08-Feb-2020, Net Repair Days : 6, Total Man Hours : 0

P N VISHWKARMA - SSE	T R LAHRE - JE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	----------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC08403


Type : GS

Built Year : 2008

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

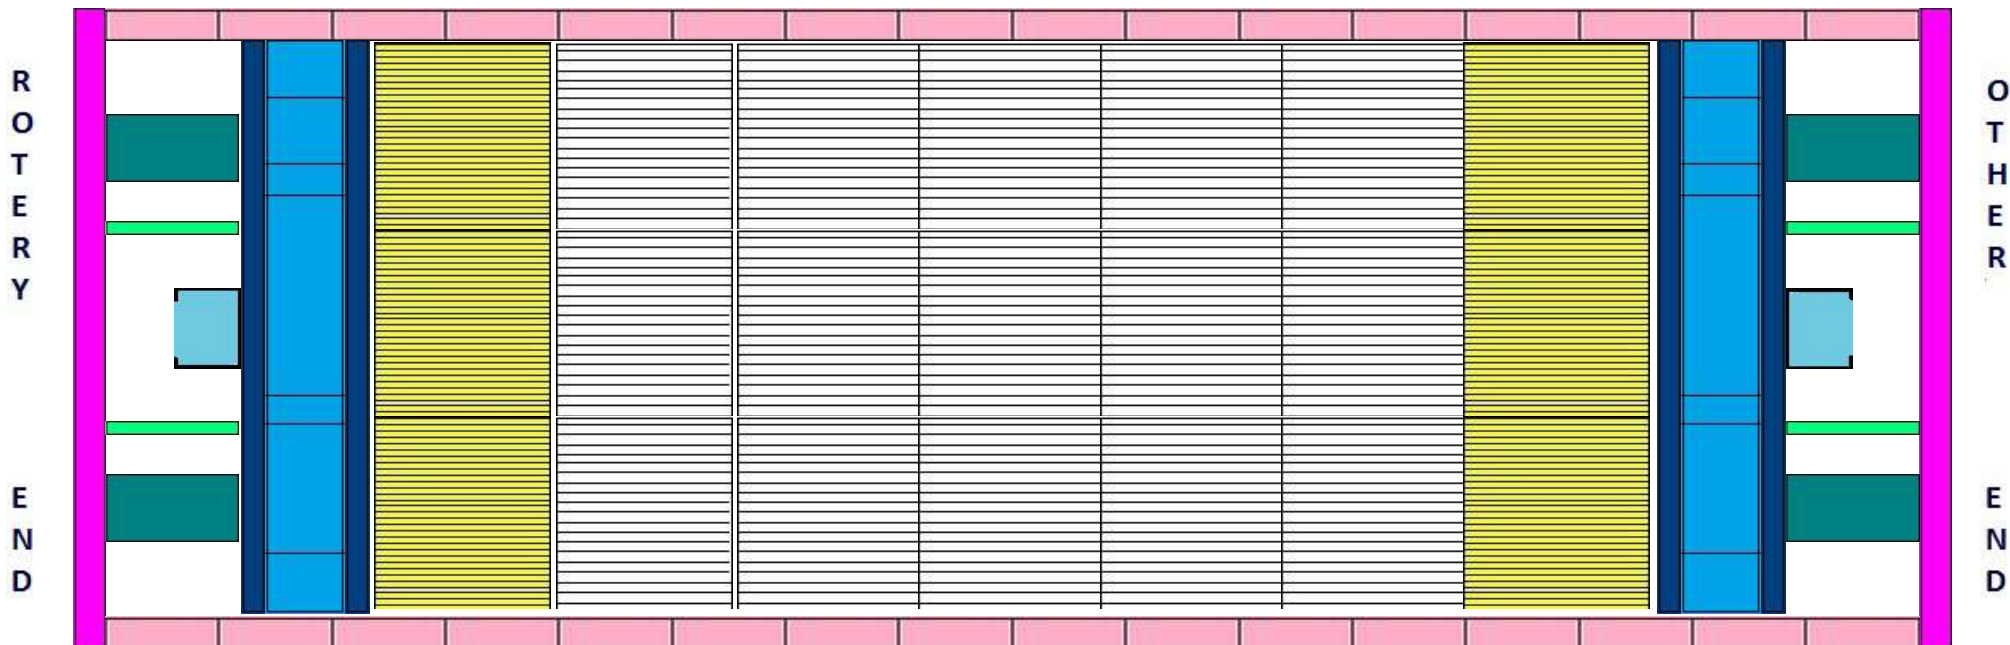

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Blue	Aux. Head stock	4	100%	Yellow	Sole Bar	16	100%	Blue	Draft Gear Bracket	2	100%
Red	Trough floor	2	29%	Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	20	50%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 28-Jan-2020, Completion Date : 08-Feb-2020, Net Repair Days : 11, Total Man Hours : 1008

P N VISHWKARMA - SSE	T R LAHRE - JE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	----------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC10602


Type : WGSCZ

Built Year : 2010

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

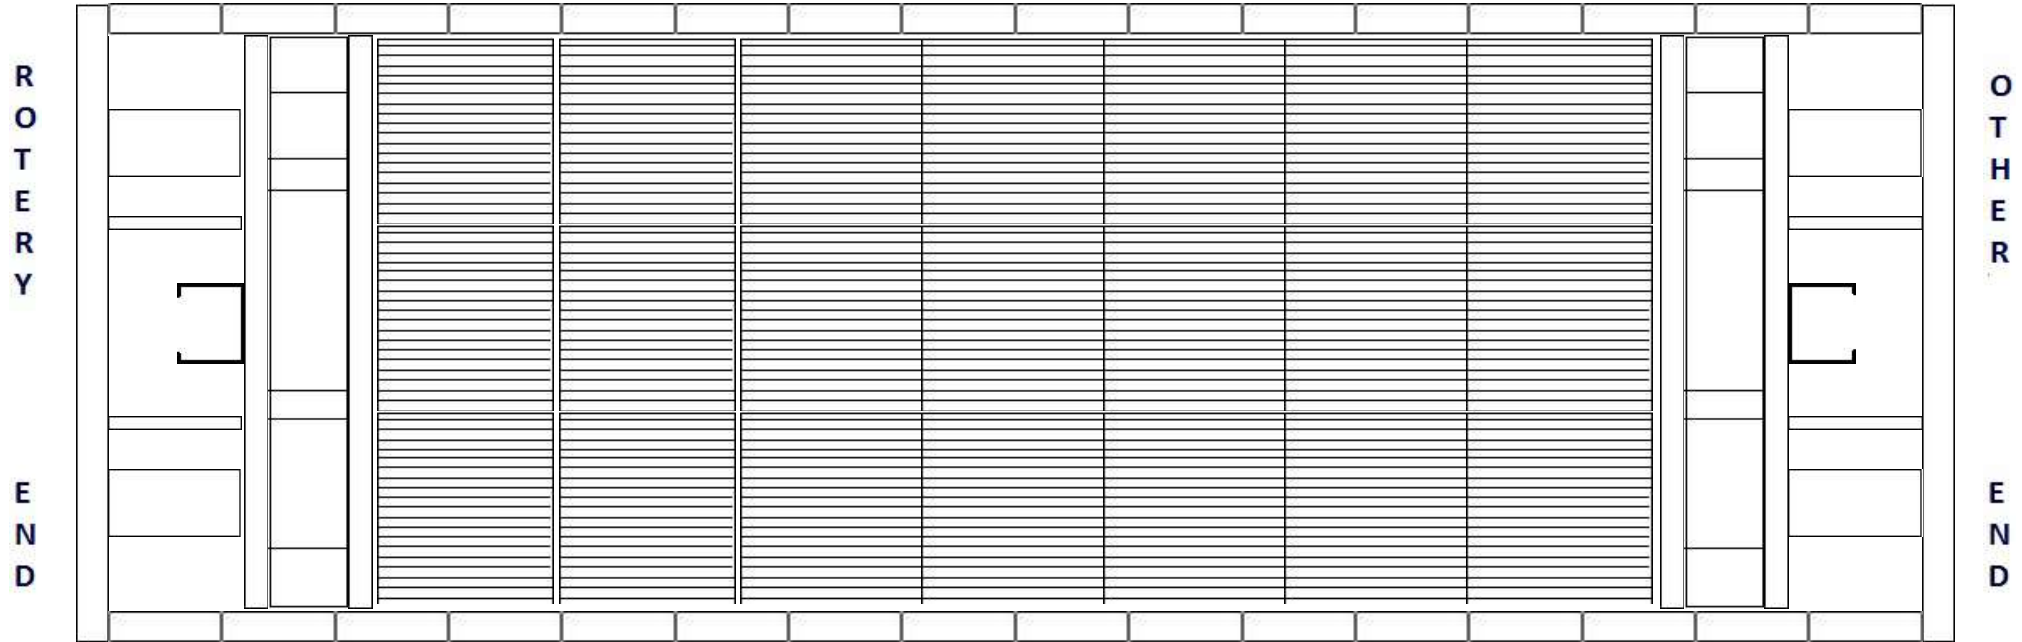

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	0	0%
	Bottom Wall Part	0	0%		Body panel/patch		20%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 22-Aug-2019, Completion Date : 26-Aug-2019, Net Repair Days : 4, Total Man Hours : 0

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC12443


Type : GS

Built Year : 2012

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

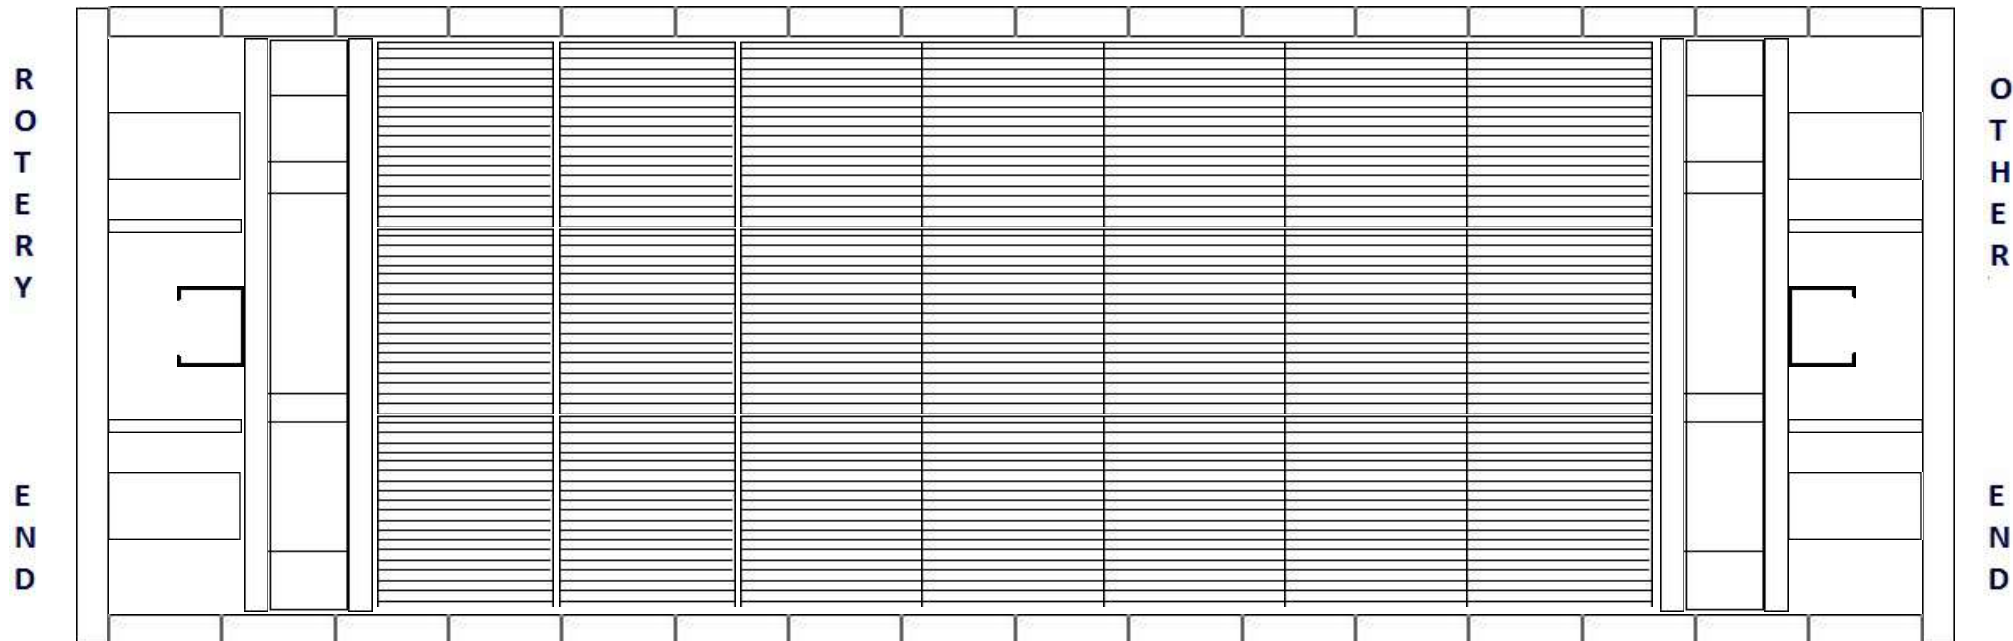

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 27-Aug-2019, Completion Date : 02-Sep-2019, Net Repair Days : 6, Total Man Hours : 528

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC12701


Type : GSLRD

Built Year : 2012

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

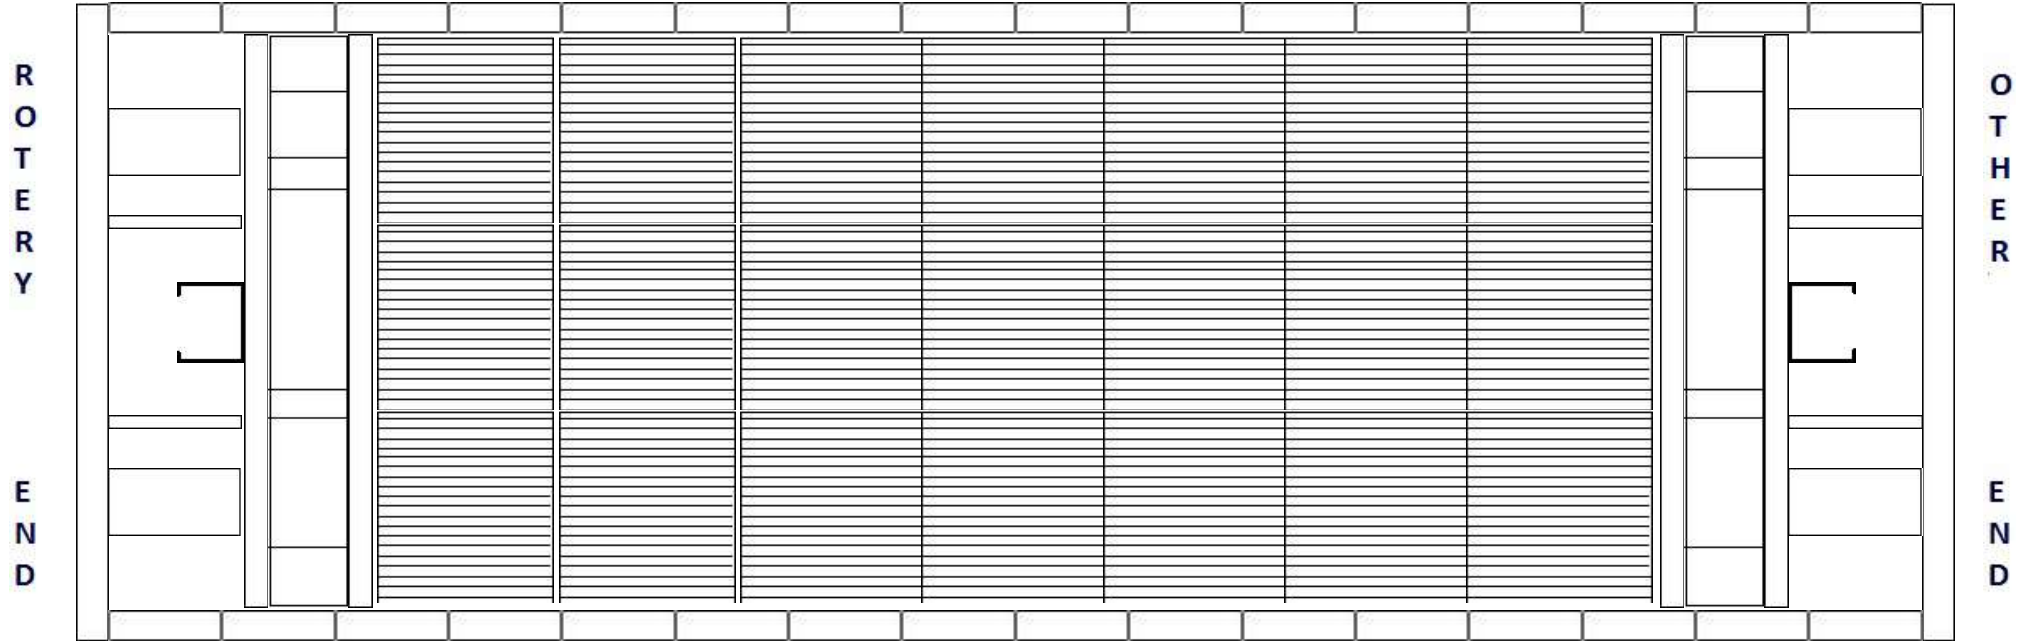

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		20%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 22-Aug-2019, Completion Date : 24-Aug-2019, Net Repair Days : 3, Total Man Hours : 0

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC13406


Type : GS

Built Year : 2013

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

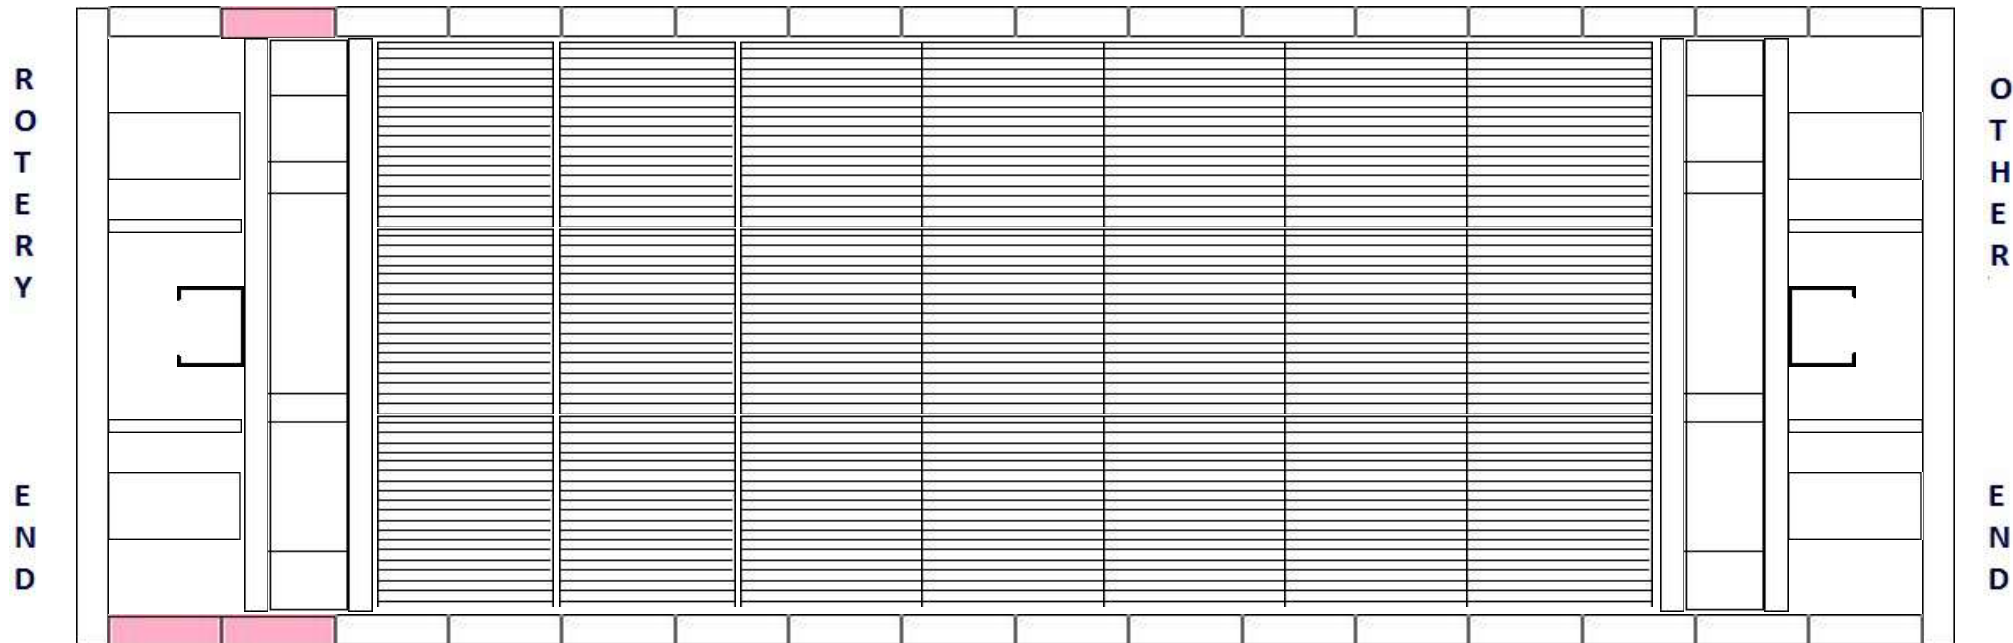

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	1.5	9%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	1.5	9%		Body panel/patch		20%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 30-Jan-2020, Completion Date : 05-Feb-2020, Net Repair Days : 6, Total Man Hours : 0

T R LAHRE - JE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC11402


Type : GS

Built Year : 2011

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

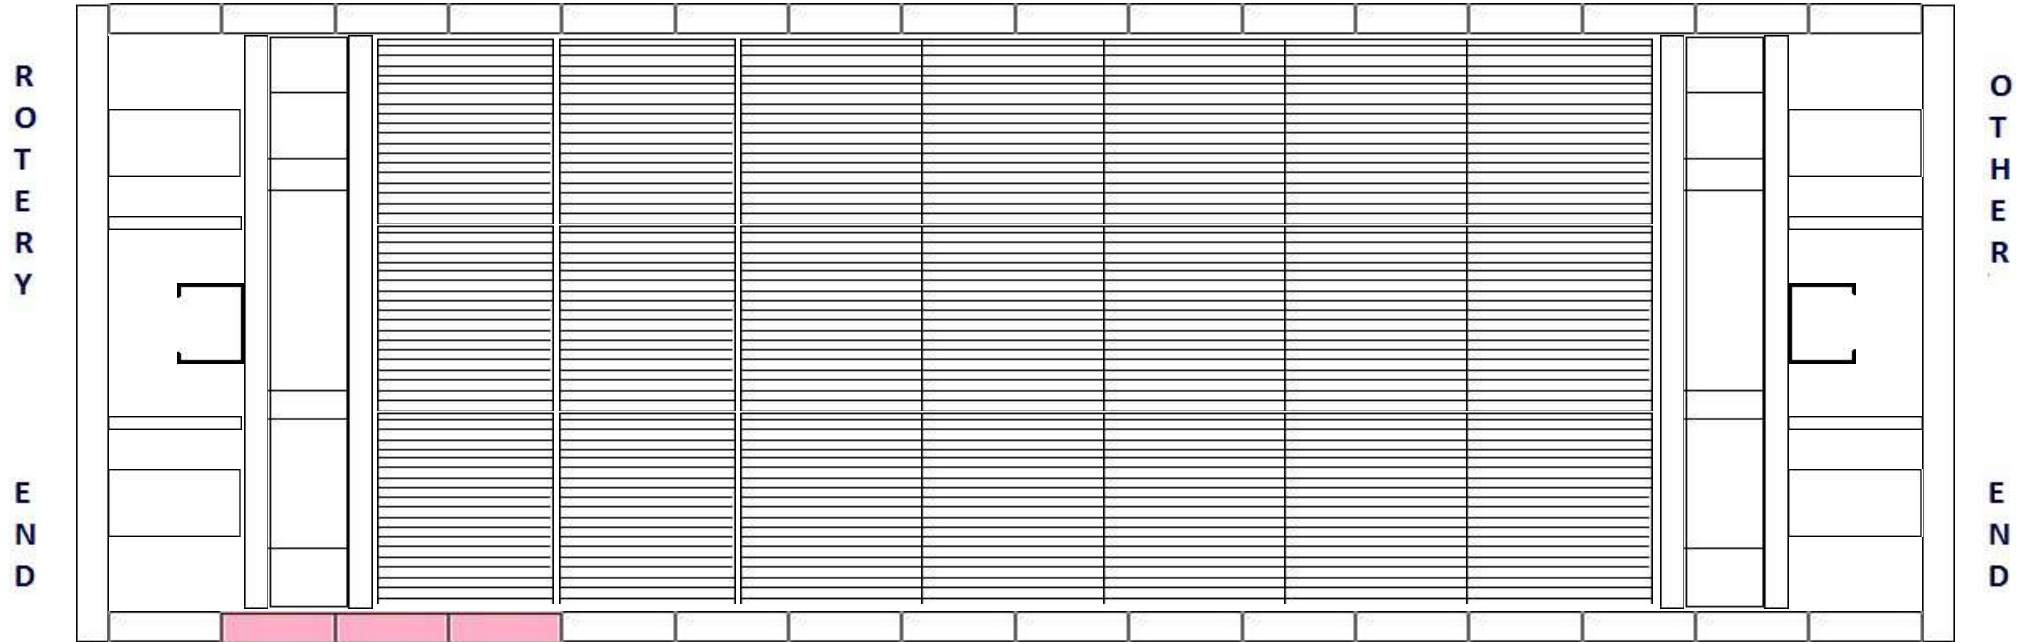

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	0	0%	Red	Centre Stiffner for Headstock	0	0%	Green	Floor Stiffner for Headstock	0	0%
Blue	Aux. Head stock	0	0%	Pink	Sole Bar	1.5	9%	Light Blue	Draft Gear Bracket	0	0%
Orange	Trough floor	0	0%	Light Blue	Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	1.5	9%		Body panel/patch		20%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 29-Jan-2020, Completion Date : 03-Feb-2020, Net Repair Days : 5, Total Man Hours : 0

ANASTA PRASAD - JE	MOHD. JAFER QURASHI - JE	S K SHARMA - SSE	ARUN SINGH - SSE In-charge	Verified By:QU-Incharge
--------------------	--------------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC12712


Type : GSLRD

Built Year : 2012

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

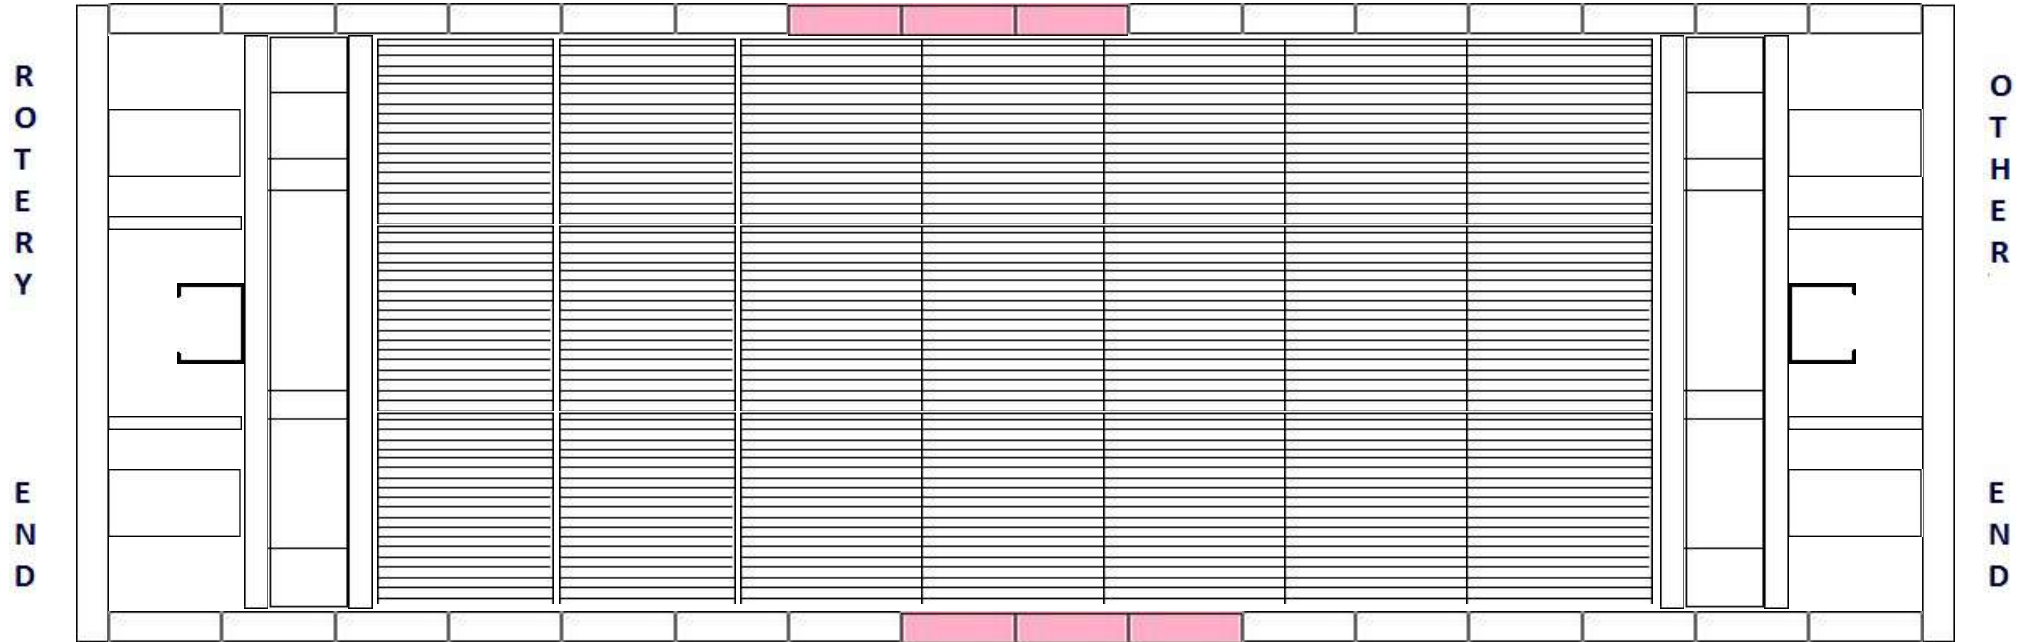

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	3	19%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	3	19%		Body panel/patch		30%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 29-Jan-2020, Completion Date : 01-Feb-2020, Net Repair Days : 4, Total Man Hours : 0

ANASTA PRASAD - JE	MOHD. JAFER QURASHI - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	--------------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC11602


Type : WGSCZ

Built Year : 2011

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

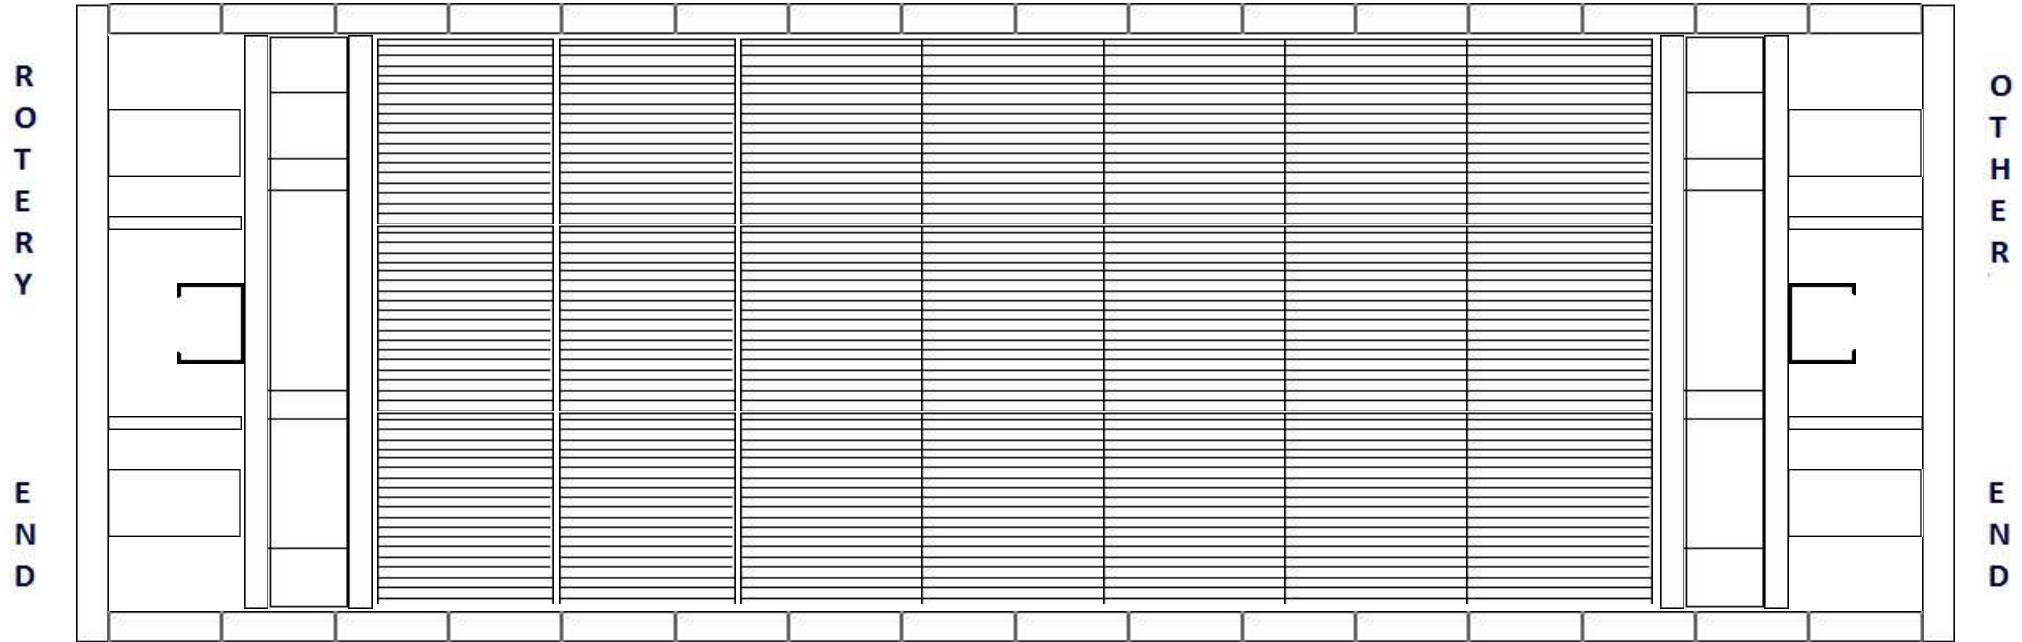

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		20%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 03-Sep-2019, Completion Date : 05-Sep-2019, Net Repair Days : 3, Total Man Hours : 444

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC05728


Type : GSLRD

Built Year : 2005

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

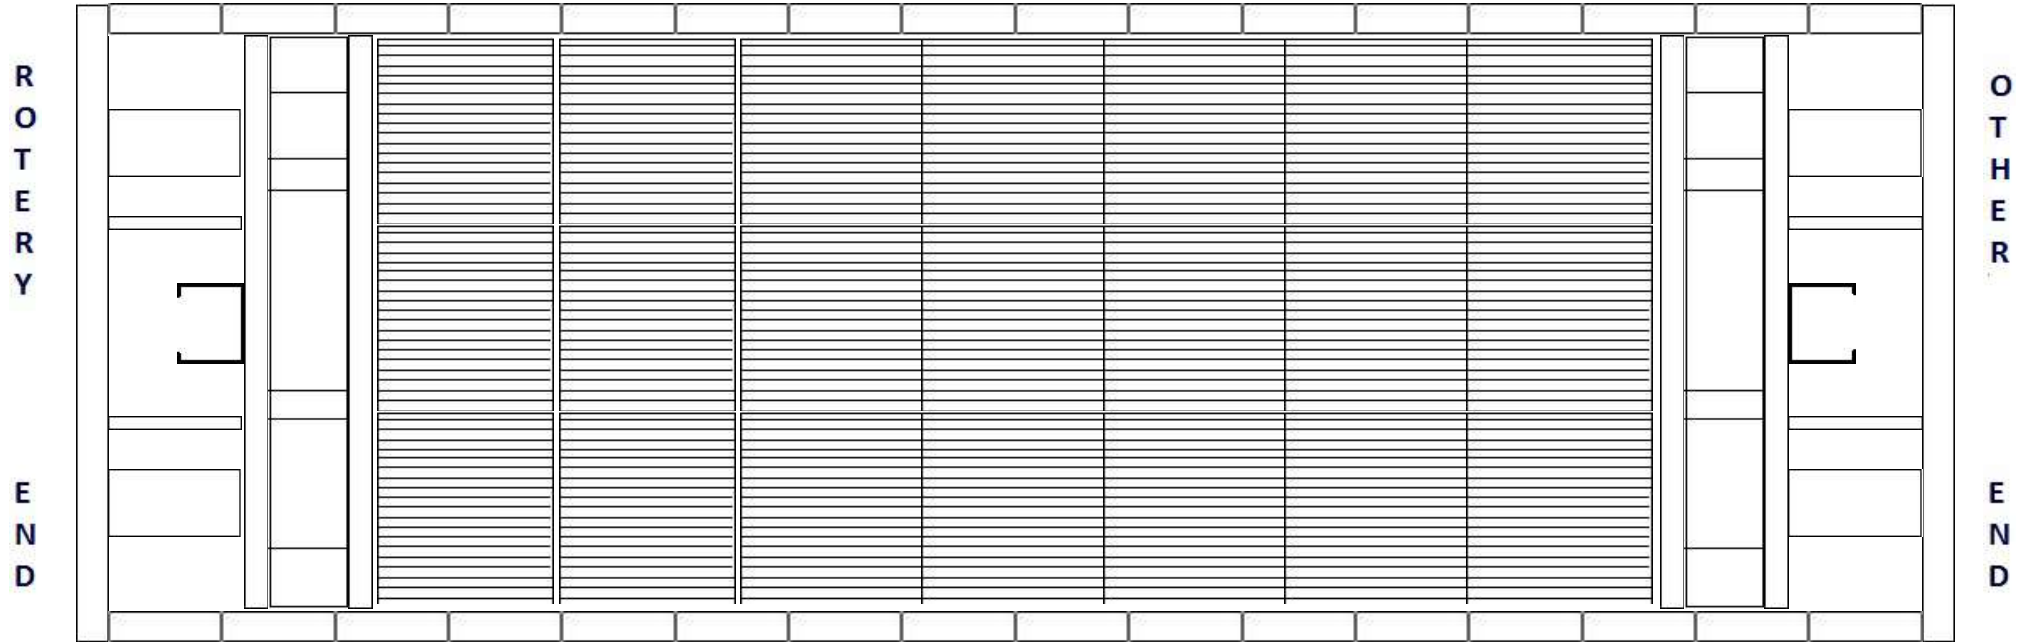

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		20%		Door Top/Roof Patch		100%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 06-Sep-2019, Completion Date : 07-Sep-2019, Net Repair Days : 2, Total Man Hours : 136

HAMANT JADAV - JE	M L KOLI - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	---------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07713


Type : GSRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

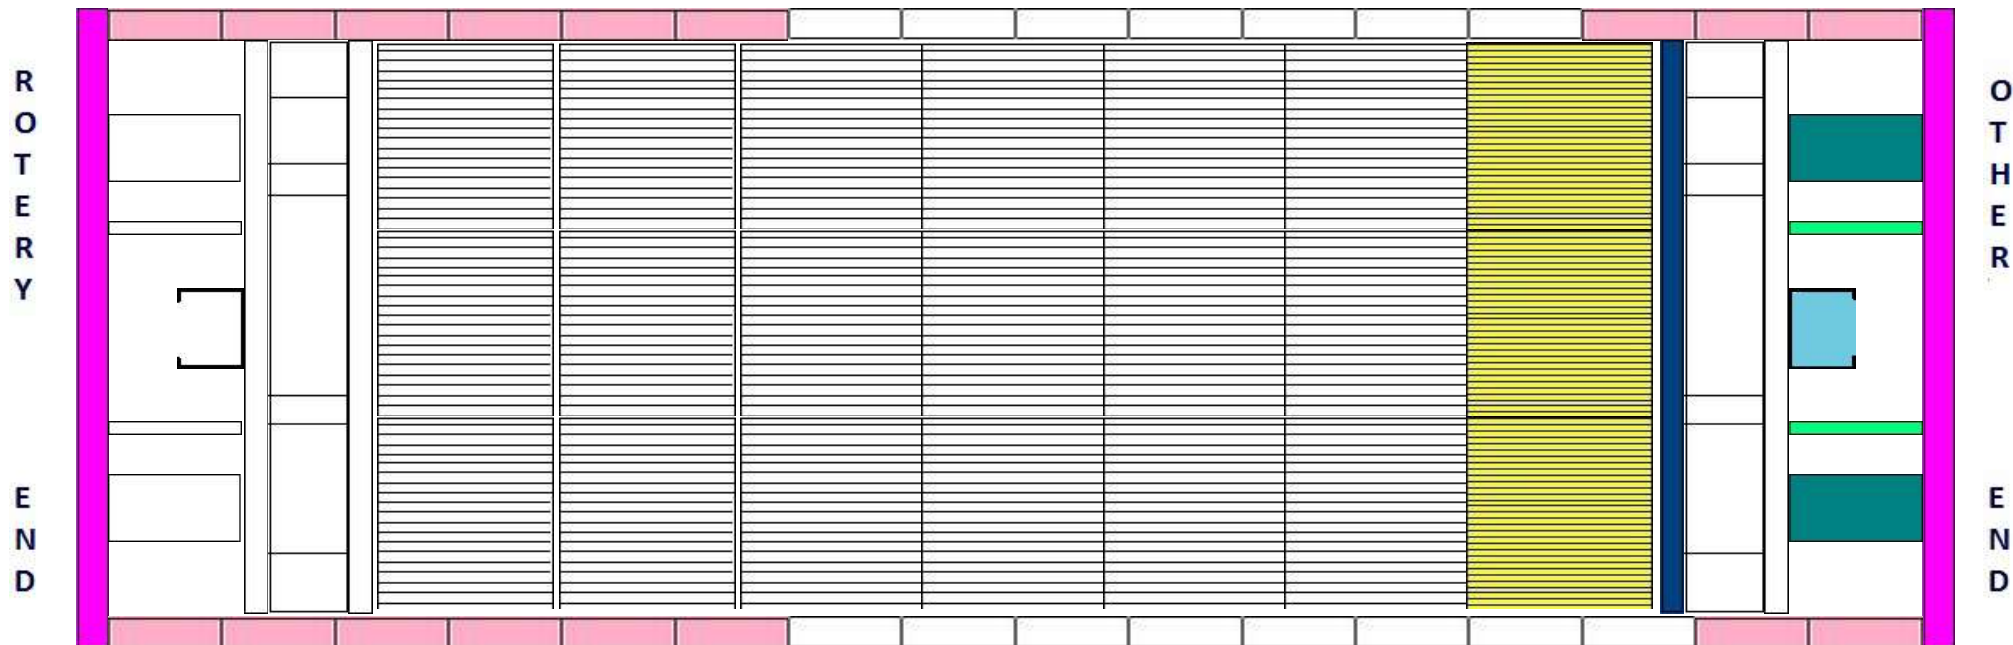

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Blue	Centre Stiffner for Headstock	2	50%	Green	Floor Stiffner for Headstock	2	50%
Pink	Aux. Head stock	2	50%	Yellow	Sole Bar	8.5	53%	Blue	Draft Gear Bracket	1	50%
Blue	Trough floor	1	14%	Green	Centre plate	1	50%		SoleBar Stiffner	4	100%
	Bottom Wall Part	8.5	53%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	39%		Window Bar	36	21%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 09-Aug-2019, Completion Date : 21-Aug-2019, Net Repair Days : 11, Total Man Hours : 0

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC12601


Type : WGSCZ

Built Year : 2012

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

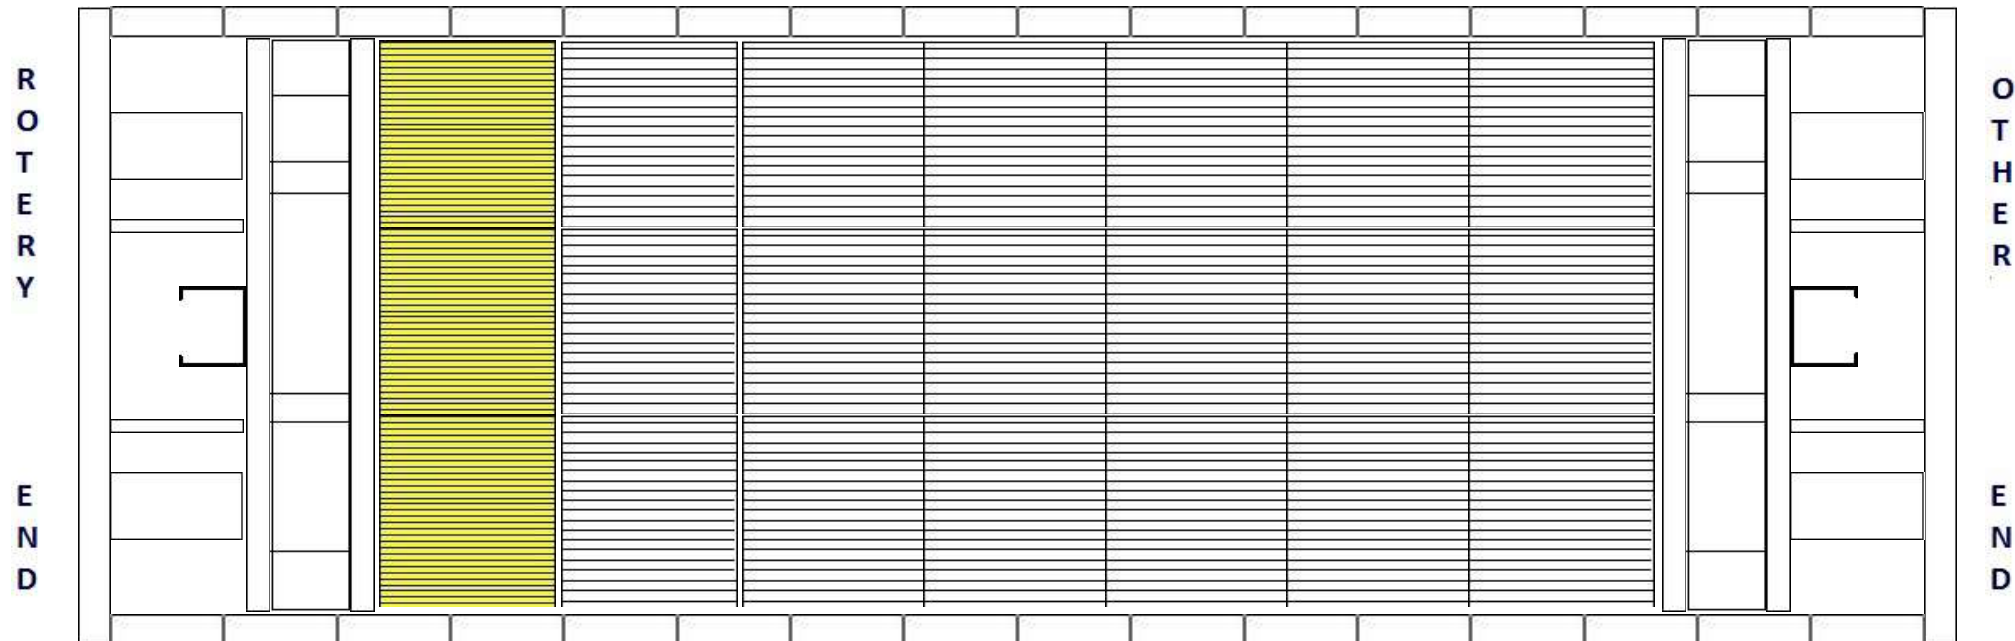

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	1	14%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		20%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 09-Aug-2019, Completion Date : 13-Aug-2019, Net Repair Days : 4, Total Man Hours : 388

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC10425


Type : GS

Built Year : 2010

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

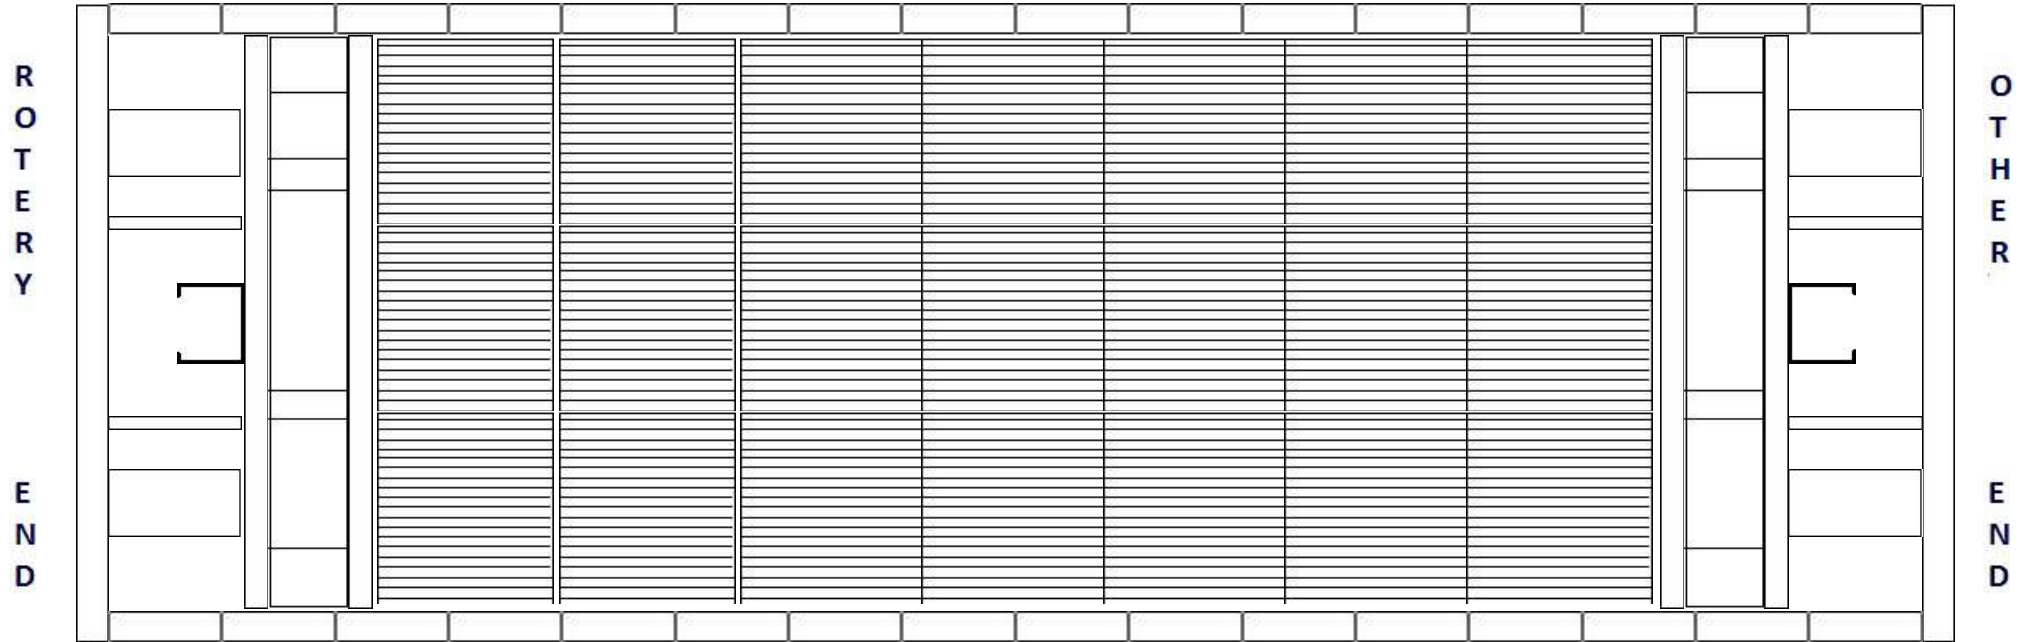

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		0%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 06-Aug-2019, Completion Date : 08-Aug-2019, Net Repair Days : 3, Total Man Hours : 264

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07708


Type : GSRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

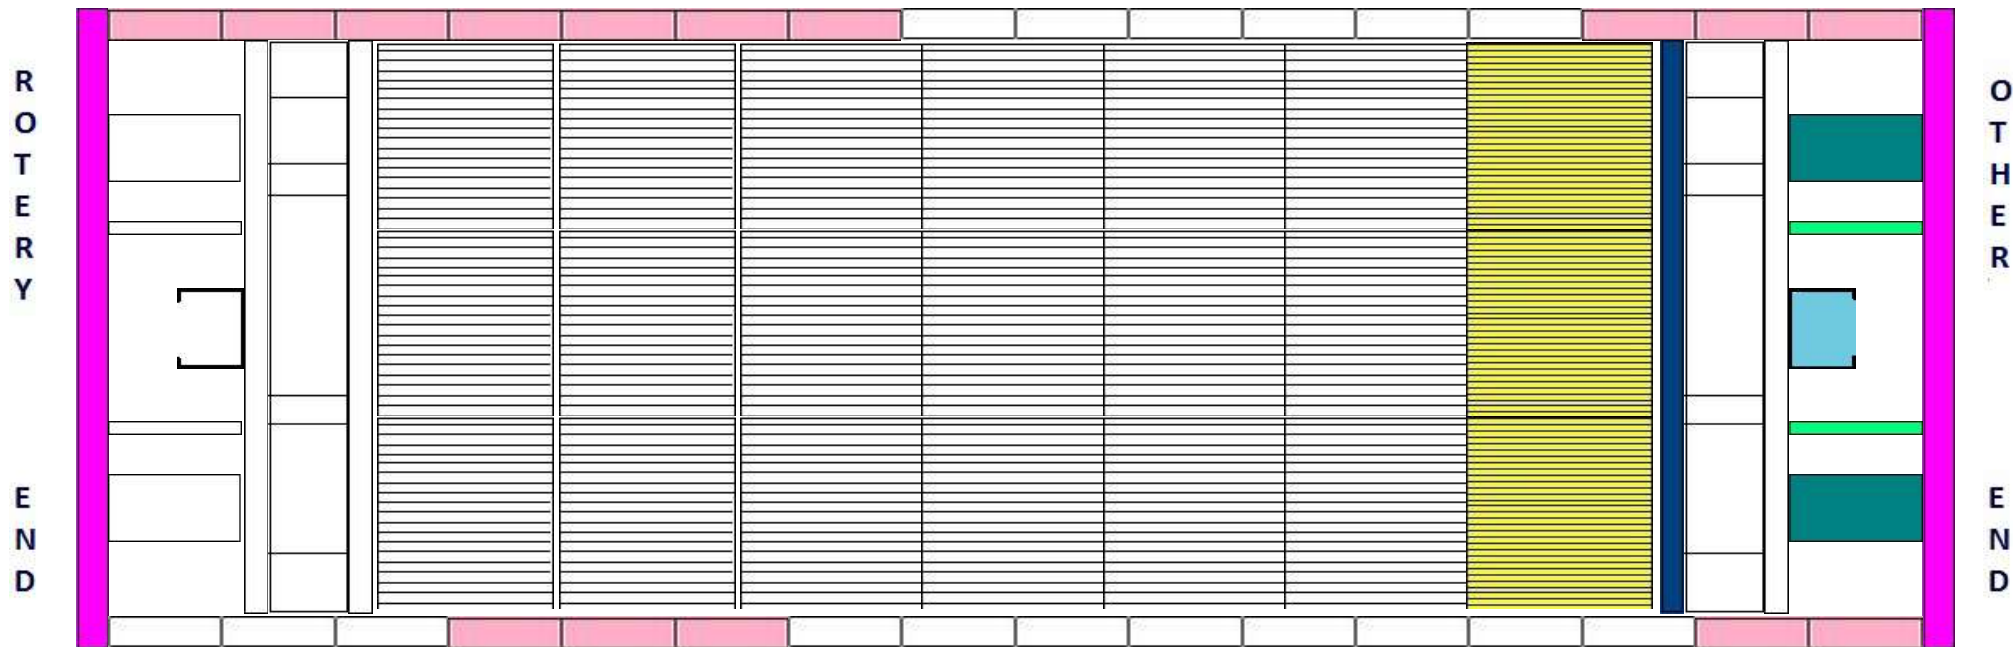

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	2	50%	Blue	Floor Stiffner for Headstock	2	50%
Pink	Aux. Head stock	2	50%	Blue	Sole Bar	7.5	47%	Yellow	Draft Gear Bracket	1	50%
Blue	Trough floor	1	14%	Blue	Centre plate	1	50%	Blue	SoleBar Stiffner	4	100%
Blue	Bottom Wall Part	7.5	47%	Blue	Body panel/patch		100%	Blue	Door Top/Roof Patch		0%
Blue	Window Module		0%	Blue	Window Sill	20	67%	Blue	Window Bar	18	21%
Blue	Seat pillar/lav. Partition		100%	Blue	UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : -4 Other End - EAST : -6, WEST : -5
Start Date : 06-Aug-2019, Completion Date : 14-Aug-2019, Net Repair Days : 8, Total Man Hours : 1168

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	--------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC12602


Type : CZ

Built Year : 2012

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

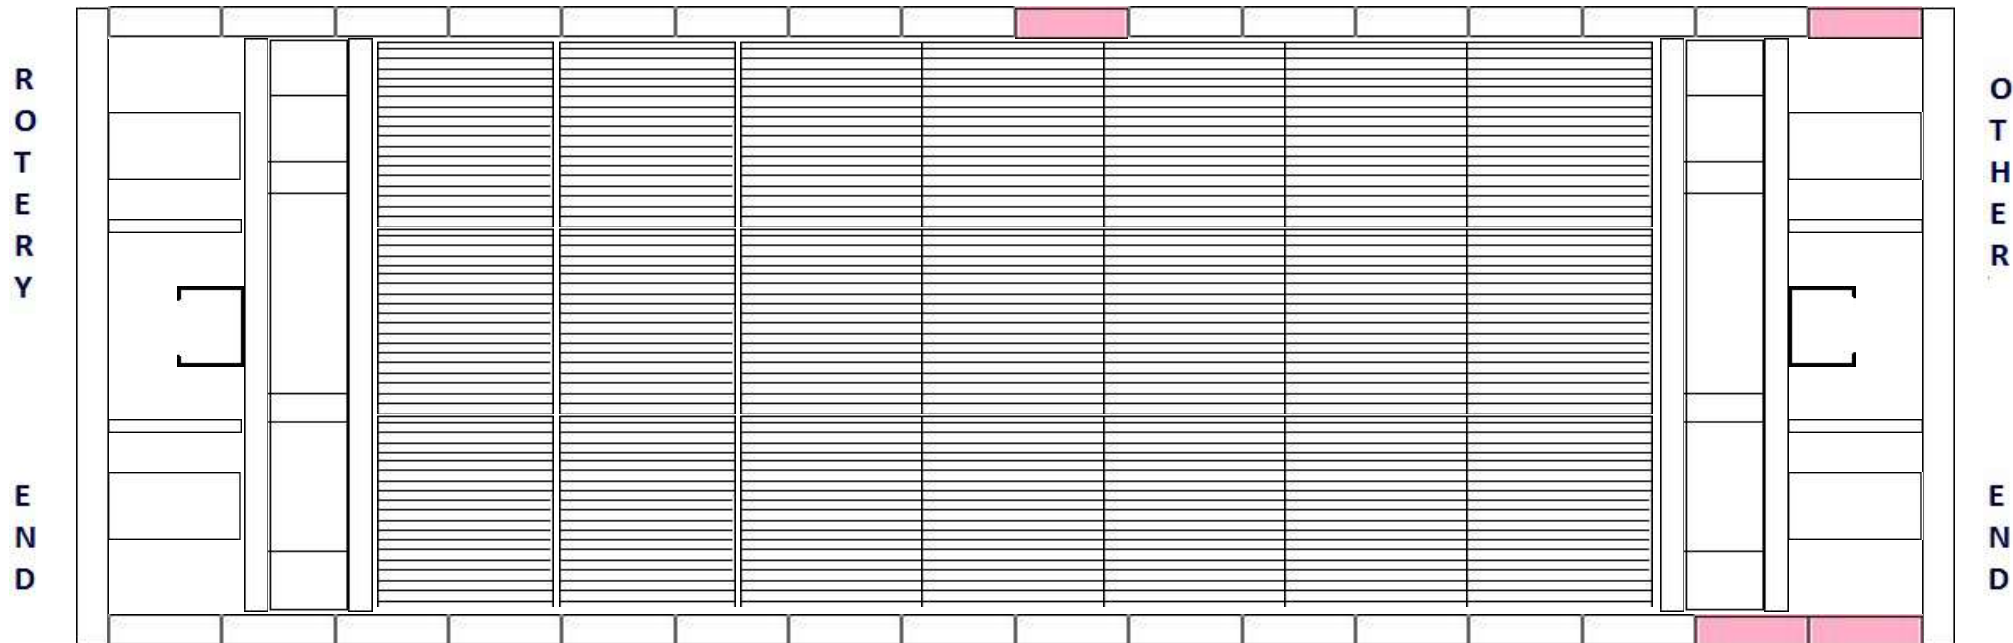

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	2	13%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2	13%		Body panel/patch		30%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 07-Aug-2019, Completion Date : 10-Aug-2019, Net Repair Days : 4, Total Man Hours : 0

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC11708


Type : GSLRD

Built Year : 2011

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

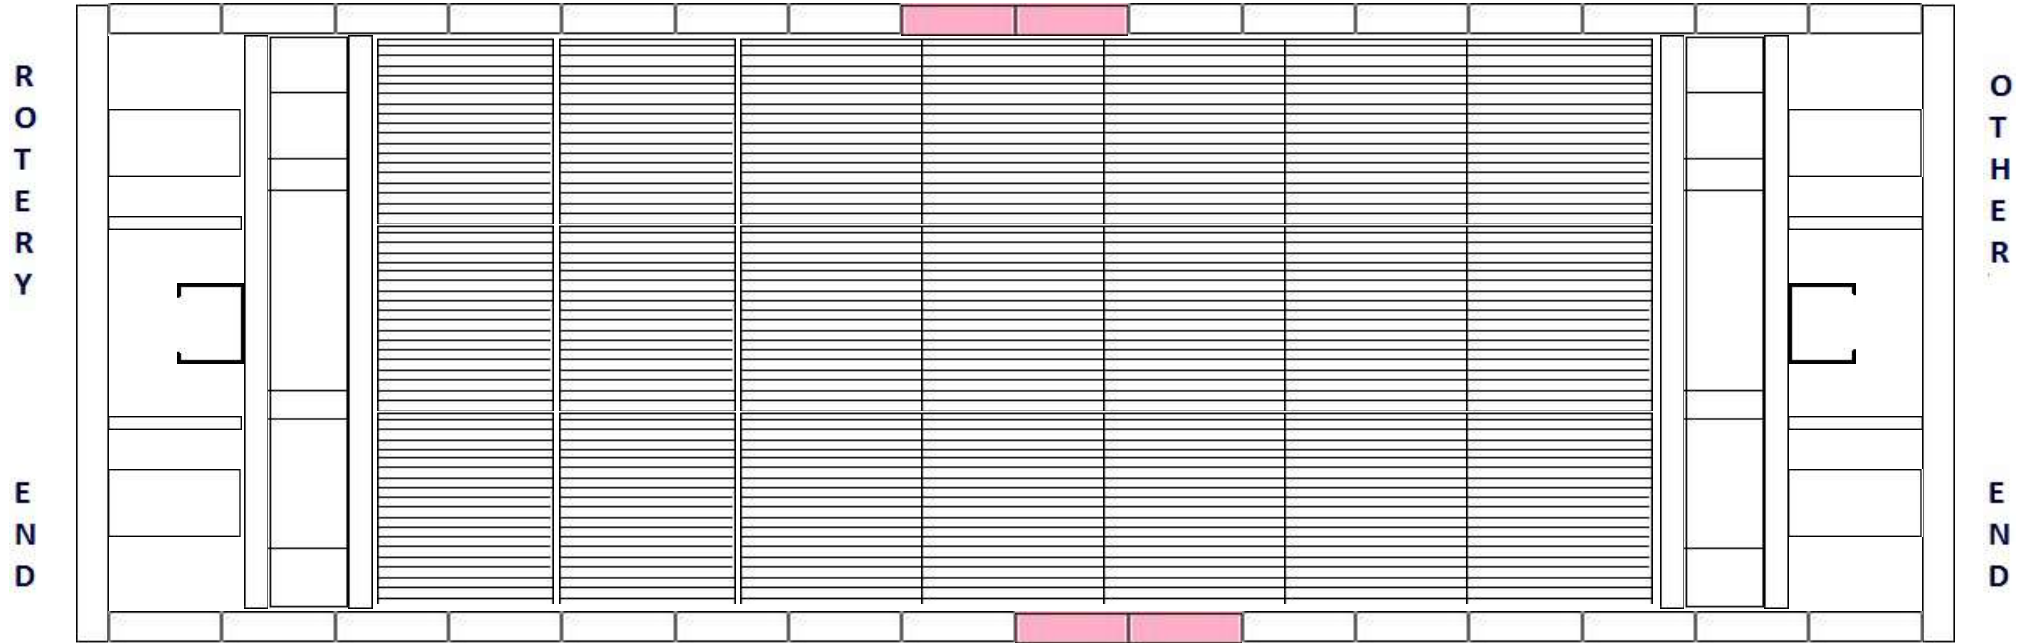

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	2	13%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2	13%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 31-Aug-2019, Completion Date : 02-Sep-2019, Net Repair Days : 2, Total Man Hours : 486

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07710


Type : GSRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

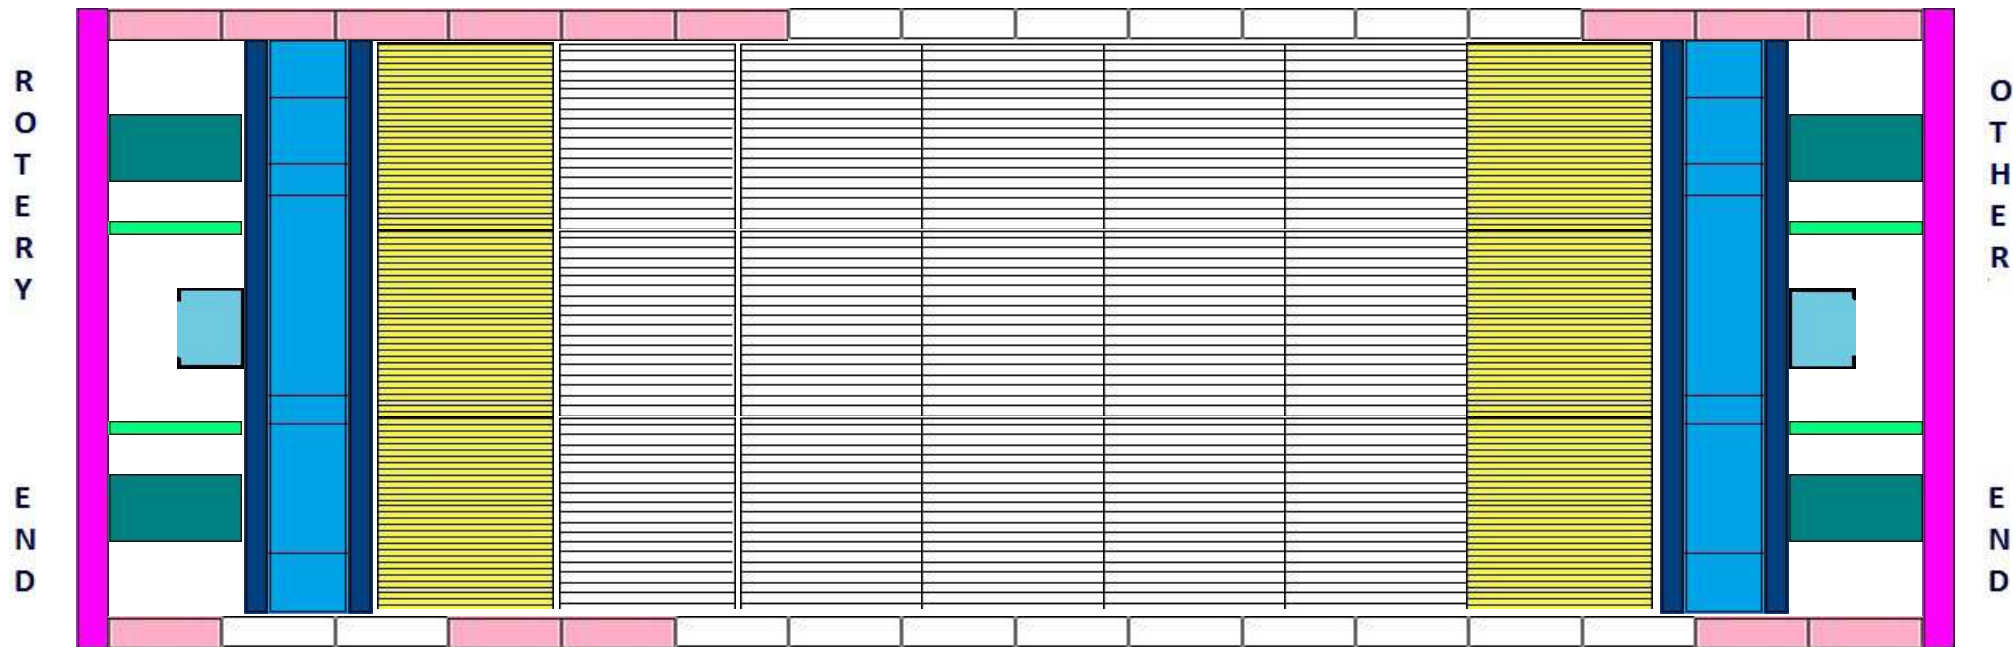

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	7	44%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	7	44%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	18	50%		Window Bar	28	16%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 2, WEST : 6 Other End - EAST : 4, WEST : -3
Start Date : 02-Sep-2019, Completion Date : 07-Sep-2019, Net Repair Days : 6, Total Man Hours : 1244

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04203


Type : WGSCN

Built Year : 2004

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

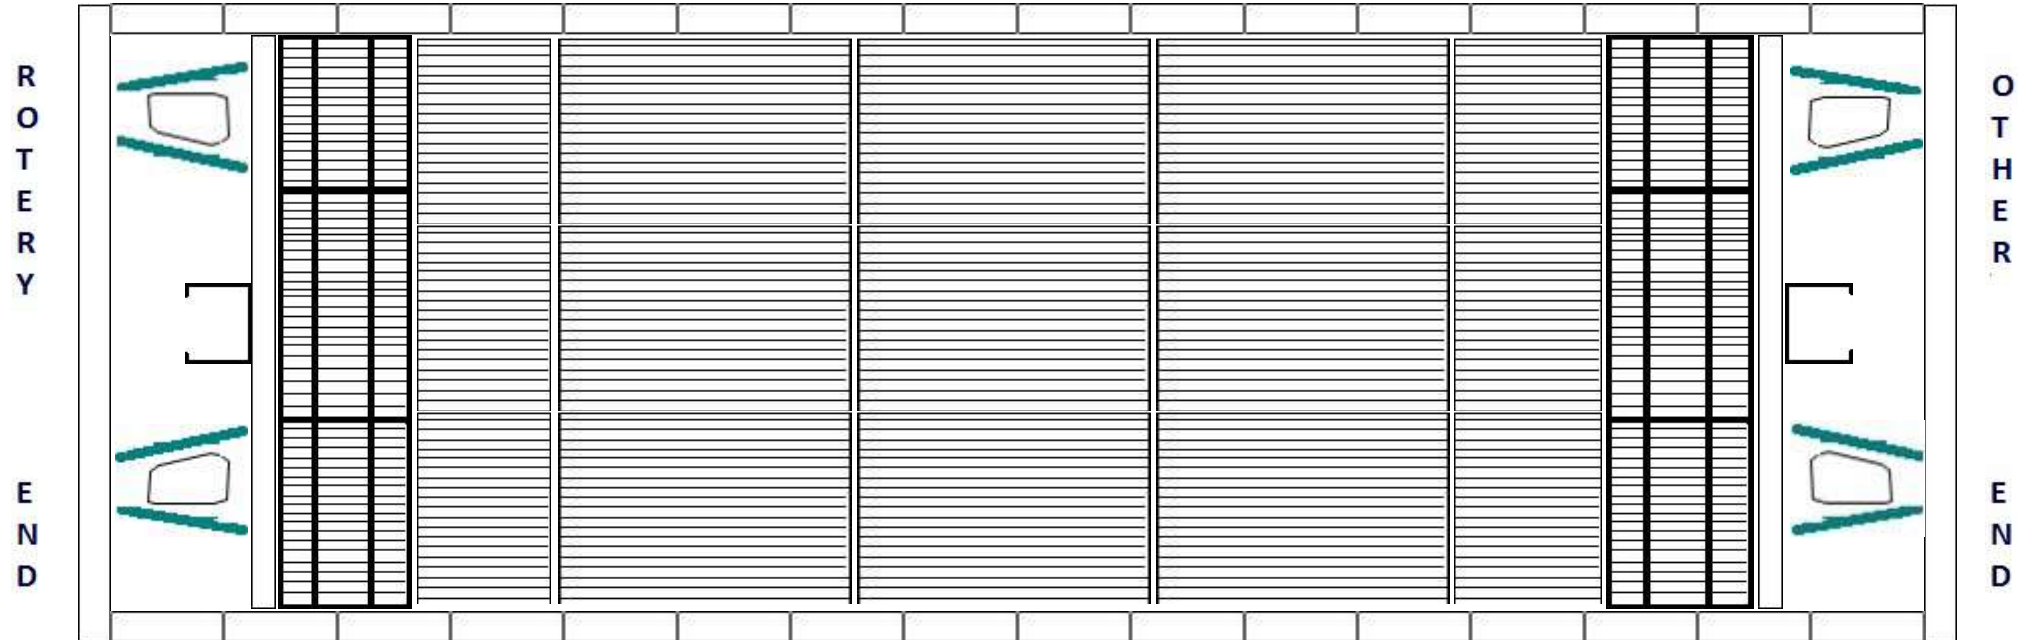

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Diagonal	4	100%		Logitudinal Channel Structure	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Bottom Wall Part	0	0%		Body panel/patch		0%
	Door Top/Roof Patch		100%		Seat Bracket Rail		0%		Window Sill	0	0%
	Window Bar	0	0%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	0	100%								

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 03-Sep-2019, Completion Date : 05-Sep-2019, Net Repair Days : 3, Total Man Hours : 120

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
------------------	----------------------	------------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC12604


Type : WGSCZ

Built Year : 2012

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

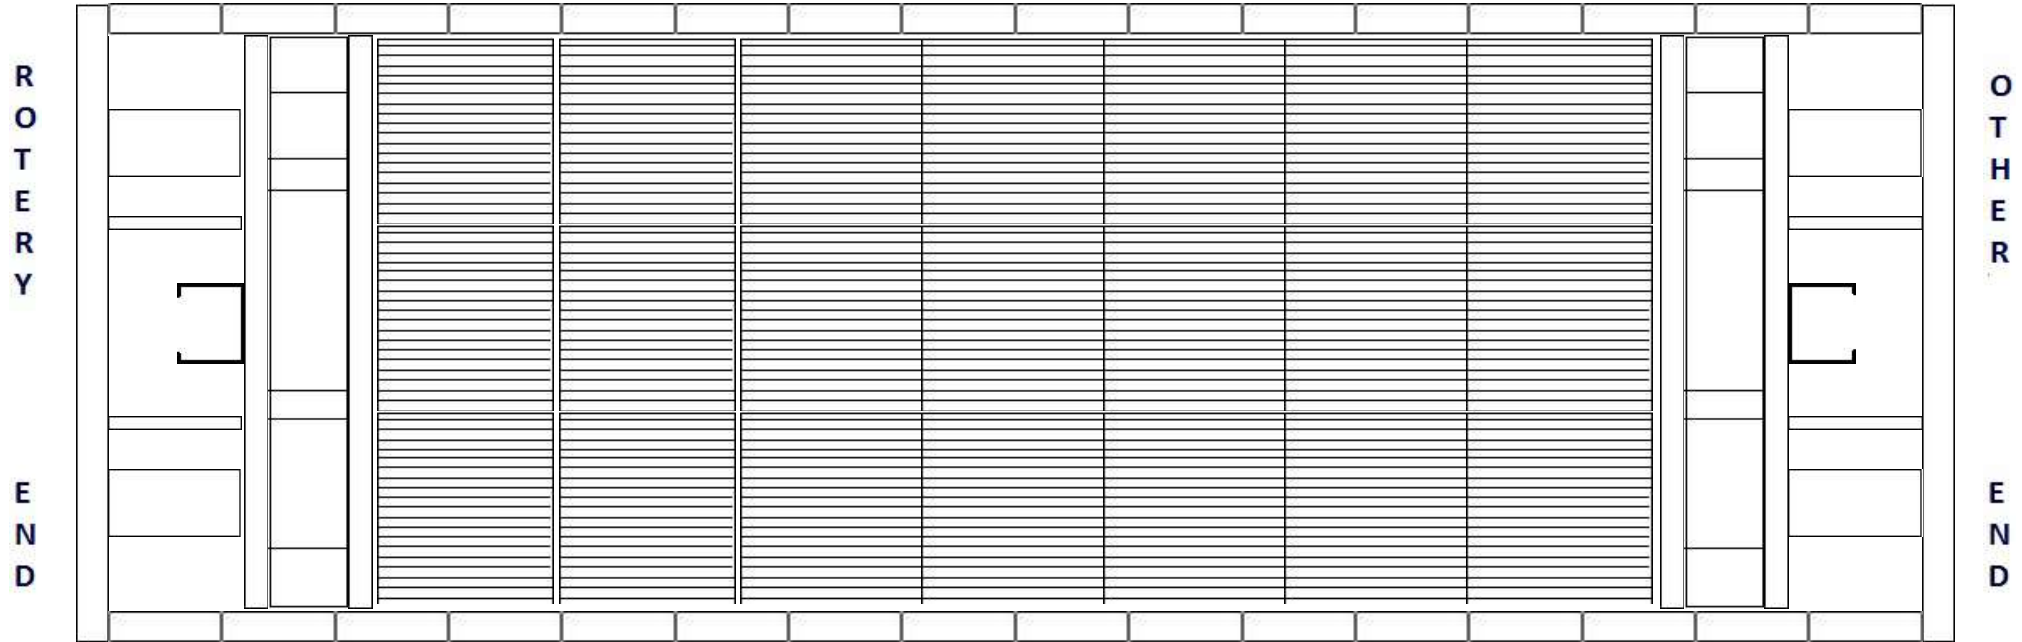

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		15%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 30-Sep-2019, Completion Date : 01-Oct-2019, Net Repair Days : 4, Total Man Hours : 196

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC10601


Type : WGSCZ

Built Year : 2010

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

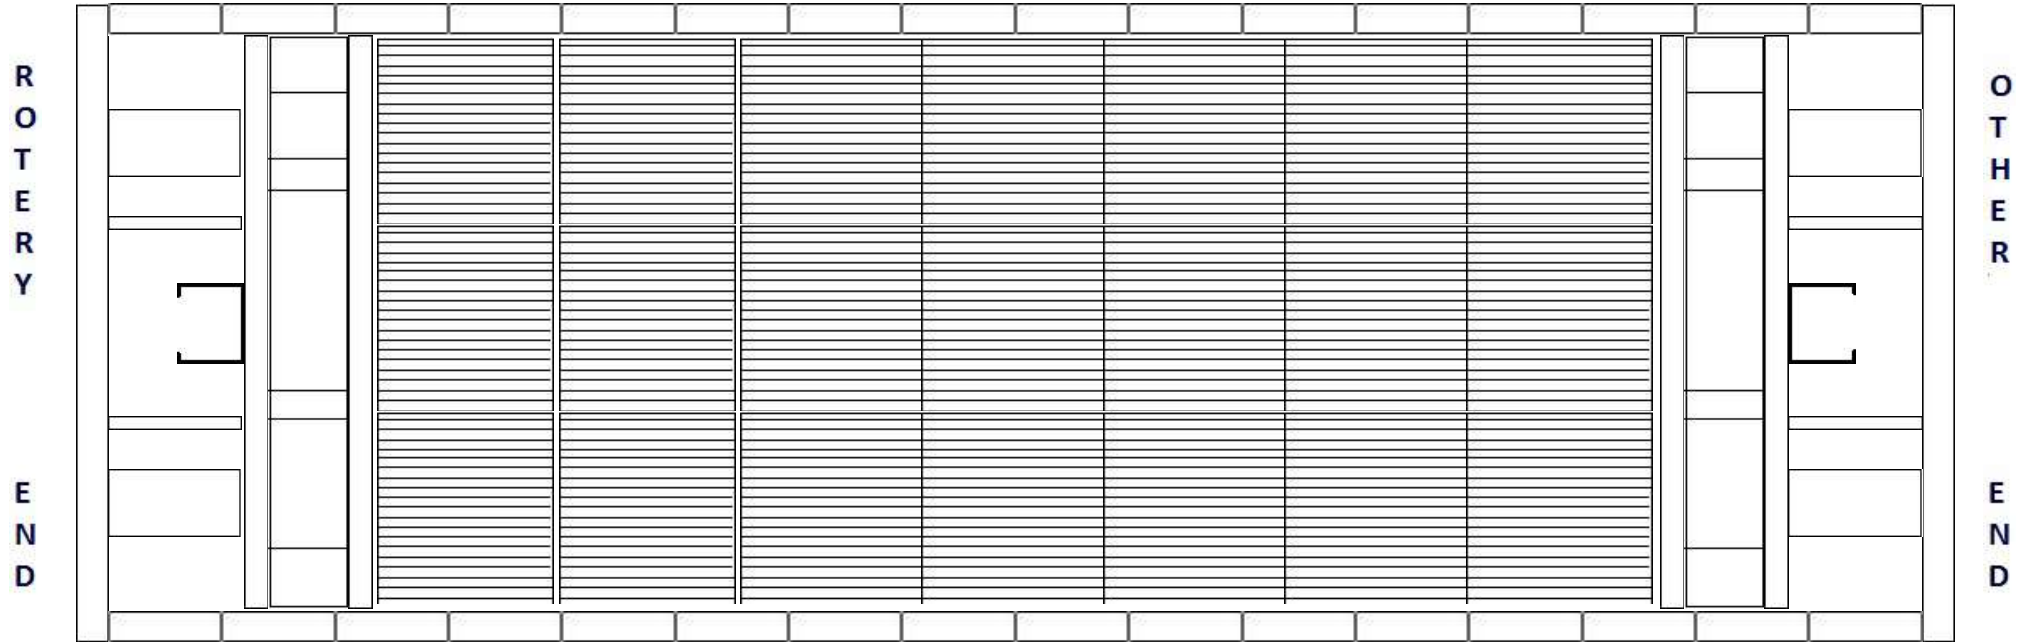

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		0%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 12-Oct-2019, Completion Date : 14-Oct-2019, Net Repair Days : 2, Total Man Hours : 164

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC06406


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

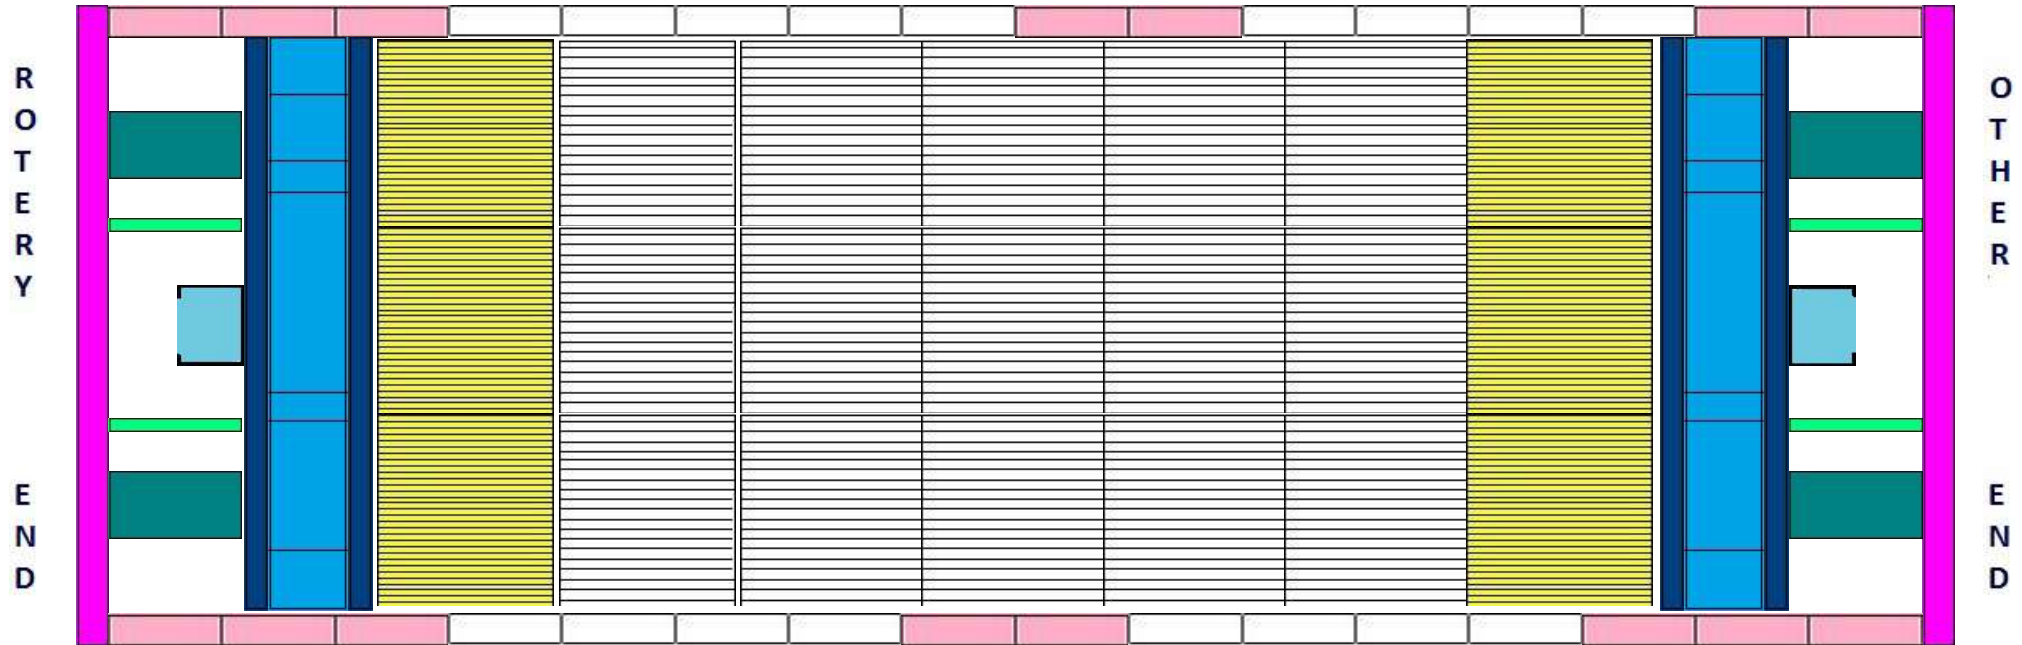

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	7.5	47%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	7.5	47%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 2, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 25-Nov-2019, Completion Date : 03-Dec-2019, Net Repair Days : 8, Total Man Hours : 1344

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07723


Type : GSRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

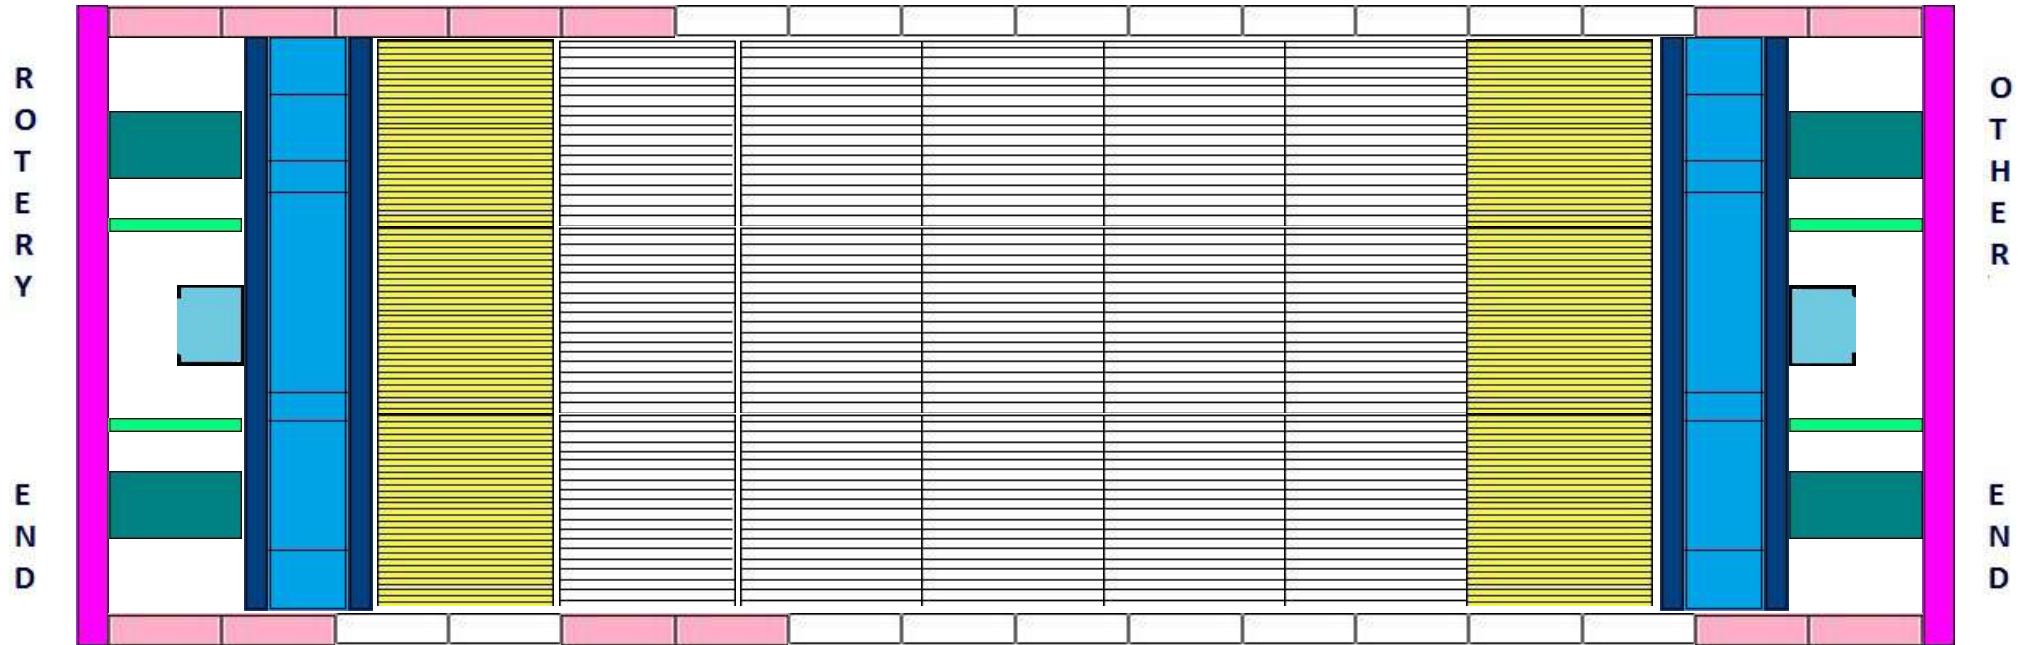

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	6.5	41%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	6.5	41%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	18	55%		Window Bar	40	28%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : -7 Other End - EAST : 5, WEST : 5
Start Date : 26-Nov-2019, Completion Date : 03-Dec-2019, Net Repair Days : 7, Total Man Hours : 1416

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07419


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

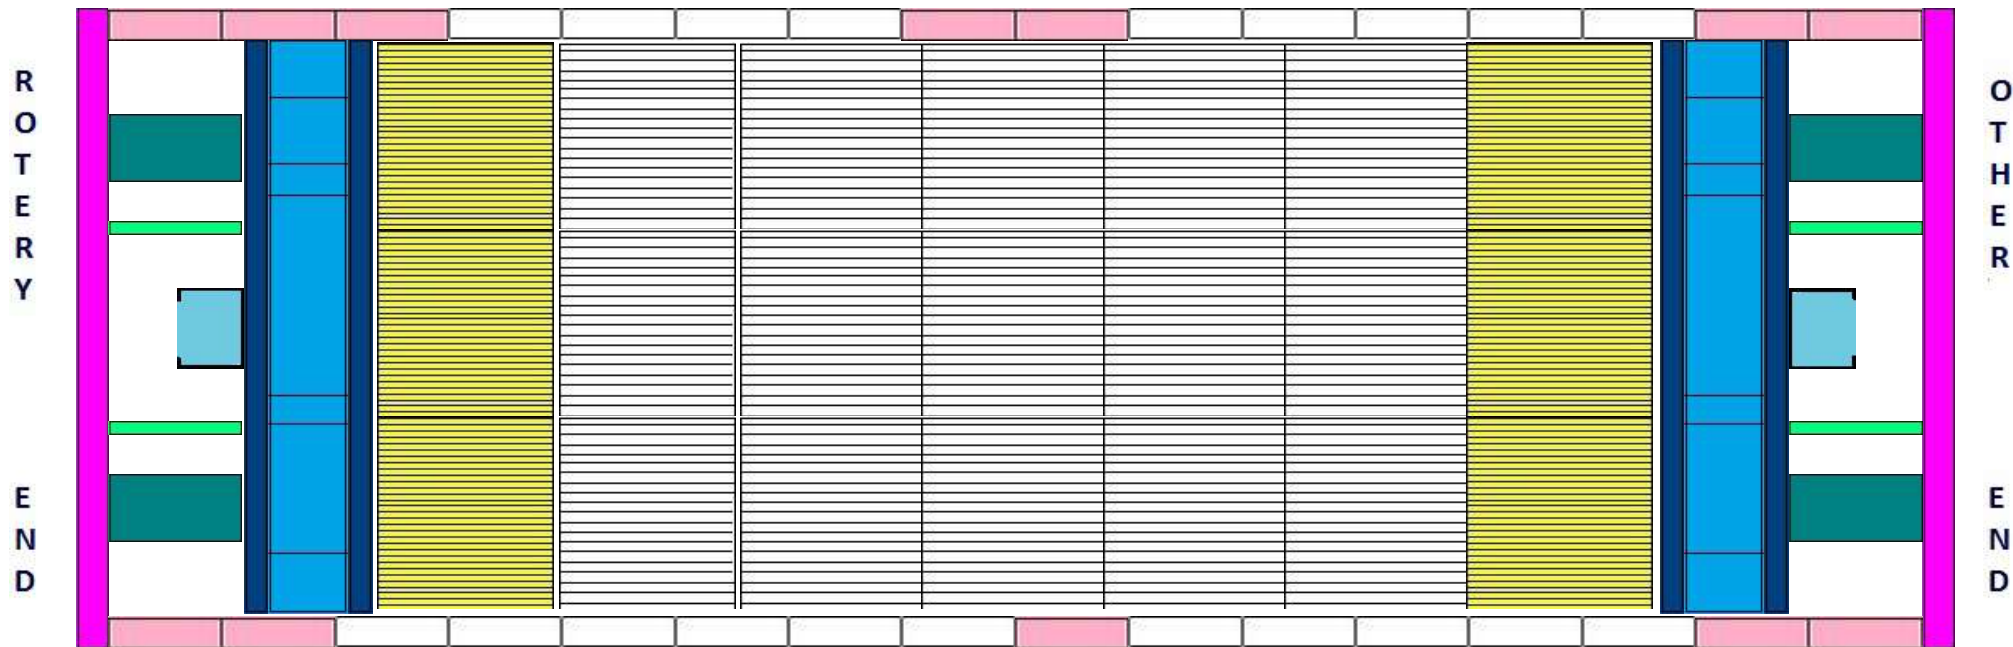

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	6	38%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	6	38%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 4, WEST : -6 Other End - EAST : -4, WEST : -2
Start Date : 05-Nov-2019, Completion Date : 14-Nov-2019, Net Repair Days : 9, Total Man Hours : 1228

HAMANT JADAV - JE	M L KOLI - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	---------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07715


Type : GSRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

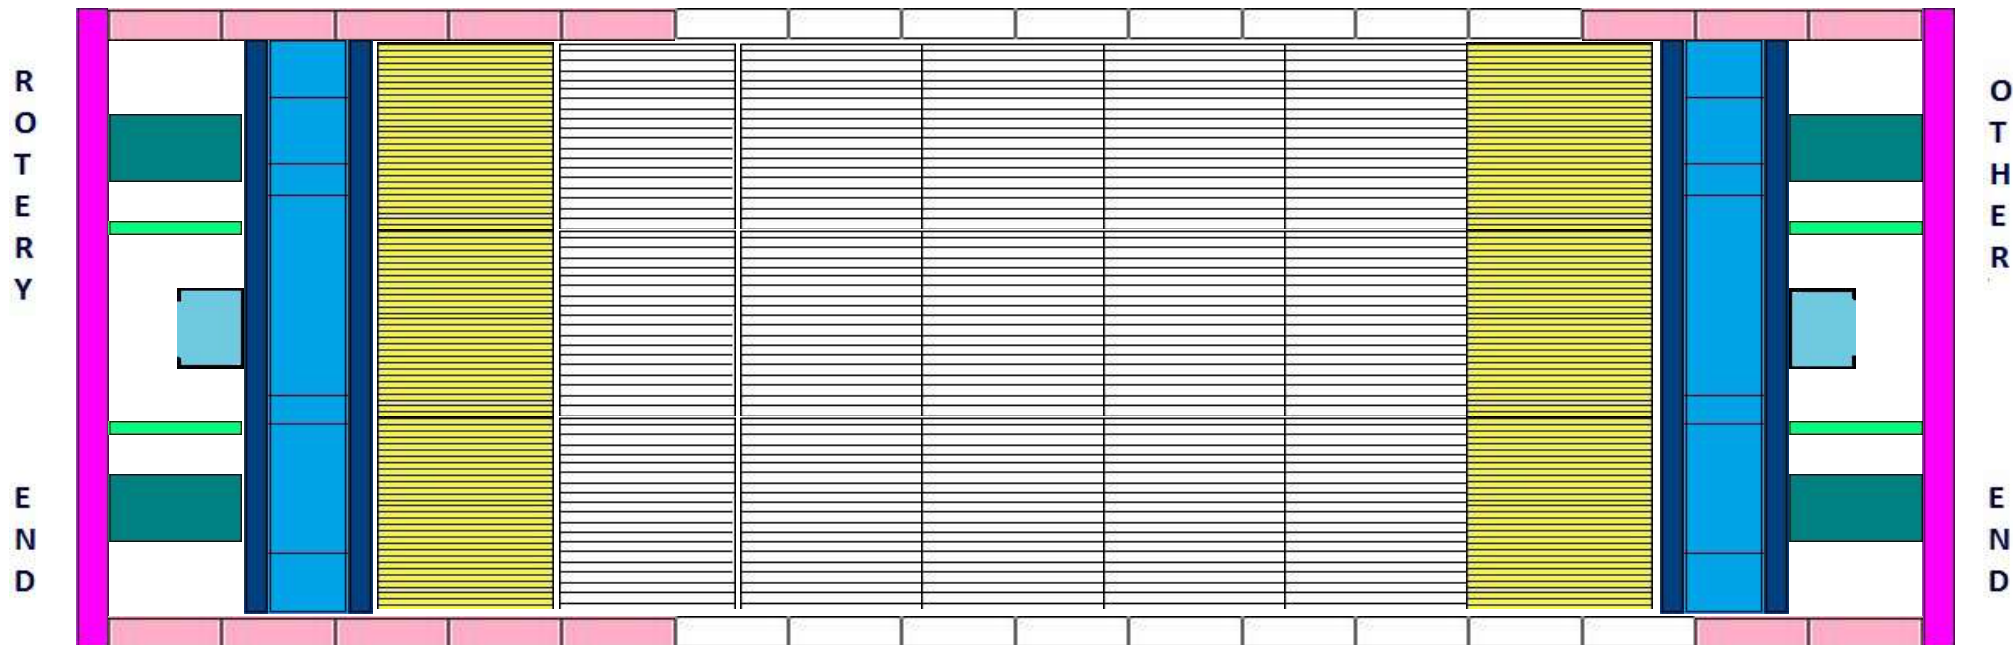

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	7.5	47%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	7.5	47%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	24	67%		Window Bar	44	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -2, WEST : -2 Other End - EAST : 0, WEST : 0
Start Date : 20-Nov-2019, Completion Date : 02-Dec-2019, Net Repair Days : 11, Total Man Hours : 1616

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07603


Type : WGSCZ

Built Year : 2007

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

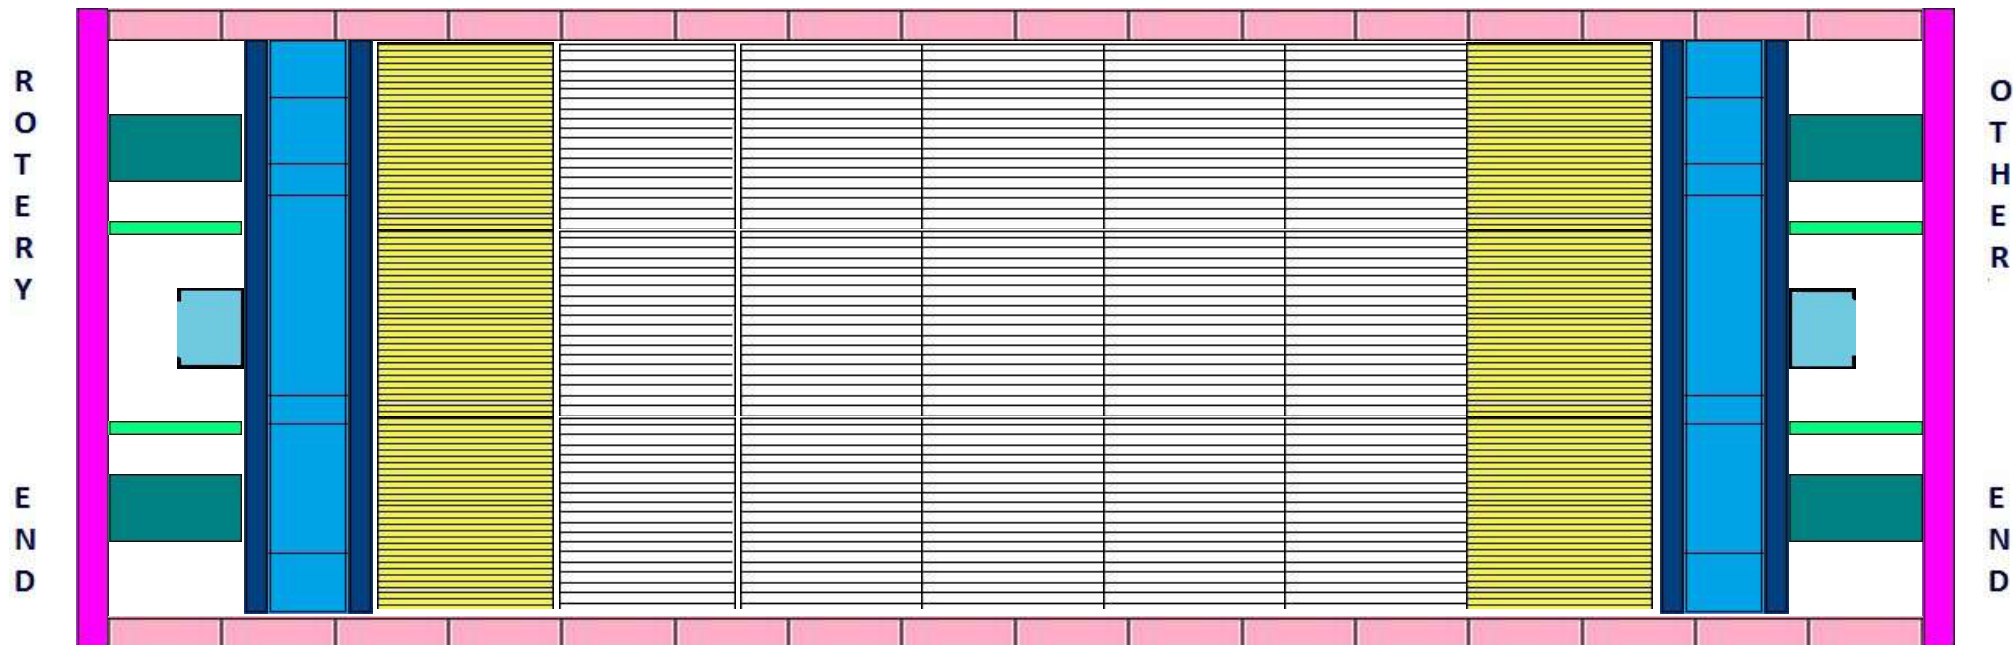

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Light Blue	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	40	23%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -2, WEST : -6 Other End - EAST : 0, WEST : 5

Start Date : 08-Nov-2019, Completion Date : 18-Nov-2019, Net Repair Days : 9, Total Man Hours : 1252

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC12606


Type : WGSCZ

Built Year : 2012

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

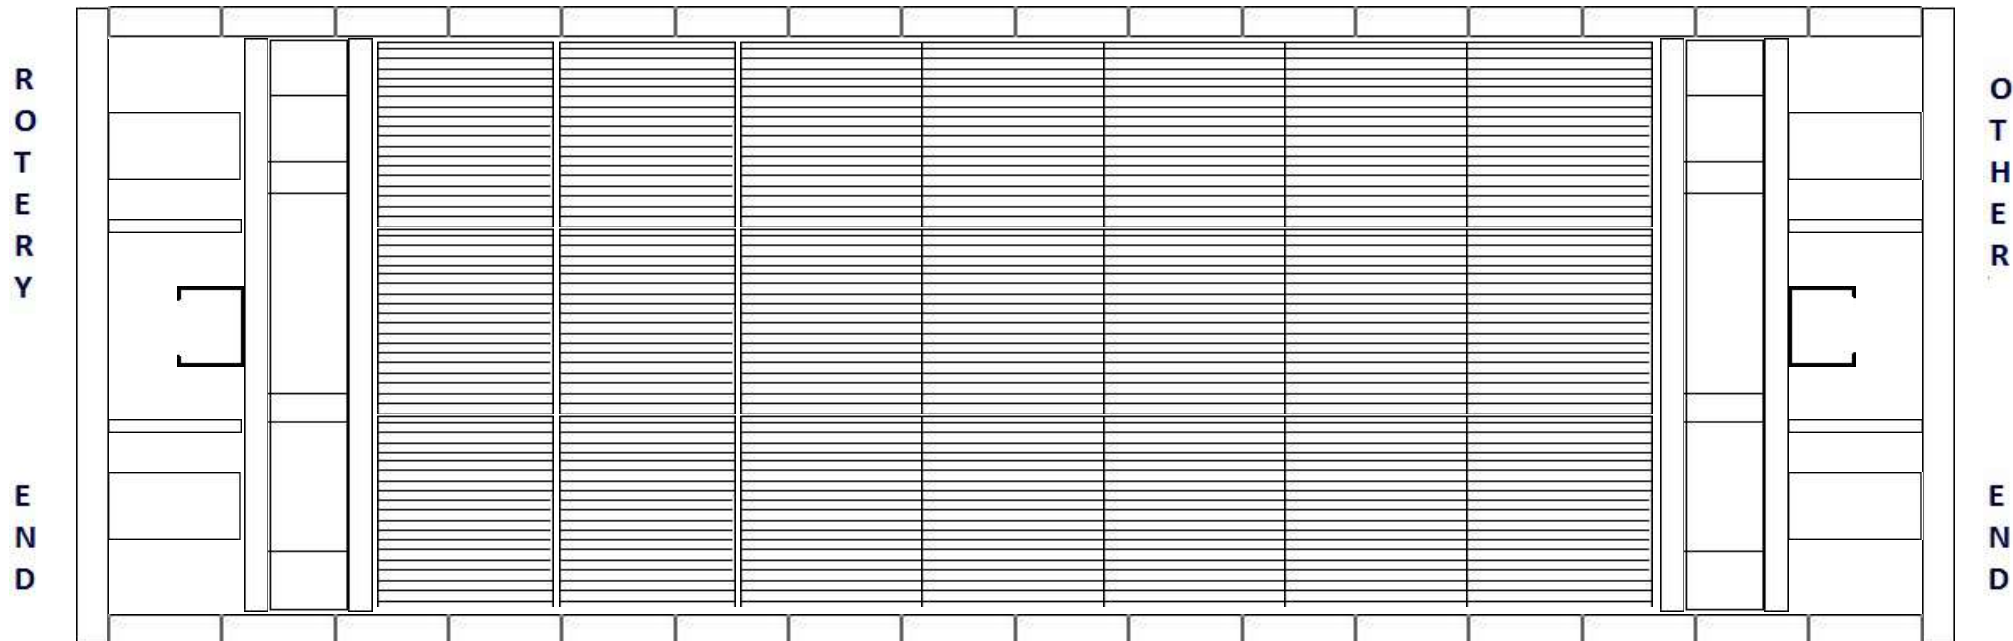

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		0%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 04-Oct-2019, Completion Date : 05-Oct-2019, Net Repair Days : 2, Total Man Hours : 168

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	--------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC10603


Type : WGSCZ

Built Year : 2010

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

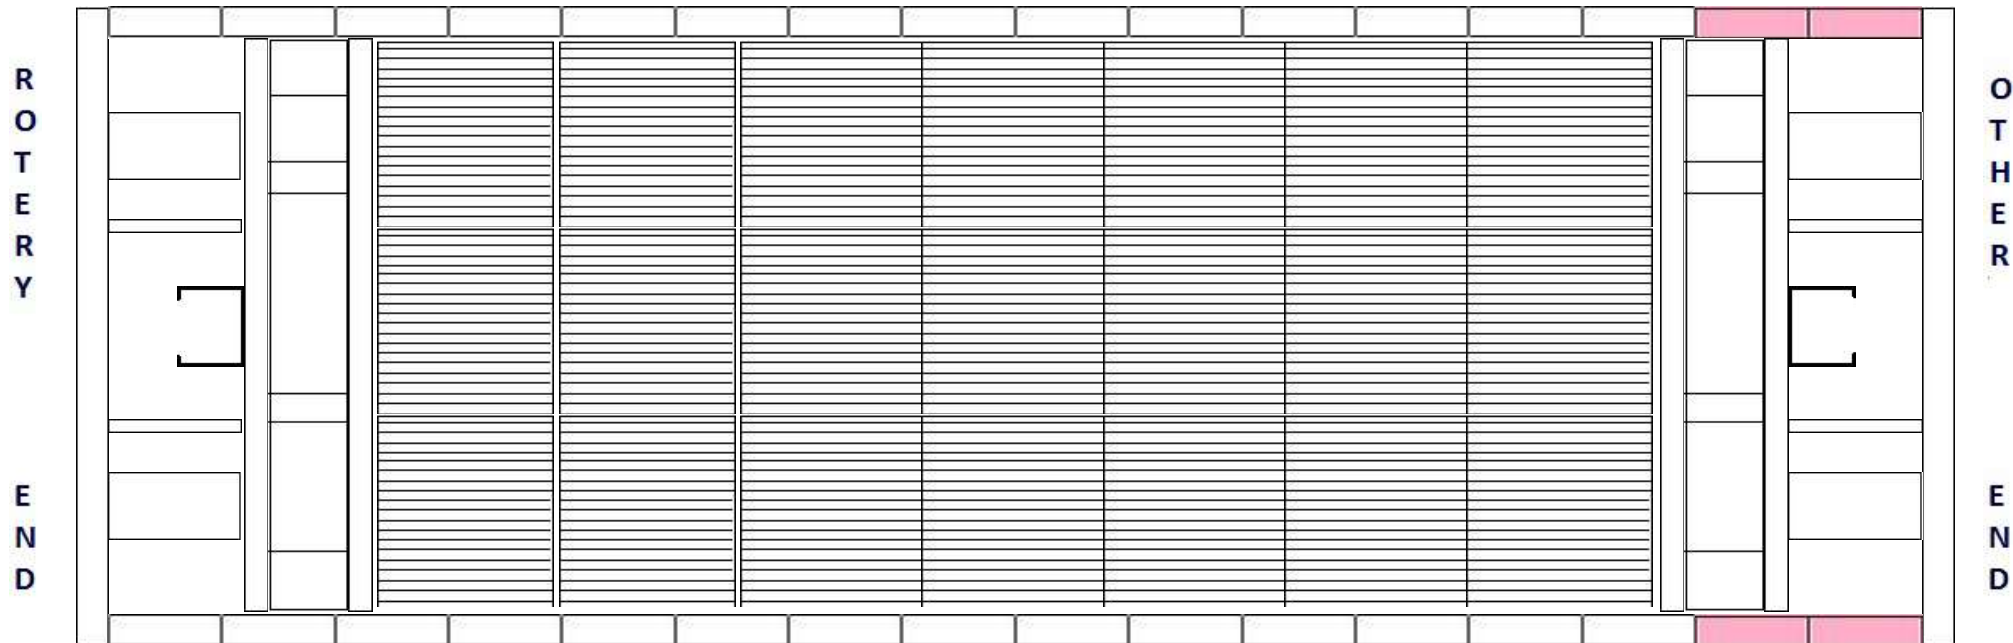

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	2	13%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2	13%		Body panel/patch		15%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 04-Oct-2019, Completion Date : 07-Oct-2019, Net Repair Days : 3, Total Man Hours : 528

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC10604


Type : WGSCZ

Built Year : 2010

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

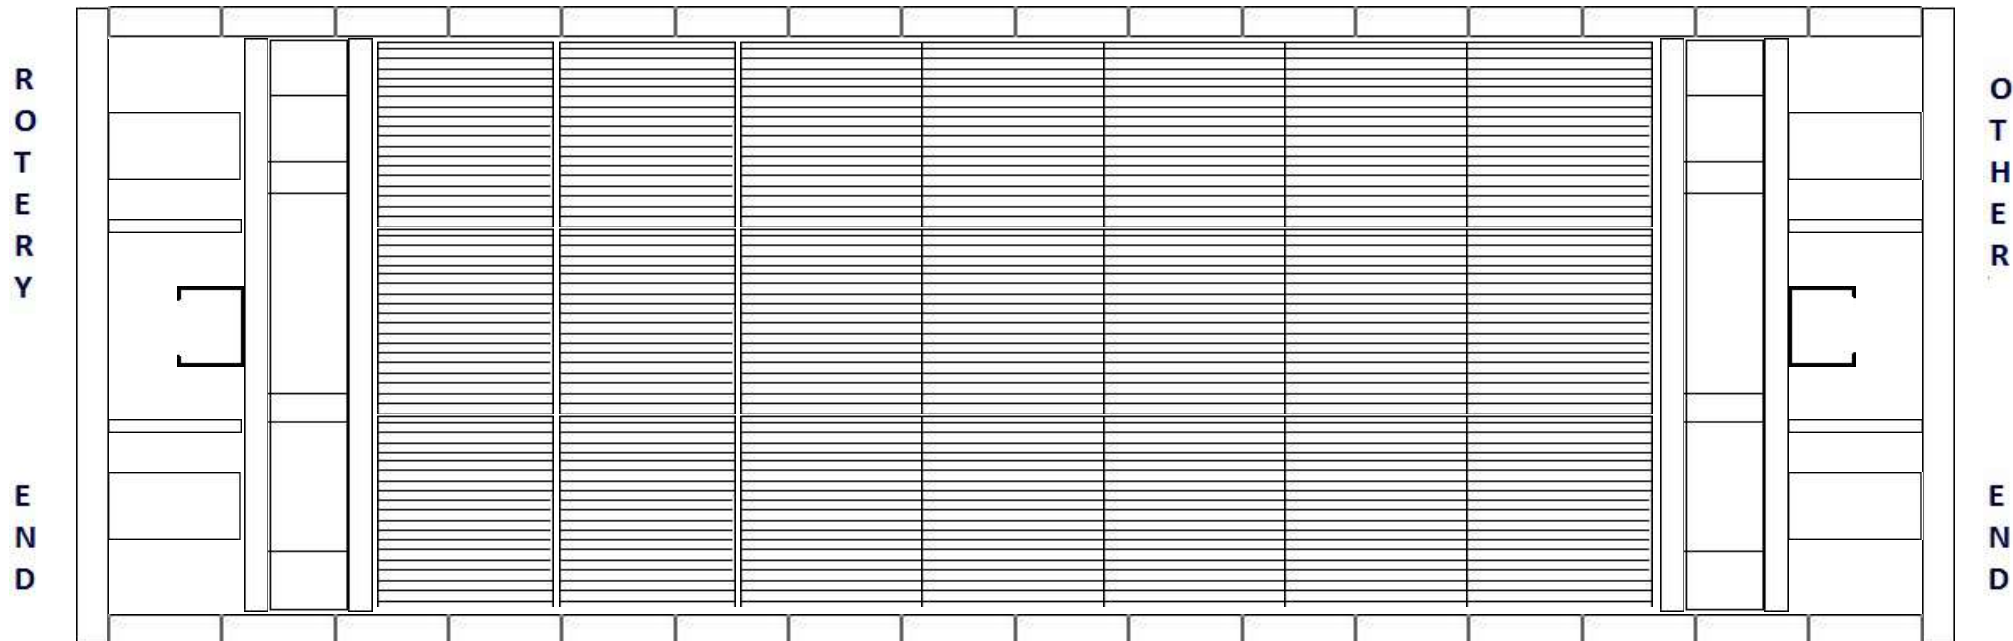

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		0%		Door Top/Roof Patch		0%
	Window Module		15%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 30-Sep-2019, Completion Date : 01-Oct-2019, Net Repair Days : 4, Total Man Hours : 196

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC06417


Type : GS

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

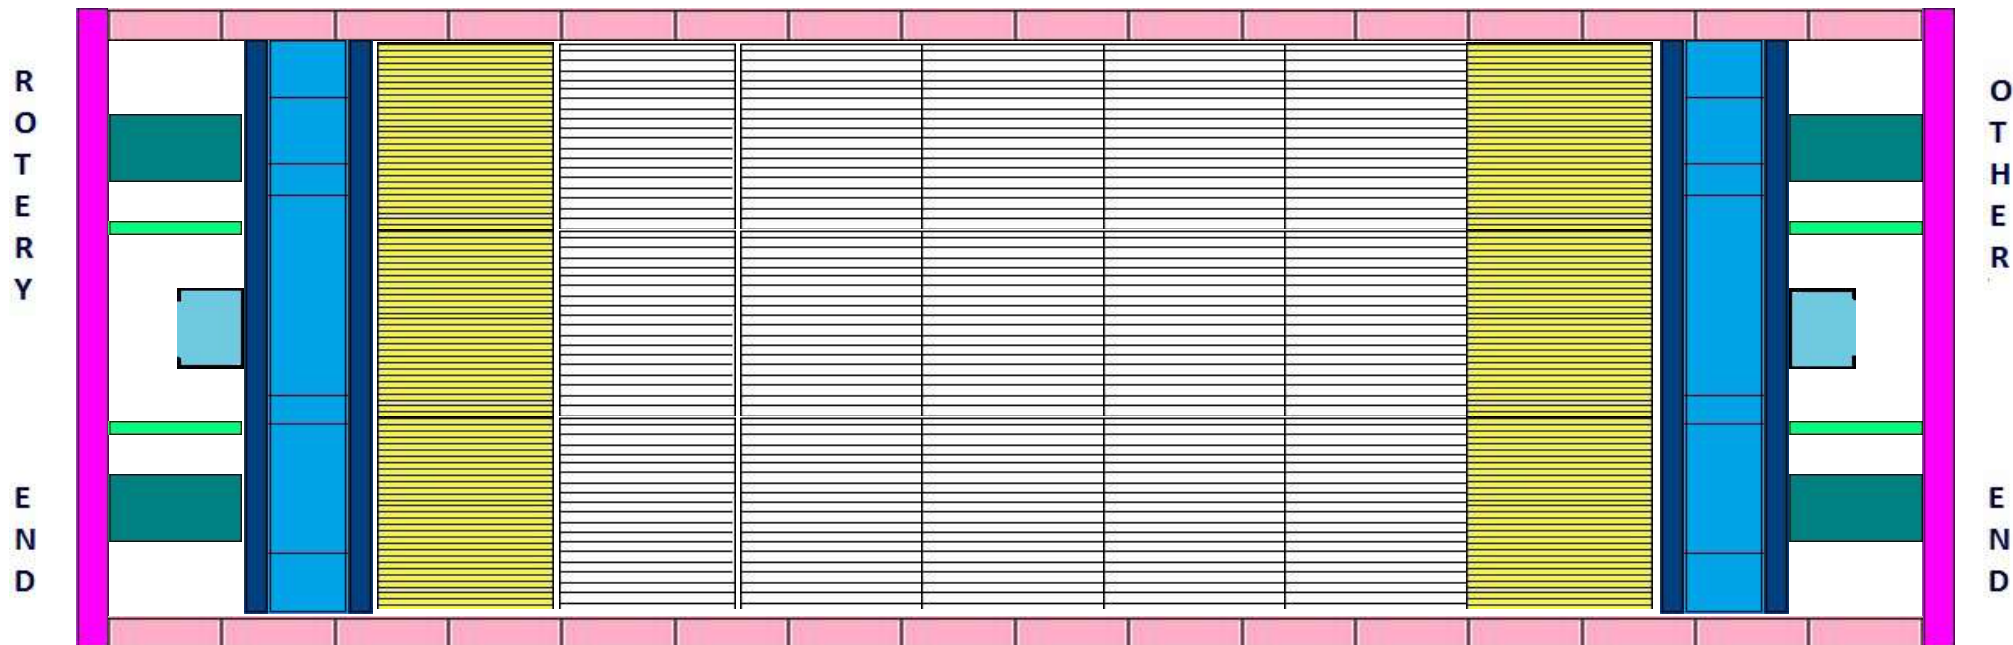

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	8	20%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : 3 Other End - EAST : -4, WEST : -7
Start Date : 20-Jan-2020, Completion Date : 01-Feb-2020, Net Repair Days : 12, Total Man Hours : 0

ANASTA PRASAD - JE	MOHD. JAFER QURASHI - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	--------------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC06422


Type : GS

Built Year : 2006

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

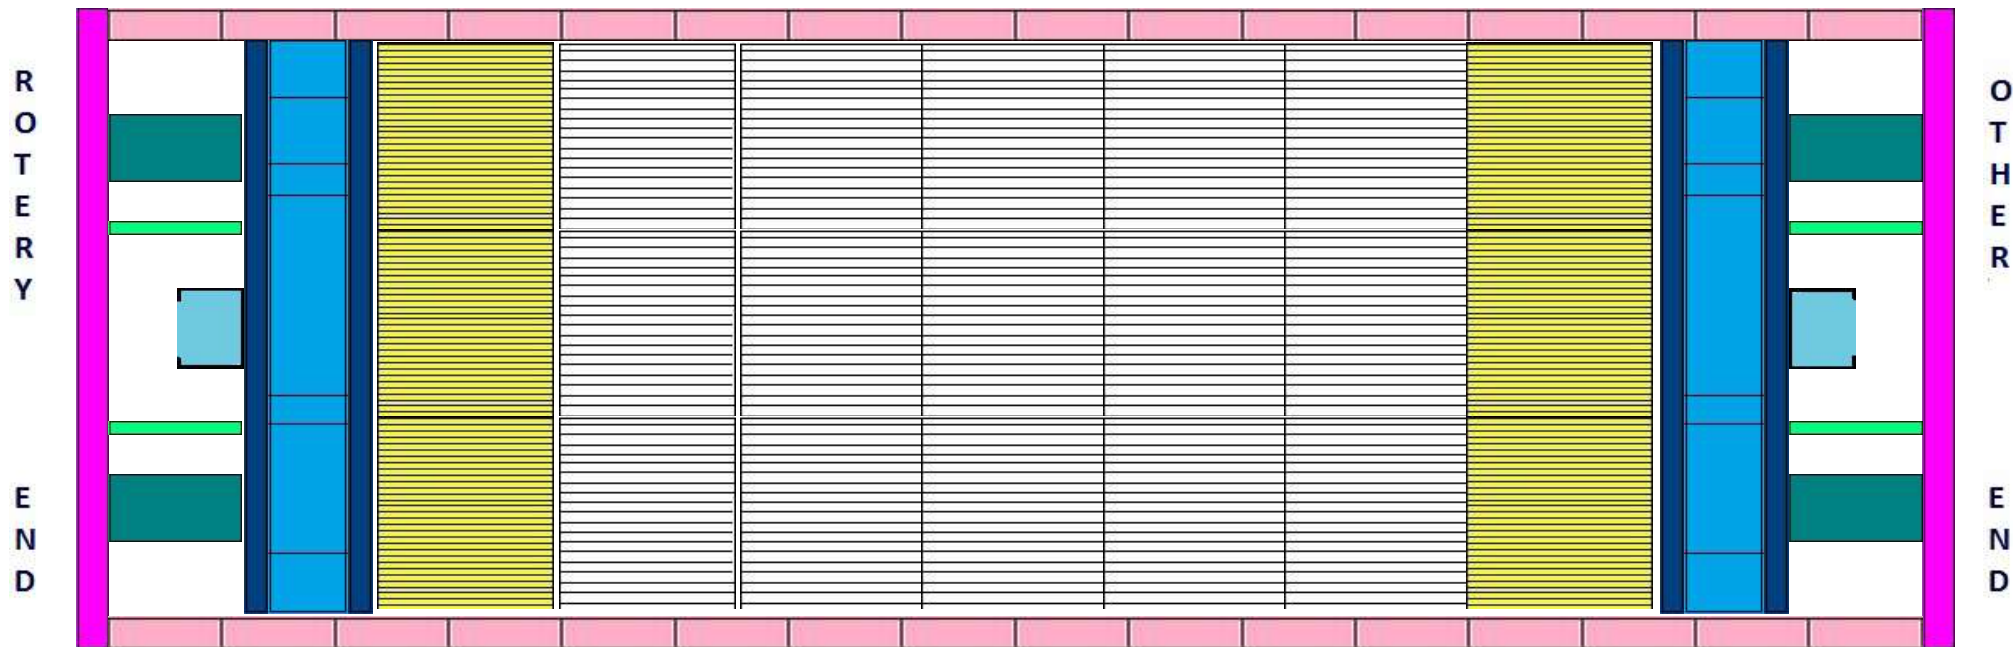

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	24	60%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : 6 Other End - EAST : -2, WEST : -5
Start Date : 09-Jan-2020, Completion Date : 16-Jan-2020, Net Repair Days : 7, Total Man Hours : 1104

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	--------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC08406


Type : GS

Built Year : 2008

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

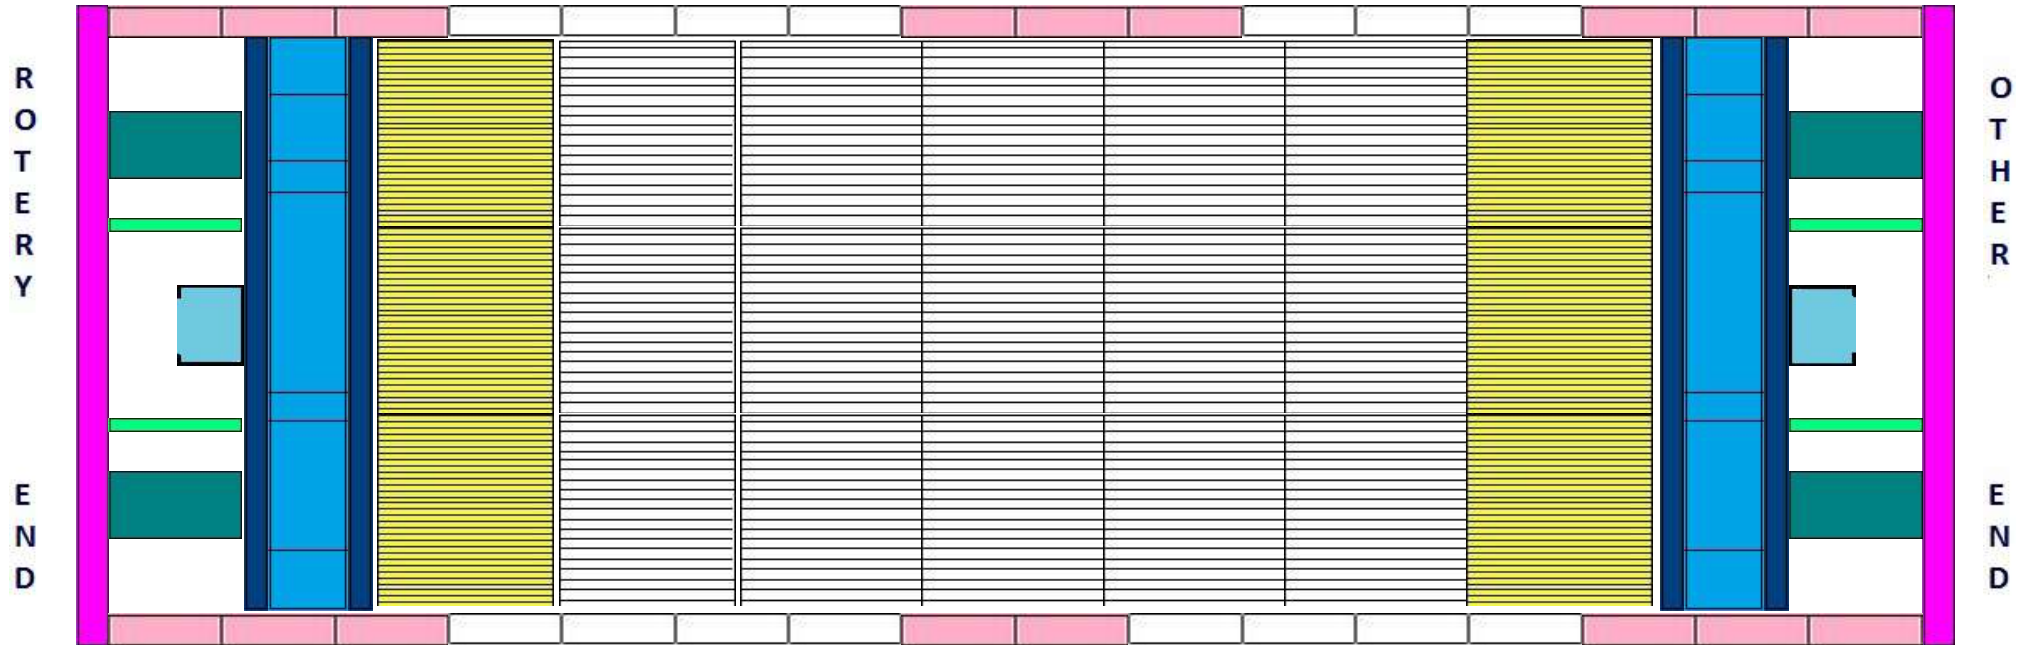

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	8.5	53%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8.5	53%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	14	35%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 3, WEST : 5 Other End - EAST : 5, WEST : 2
Start Date : 09-Jan-2020, Completion Date : 17-Jan-2020, Net Repair Days : 8, Total Man Hours : 752

ANASTA PRASAD - JE	MOHD. JAFER QURASHI - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	--------------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC08401


Type : GS

Built Year : 2008

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

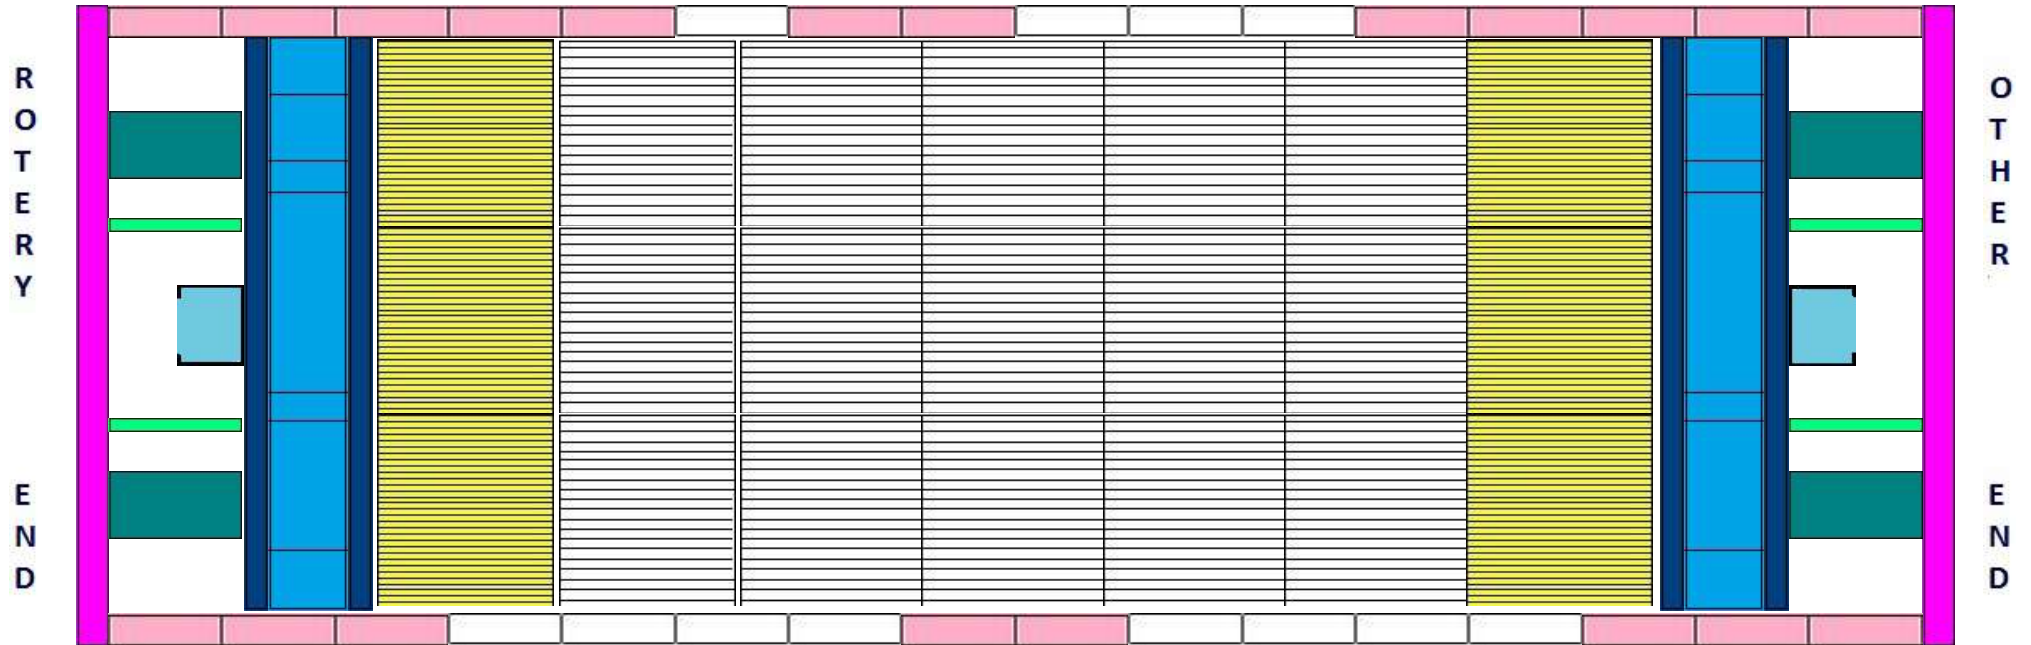

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	10	63%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	10	63%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	7	18%		Window Bar	40	23%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 3, WEST : 5 Other End - EAST : 0, WEST : 5
Start Date : 22-Jan-2020, Completion Date : 01-Feb-2020, Net Repair Days : 10, Total Man Hours : 824

P N VISHWKARMA - SSE	T R LAHRE - JE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	----------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07605


Type : CZ

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

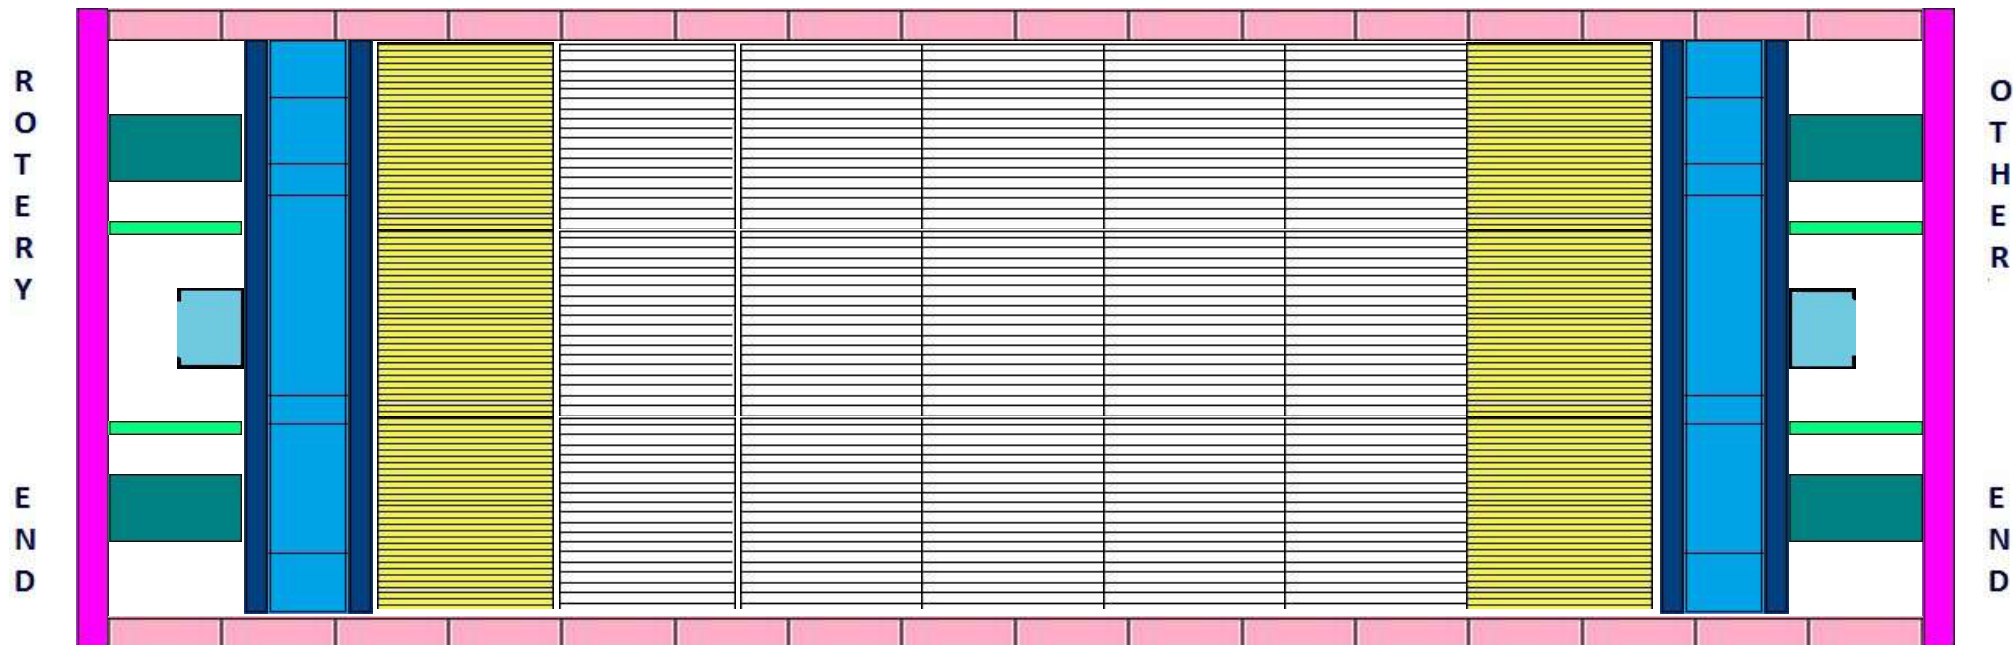

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Light Blue	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	7	18%		Window Bar	40	23%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 23-Jan-2020, Completion Date : 01-Feb-2020, Net Repair Days : 9, Total Man Hours : 832

K K TRIPATHI - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07220


Type : WGSCN

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

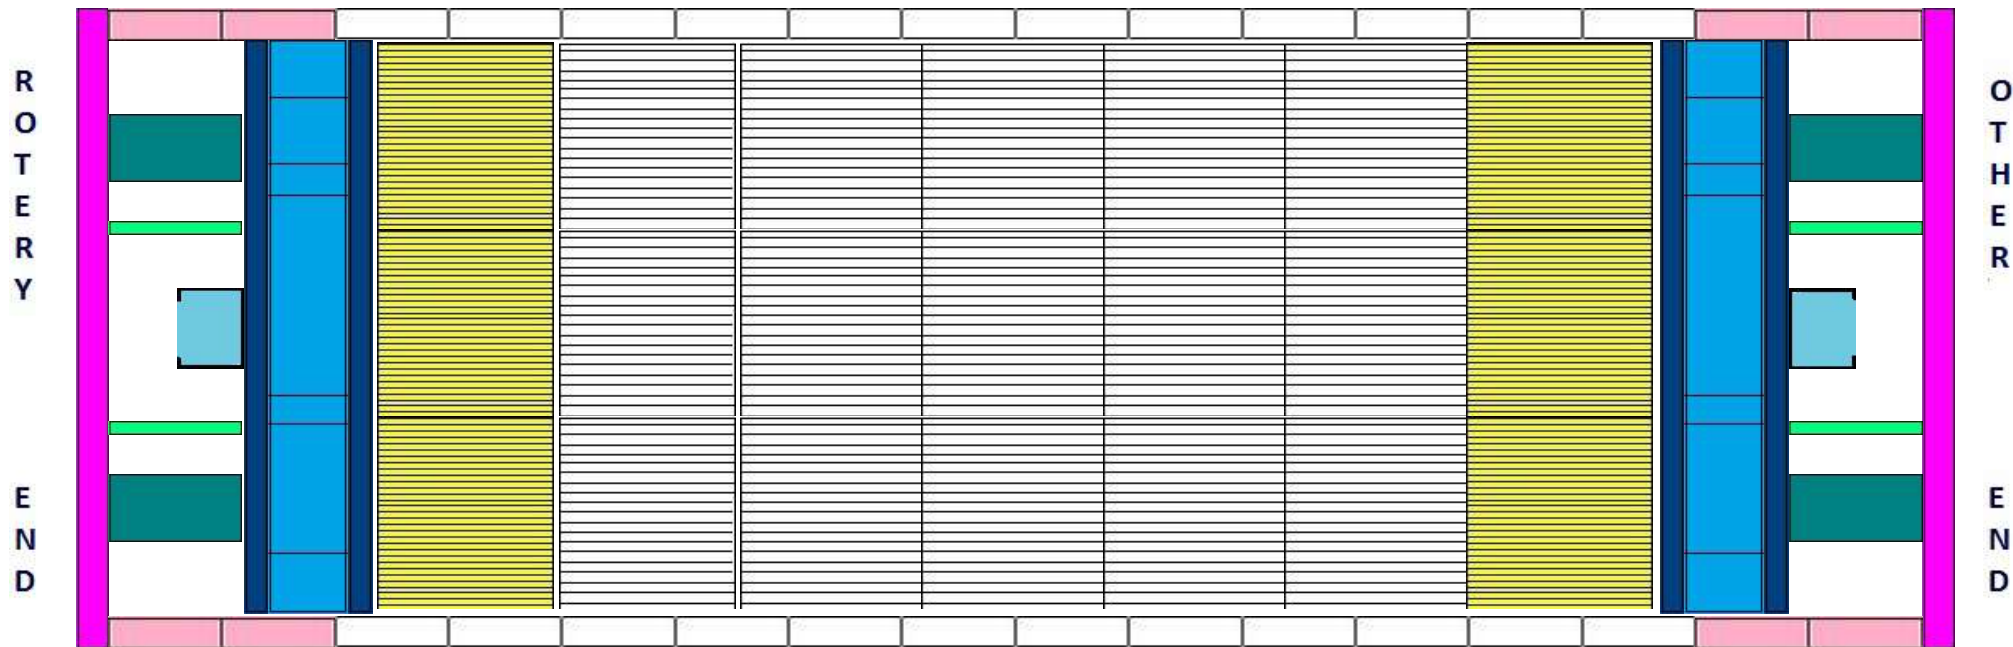

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4	25%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	30	75%		Window Bar	40	22%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -7, WEST : -5 Other End - EAST : 5, WEST : 4
Start Date : 23-Jan-2020, Completion Date : 01-Feb-2020, Net Repair Days : 9, Total Man Hours : 0

MOHD. JAFER QURASHI - JE	ANASTA PRASAD - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------------	--------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC11204


Type : WGSCN

Built Year : 2011

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

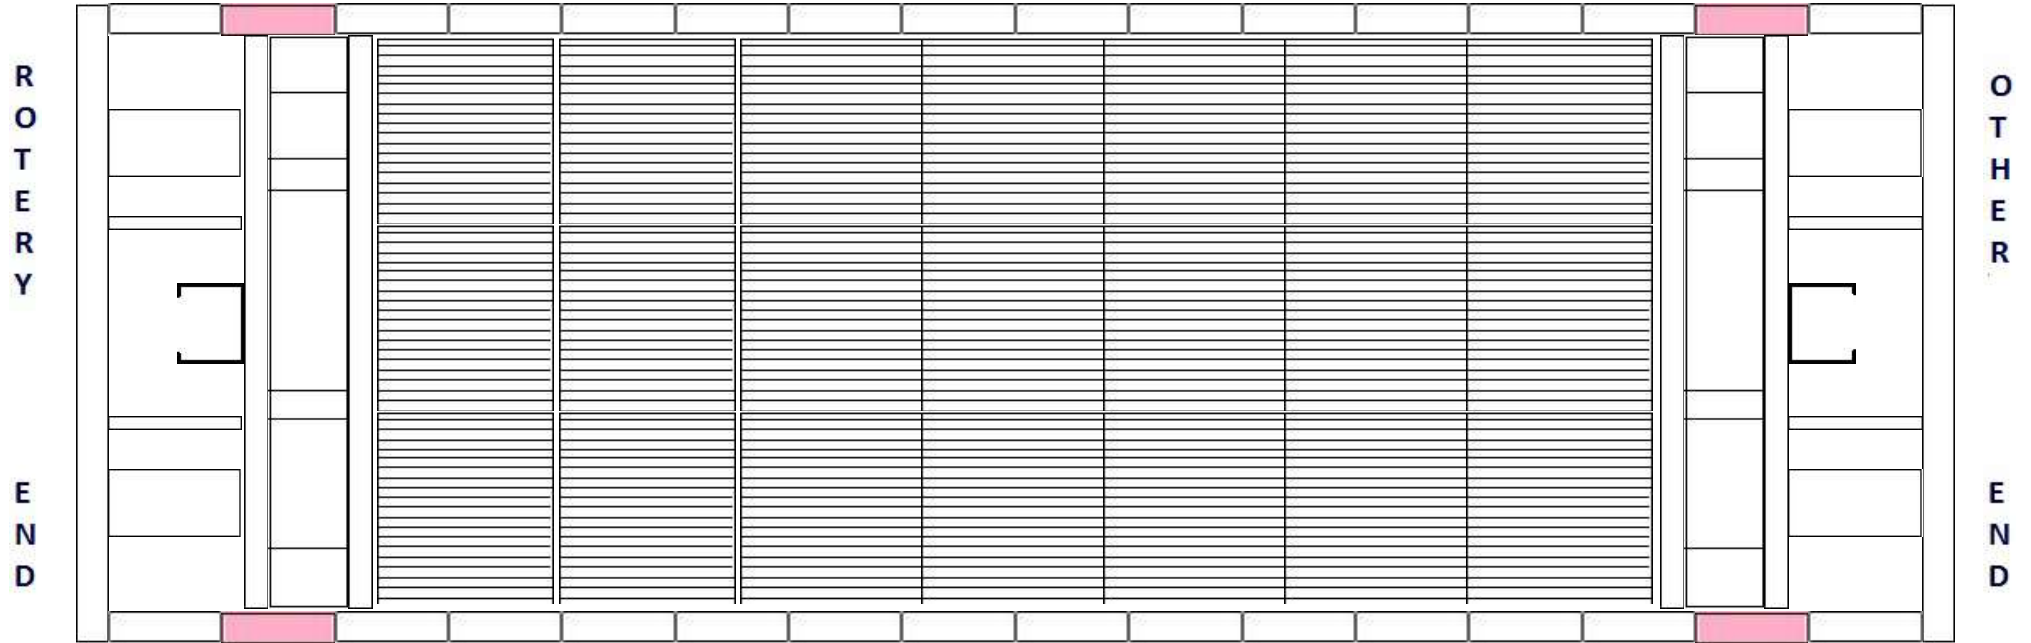

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	2	13%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2	13%		Body panel/patch		20%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 06-Feb-2020, Completion Date : 10-Feb-2020, Net Repair Days : 4, Total Man Hours : 0

P N VISHWKARMA - SSE	T R LAHRE - JE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	----------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC02965


Type : WGSCZJ

Built Year : 2002

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

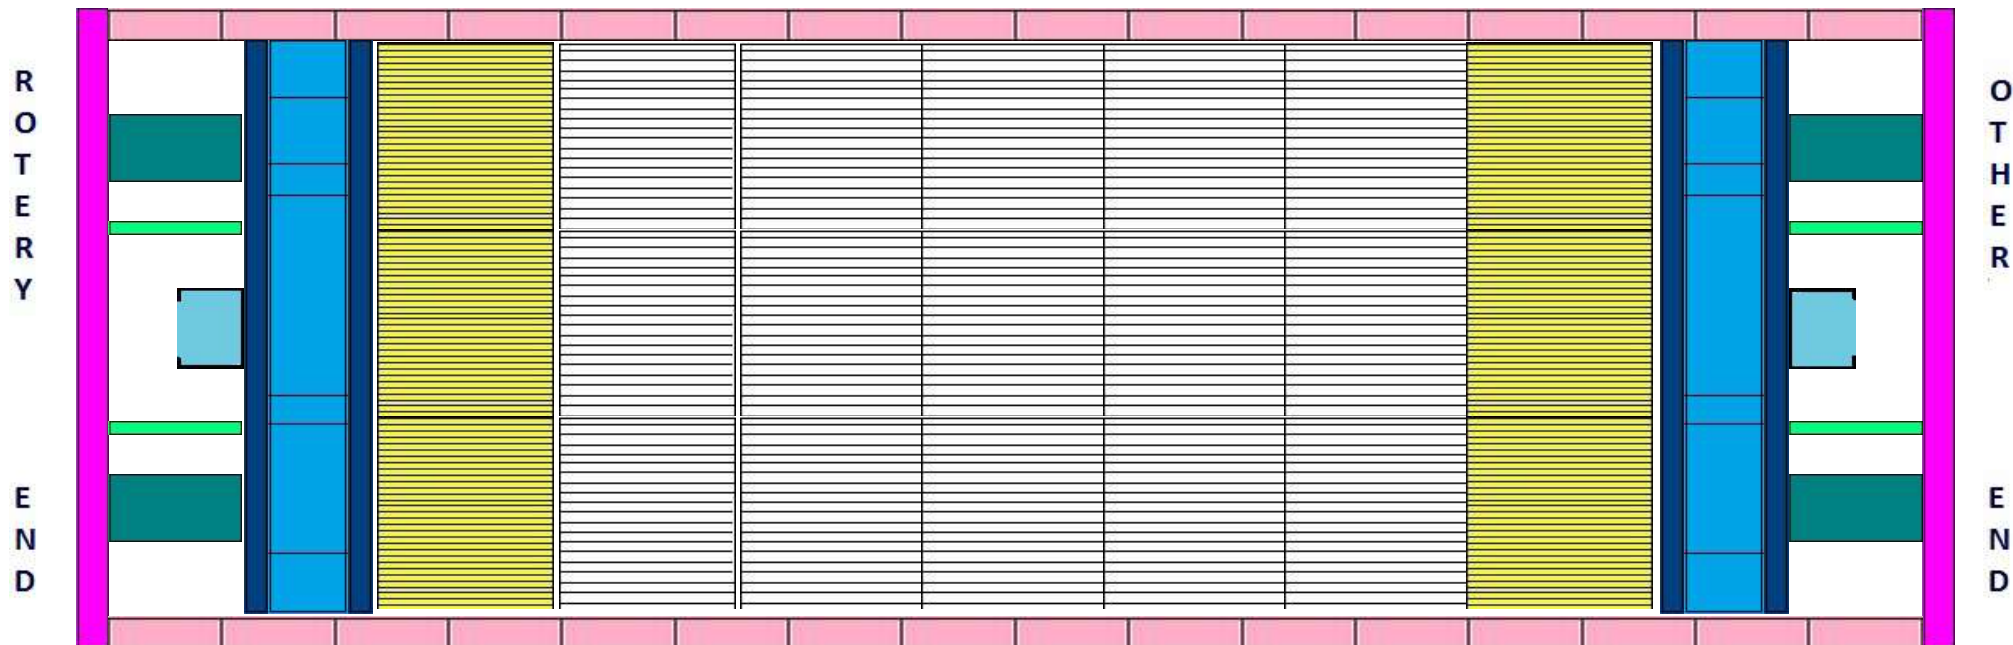

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		4%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -3, WEST : -6 Other End - EAST : -5, WEST : 0
Start Date : 10-Oct-2019, Completion Date : 19-Oct-2019, Net Repair Days : 9, Total Man Hours : 1415

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC02966


Type : WGSCZJ

Built Year : 2002

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

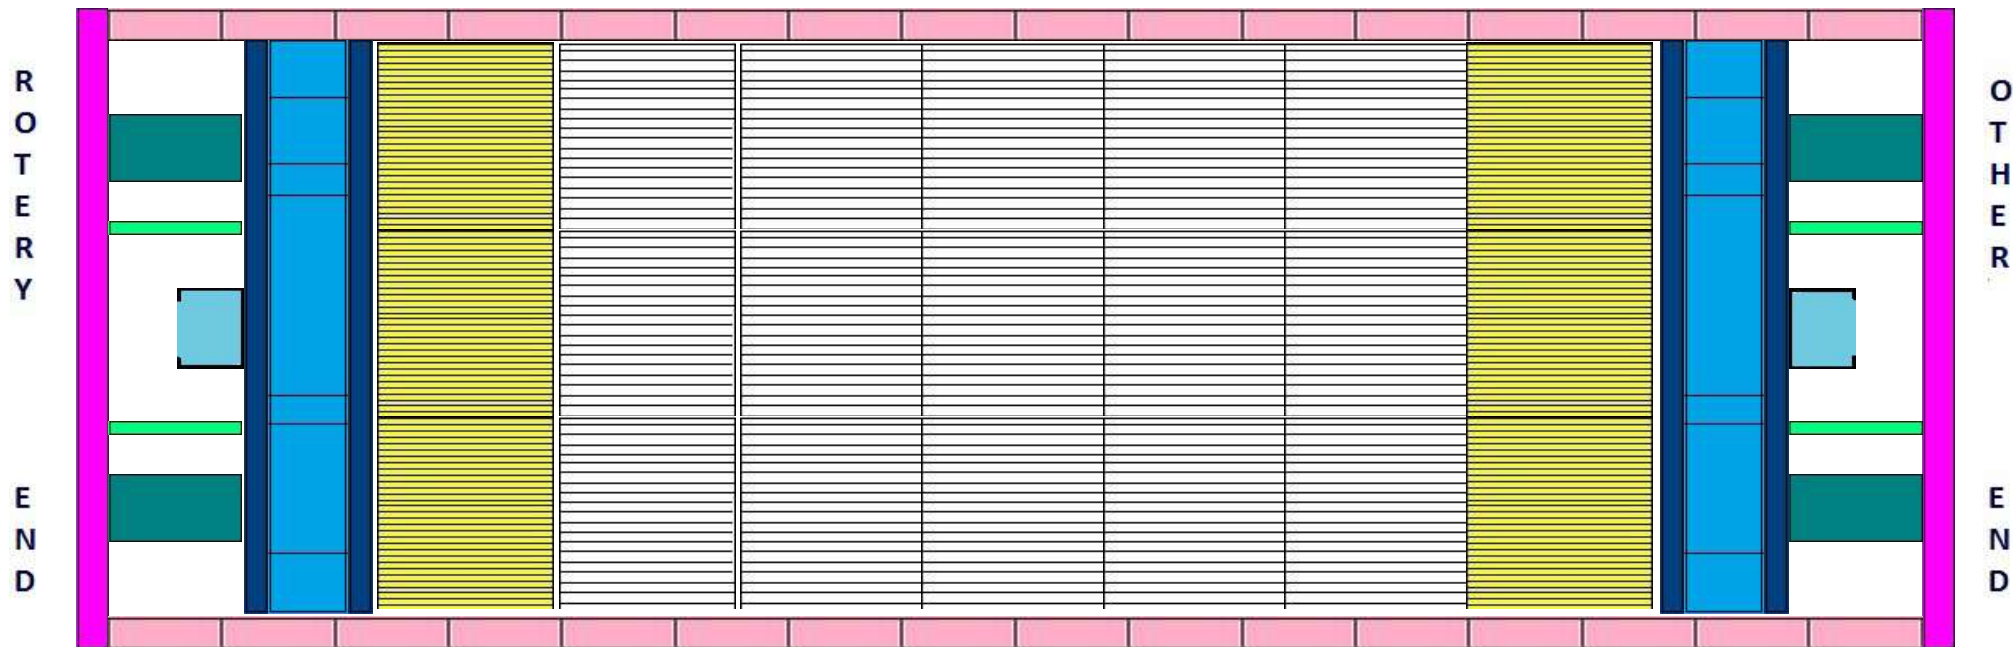

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		12%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 24-Jan-2020, Completion Date : 03-Feb-2020, Net Repair Days : 9, Total Man Hours : 1084

K K TRIPATHI - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC02967


Type : WGSCZJ

Built Year : 2002

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

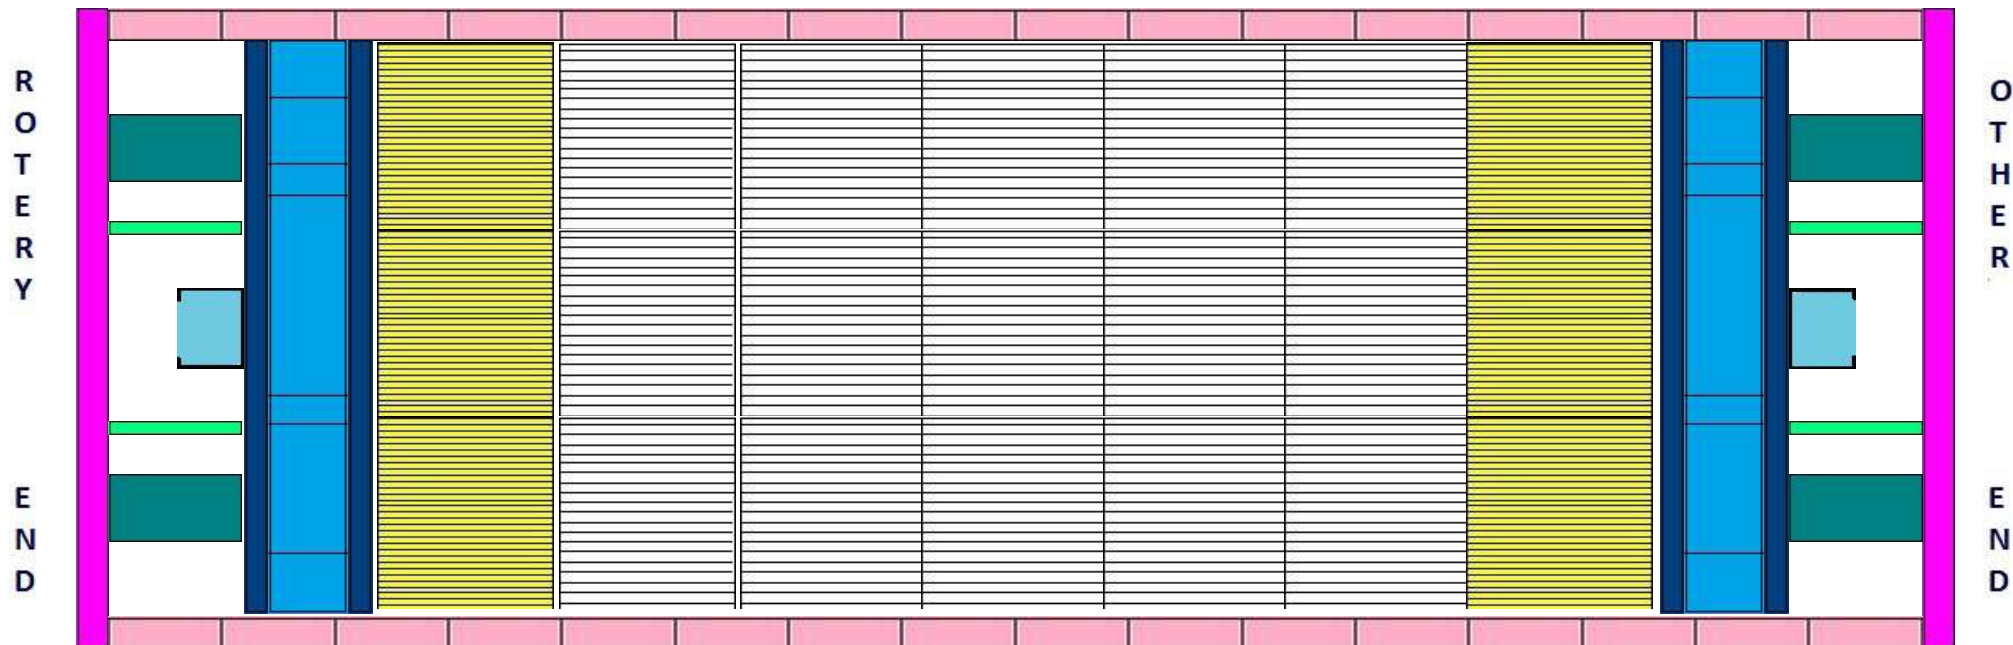

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		4%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -7, WEST : -4 Other End - EAST : 6, WEST : 3
Start Date : 20-Jan-2020, Completion Date : 01-Feb-2020, Net Repair Days : 12, Total Man Hours : 0

PANKAJ DAMARE - JE	HAMANT JADAV - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC02968


Type : WGSCZJ

Built Year : 2002

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

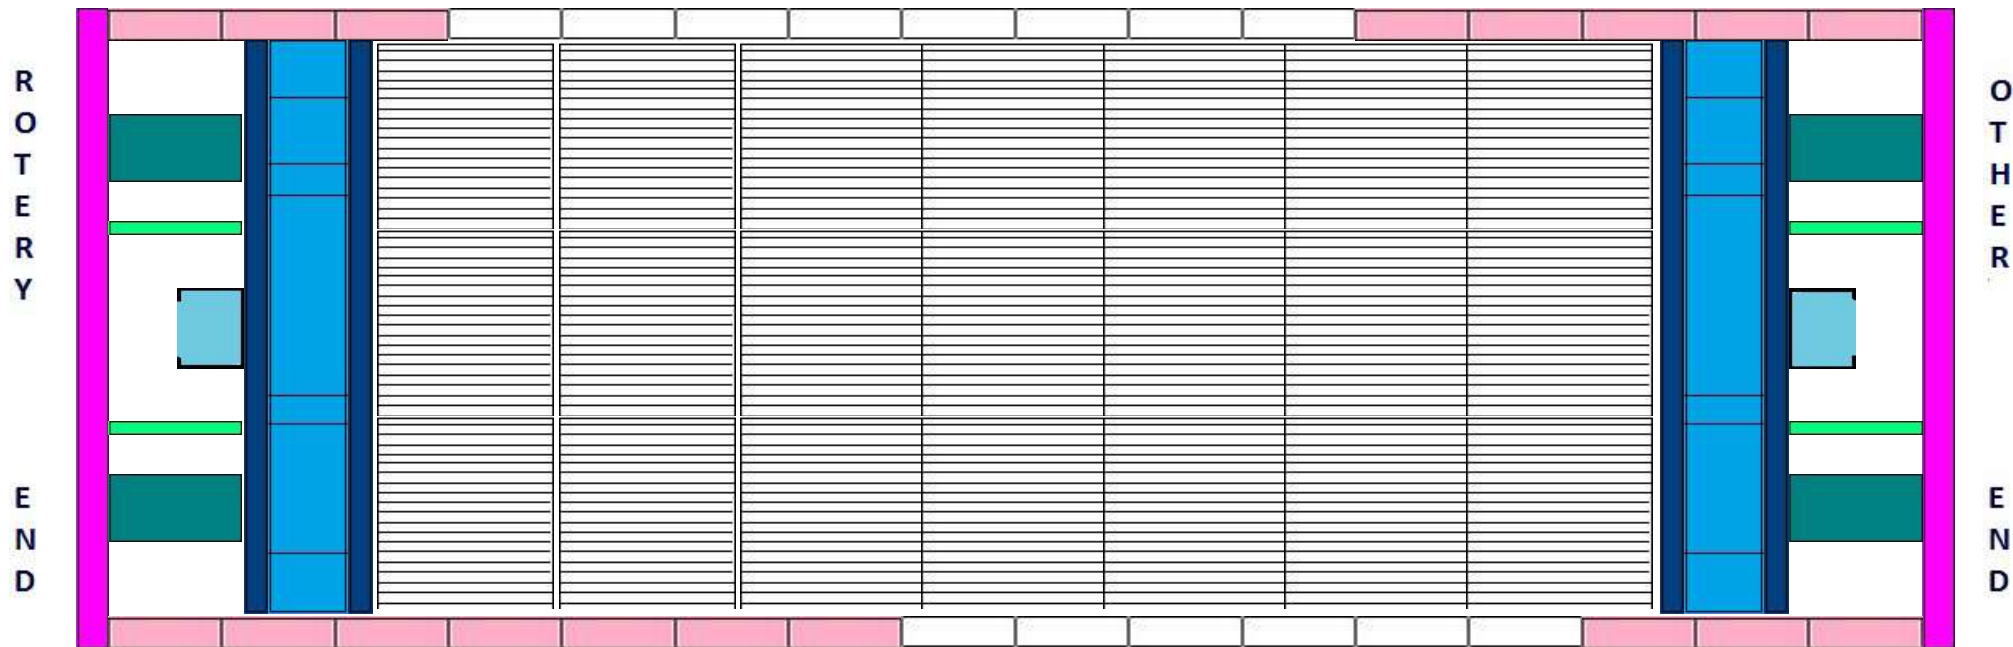

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	9	56%		Draft Gear Bracket	2	100%
	Trough floor	0	0%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	9	56%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		2%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -3, WEST : -2 Other End - EAST : -5, WEST : -6
Start Date : 08-Jun-2019, Completion Date : 15-Jun-2019, Net Repair Days : 7, Total Man Hours : 708

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC02971


Type : WGSCZJ

Built Year : 2002

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

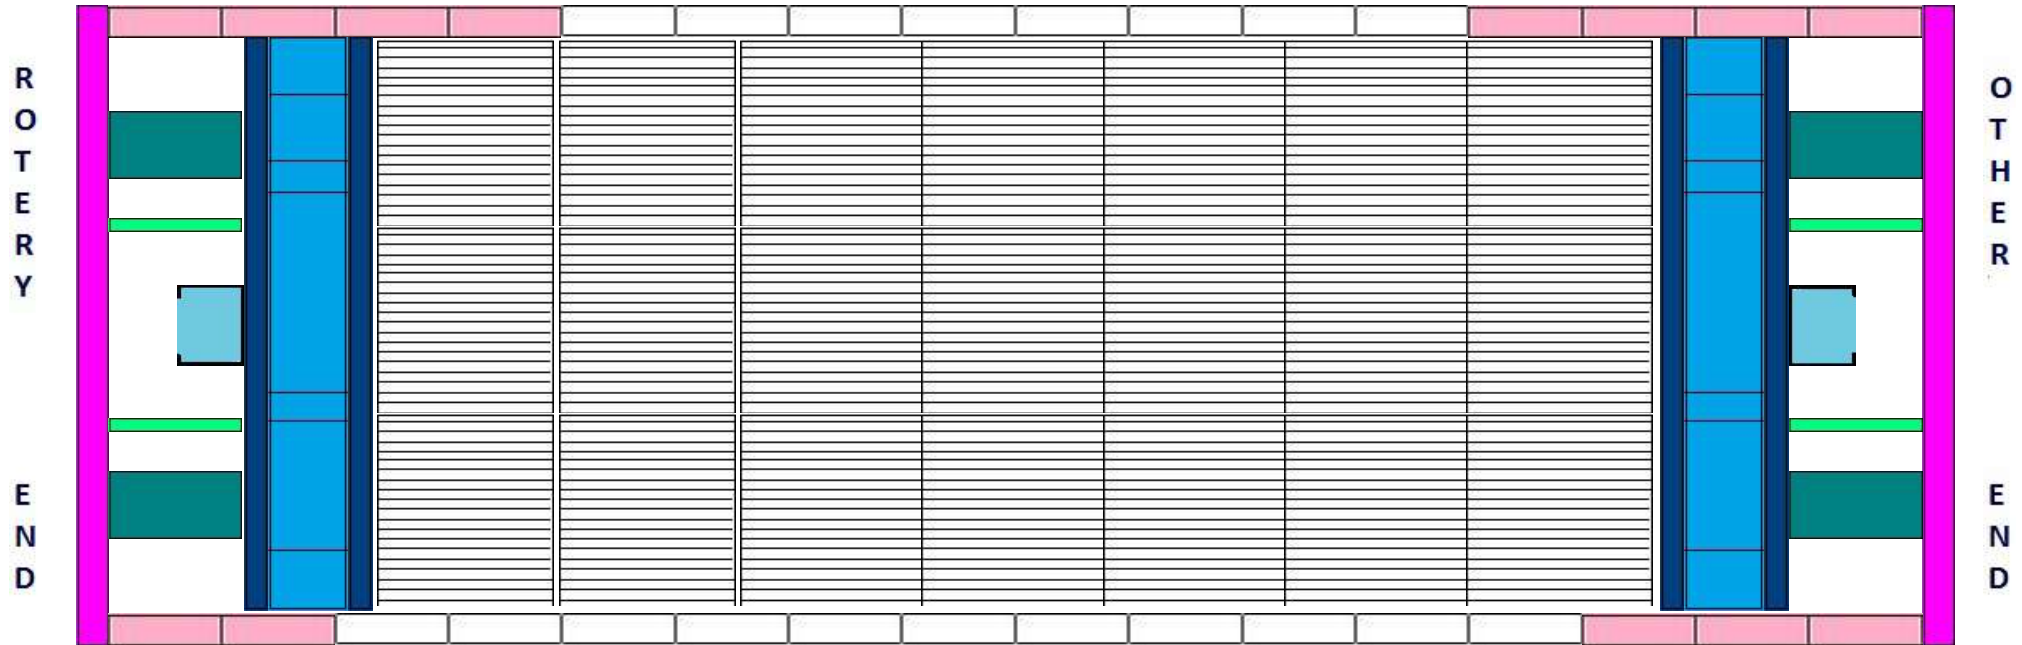

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	2	100%	Red	Centre Stiffner for Headstock	4	100%	Green	Floor Stiffner for Headstock	4	100%
Black	Aux. Head stock	4	100%	Blue	Sole Bar	6.5	41%	Yellow	Draft Gear Bracket	2	100%
Orange	Trough floor	0	0%	Red	Centre plate	2	100%	Black	SoleBar Stiffner	4	100%
	Bottom Wall Part	6.5	41%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		5%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 2, WEST : -5 Other End - EAST : -6, WEST : -3
Start Date : 04-Jun-2019, Completion Date : 14-Jun-2019, Net Repair Days : 10, Total Man Hours : 1024

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC02972


Type : WGSCZJ

Built Year : 2002

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

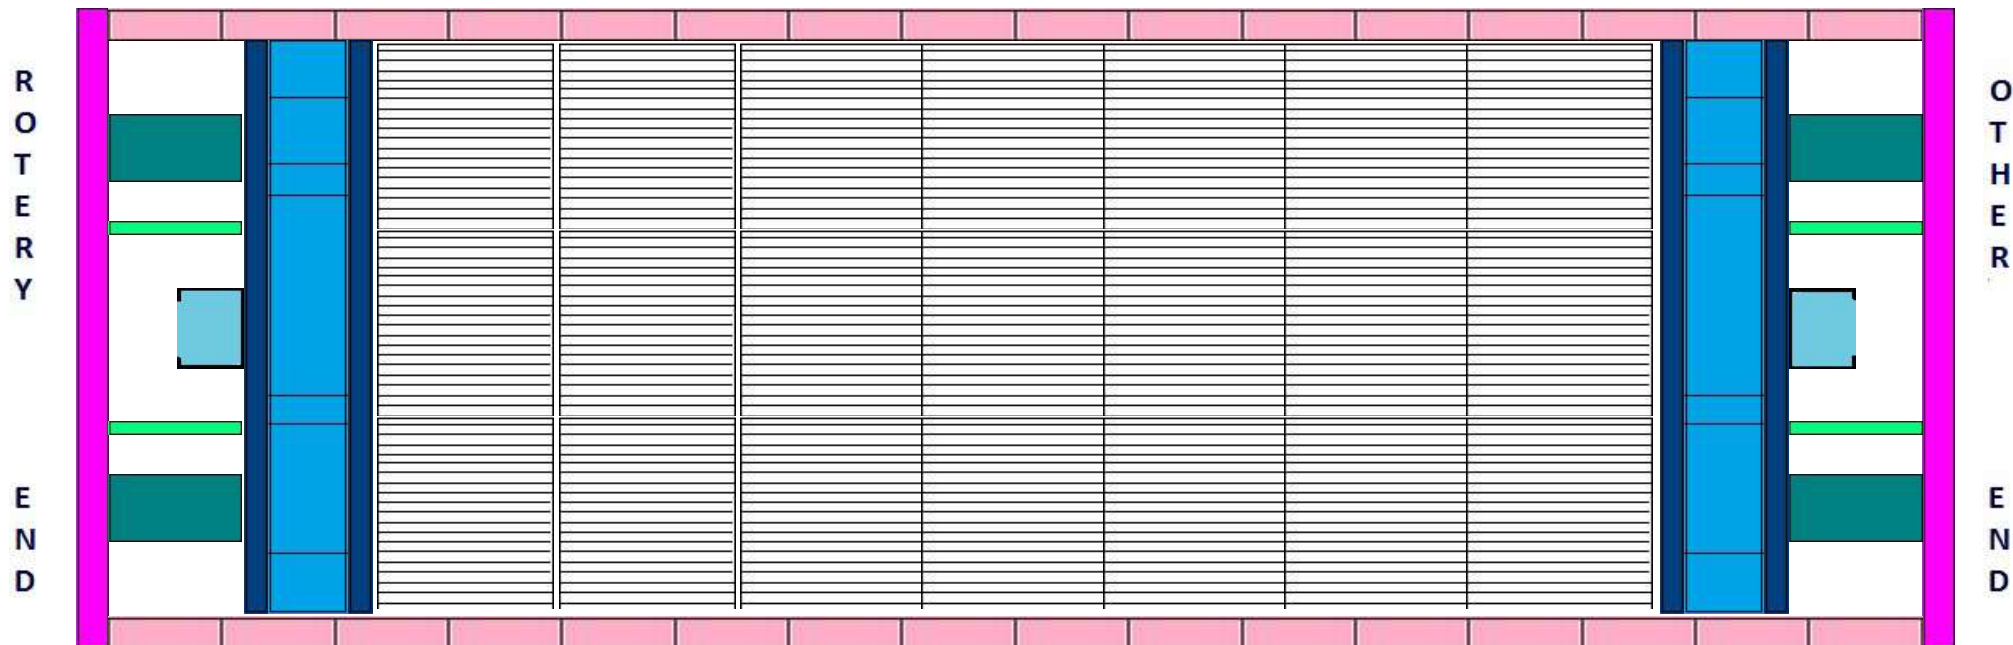

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	0	0%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -10, WEST : -10 Other End - EAST : 10, WEST : 10
Start Date : 07-Jun-2019, Completion Date : 17-Jun-2019, Net Repair Days : 9, Total Man Hours : 1348

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC02982


Type : WGSRJ

Built Year : 2002

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

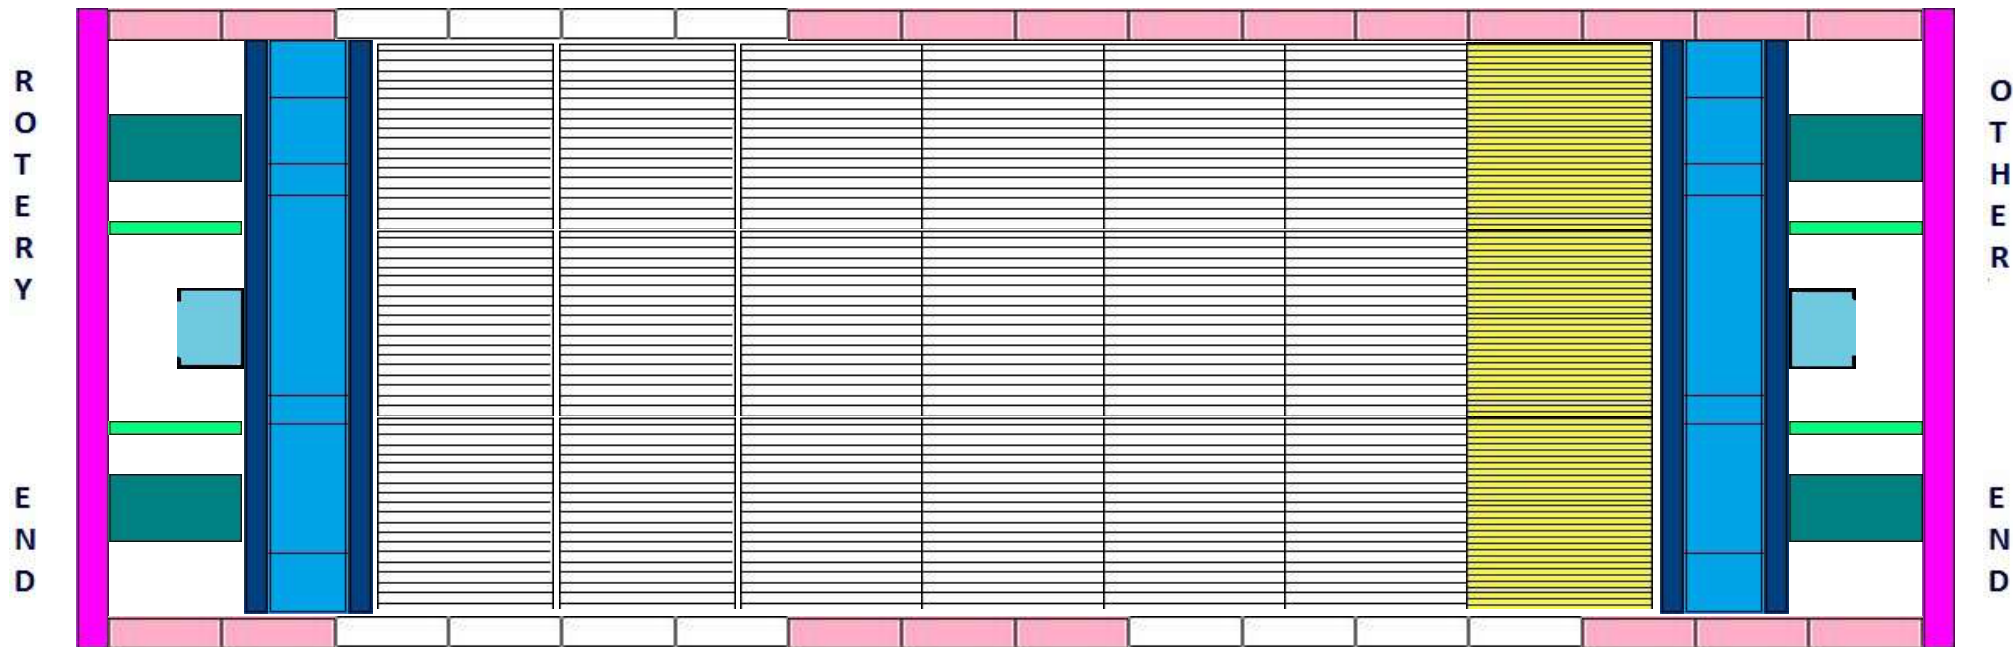

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	2	100%	Red	Centre Stiffner for Headstock	4	100%	Green	Floor Stiffner for Headstock	4	100%
Black	Aux. Head stock	4	100%	Yellow	Sole Bar	10	63%	Light Blue	Draft Gear Bracket	2	100%
Orange	Trough floor	1	14%	Dark Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	10	63%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		2%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -7, WEST : -8 Other End - EAST : -12, WEST : -10
Start Date : 02-Apr-2019, Completion Date : 12-Apr-2019, Net Repair Days : 10, Total Man Hours : 1144

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC02985


Type : WGSRJ

Built Year : 2002

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

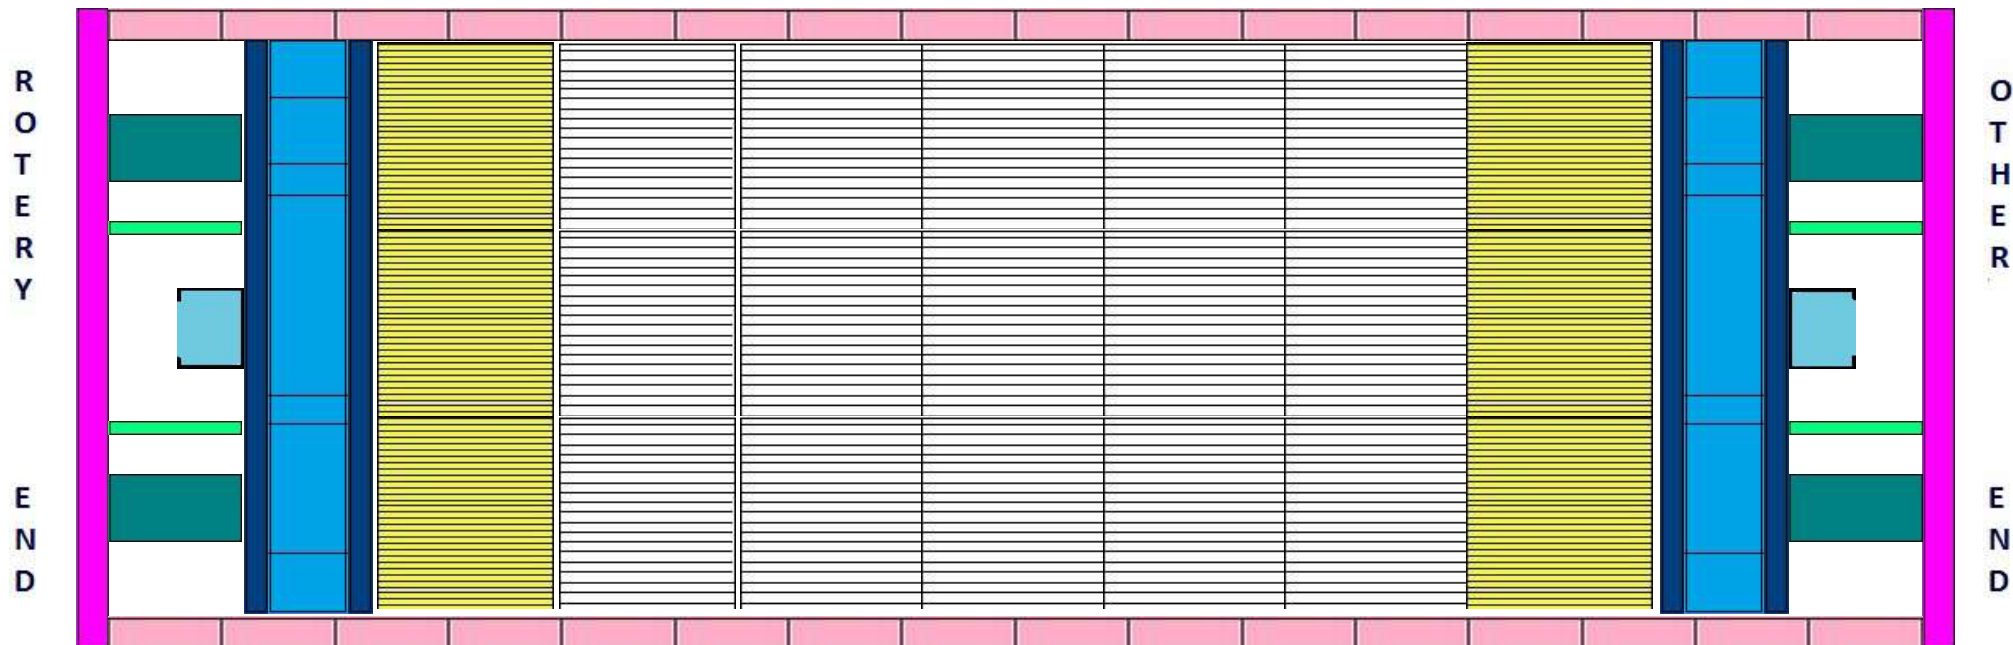

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Black	Aux. Head stock	4	100%	Yellow	Sole Bar	16	100%	Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Red	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		4%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 3, WEST : 4
Start Date : 20-Dec-2019, Completion Date : 01-Jan-2020, Net Repair Days : 11, Total Man Hours : 920

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC02986


Type : WGSCZRJ

Built Year : 2002

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

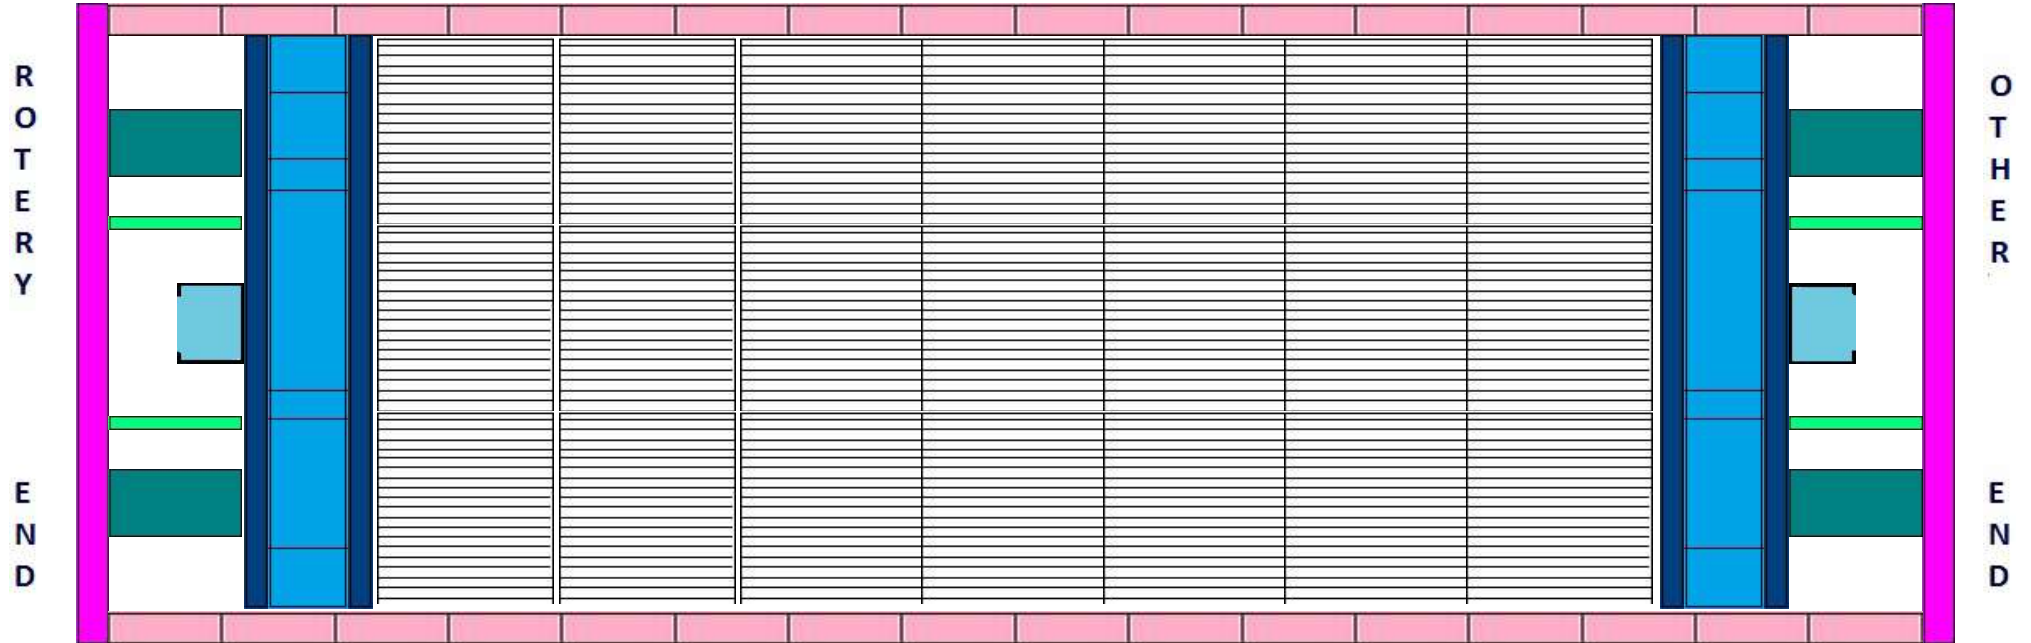

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Blue	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Green	Aux. Head stock	4	100%	Yellow	Sole Bar	16	100%	Blue	Draft Gear Bracket	2	100%
Red	Trough floor	0	0%	Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 2, WEST : 4 Other End - EAST : -4, WEST : -5
Start Date : 10-Jun-2019, Completion Date : 19-Jun-2019, Net Repair Days : 9, Total Man Hours : 968

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04998


Type : RA

Built Year : 2004

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

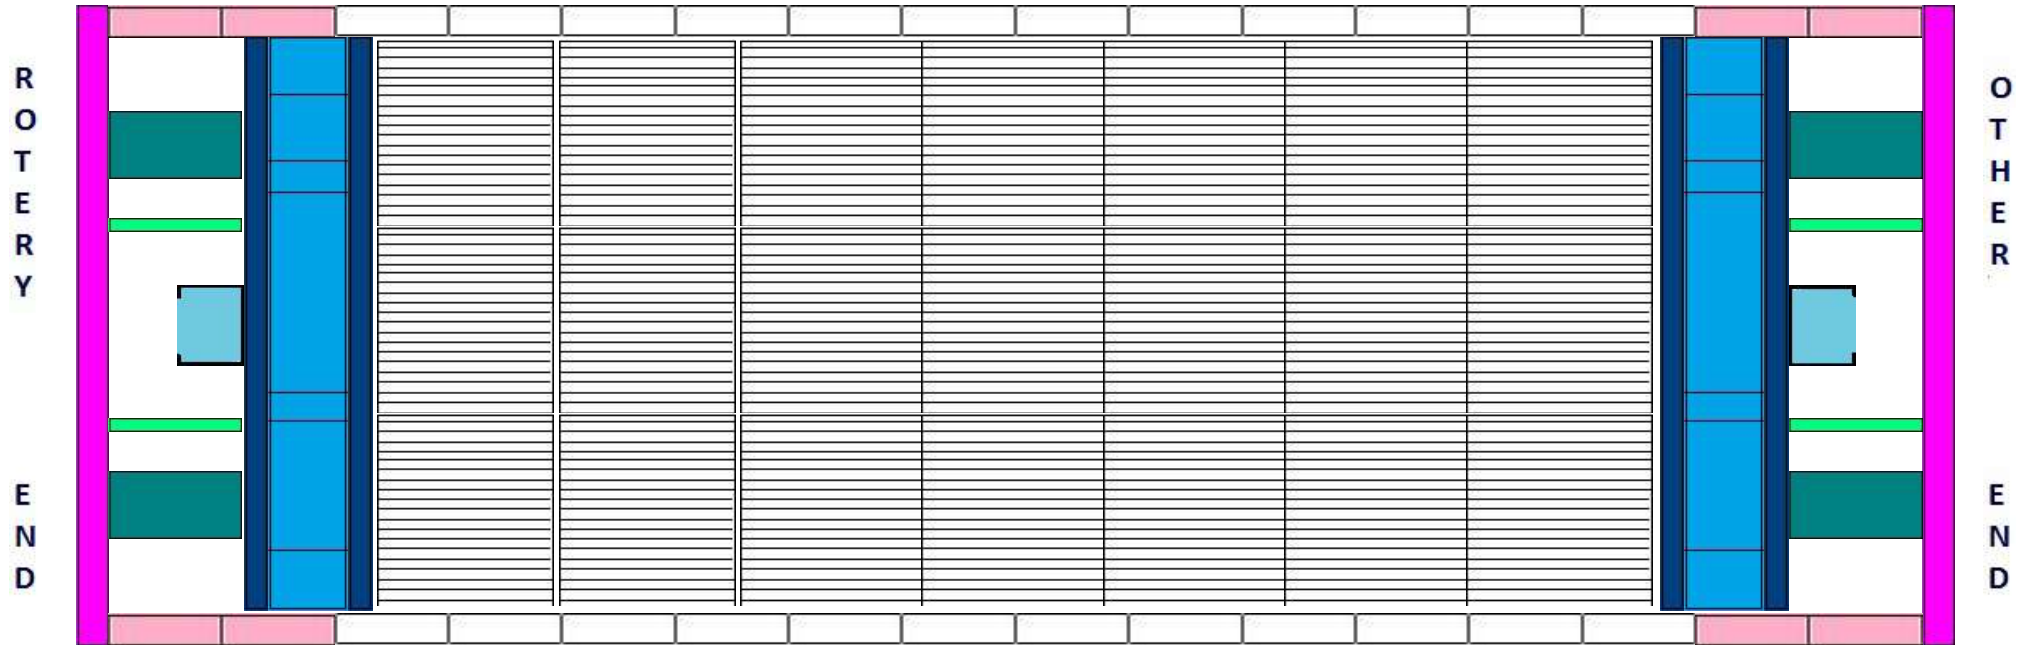

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	2	100%	Red	Centre Stiffner for Headstock	4	100%	Green	Floor Stiffner for Headstock	4	100%
Black	Aux. Head stock	4	100%	Yellow	Sole Bar	4	25%	Light Blue	Draft Gear Bracket	2	100%
Orange	Trough floor	0	0%	Dark Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4	25%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -4, WEST : -6 Other End - EAST : 3, WEST : 5
Start Date : 12-Jun-2019, Completion Date : 21-Jun-2019, Net Repair Days : 9, Total Man Hours : 676

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC96403


Type : GS

Built Year : 1996

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

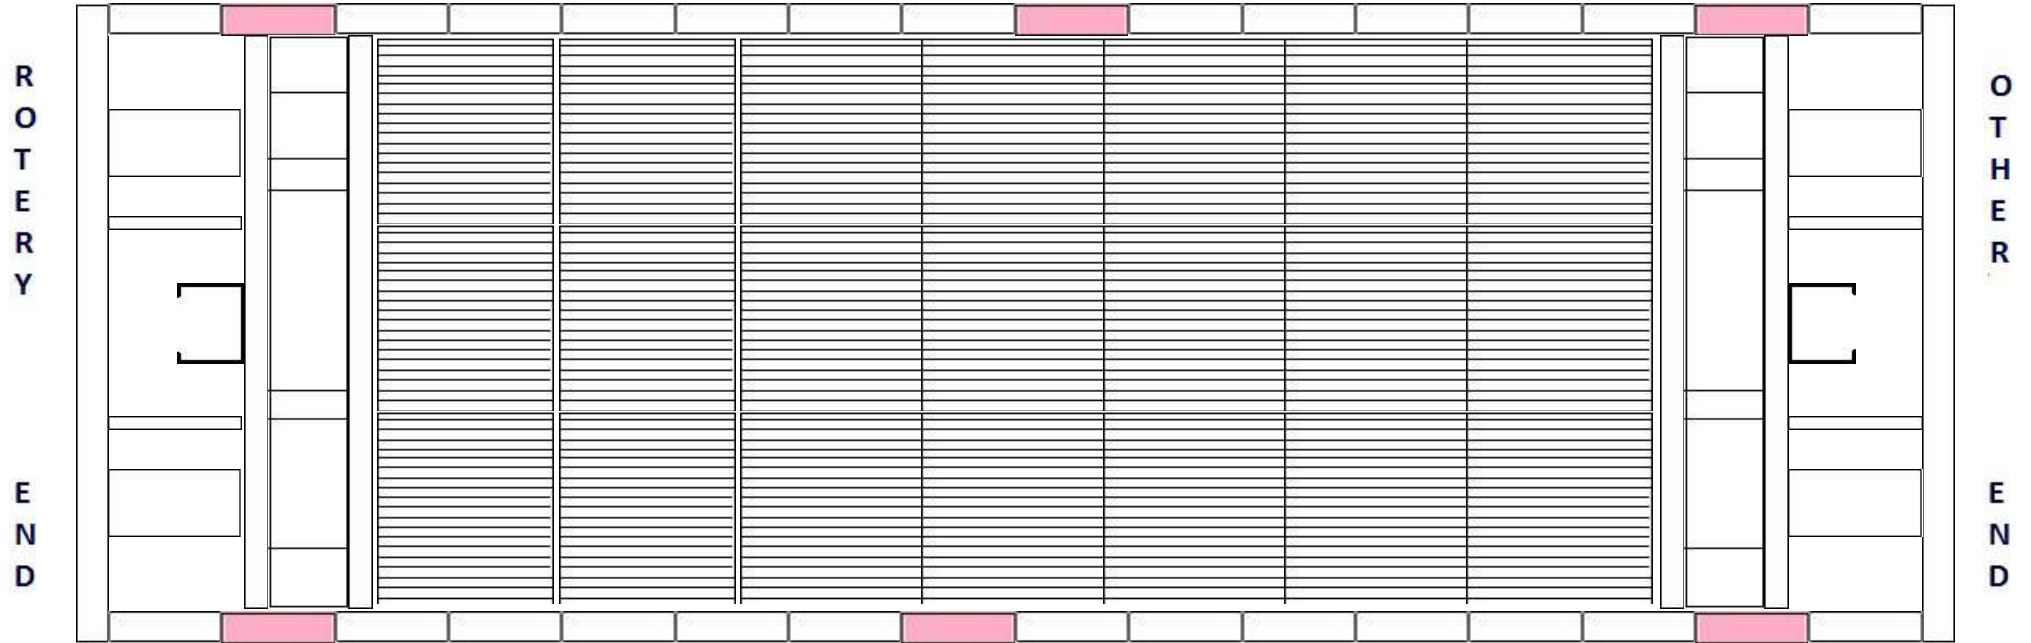

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	3	19%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	3	19%		Body panel/patch		0%		Door Top/Roof Patch		100%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 06-Feb-2020, Completion Date : 12-Feb-2020, Net Repair Days : 6, Total Man Hours : 1020

T R LAHRE - JE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	MANOJ AGARAWAL - SSE In-charge	Verified By:QU-Incharge
----------------	----------------------	------------------------	-----------------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC96702


Type : SLR

Built Year : 1996

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

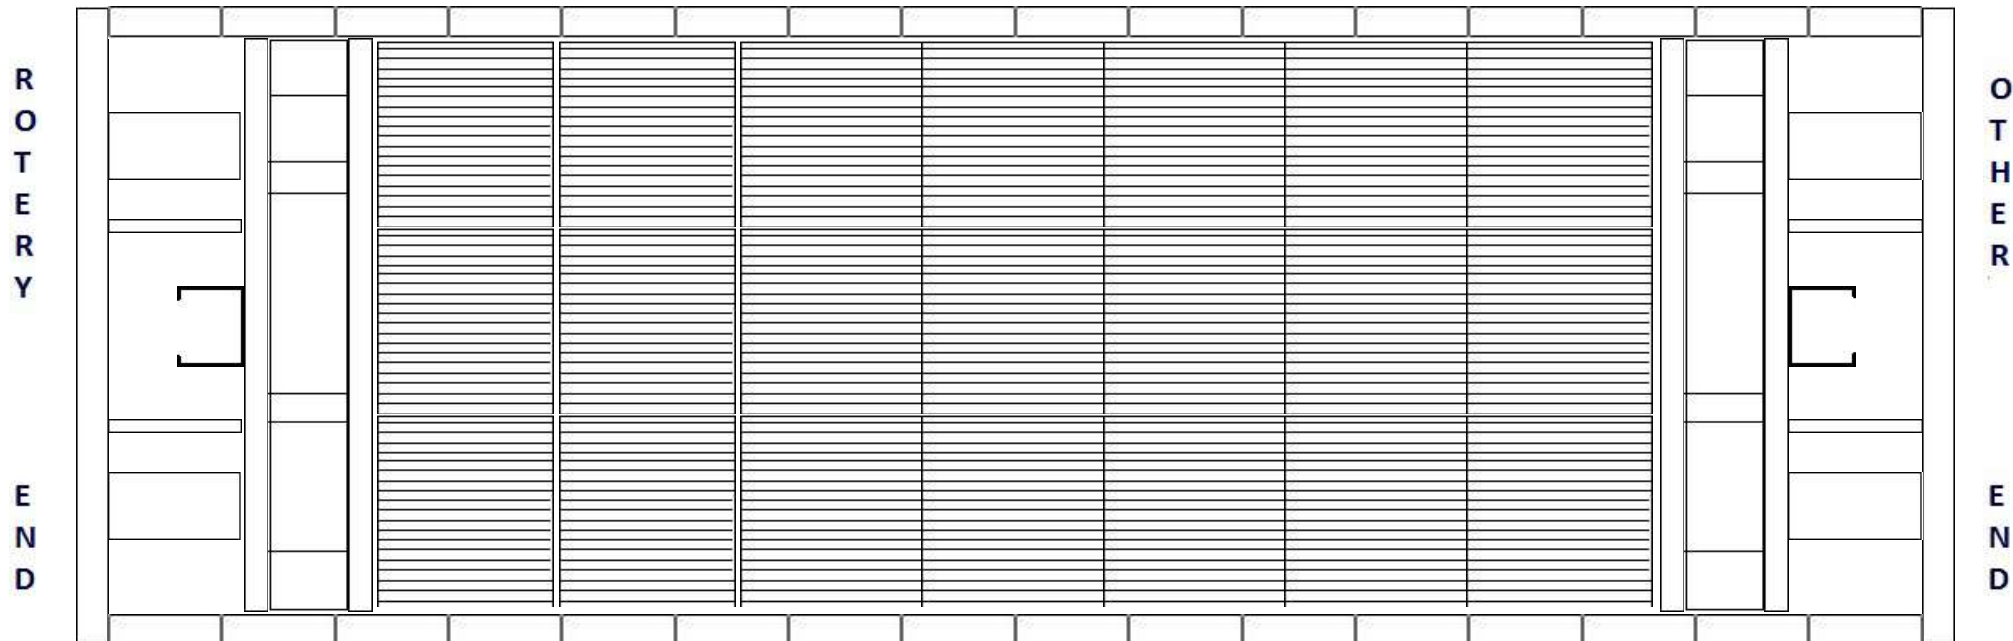

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		20%		Door Top/Roof Patch		100%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 04-Sep-2019, Completion Date : 05-Sep-2019, Net Repair Days : 2, Total Man Hours : 400

K K DEHARIA - JE	ANASTA PRASAD - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC00420


Type : GS

Built Year : 2000

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

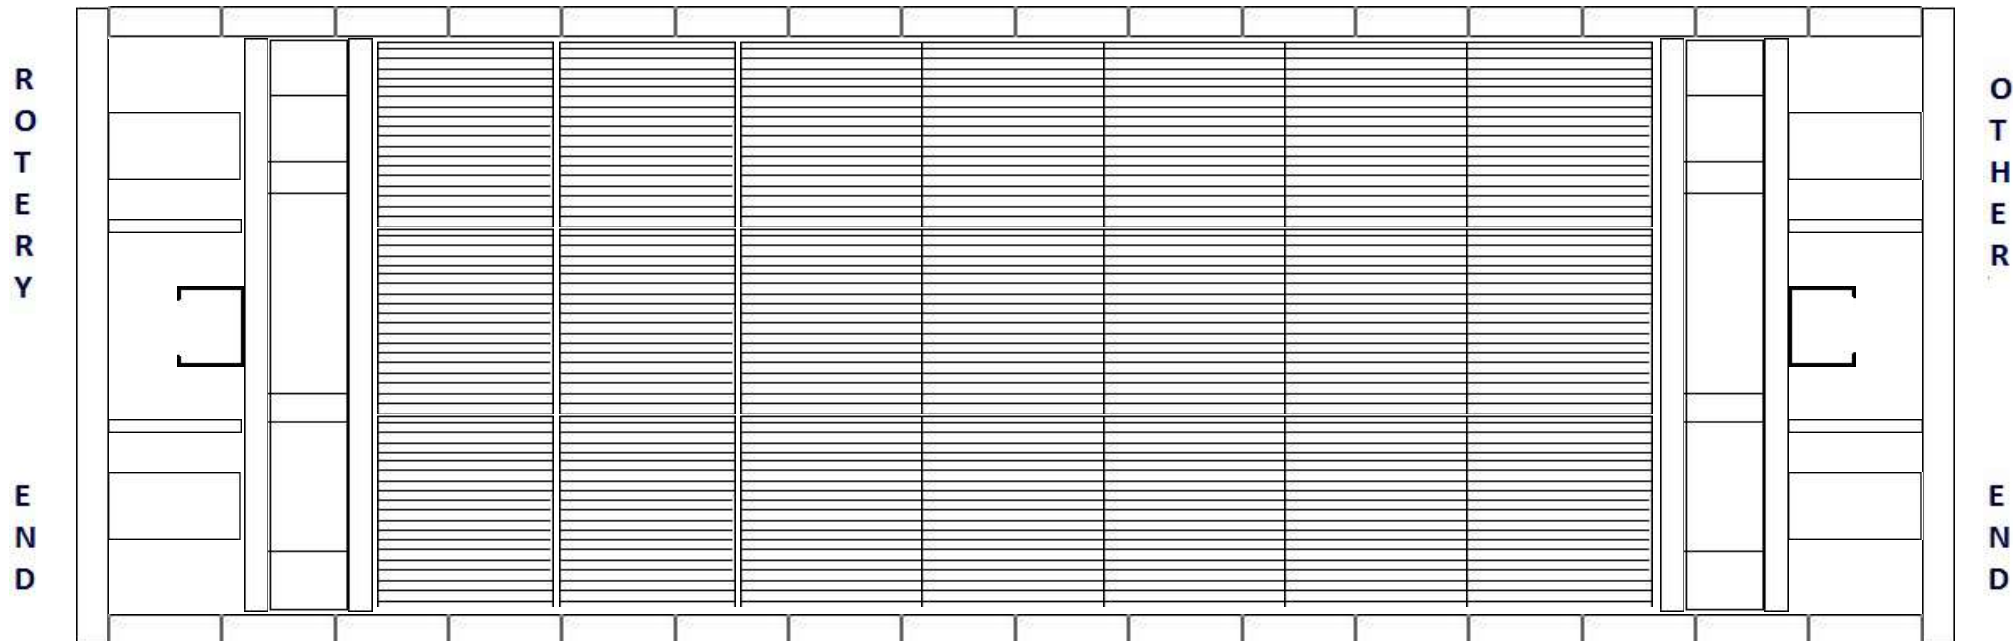

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		0%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 22-Aug-2019, Completion Date : 24-Aug-2019, Net Repair Days : 3, Total Man Hours : 440

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	--------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC03407


Type : GS

Built Year : 2003

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

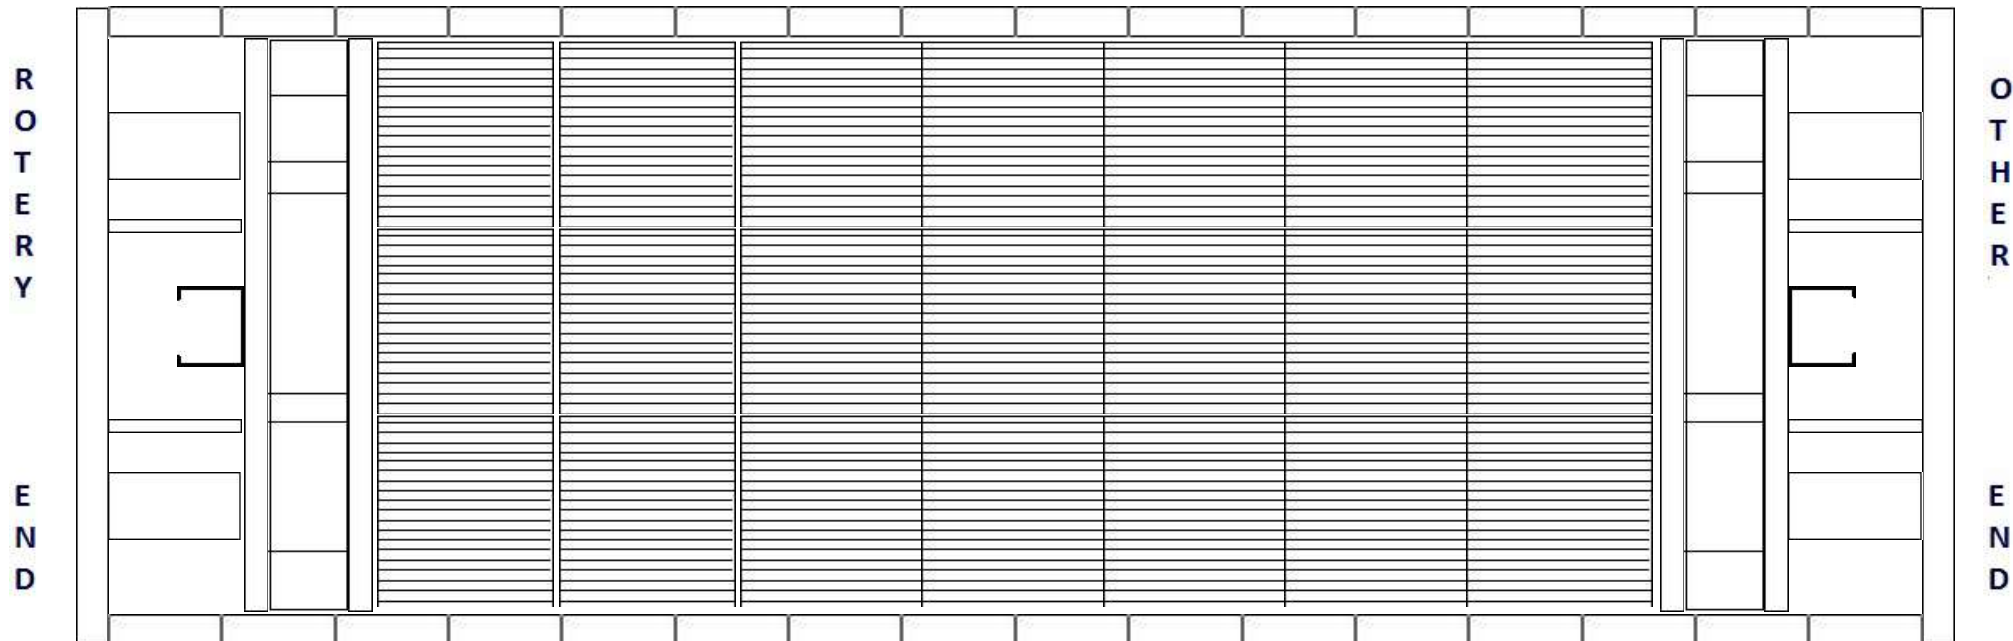

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	0	0%		Body panel/patch		20%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 04-Sep-2019, Completion Date : 06-Sep-2019, Net Repair Days : 3, Total Man Hours : 172

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC03976


Type : WGSCZJ

Built Year : 2002

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

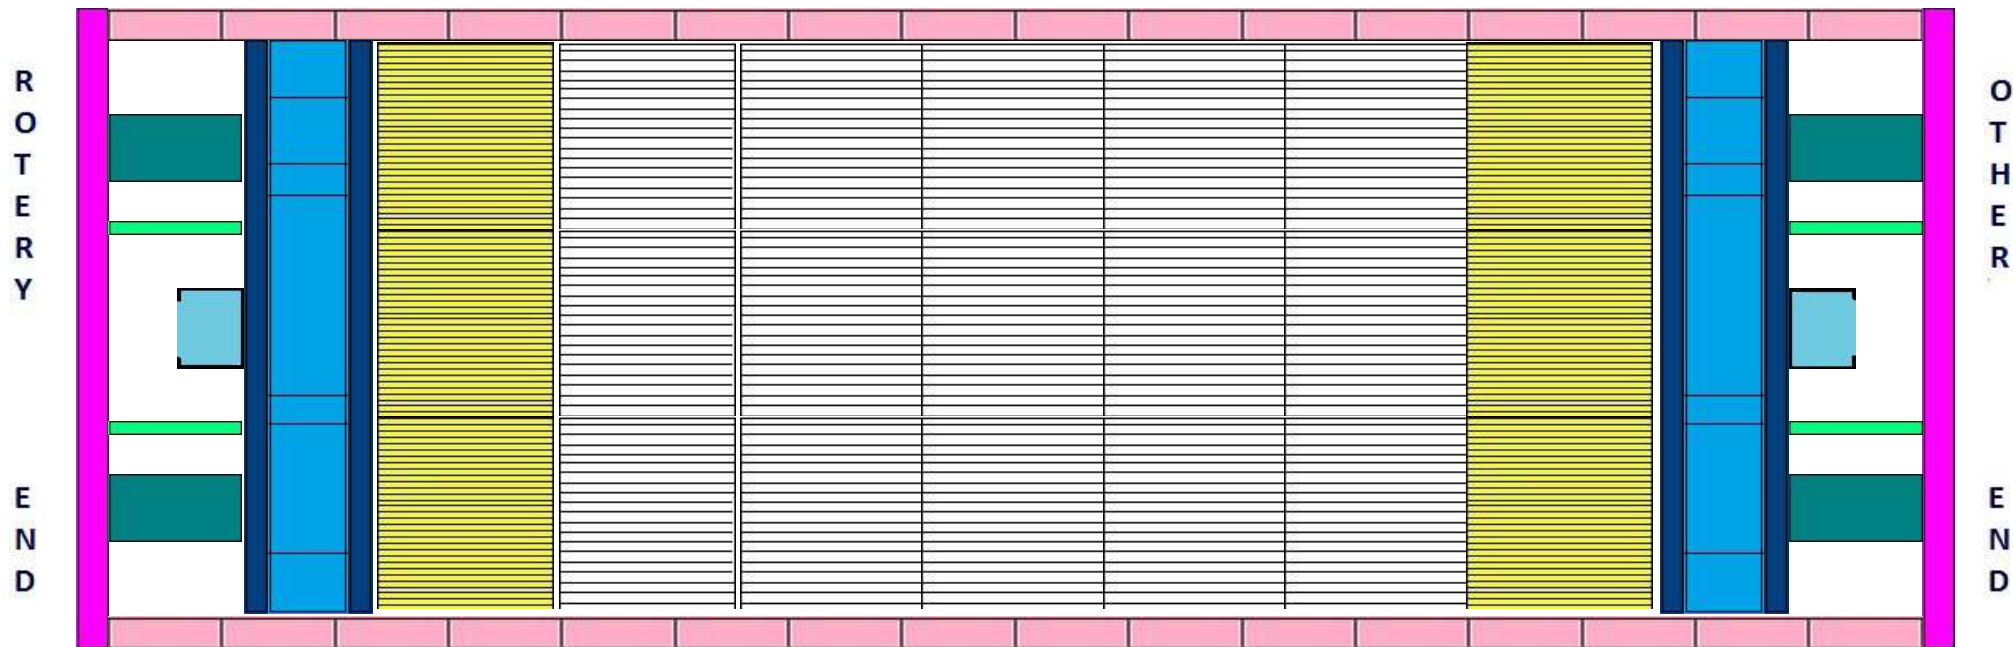

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Light Blue	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		10%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : -4 Other End - EAST : -3, WEST : -2
Start Date : 03-Apr-2019, Completion Date : 12-Apr-2019, Net Repair Days : 9, Total Man Hours : 1512

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04104


Type : WGACCN

Built Year : 2004

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

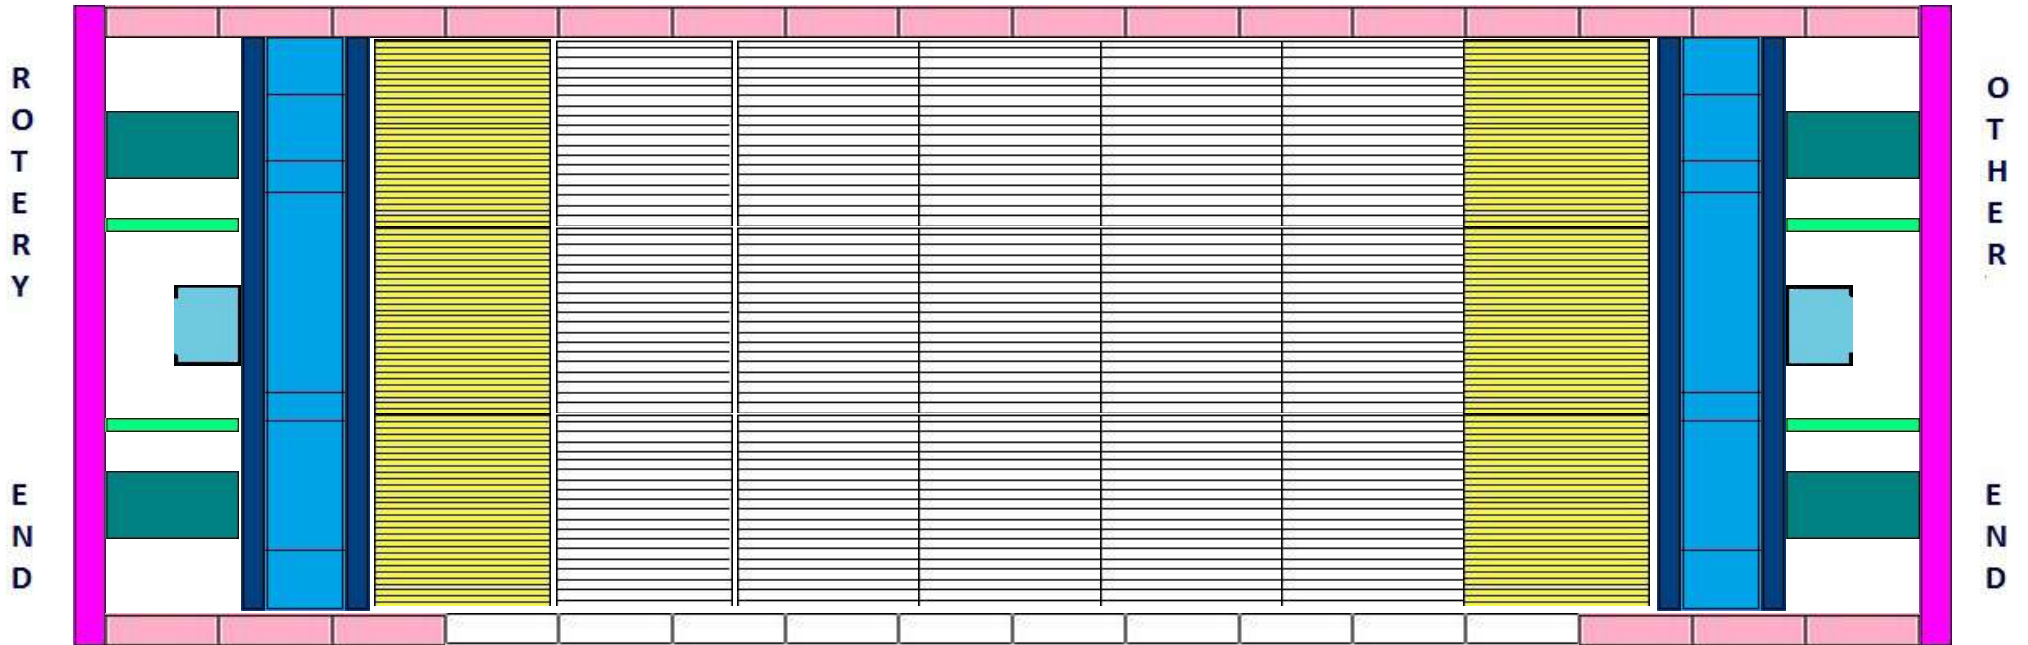

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Black	Aux. Head stock	4	100%	Yellow	Sole Bar	11	69%	Light Blue	Draft Gear Bracket	2	100%
Orange	Trough floor	2	29%	Dark Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	11	69%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		5%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 3, WEST : 4 Other End - EAST : 6, WEST : 0
Start Date : 08-Apr-2019, Completion Date : 23-Apr-2019, Net Repair Days : 14, Total Man Hours : 1536

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07409


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

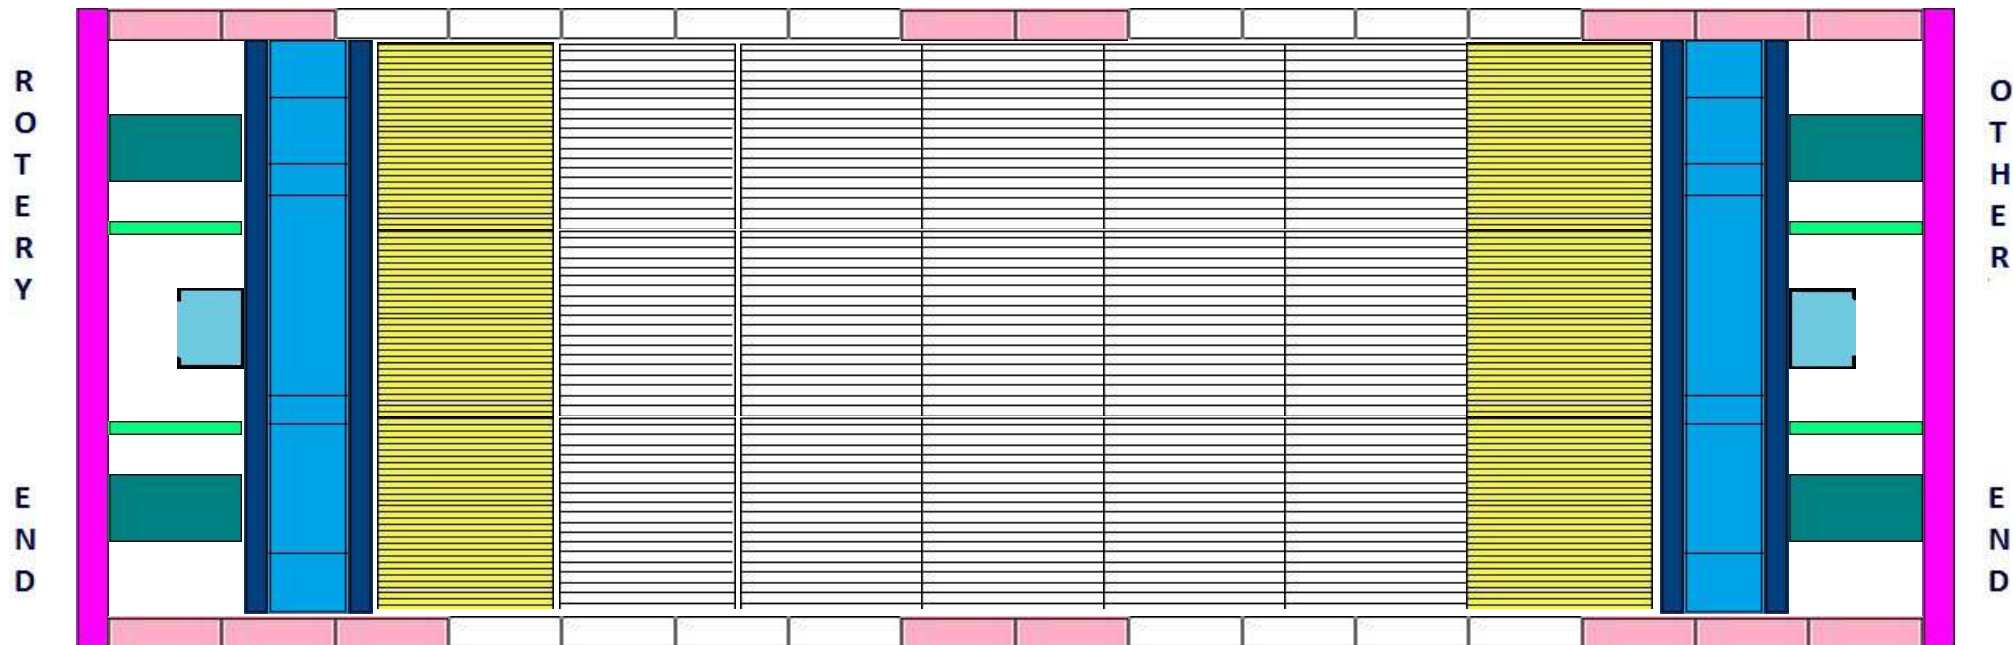

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	7.5	47%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	7.5	47%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	18	45%		Window Bar	40	23%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 4, WEST : 0 Other End - EAST : 3, WEST : 0
Start Date : 03-Jan-2020, Completion Date : 13-Jan-2020, Net Repair Days : 9, Total Man Hours : 896

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07410


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

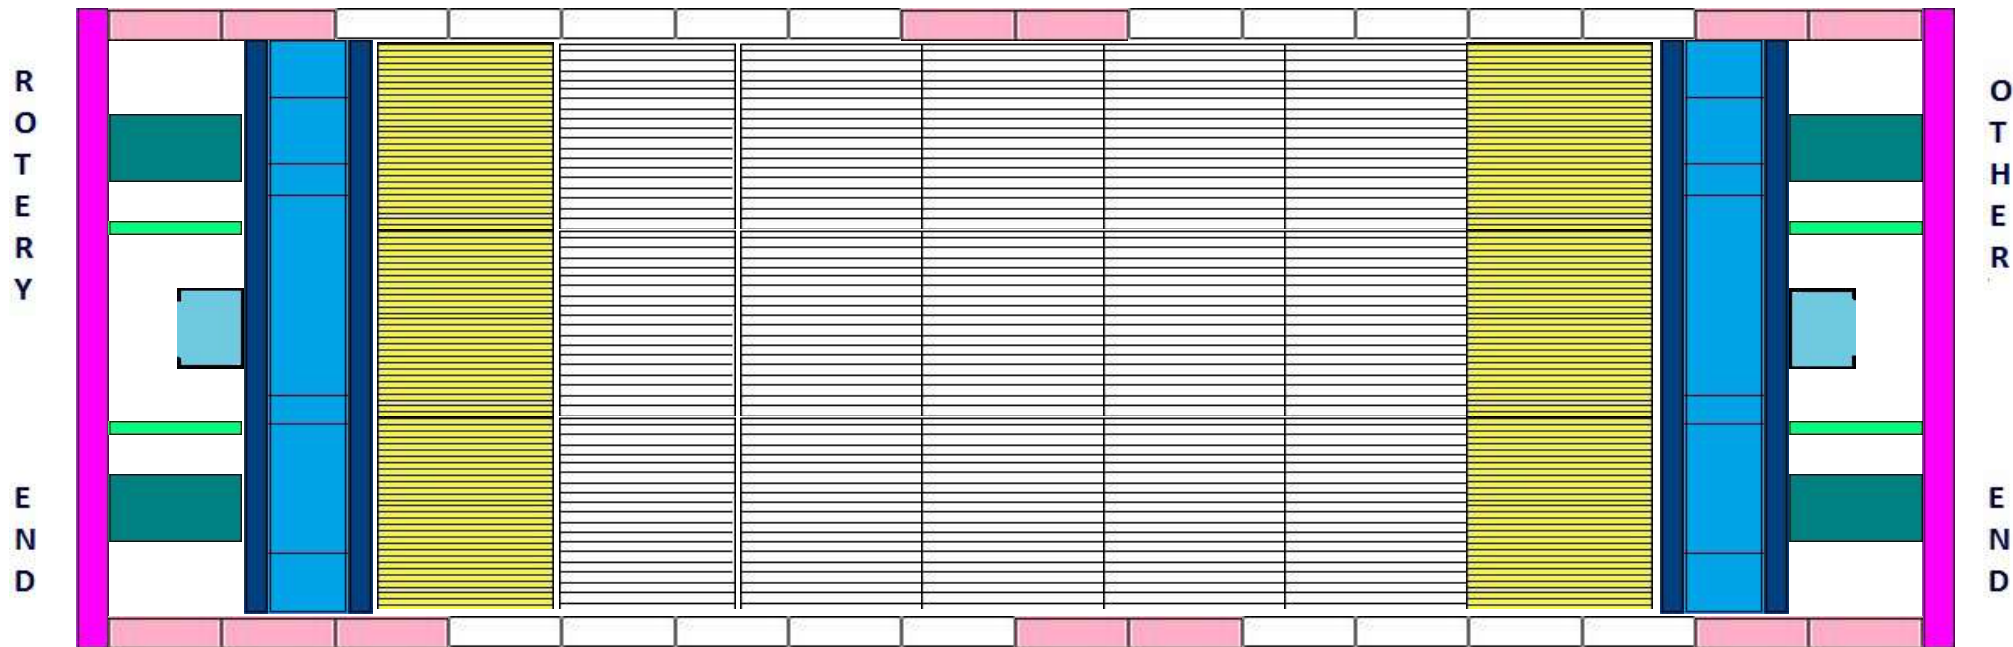

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
 	Headstock Beam	2	100%	 	Centre Stiffner for Headstock	4	100%	 	Floor Stiffner for Headstock	4	100%
 	Aux. Head stock	4	100%	 	Sole Bar	6.5	41%	 	Draft Gear Bracket	2	100%
 	Trough floor	2	29%	 	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	6.5	41%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	46	26%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 4, WEST : 3 Other End - EAST : 5, WEST : 5
Start Date : 15-Jun-2019, Completion Date : 22-Jun-2019, Net Repair Days : 7, Total Man Hours : 968

M L KOLI - JE	HAMANT JADAV - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07412


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

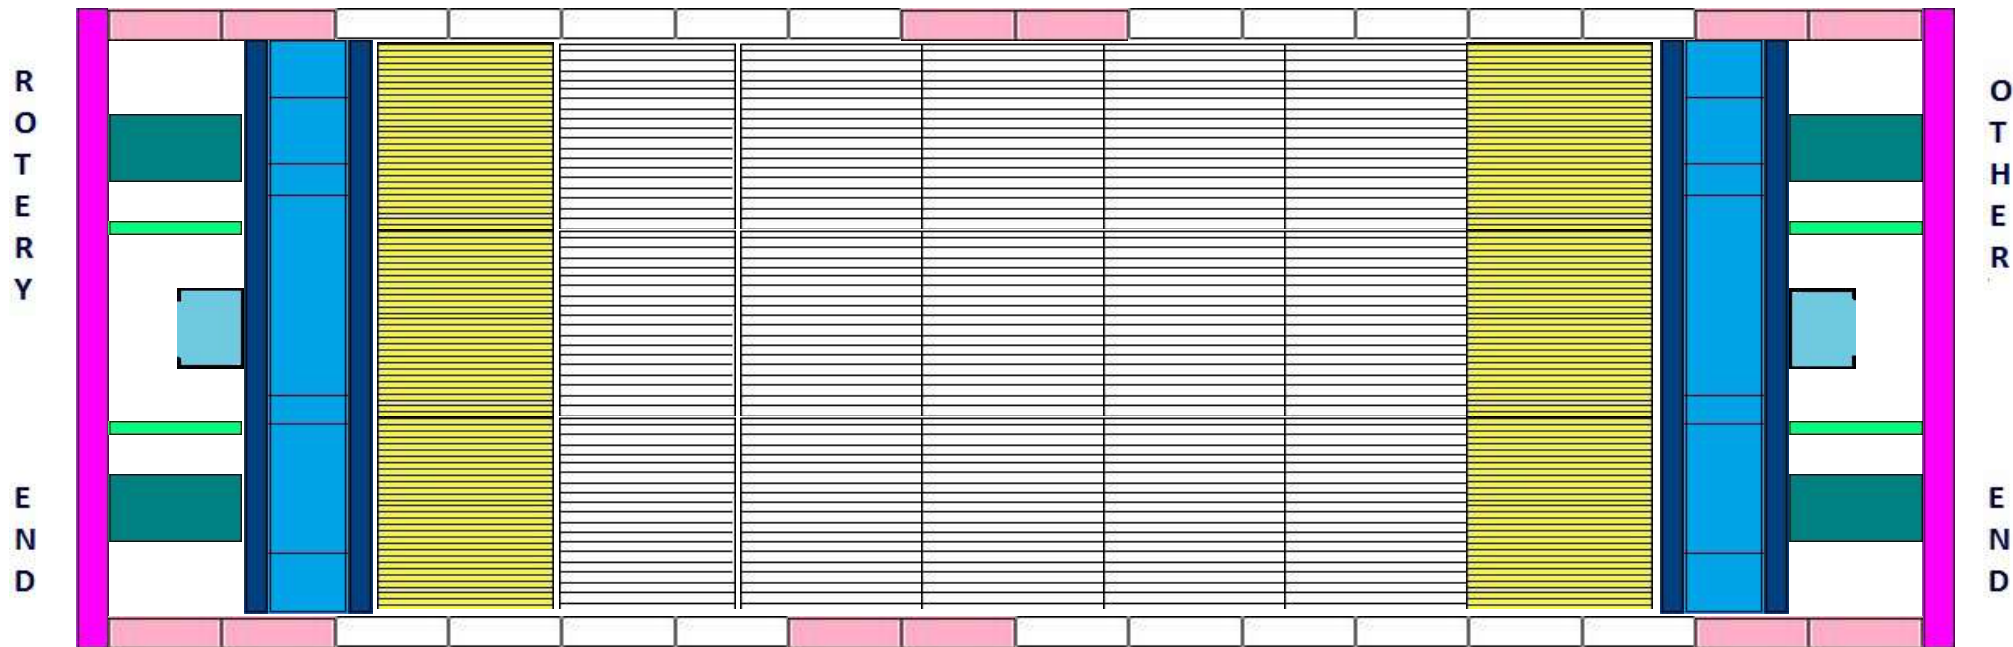

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	6	38%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	6	38%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	24	60%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 7, WEST : 9 Other End - EAST : 2, WEST : 5
Start Date : 15-Nov-2019, Completion Date : 21-Nov-2019, Net Repair Days : 6, Total Man Hours : 948

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07415


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

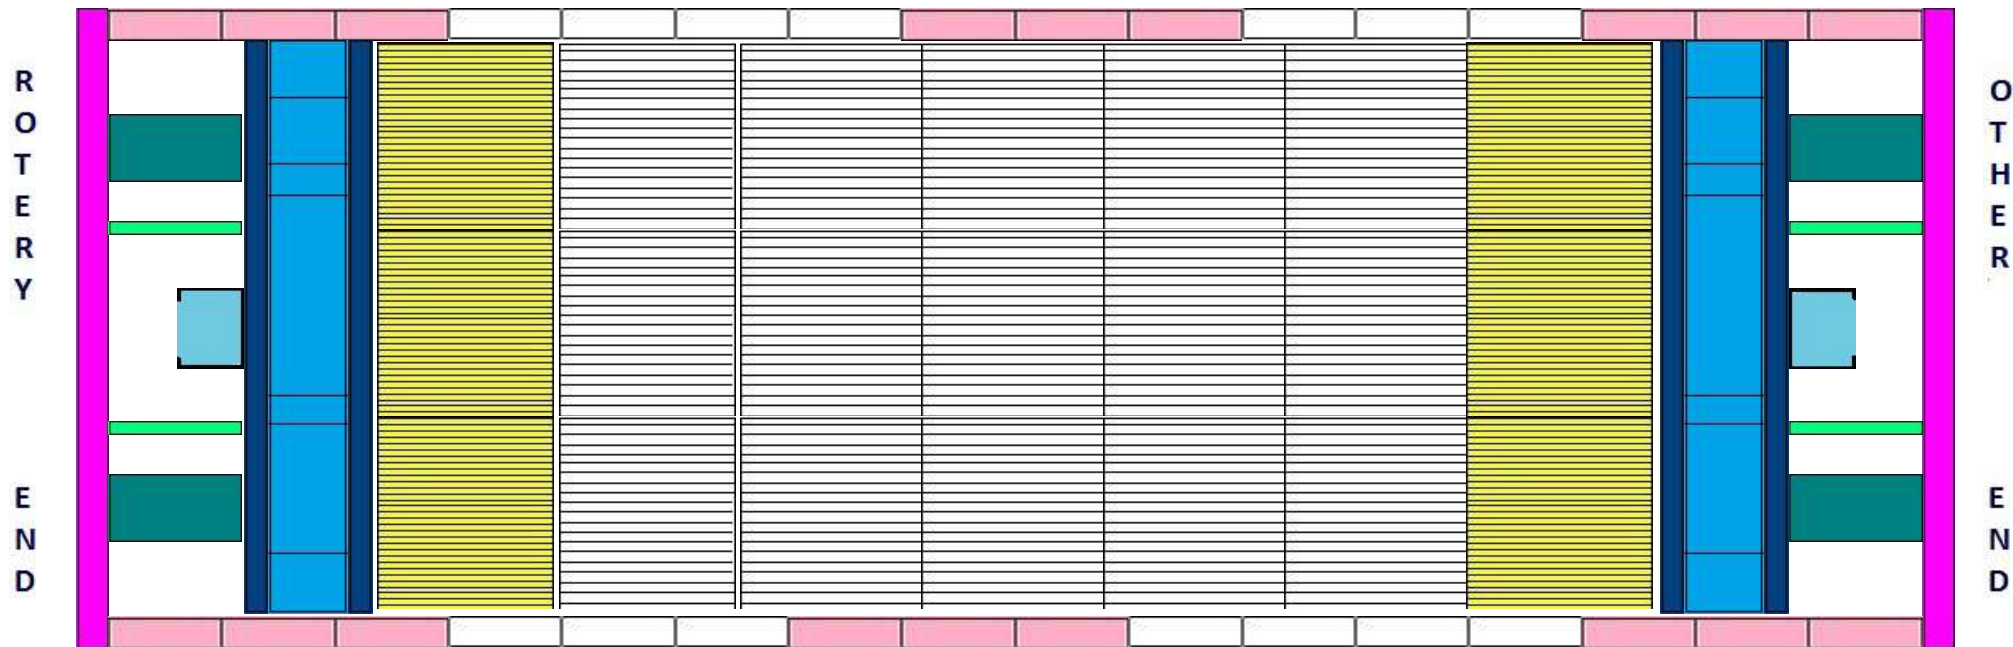

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	9	56%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	9	56%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	30	75%		Window Bar	50	28%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : -4 Other End - EAST : -3, WEST : -4

Start Date : 12-Apr-2019, Completion Date : 25-Apr-2019, Net Repair Days : 12, Total Man Hours : 1212

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07416


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

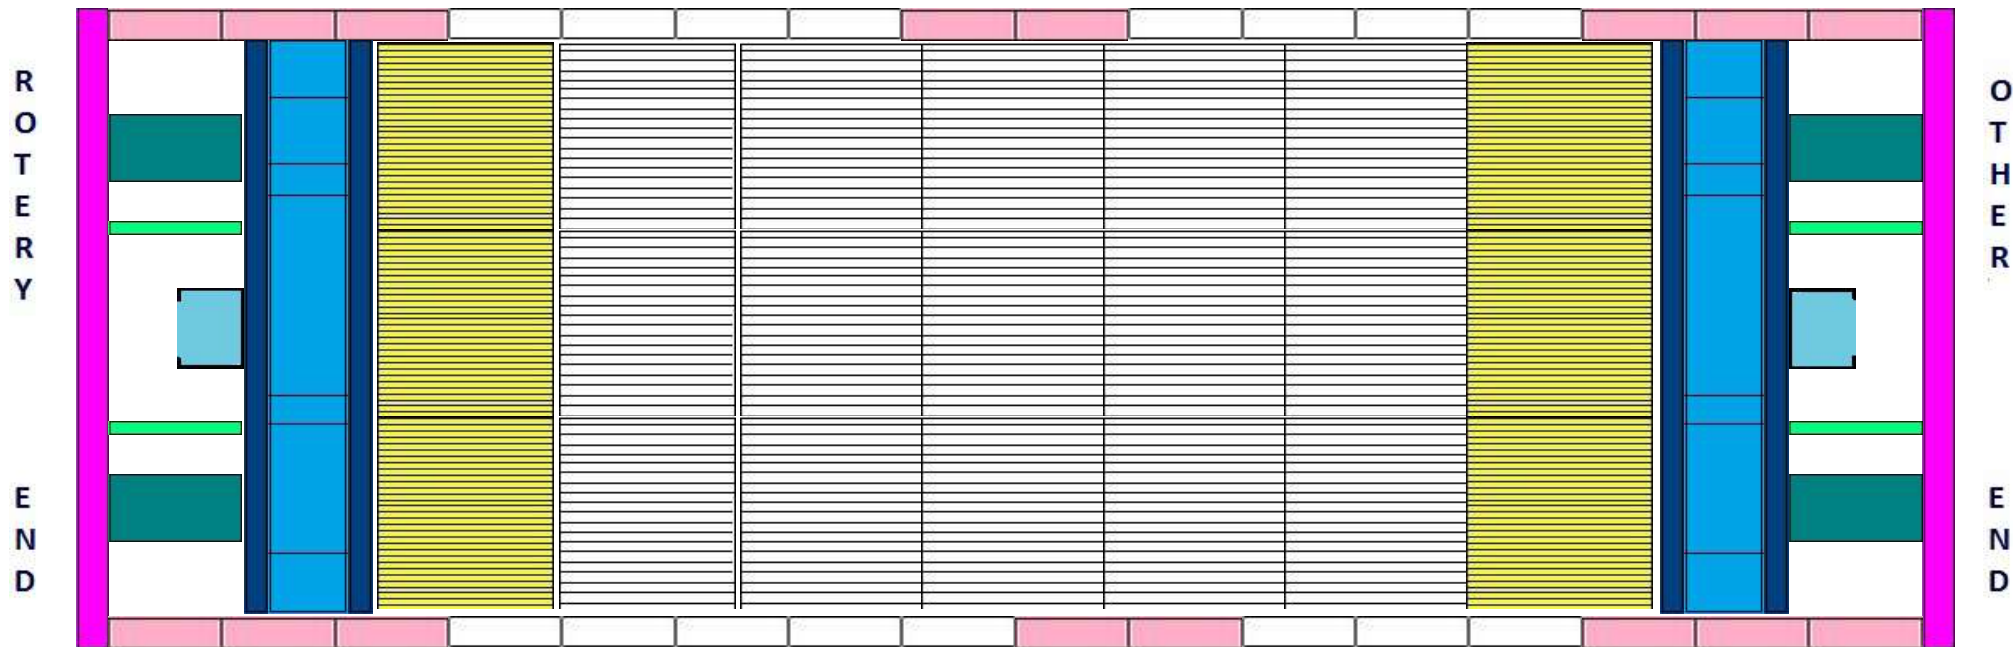

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	8	50%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8	50%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 22-Jan-2020, Completion Date : 01-Feb-2020, Net Repair Days : 10, Total Man Hours : 880

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	--------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07420


Type : GS

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

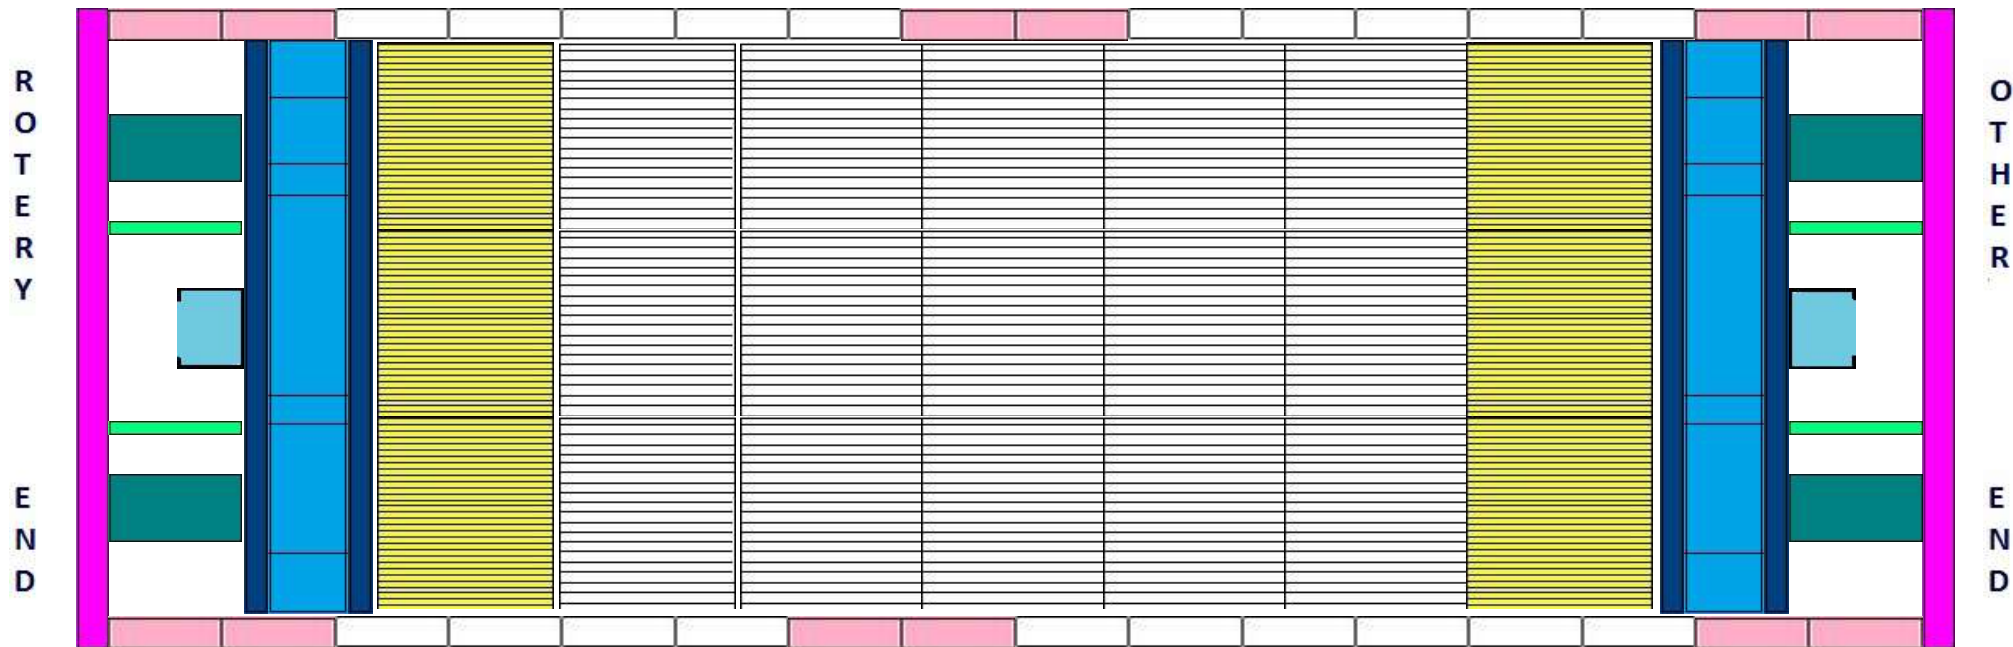

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	6	38%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	6	38%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	54	31%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 6, WEST : 8 Other End - EAST : 0, WEST : 4
Start Date : 13-Nov-2019, Completion Date : 20-Nov-2019, Net Repair Days : 7, Total Man Hours : 1044

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07601


Type : WGSCZ

Built Year : 2007

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

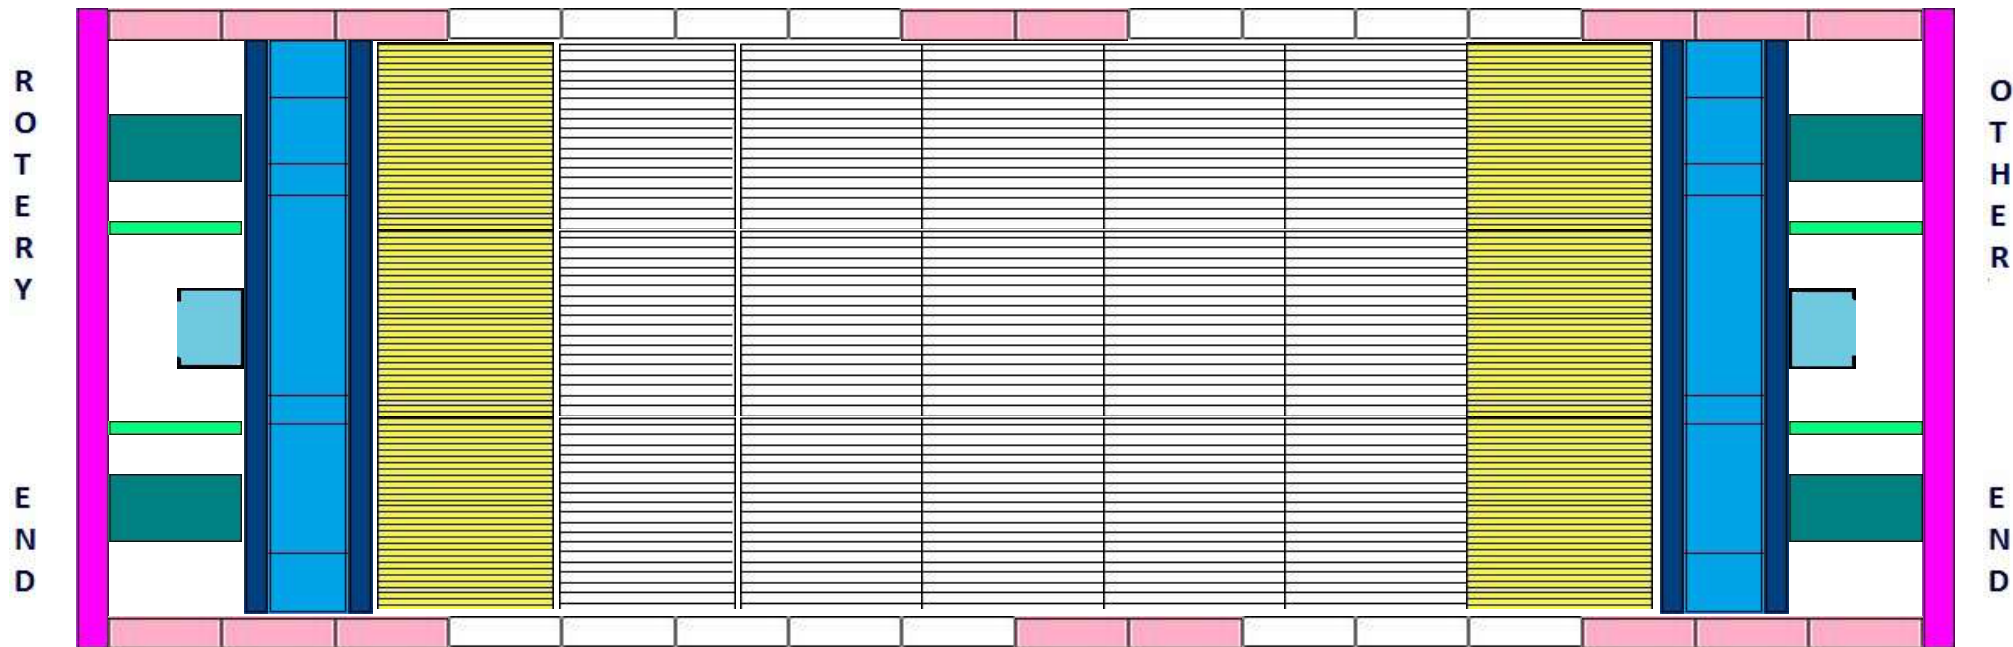

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	8	50%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8	50%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	16	40%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 5 Other End - EAST : 6, WEST : 0
Start Date : 04-Dec-2019, Completion Date : 10-Dec-2019, Net Repair Days : 6, Total Man Hours : 1580

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07604


Type : WGSCZ

Built Year : 2007

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

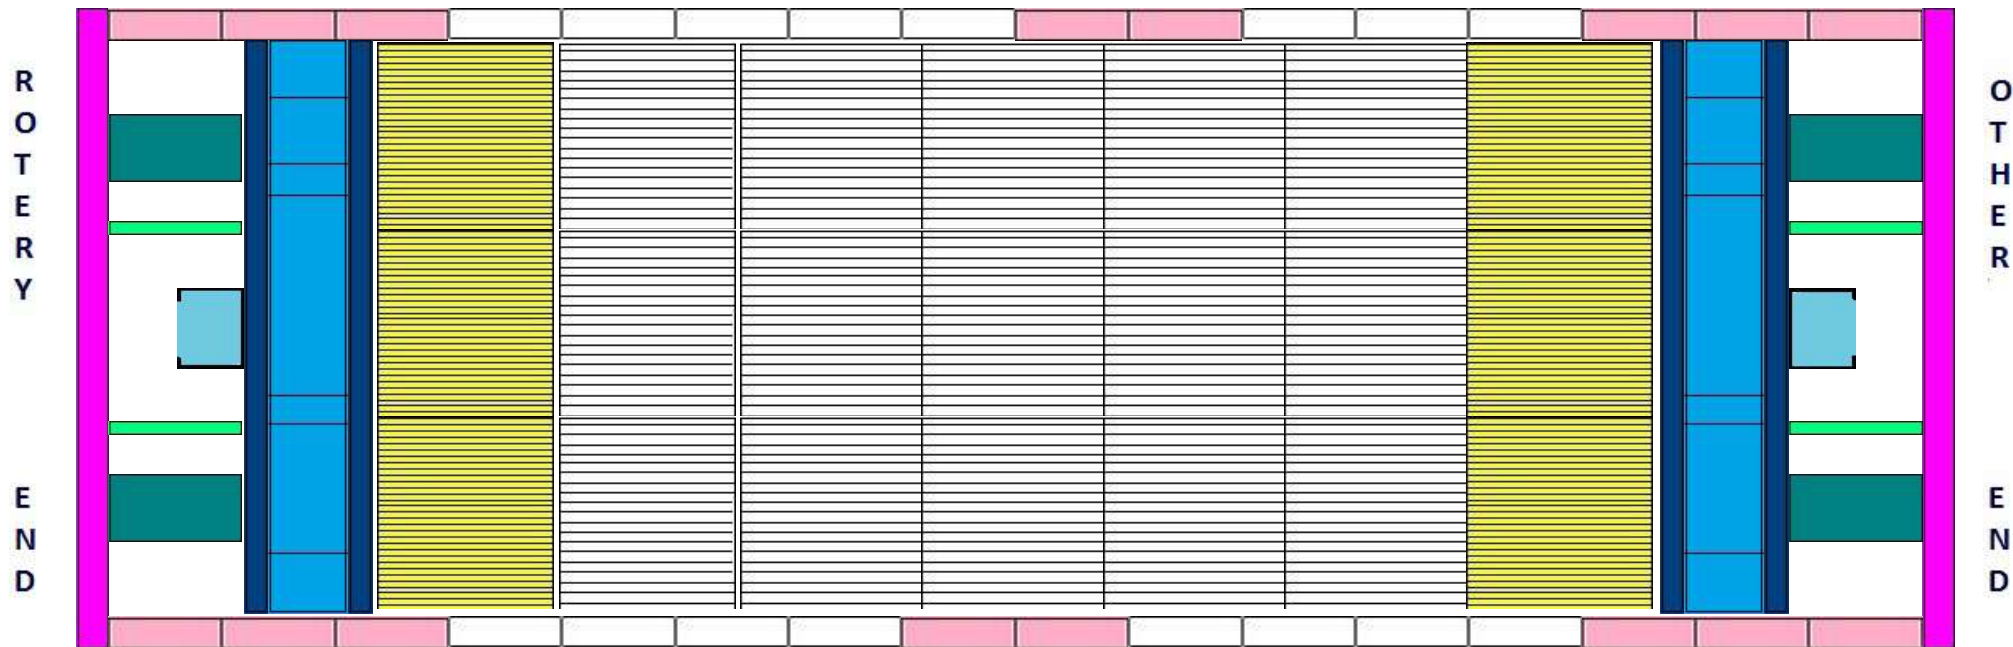

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	8	50%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8	50%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	24	60%		Window Bar	40	22%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : -2 Other End - EAST : 5, WEST : 6
Start Date : 08-Jul-2019, Completion Date : 13-Jul-2019, Net Repair Days : 6, Total Man Hours : 1072

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07705


Type : GSRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

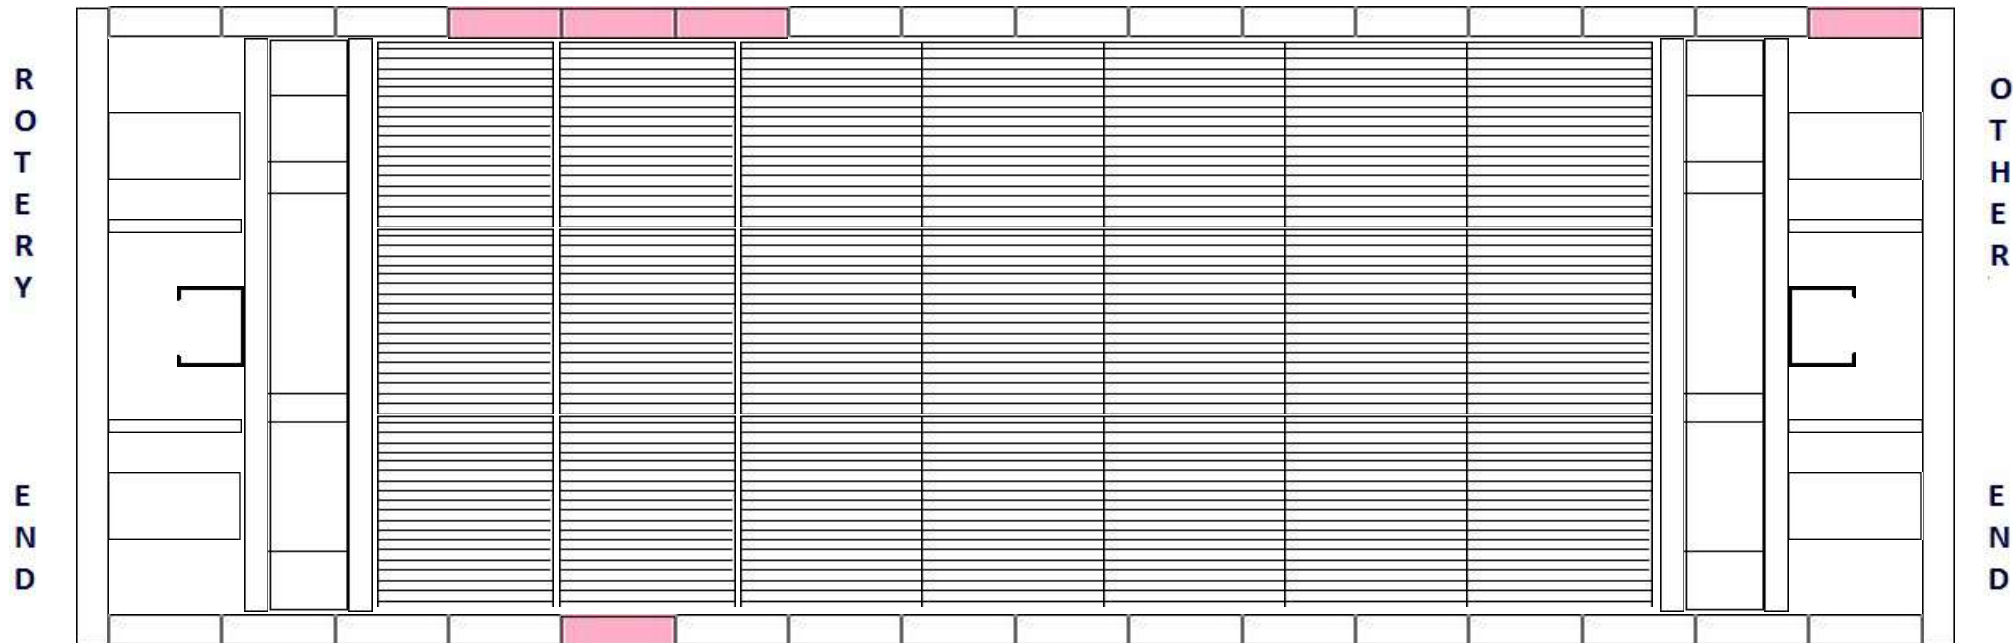

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	2.5	16%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2.5	16%		Body panel/patch		20%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	7	37%		Window Bar	30	18%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 31-Aug-2019, Completion Date : 05-Sep-2019, Net Repair Days : 5, Total Man Hours : 558

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07721


Type : GSLRD

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

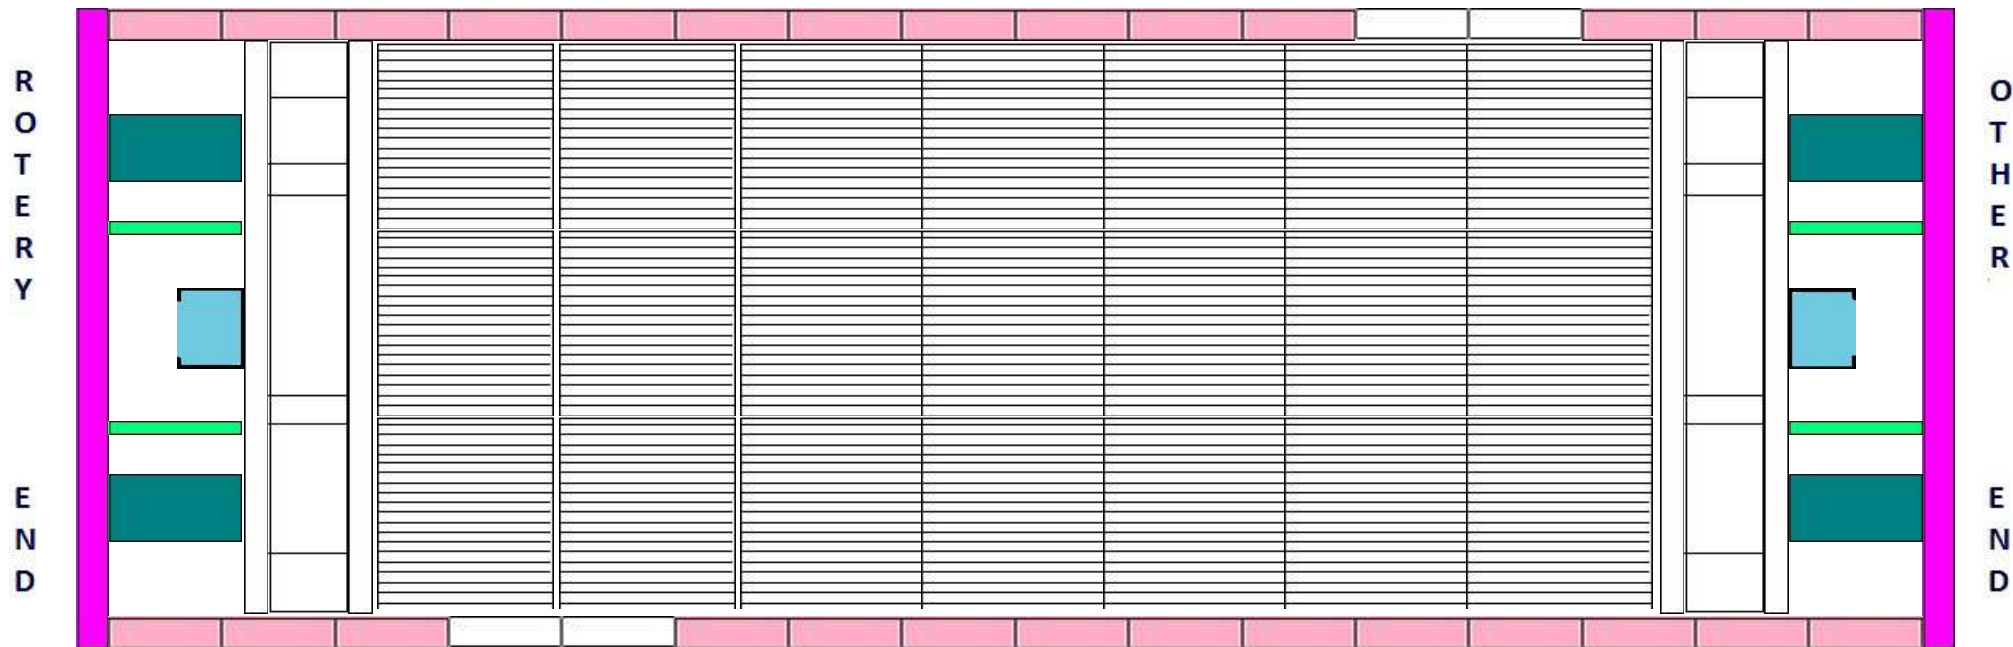

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Blue	Centre Stiffner for Headstock	4	100%	Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	0	0%	Pink	Sole Bar	14	88%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	0	0%	Light Blue	Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	14	88%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	9	47%		Window Bar	12	14%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 2, WEST : 2 Other End - EAST : 5, WEST : 2
Start Date : 29-Apr-2019, Completion Date : 10-May-2019, Net Repair Days : 11, Total Man Hours : 1600

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	ARUN SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC07951


Type : WGCWNAC

Built Year : 2007

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

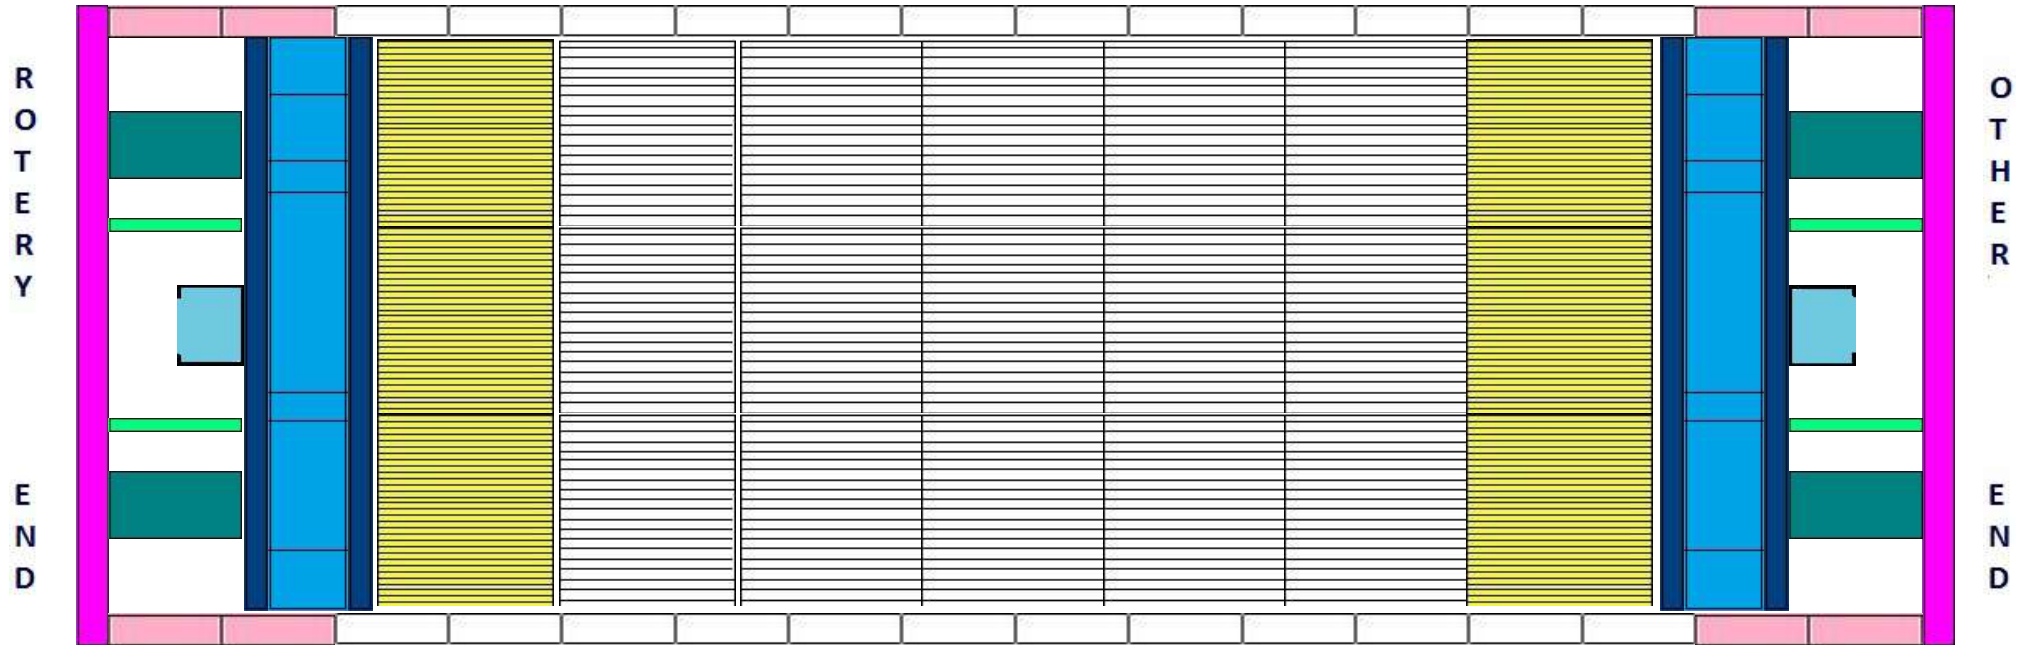

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4	25%		Body panel/patch		10%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 01-Feb-2020, Completion Date : 08-Feb-2020, Net Repair Days : 7, Total Man Hours : 0

ANASTA PRASAD - JE	MOHD. JAFER QURASHI - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	--------------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC98411


Type : GS

Built Year : 1998

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

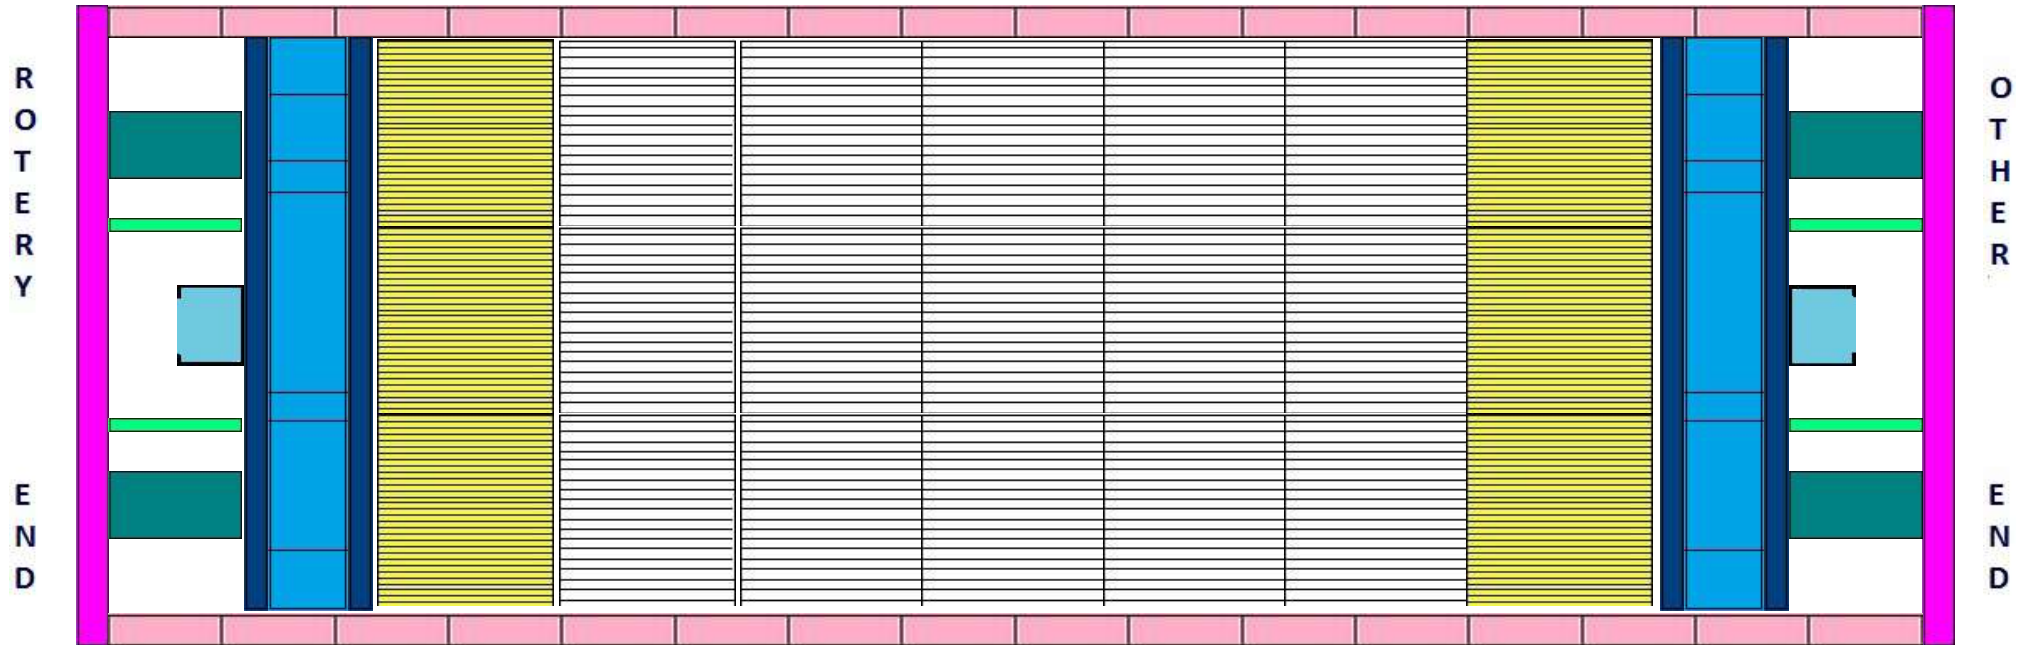

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Blue	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	68	39%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 08-Jan-2020, Completion Date : 18-Jan-2020, Net Repair Days : 10, Total Man Hours : 0

R KU KHARE - SSE	MAYANK PRAJAPATI - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	-----------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC98415


Type : WGSCZ

Built Year : 1998

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

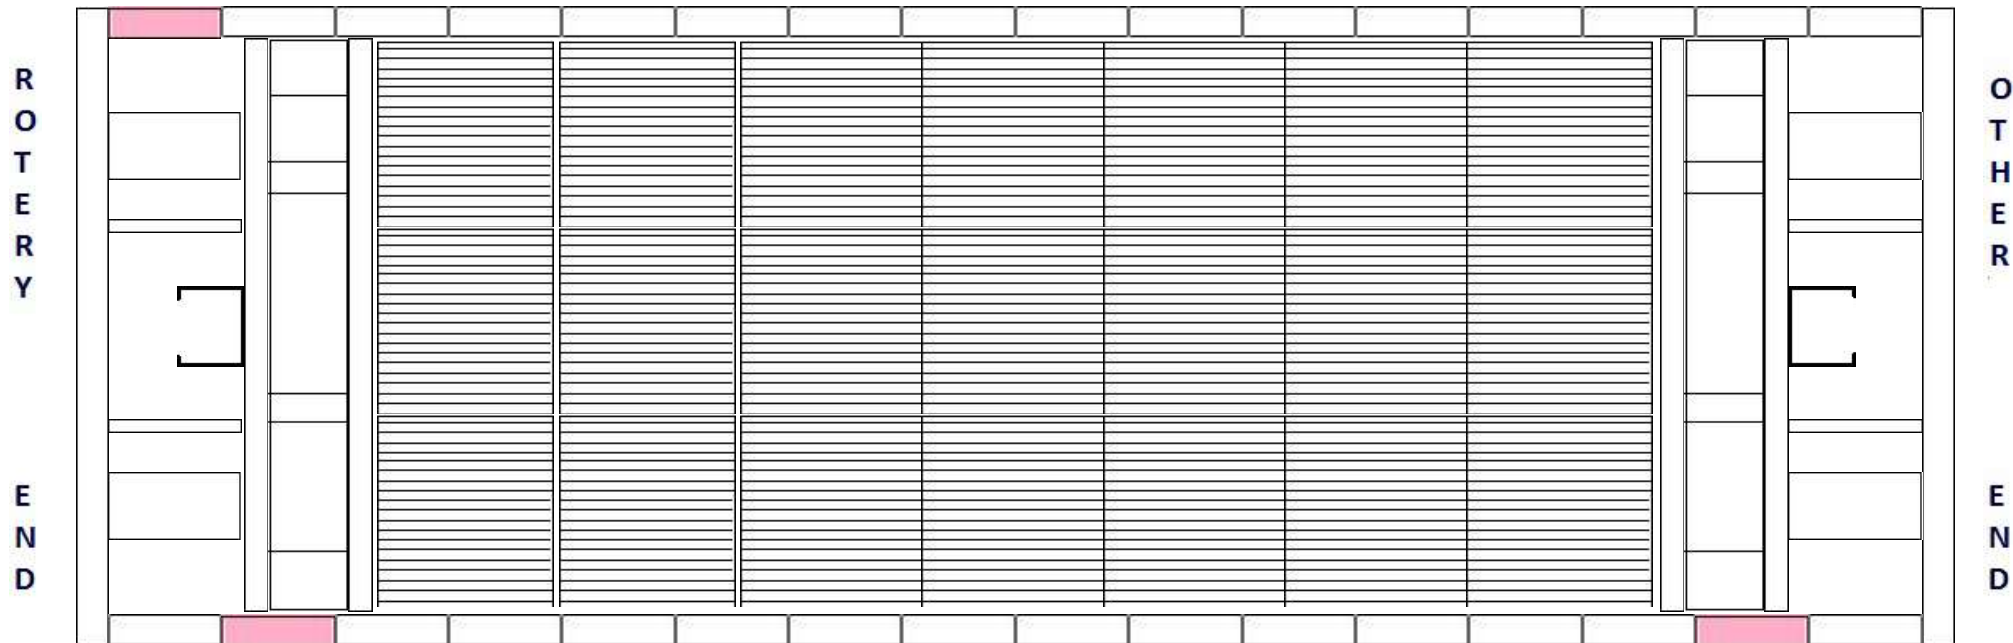

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	0	0%	Red	Centre Stiffner for Headstock	0	0%	Green	Floor Stiffner for Headstock	0	0%
Black	Aux. Head stock	0	0%	Pink	Sole Bar	1.5	9%	Light Blue	Draft Gear Bracket	0	0%
Yellow	Trough floor	0	0%	Light Blue	Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	1.5	9%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 08-Jul-2019, Completion Date : 11-Jul-2019, Net Repair Days : 4, Total Man Hours : 632

MAYANK PRAJAPATI - JE	R KU KHARE - SSE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-----------------------	------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC95201


Type : WGSCN

Built Year : 1995

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

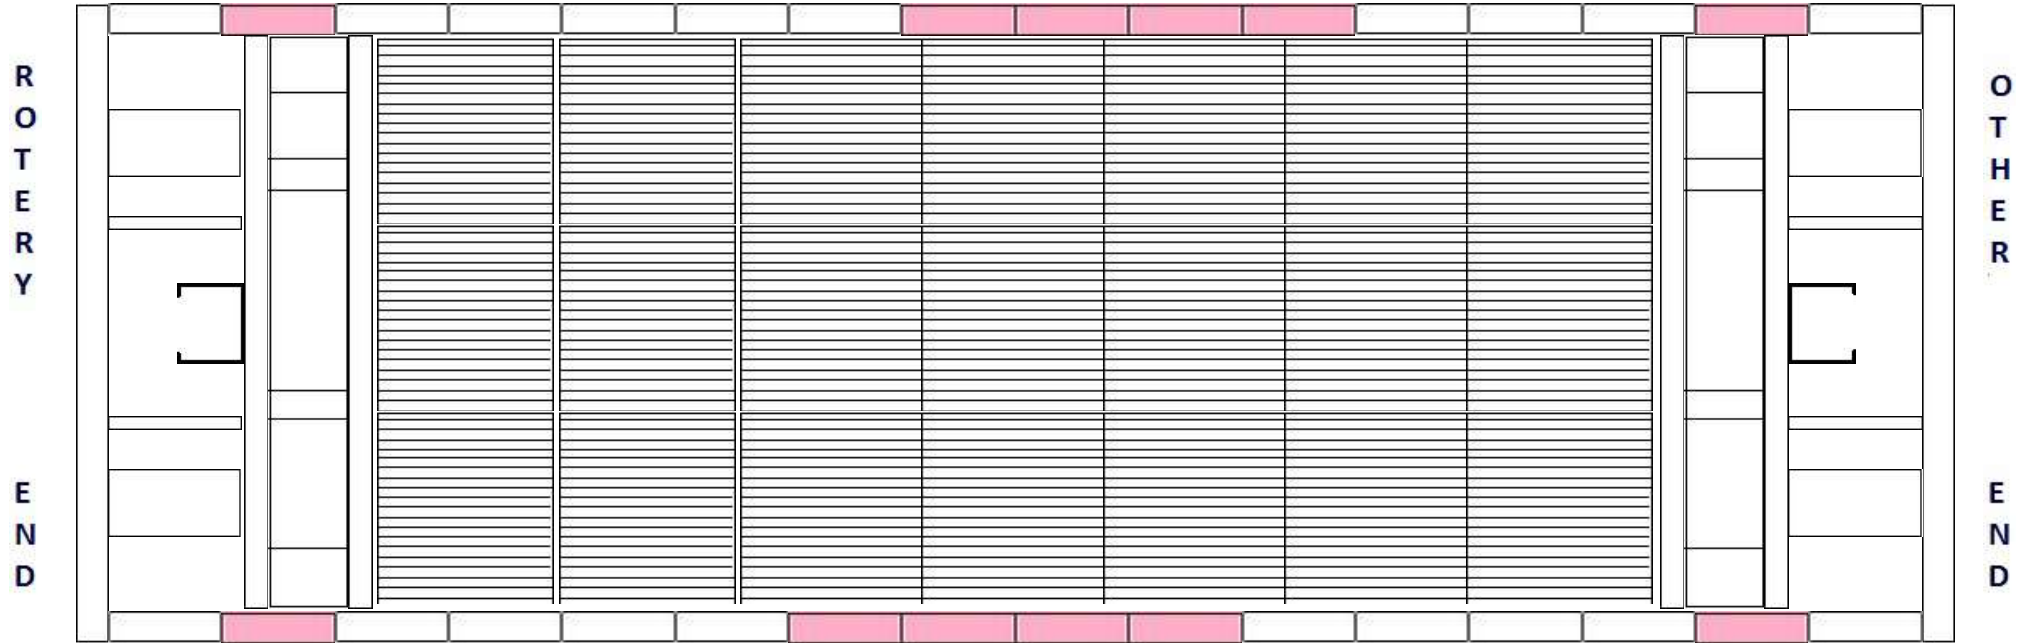

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	6	38%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	6	38%		Body panel/patch		20%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 10-Feb-2020, Completion Date : 18-Mar-2020, Net Repair Days : 33, Total Man Hours : 0

ANASTA PRASAD - JE	MOHD. JAFER QURASHI - JE	S K SHARMA - SSE	ARUN SINGH - SSE In-charge	Verified By:QU-Incharge
--------------------	--------------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC10102


Type : WGACCN

Built Year : 2010

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

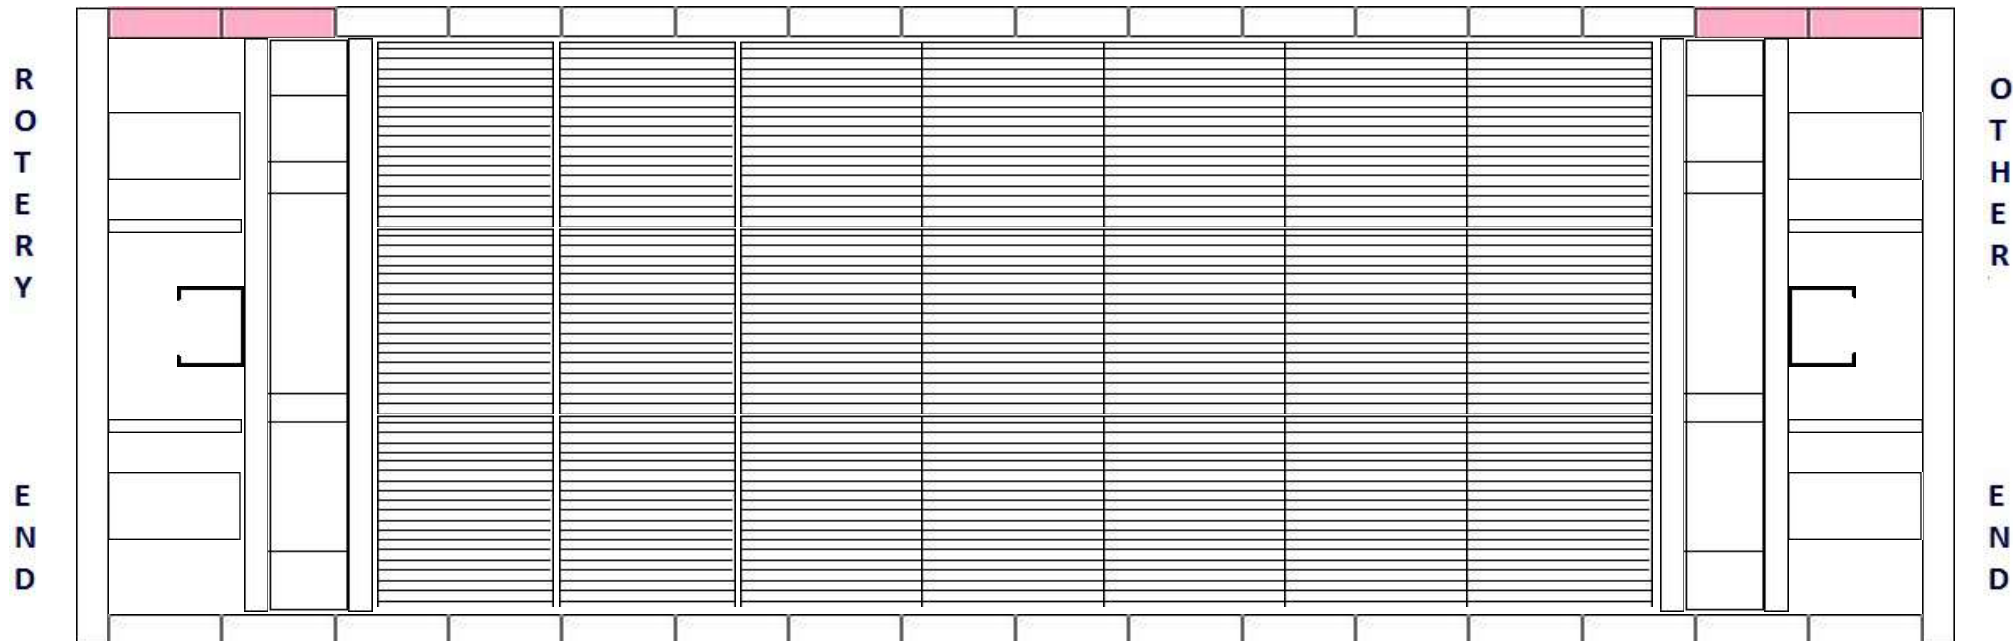

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	2	13%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2	13%		Body panel/patch		20%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 04-Feb-2020, Completion Date : 08-Feb-2020, Net Repair Days : 5, Total Man Hours : 0

PANKAJ DAMARE - JE	HAMANT JADAV - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC05215


Type : WGSCN

Built Year : 2005

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

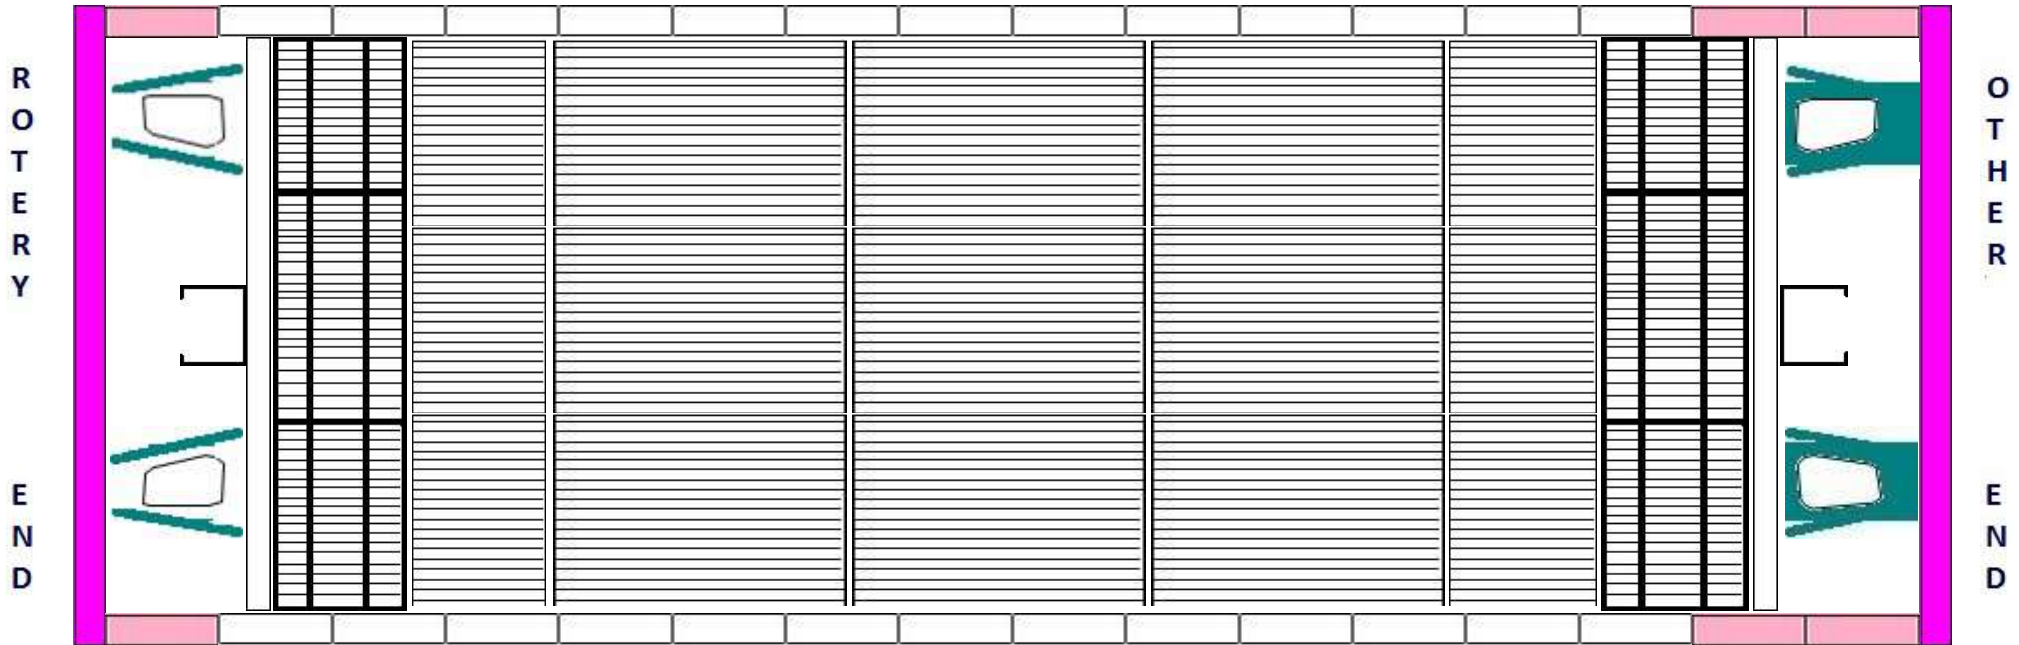

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Diagonal	4	100%		Logitudinal Channel Structure	0	0%
	Aux. Head stock	0	0%		Sole Bar	3	19%		Draft Gear Bracket	1	50%
	Trough floor	0	0%		Bottom Wall Part	3	19%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	0	0%
	Window Bar	0	0%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	17	100%								

End Drooping: Rotary End - EAST : -6, WEST : -7 Other End - EAST : -6, WEST : -5
Start Date : 25-Jun-2019, Completion Date : 03-Jul-2019, Net Repair Days : 8, Total Man Hours : 988

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
-------------------	--------------------	------------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC05404


Type : GS

Built Year : 2005

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

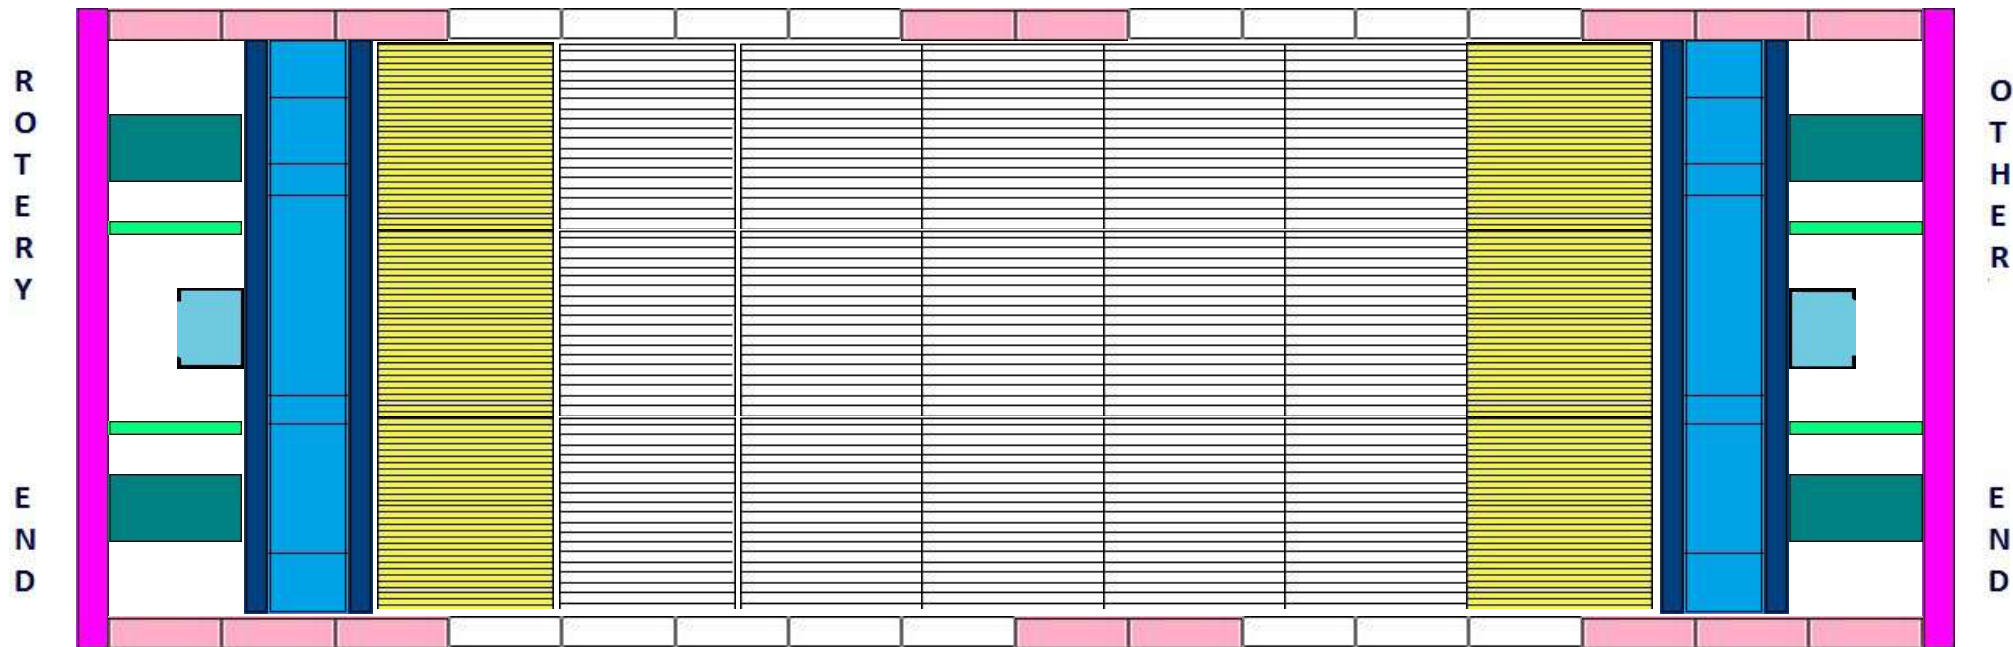

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	8	50%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8	50%		Body panel/patch		10%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	30	75%		Window Bar	44	25%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 8, WEST : 6 Other End - EAST : -3, WEST : -5
Start Date : 21-May-2019, Completion Date : 30-May-2019, Net Repair Days : 9, Total Man Hours : 1404

HAMANT JADAV - JE	M L KOLI - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	---------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC08114


Type : WGACCNH

Built Year : 2008

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

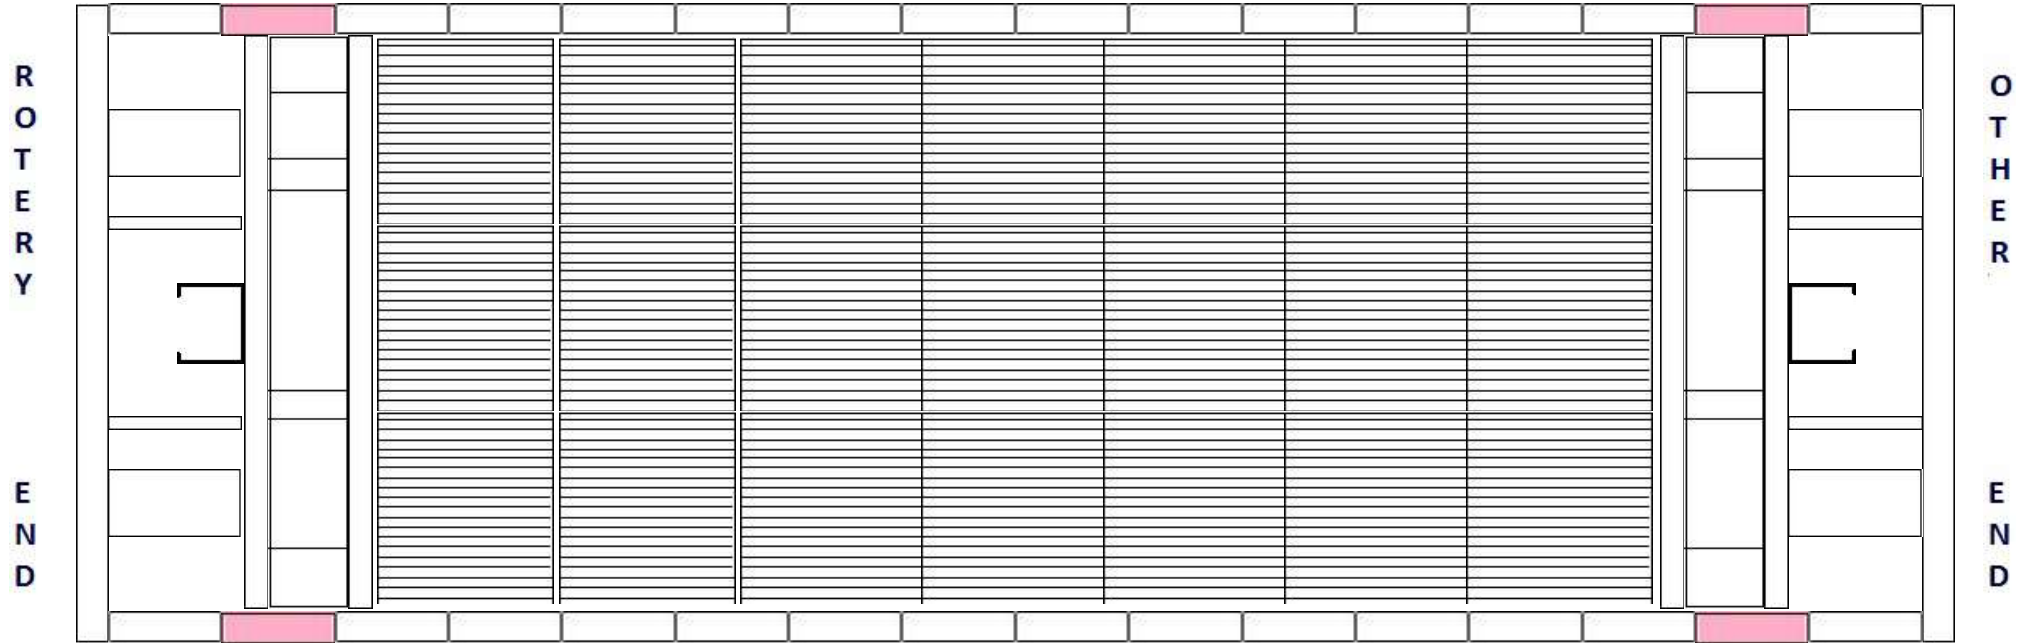

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	2	13%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2	13%		Body panel/patch		200%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 10-Feb-2020, Completion Date : 14-Mar-2020, Net Repair Days : 30, Total Man Hours : 208

P N VISHWKARMA - SSE	T R LAHRE - JE	OM PRAKASH SINGH - SSE	MANOJ AGARAWAL - SSE In-charge	Verified By:QU-Incharge
----------------------	----------------	------------------------	-----------------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04215


Type : WGSCN

Built Year : 2004

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

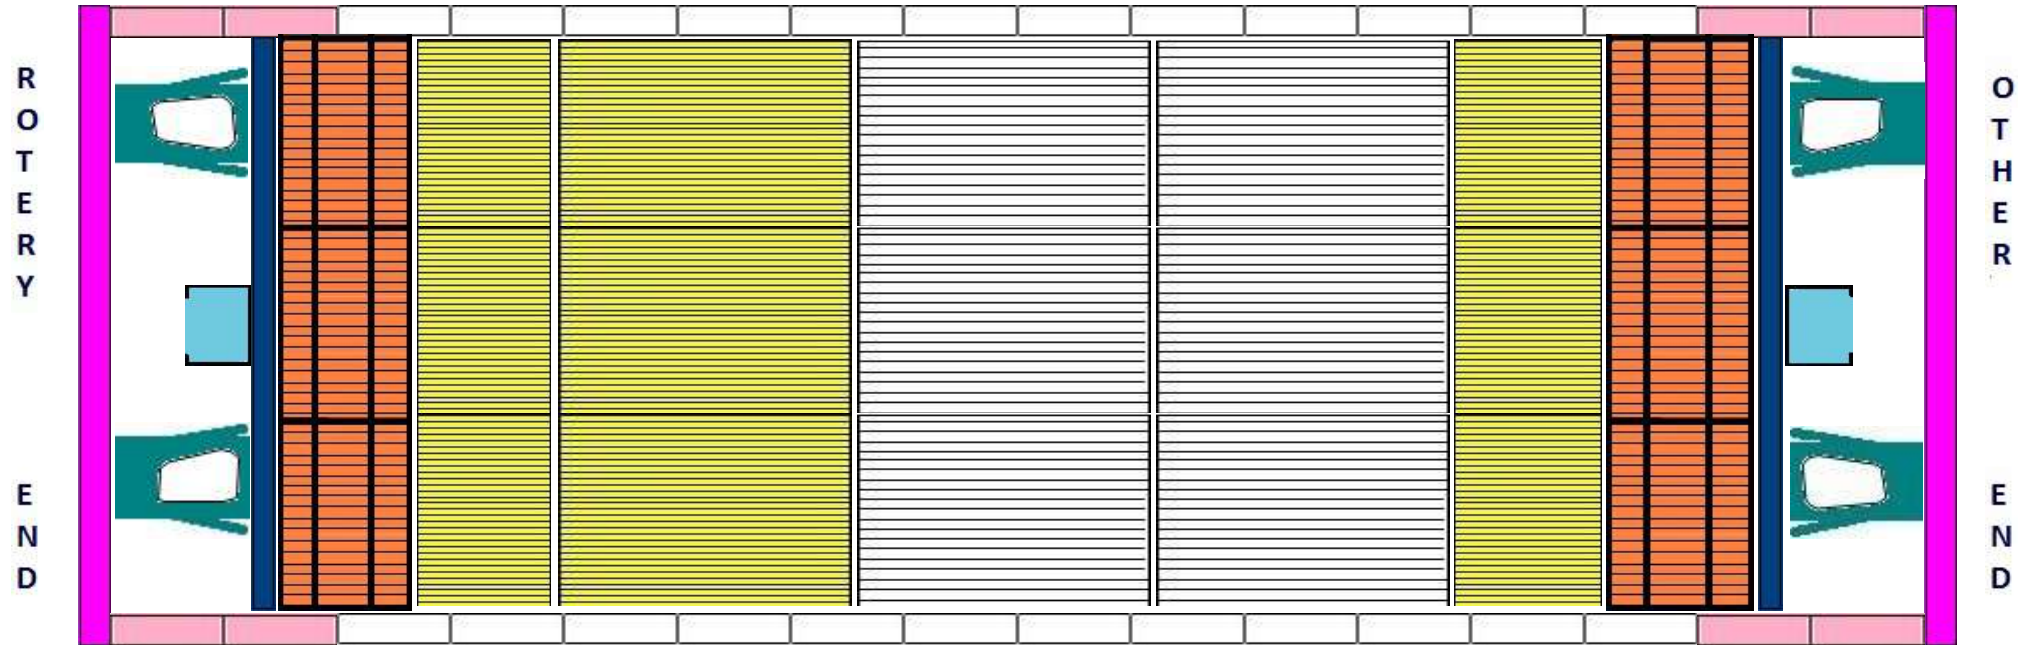

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	3	60%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	5	13%
	Window Bar	14	8%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : -10, WEST : -10 Other End - EAST : -9, WEST : -9
Start Date : 03-May-2019, Completion Date : 14-May-2019, Net Repair Days : 10, Total Man Hours : 1032

K K DEHARIA - JE	ANASTA PRASAD - JE	ARUN SINGH - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
------------------	--------------------	------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04224


Type : WGSCN

Built Year : 2005

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

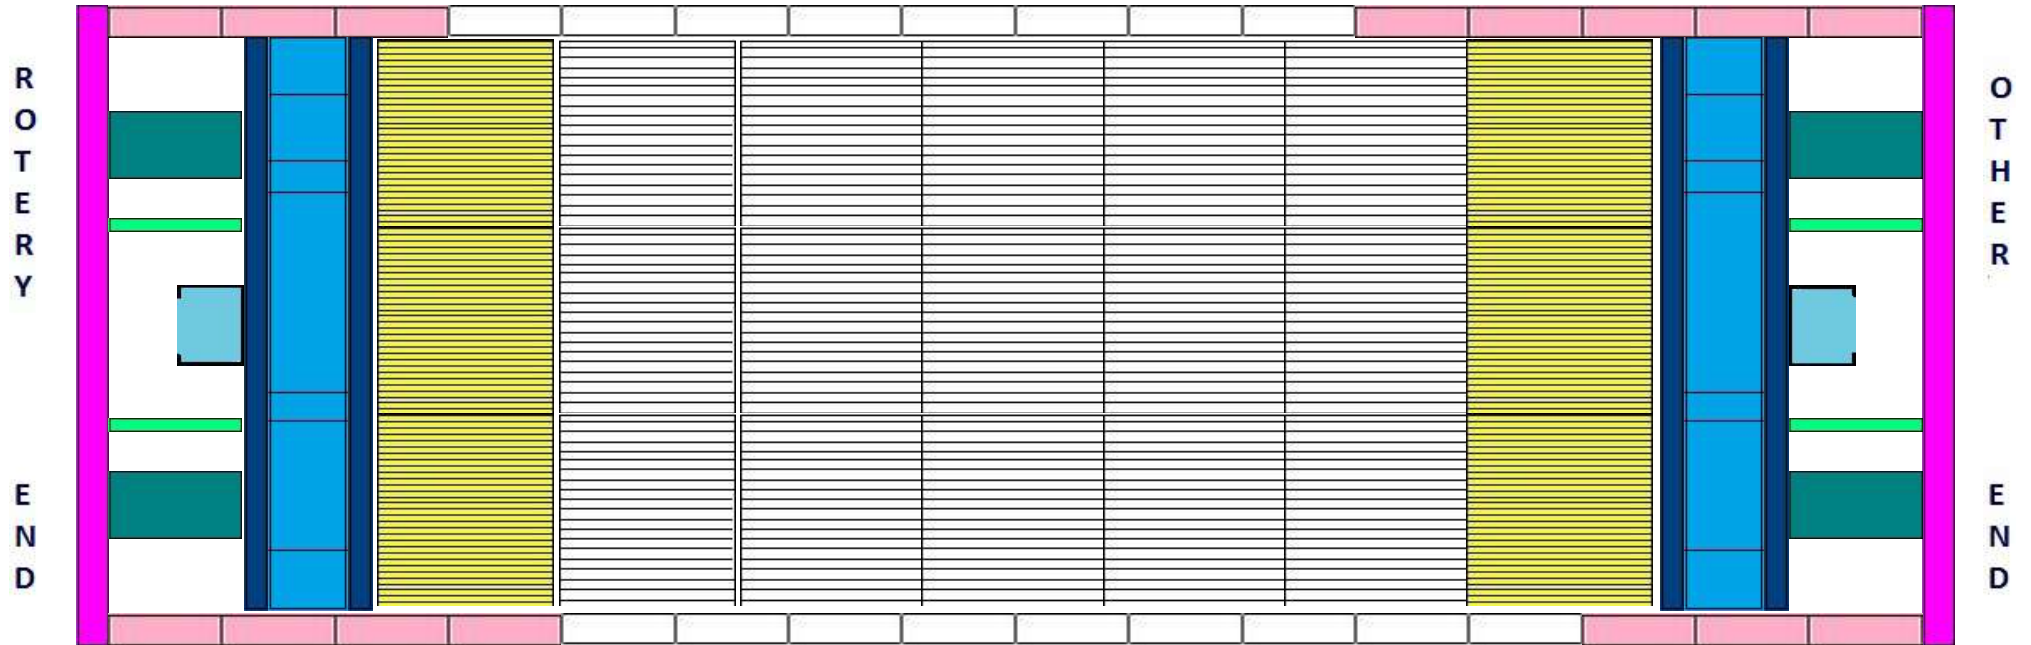

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	7.5	47%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	7.5	47%		Body panel/patch		0%		Door Top/Roof Patch		100%
	Window Module		0%		Window Sill	28	70%		Window Bar	42	23%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -5, WEST : 5 Other End - EAST : -5, WEST : -5
Start Date : 30-Apr-2019, Completion Date : 07-May-2019, Net Repair Days : 7, Total Man Hours : 0

U S BAJPAI - SSE	P N VISHWKARMA - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	----------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC00705


Type : SLR

Built Year : 2000

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

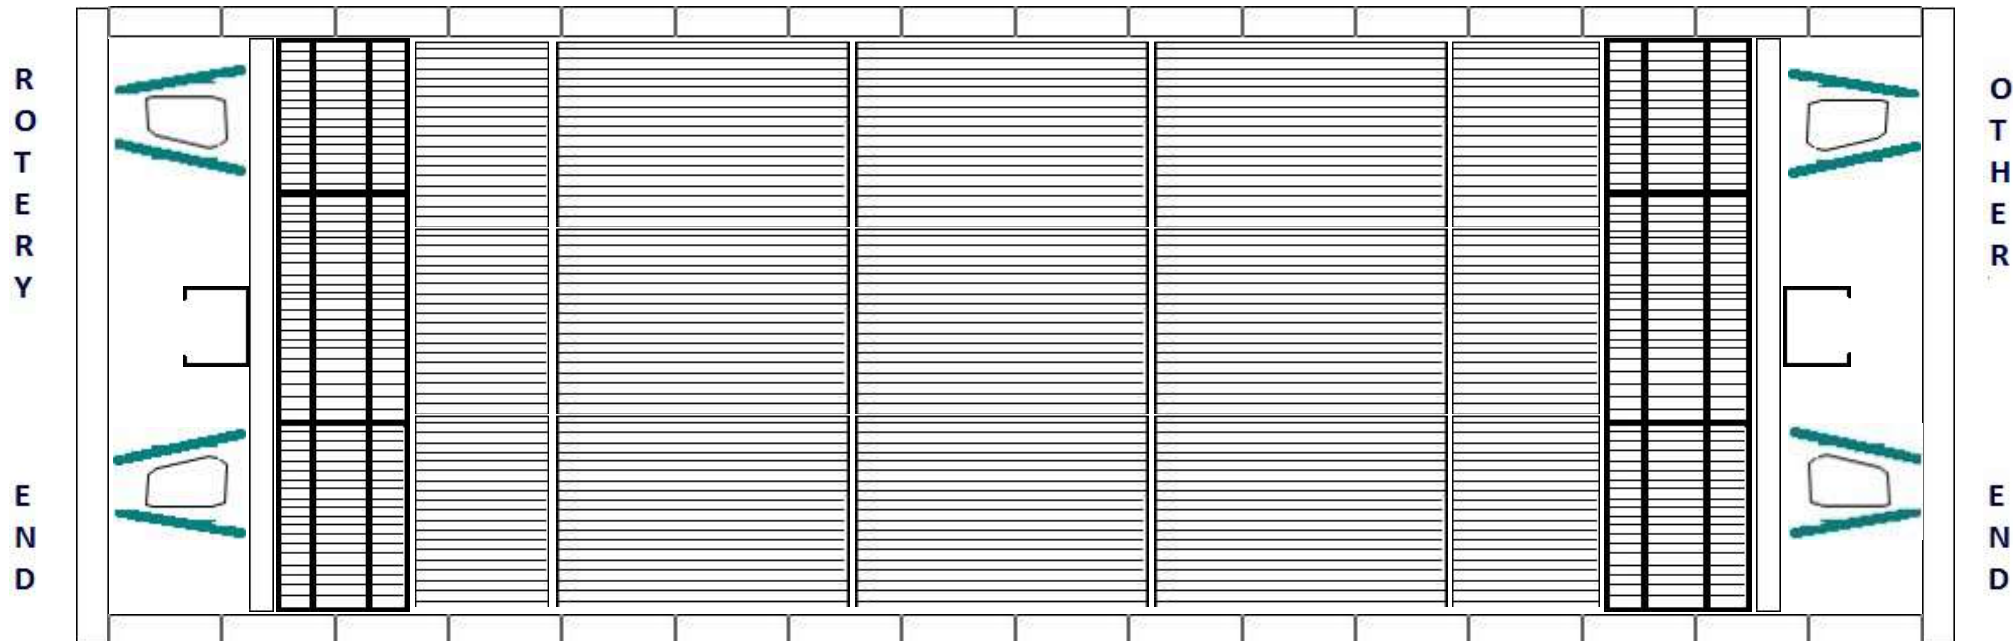

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Diagonal	4	100%		Logitudinal Channel Structure	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Bottom Wall Part	0	0%		Body panel/patch		0%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	0	0%
	Window Bar	0	0%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	0	100%								

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 20-Aug-2019, Completion Date : 23-Aug-2019, Net Repair Days : 4, Total Man Hours : 538

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
--------------------	-------------------	------------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC11613


Type : WGSCZ

Built Year : 0

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

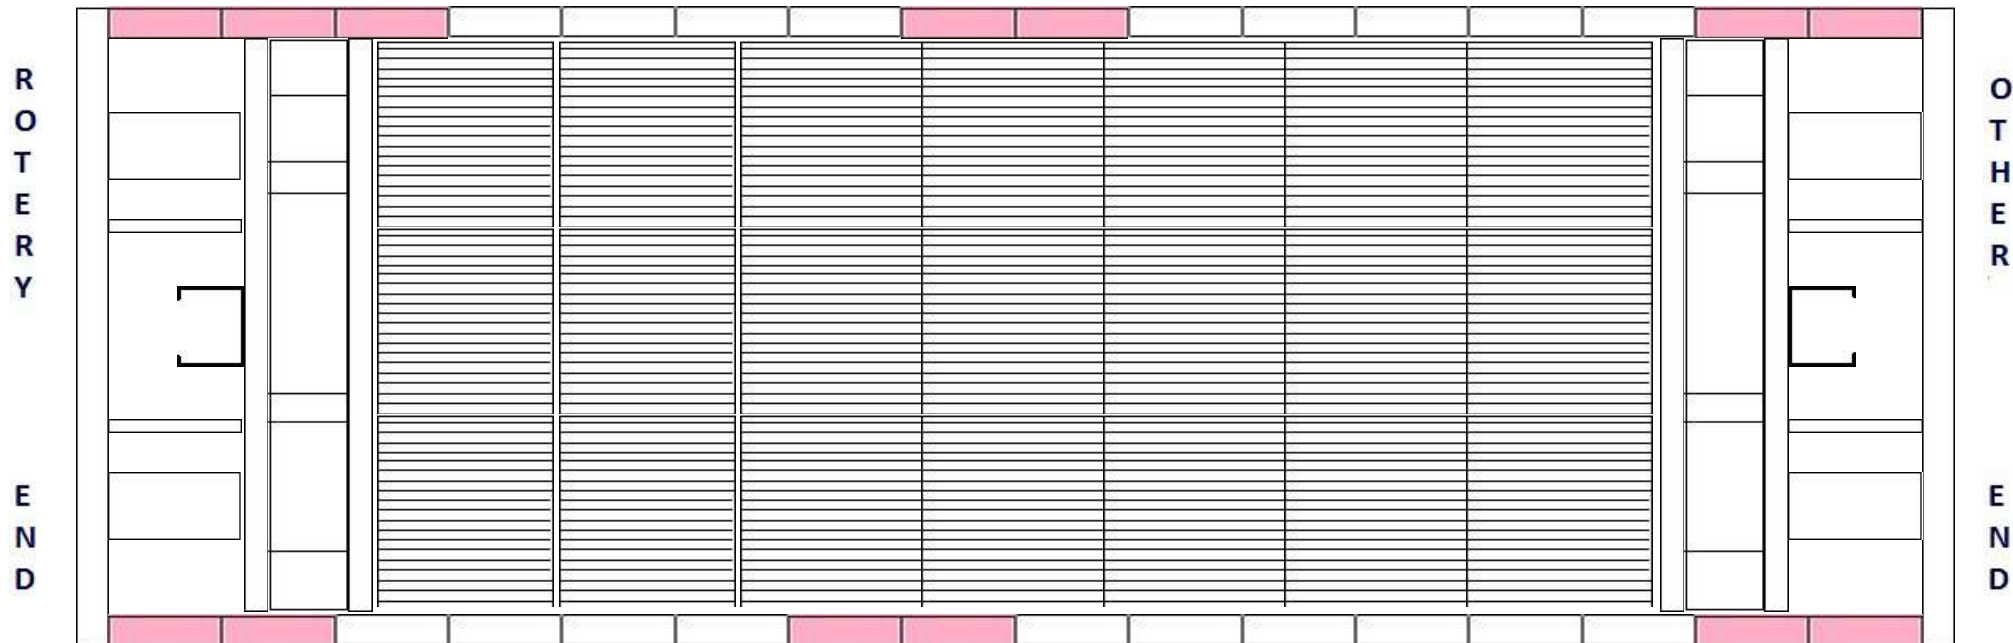

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	6.5	41%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	6	100%
	Bottom Wall Part	6.5	41%		Body panel/patch		40%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 07-Feb-2020, Completion Date : 15-Feb-2020, Net Repair Days : 8, Total Man Hours : 0

MOHD. JAFER QURASHI - JE	ANASTA PRASAD - JE	S K SHARMA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------------	--------------------	------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC12111


Type : WGACCN

Built Year : 2012

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

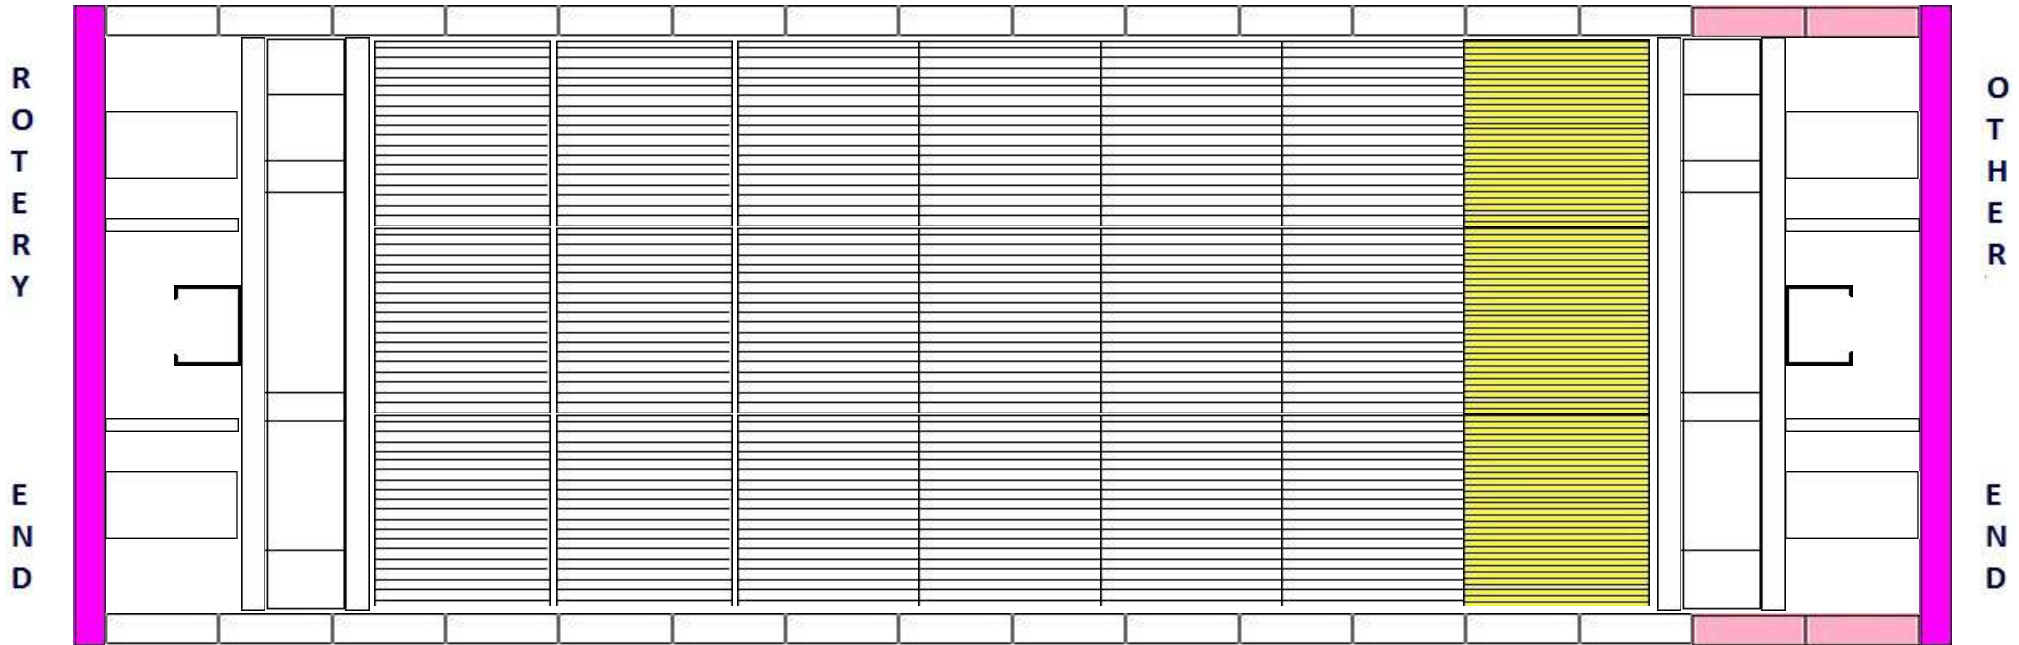

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Blue	Headstock Beam	0	0%	Red	Centre Stiffner for Headstock	0	0%	Green	Floor Stiffner for Headstock	0	0%
Black	Aux. Head stock	0	0%	Pink	Sole Bar	2	13%	Light Blue	Draft Gear Bracket	0	0%
Yellow	Trough floor	1	14%	Cyan	Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	2	13%		Body panel/patch		15%		Door Top/Roof Patch		100%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 03-Jul-2019, Completion Date : 10-Jul-2019, Net Repair Days : 7, Total Man Hours : 428

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	-----------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC98703


Type : SLR

Built Year : 1998

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

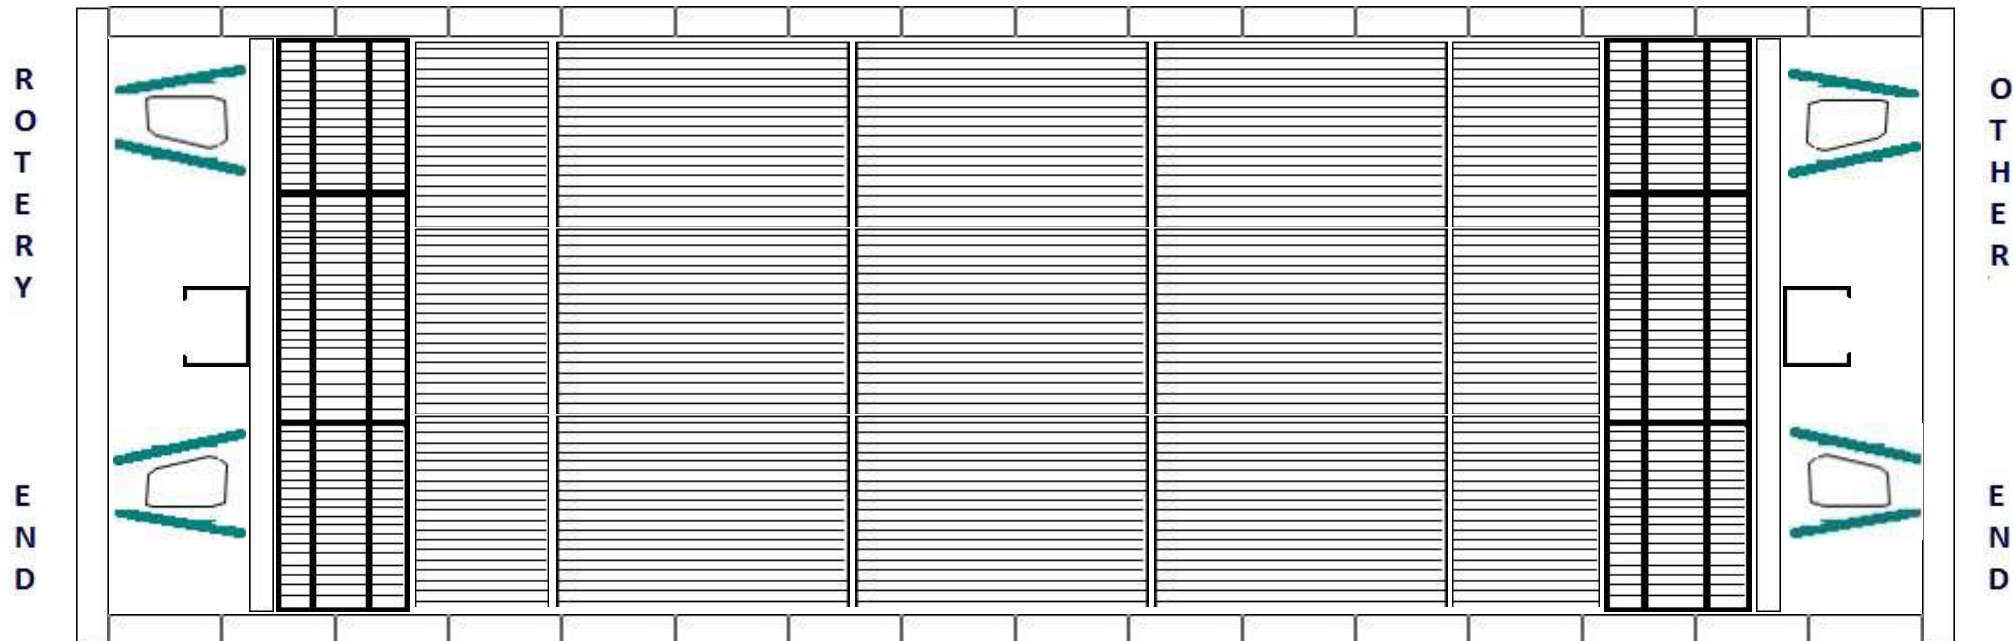

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Diagonal	4	100%		Logitudinal Channel Structure	0	0%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Bottom Wall Part	0	0%		Body panel/patch		0%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	0	0%
	Window Bar	0	0%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	0	100%								

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 31-Aug-2019, Completion Date : 02-Sep-2019, Net Repair Days : 2, Total Man Hours : 320

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
---------------	-------------------	-----------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC98706


Type : SLR

Built Year : 1998

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

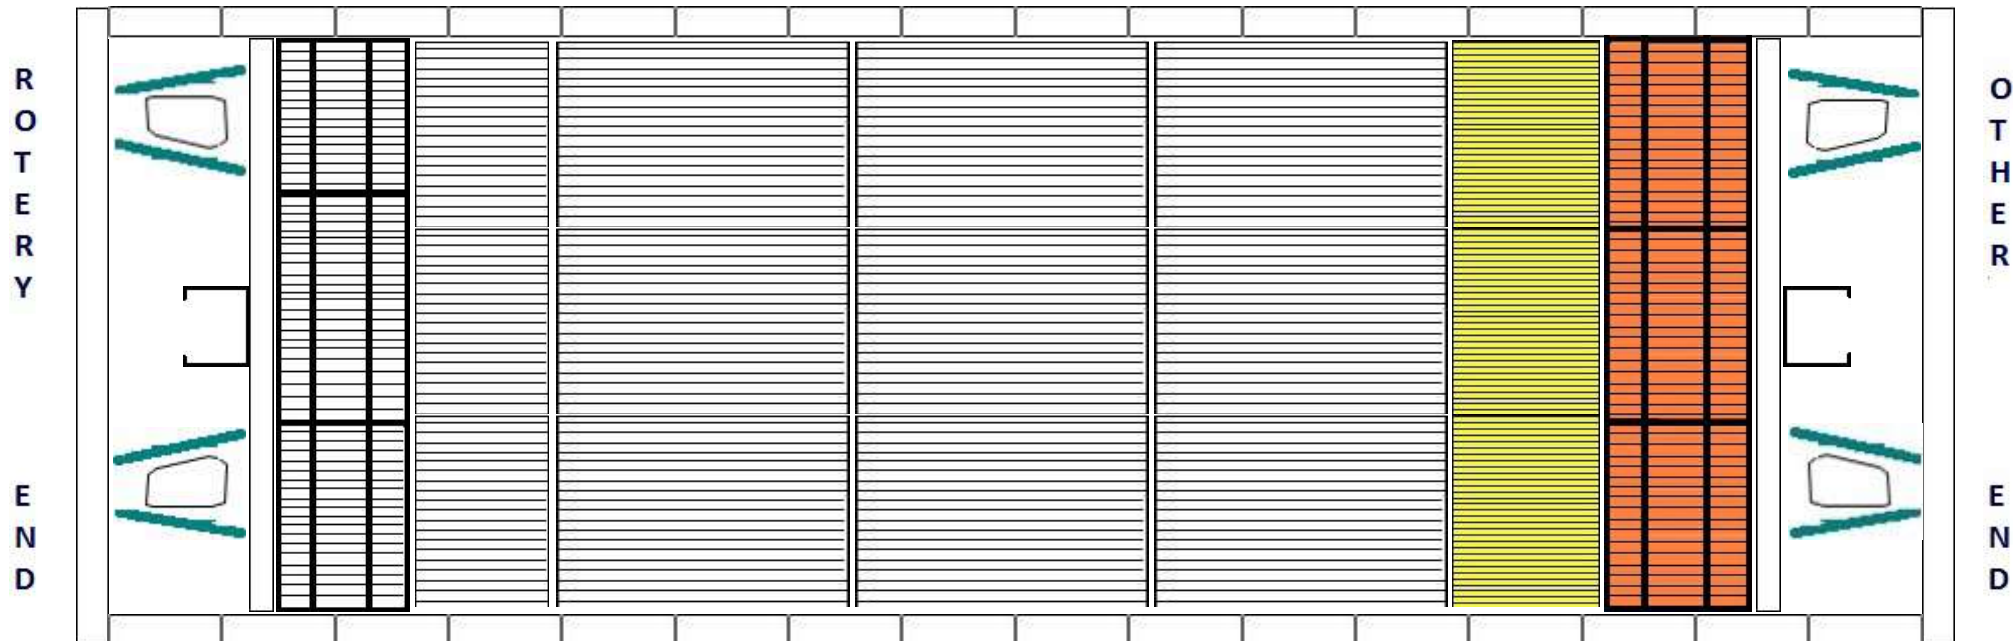

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Diagonal	4	100%		Logitudinal Channel Structure	1	50%
	Aux. Head stock	0	0%		Sole Bar	0	0%		Draft Gear Bracket	0	0%
	Trough floor	1	20%		Bottom Wall Part	0	0%		Body panel/patch		20%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	0	0%
	Window Bar	0	0%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	0	100%								

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 22-Aug-2019, Completion Date : 24-Aug-2019, Net Repair Days : 3, Total Man Hours : 402

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
---------------	-------------------	-----------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04252


Type : WGSCN

Built Year : 2004

Make : BEML

Form No. F/BR/BEML/002

Valid From: 02/04/2015

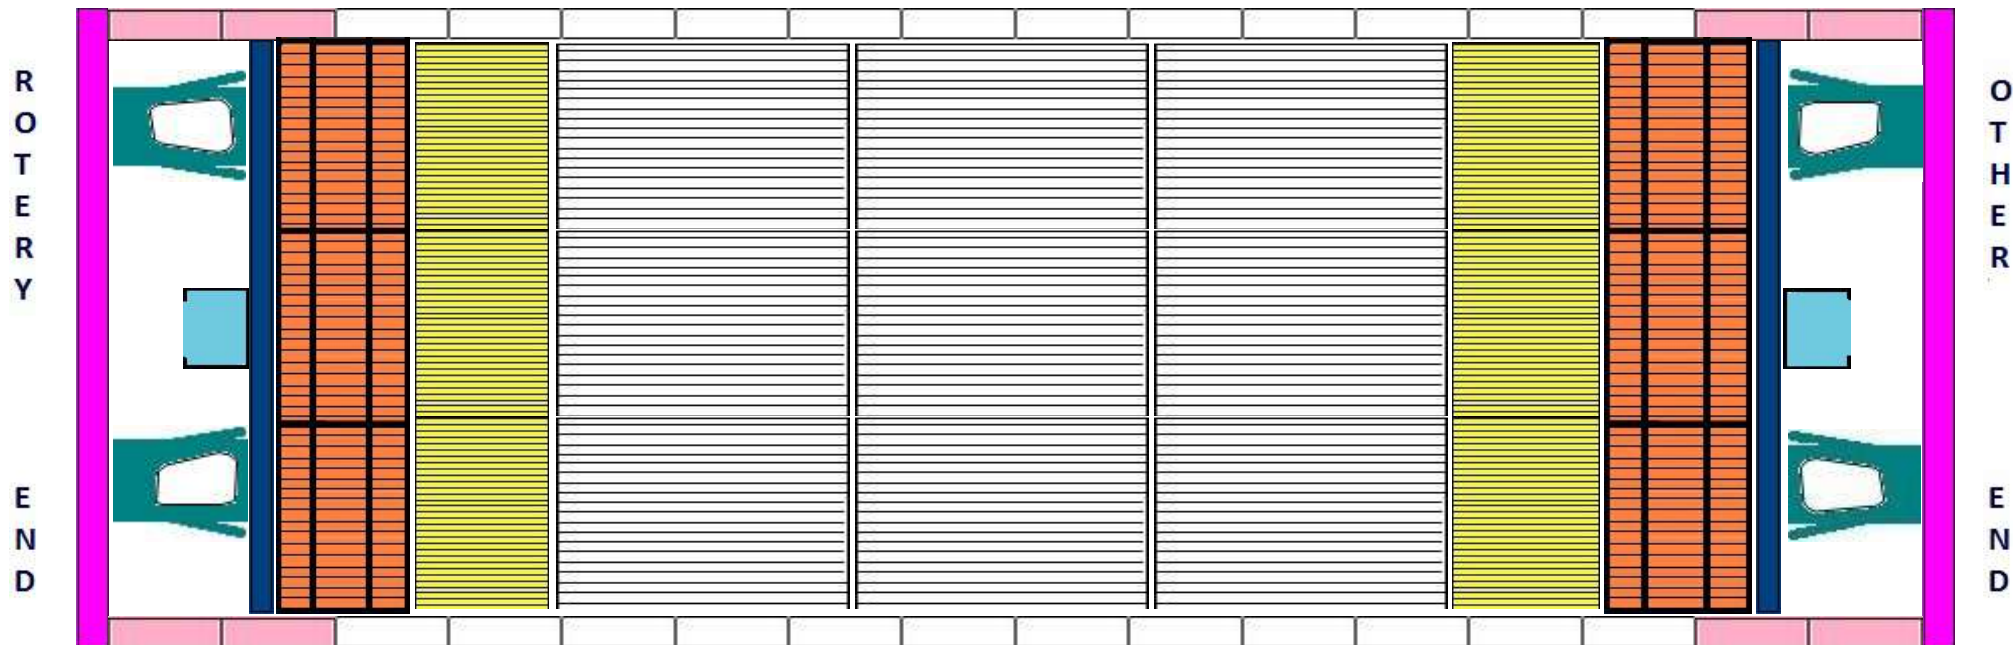

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Diagonal	4	100%		Logitudinal Channel Structure	2	100%
	Aux. Head stock	2	100%		Sole Bar	4	25%		Draft Gear Bracket	2	100%
	Trough floor	2	40%		Bottom Wall Part	4	25%		Body panel/patch		100%
	Door Top/Roof Patch		0%		Seat Bracket Rail		0%		Window Sill	0	0%
	Window Bar	10	5%		Seat pillar/lav. Partition		100%		UIC end construction		0%
	Body Pillar Part	22	100%								

End Drooping: Rotary End - EAST : 5, WEST : 4 Other End - EAST : -2, WEST : -4
Start Date : 30-Apr-2019, Completion Date : 13-May-2019, Net Repair Days : 12, Total Man Hours : 1096

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	S K SHARMA - SSE	V N GANVIR - SSE	Verified By:QU-Incharge
----------------------	---------------------	------------------	------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04416


Type : GS

Built Year : 2004

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

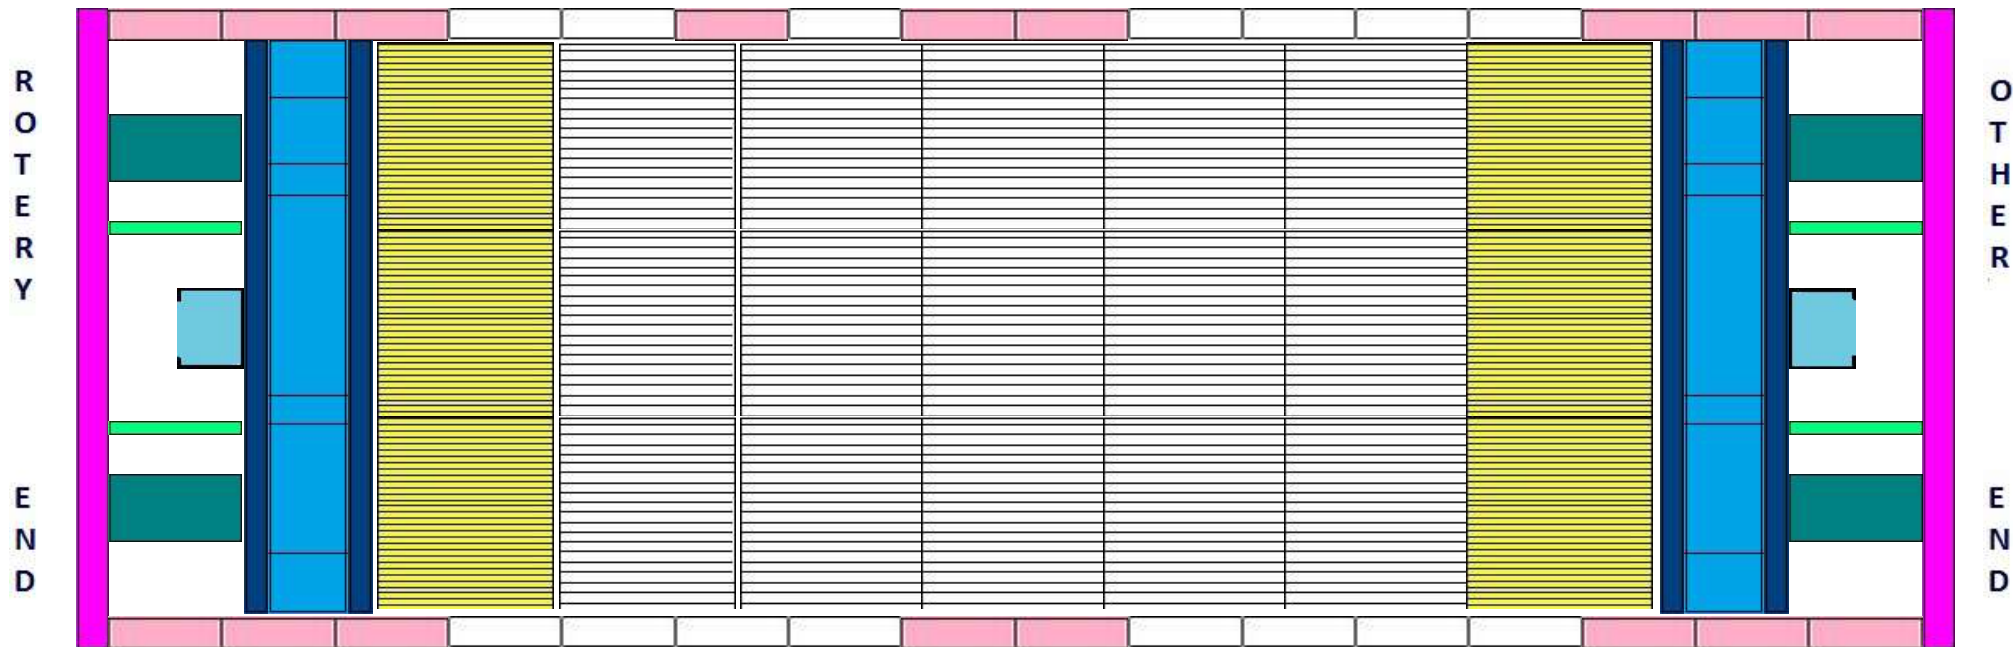

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	8.5	53%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	8.5	53%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	28	70%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -6, WEST : 0 Other End - EAST : 5, WEST : 0
Start Date : 12-Jul-2019, Completion Date : 19-Jul-2019, Net Repair Days : 7, Total Man Hours : 1400

K K DEHARIA - JE	ANASTA PRASAD - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	--------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04701


Type : GSLRD

Built Year : 2004

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

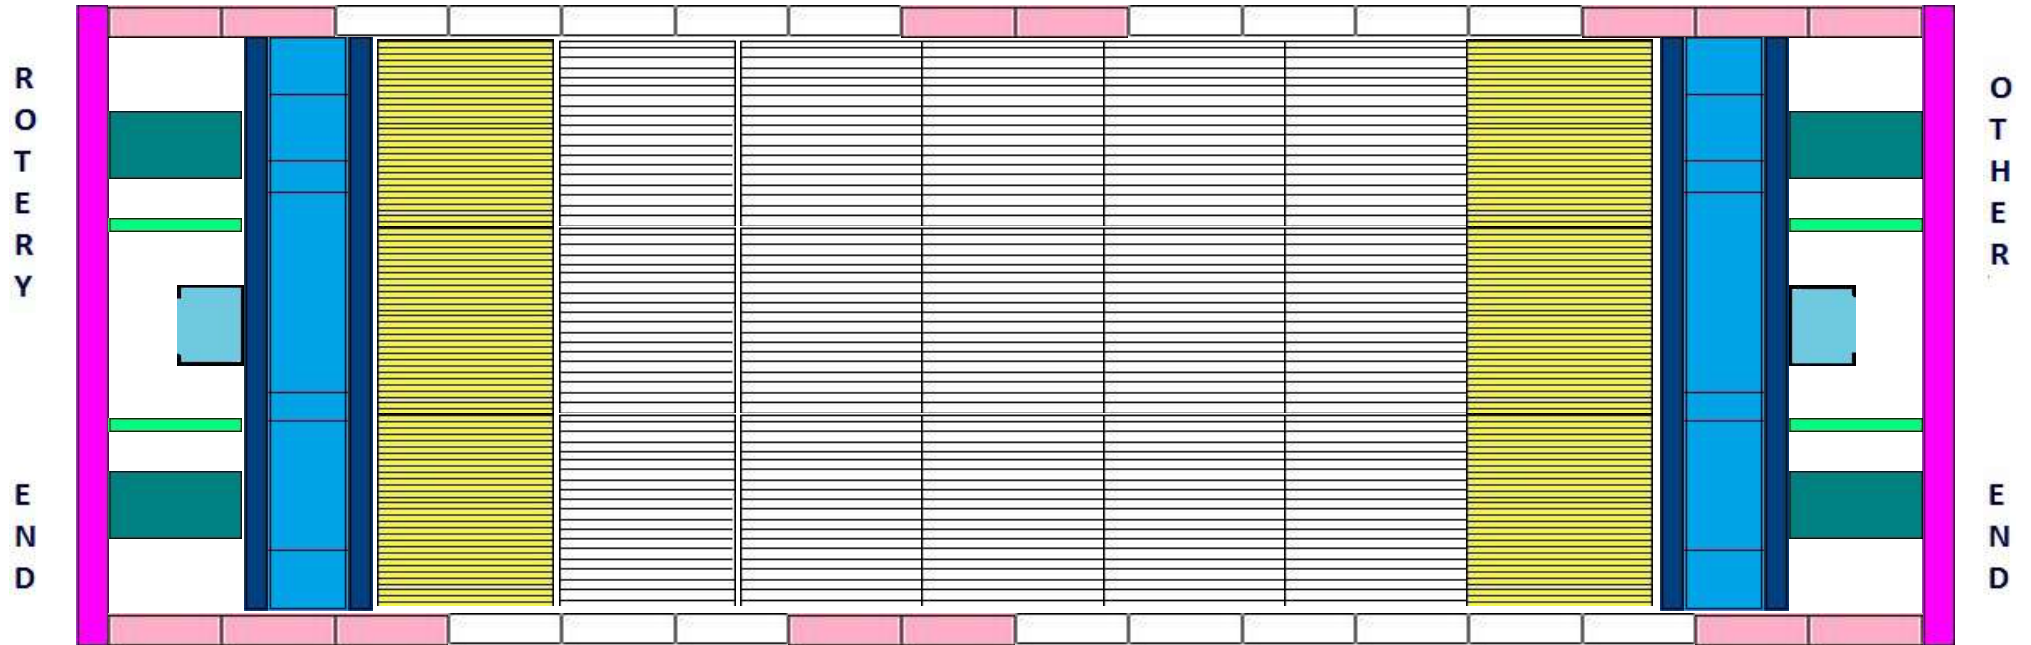

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	7	44%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	7	44%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	18	45%		Window Bar	48	27%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0
Start Date : 25-Jun-2019, Completion Date : 04-Jul-2019, Net Repair Days : 9, Total Man Hours : 0

H R KANNOJE - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	--------------------	------------------------	----------------------------	-------------------------

Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :WC04705


Type : GSLRD

Built Year : 2004

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

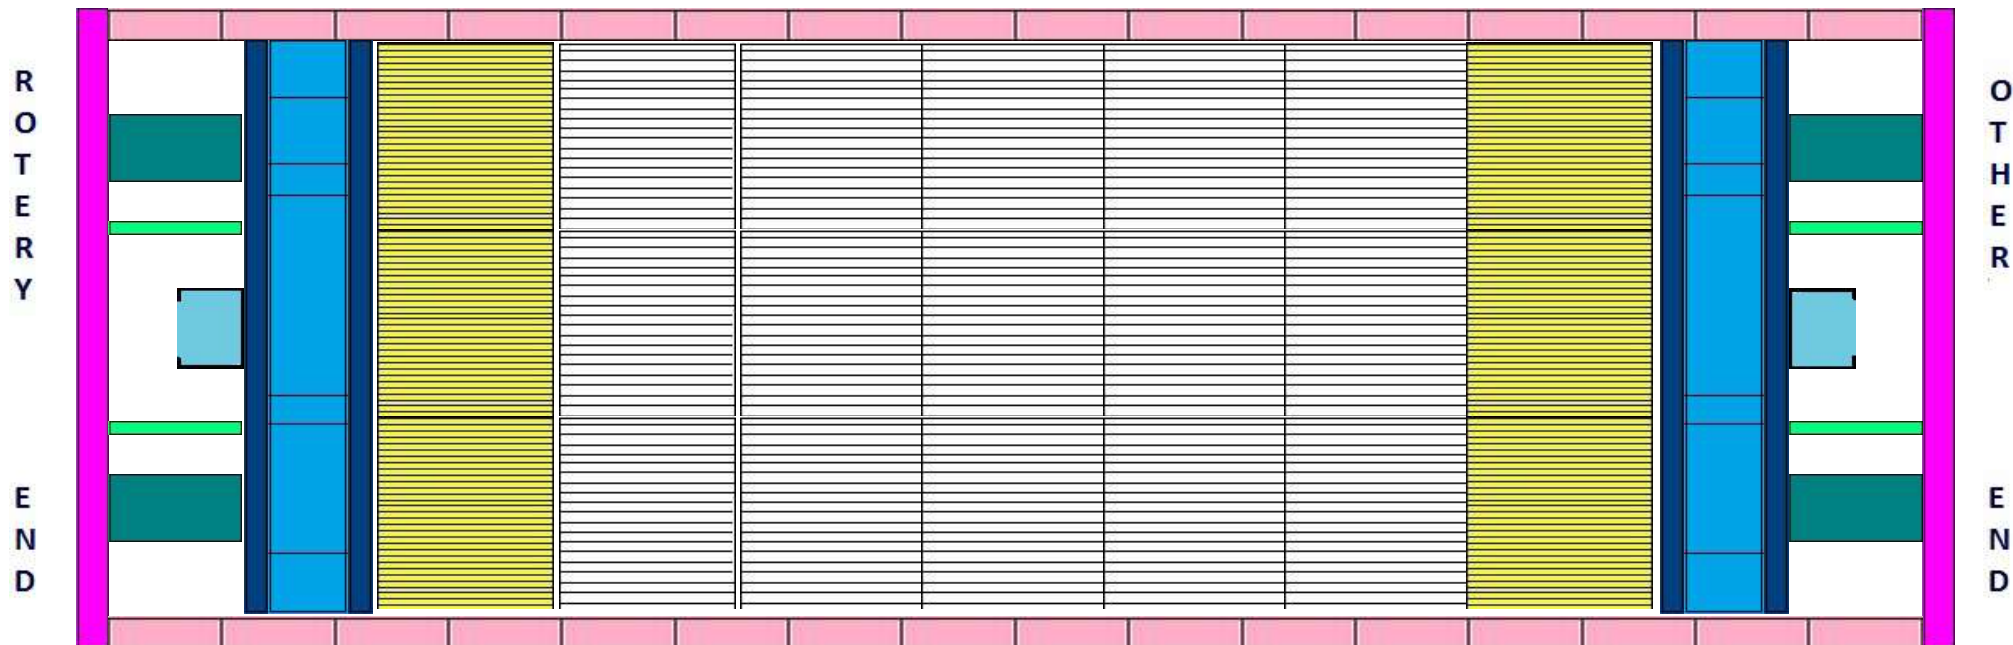

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	16	100%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	18	53%		Window Bar	30	19%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -8, WEST : -8 Other End - EAST : -8, WEST : -10
Start Date : 28-Aug-2019, Completion Date : 04-Sep-2019, Net Repair Days : 7, Total Man Hours : 1512

K K TRIPATHI - SSE	H R KANNOJE - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	-------------------	------------------------	----------------------------	-------------------------