

# Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)  
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :ER94739


Type : SLR

Built Year : 1994

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

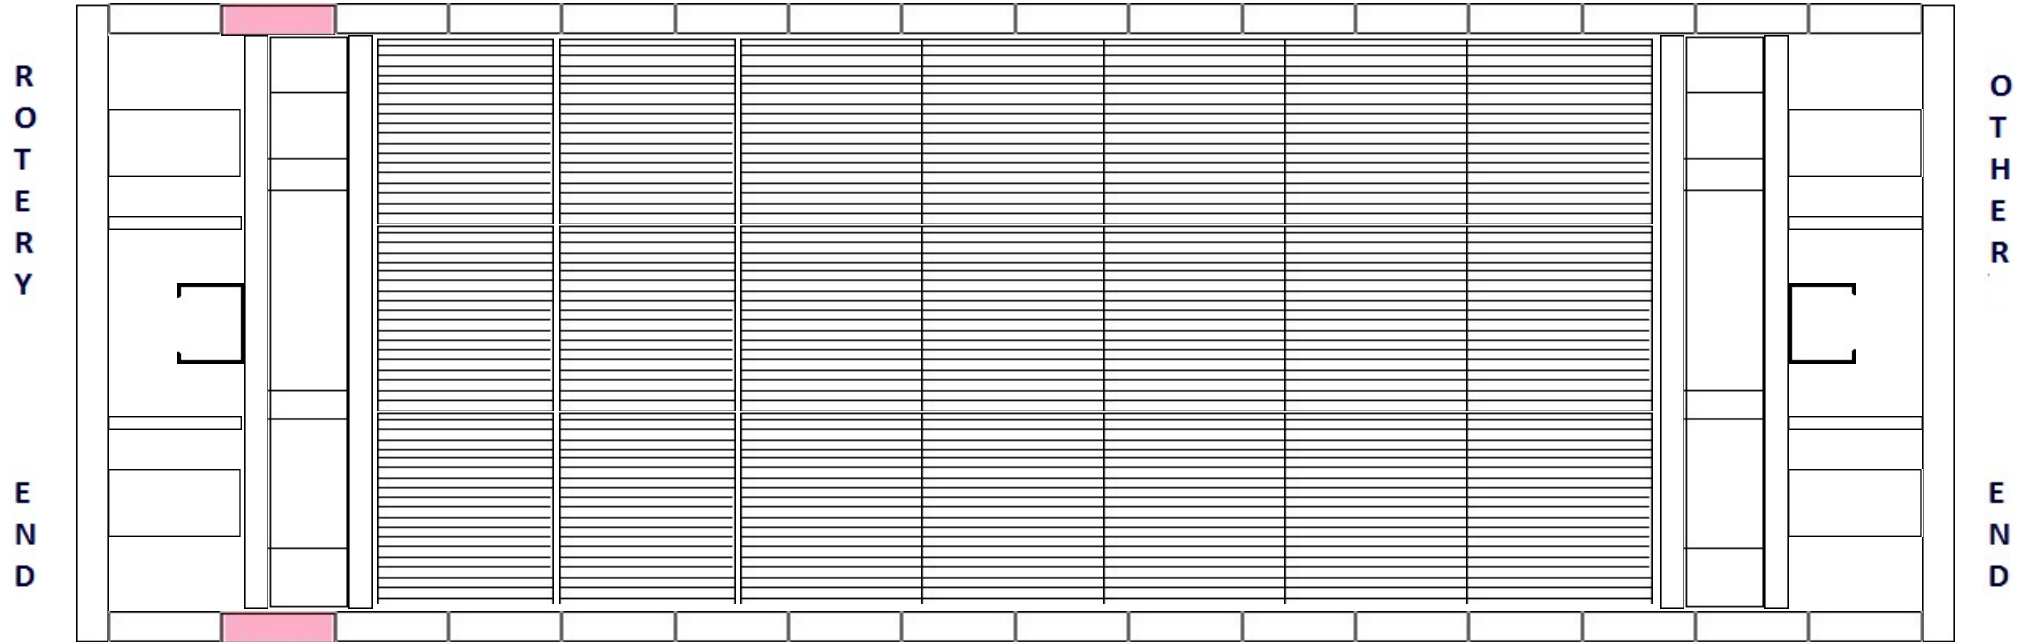

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	0	0%		Centre Stiffner for Headstock	0	0%		Floor Stiffner for Headstock	0	0%
	Aux. Head stock	0	0%		Sole Bar	1	6%		Draft Gear Bracket	0	0%
	Trough floor	0	0%		Centre plate	0	0%		SoleBar Stiffner	4	100%
	Bottom Wall Part	1	6%		Body panel/patch		20%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 0 Other End - EAST : 0, WEST : 0  
Start Date : 13-Feb-2020, Completion Date : 20-Feb-2020, Net Repair Days : 7, Total Man Hours : 0

U S BAJPAI - SSE	K K TRIPATHI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	------------------------	----------------------------	-------------------------

# Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)  
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :ER04713


Type : SLRD

Built Year : 2004

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

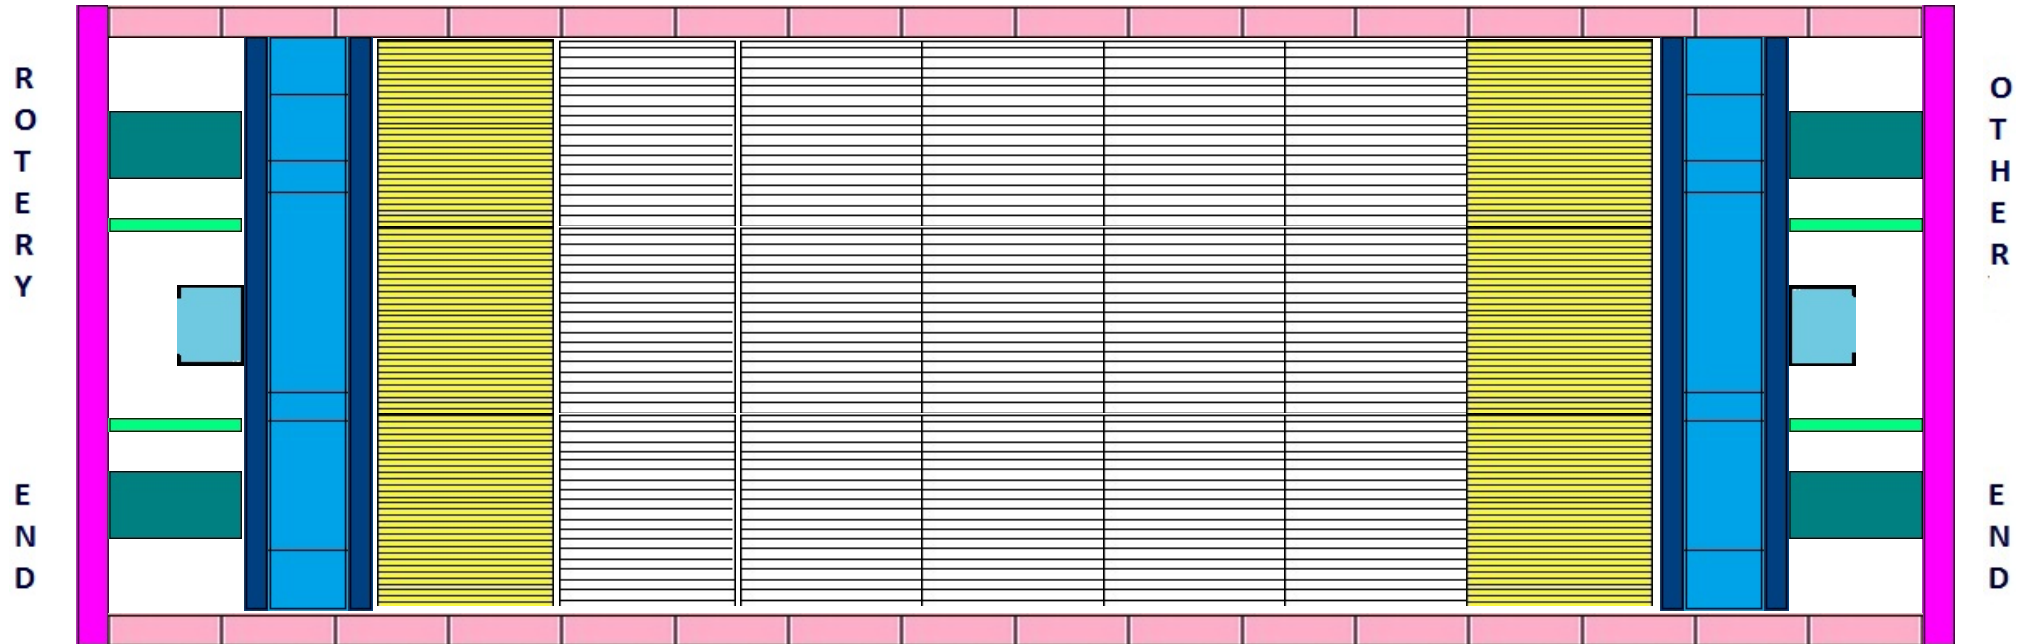

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	12	63%		Window Bar	18	21%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -8, WEST : -9 Other End - EAST : -9, WEST : -6  
Start Date : 13-Aug-2019, Completion Date : 23-Aug-2019, Net Repair Days : 10, Total Man Hours : 2017

ALOK CHOUDHARY - JE	PANKAJ KU SINGH - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------------	----------------------	-----------------	----------------------------	-------------------------

# Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)  
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :ER06402


Type : GS

Built Year : 2006

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

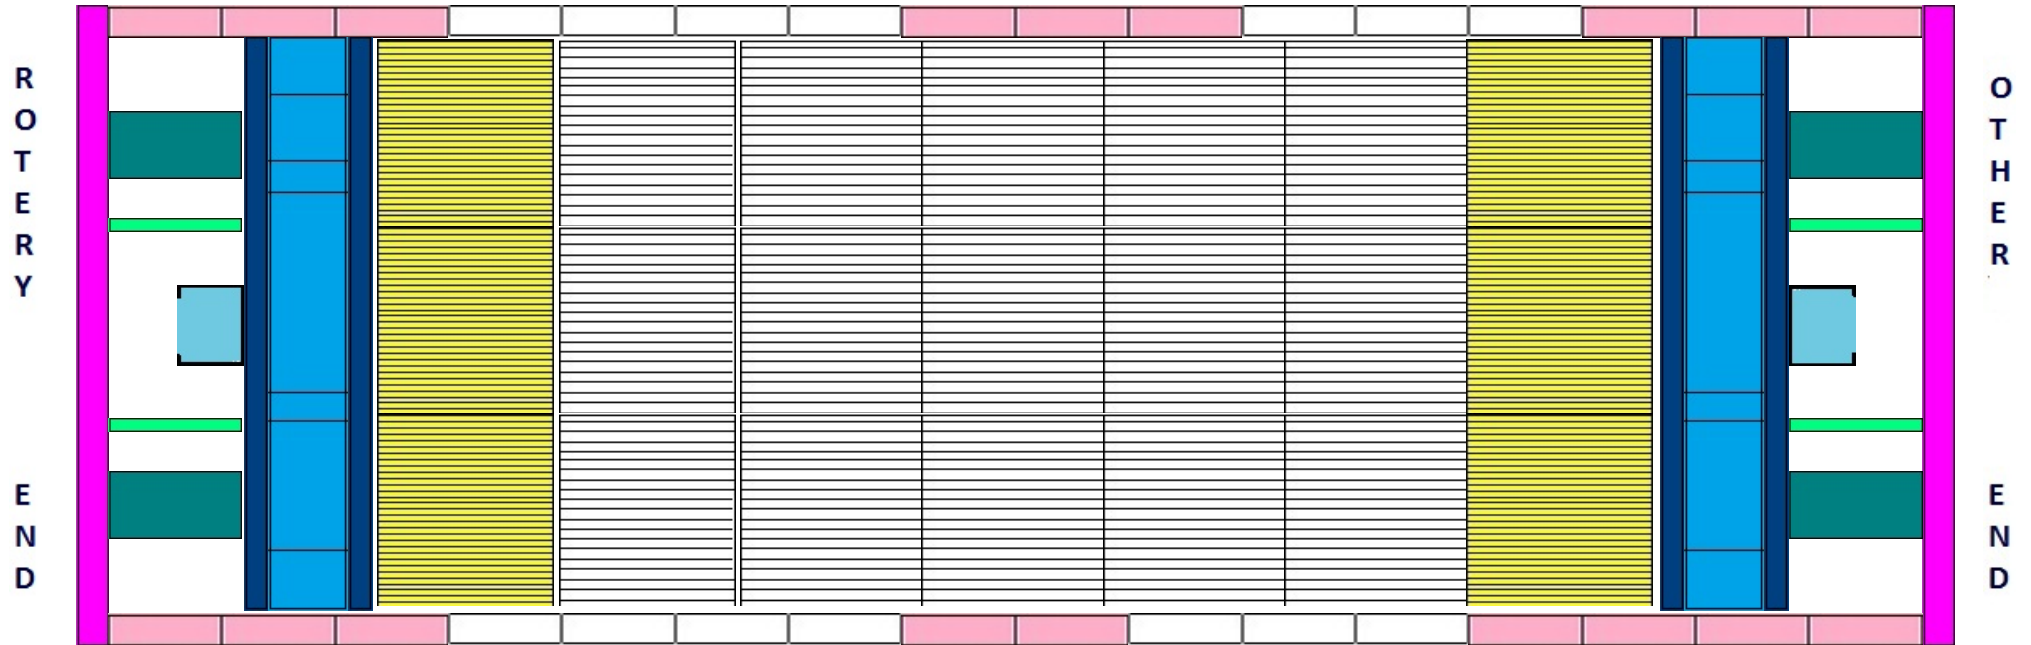

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	9	56%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	6	100%
	Bottom Wall Part	9	56%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	72	40%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : -4 Other End - EAST : -3, WEST : -5  
Start Date : 02-Aug-2019, Completion Date : 17-Aug-2019, Net Repair Days : 14, Total Man Hours : 1804

P N VISHWKARMA - SSE	U S BAJPAI - SSE	OM PRAKASH SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	------------------	------------------------	----------------------------	-------------------------

# Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)  
Final Inspection Sheet - Details of Corrosion Repair

Coach No. :ER07203


Type : WGSCN

Built Year : 2007

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

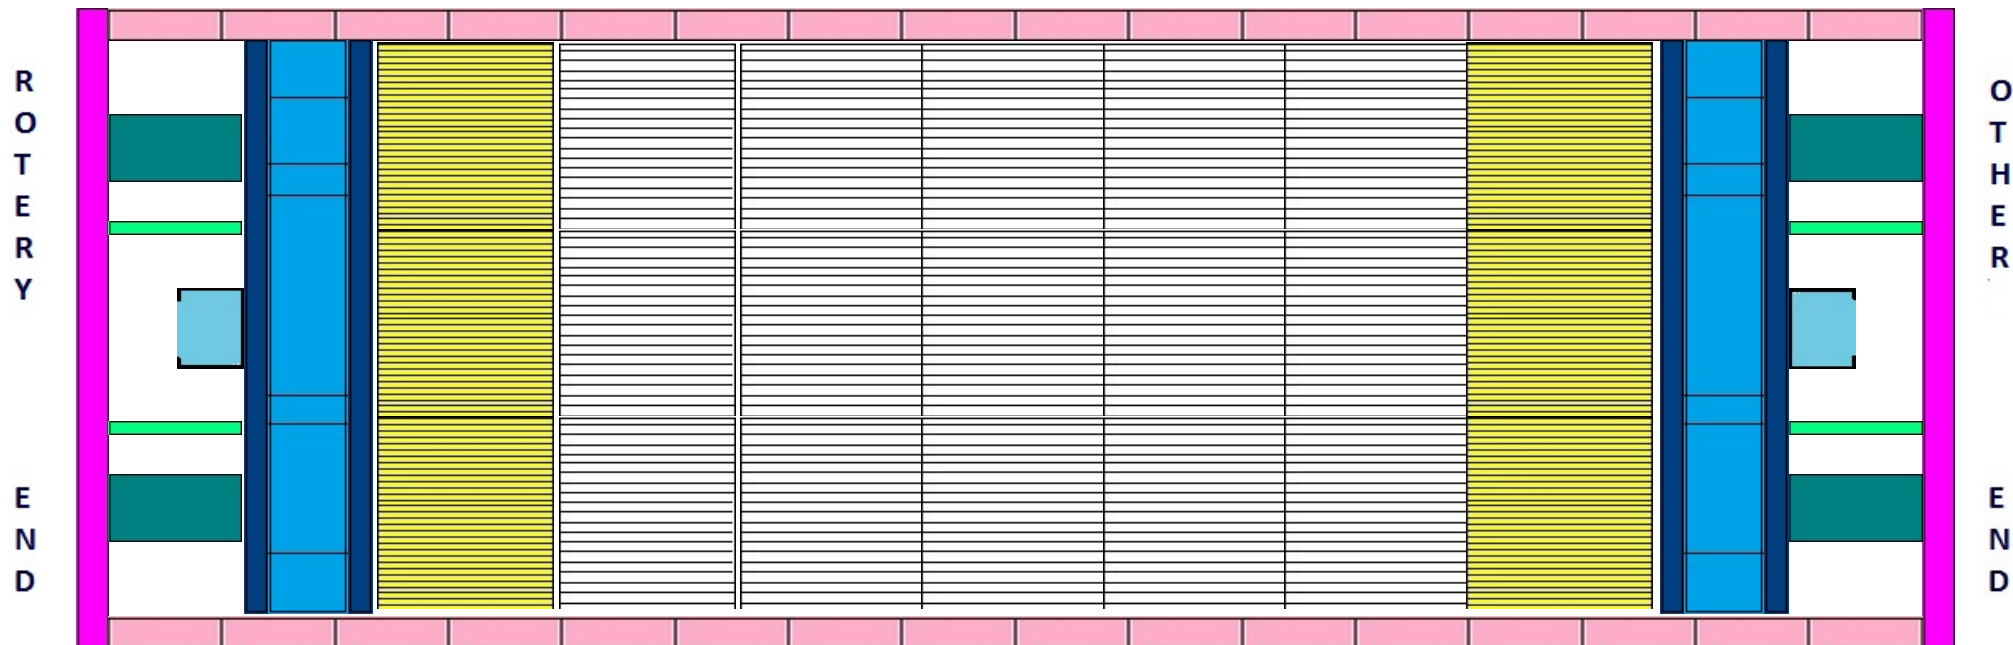

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Dark Green	Centre Stiffner for Headstock	4	100%	Light Green	Floor Stiffner for Headstock	4	100%
Dark Blue	Aux. Head stock	4	100%	Pink	Sole Bar	16	100%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Light Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	16	100%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	40	100%		Window Bar	72	39%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : -10, WEST : -10 Other End - EAST : 0, WEST : 8  
Start Date : 25-Jul-2019, Completion Date : 06-Aug-2019, Net Repair Days : 11, Total Man Hours : 1737

ANASTA PRASAD - JE	K K DEHARIA - JE	S S SHIVHARE - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
--------------------	------------------	--------------------	----------------------------	-------------------------