

# Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)  
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : NC04121


Type : WGACCN

Built Year : 2004

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

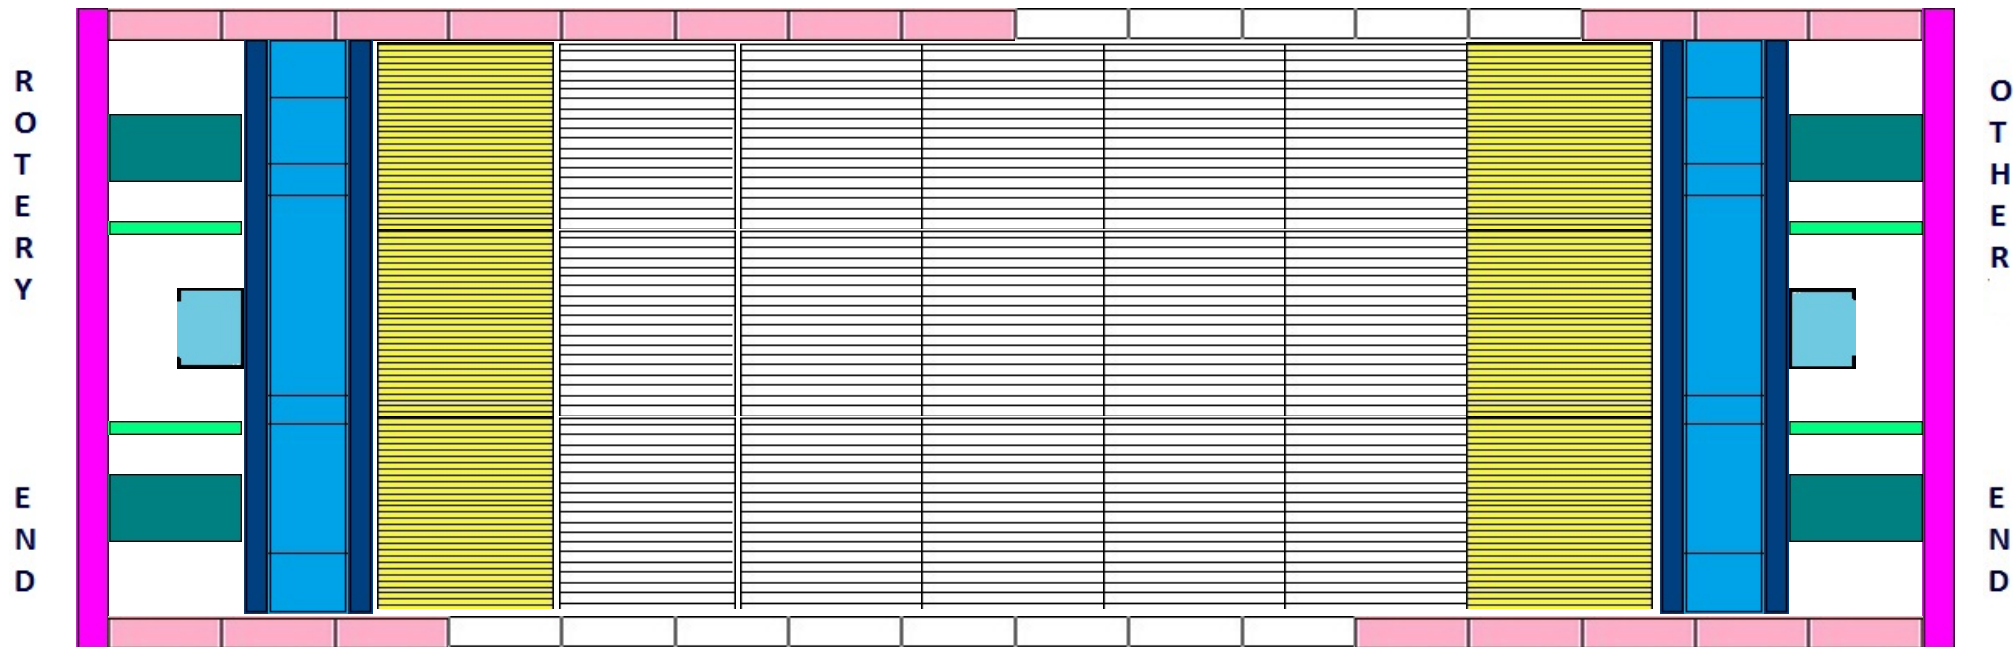

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Pink	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Yellow	Floor Stiffner for Headstock	4	100%
Blue	Aux. Head stock	4	100%	Pink	Sole Bar	9.5	59%	Light Blue	Draft Gear Bracket	2	100%
Yellow	Trough floor	2	29%	Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	9.5	59%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		3%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : 5 Other End - EAST : 7, WEST : 7  
Start Date : 24-Jun-2019, Completion Date : 02-Jul-2019, Net Repair Days : 8, Total Man Hours : 1528

HAMANT JADAV - JE	M L KOLI - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
-------------------	---------------	-----------------	----------------------------	-------------------------

# Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)  
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : NC03117


Type : WGACCN

Built Year : 2003

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

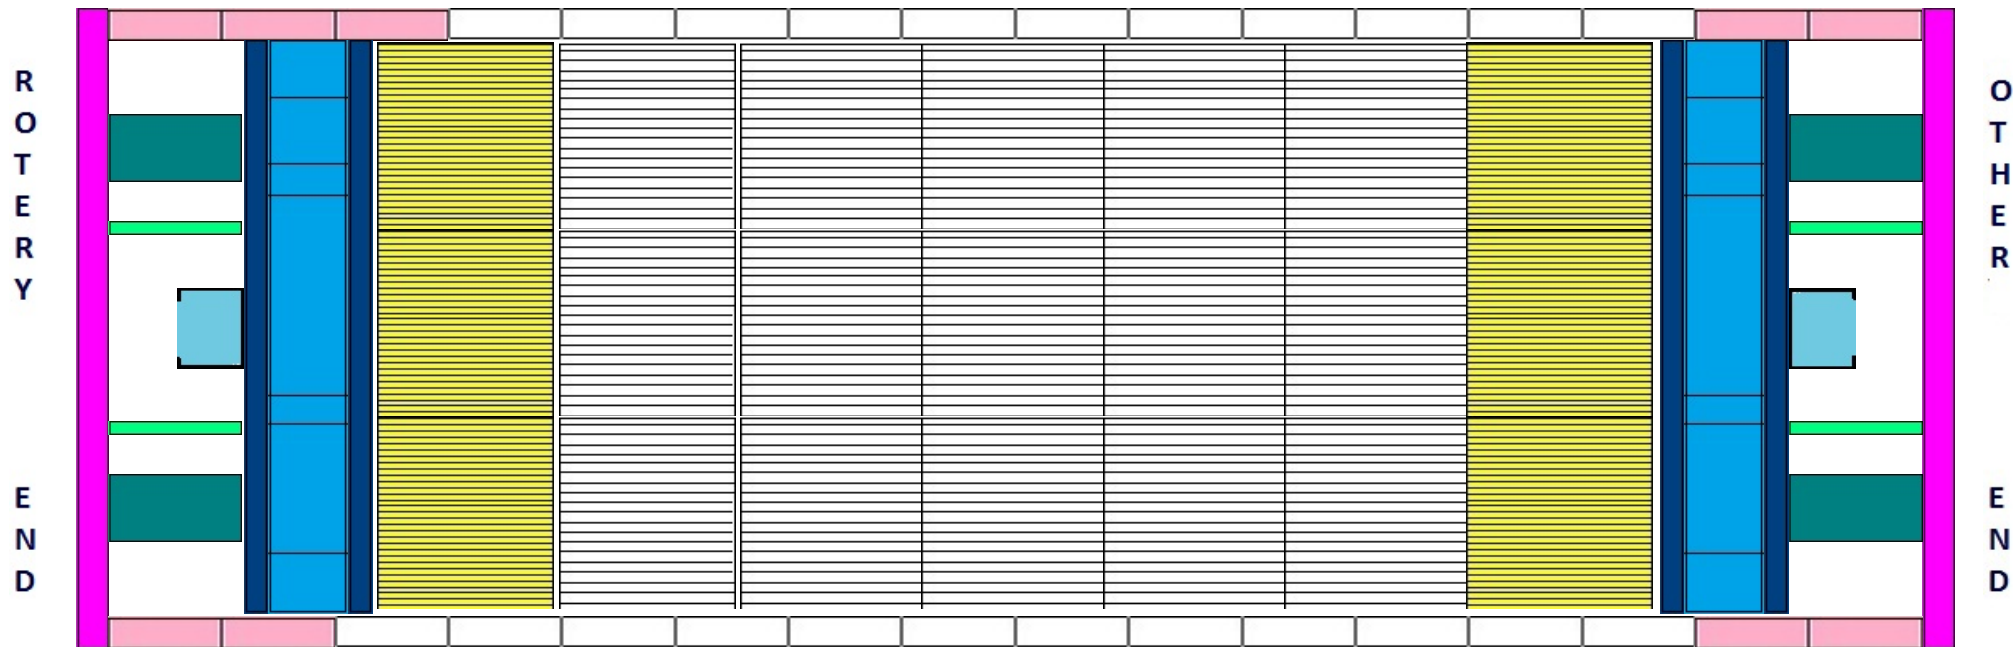

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	4.5	28%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4.5	28%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		0%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 2, WEST : 0 Other End - EAST : 5, WEST : -2  
Start Date : 27-Apr-2019, Completion Date : 06-May-2019, Net Repair Days : 8, Total Man Hours : 1032

K K DEHARIA - JE	ANASTA PRASAD - JE	ARUN SINGH - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
------------------	--------------------	------------------	----------------------------	-------------------------

# Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)  
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : NC04120


Type : WGACCN

Built Year : 2004

Make : RCF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

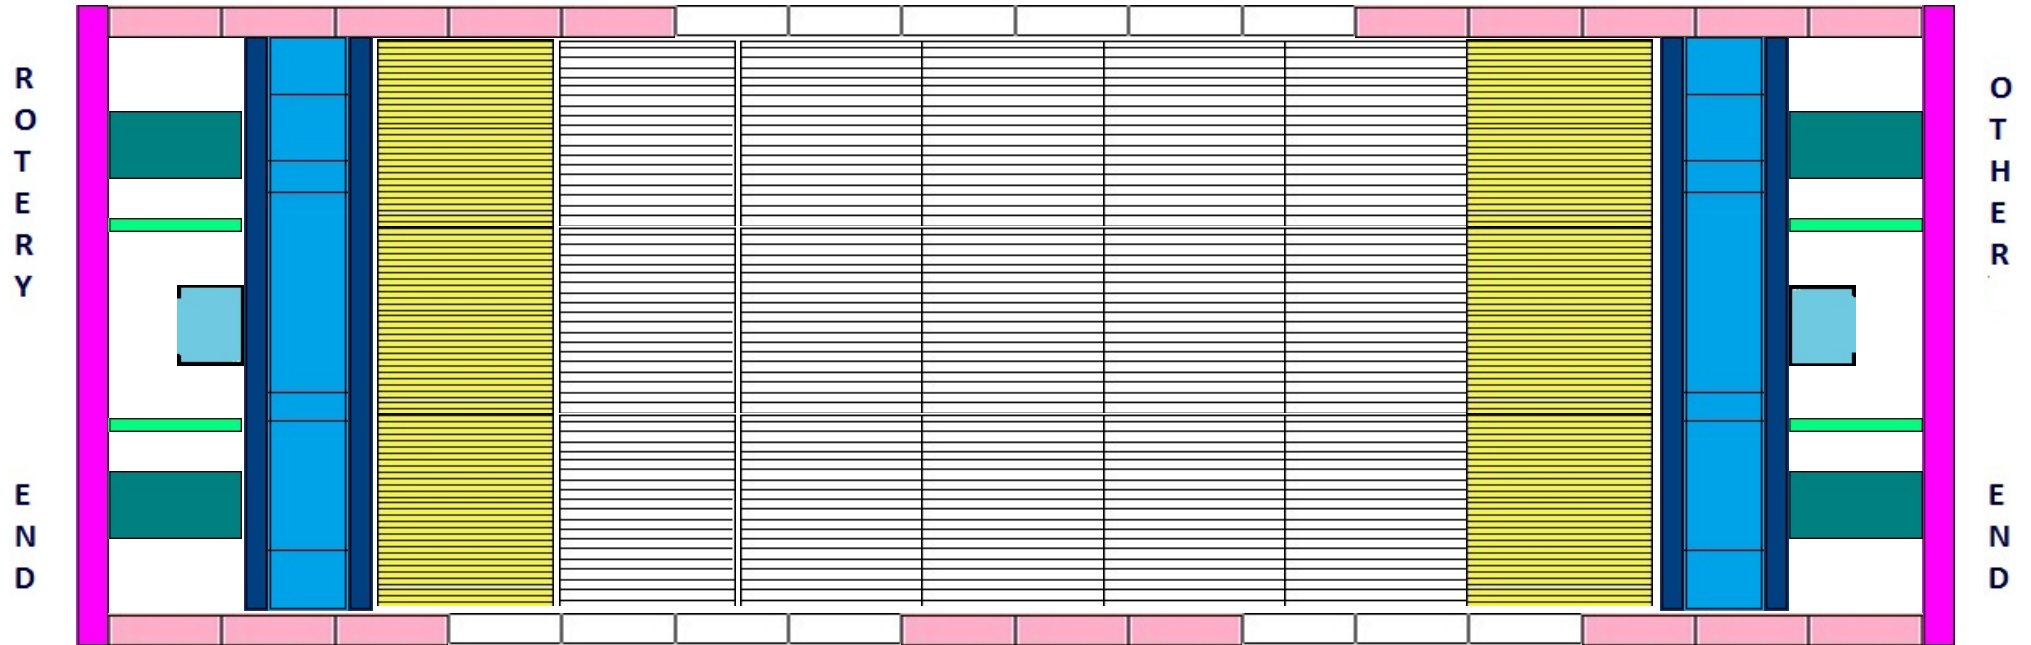

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
	Headstock Beam	2	100%		Centre Stiffner for Headstock	4	100%		Floor Stiffner for Headstock	4	100%
	Aux. Head stock	4	100%		Sole Bar	9.5	59%		Draft Gear Bracket	2	100%
	Trough floor	2	29%		Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	9.5	59%		Body panel/patch		0%		Door Top/Roof Patch		100%
	Window Module		4%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 0, WEST : 4 Other End - EAST : 10, WEST : -5  
Start Date : 07-Oct-2019, Completion Date : 15-Oct-2019, Net Repair Days : 8, Total Man Hours : 1372

M L KOLI - JE	HAMANT JADAV - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
---------------	-------------------	-----------------	----------------------------	-------------------------

# Coach Rehabilitation Workshop, WC Railway, Bhopal

(An IMS and ISO 50001 Certified Workshop)  
Final Inspection Sheet - Details of Corrosion Repair

Coach No. : NC03056


Type : WGACCW

Built Year : 2003

Make : ICF

Form No. F/BR/ICF/002

Valid From: 02/04/2015

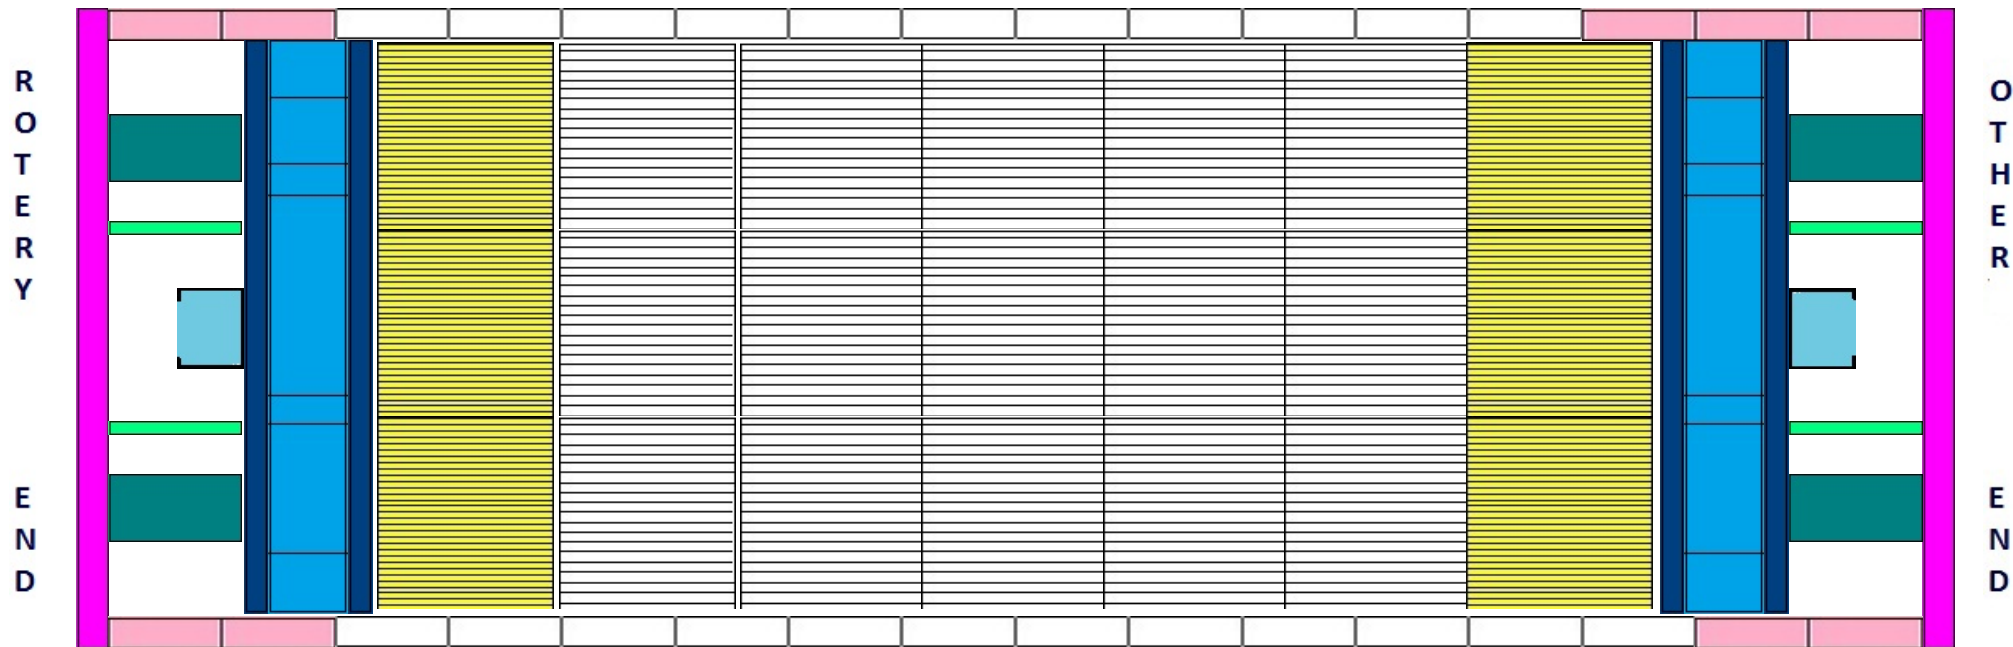

Rotary Side

Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%	Color	Particulars	Qty	Per%
Yellow	Headstock Beam	2	100%	Green	Centre Stiffner for Headstock	4	100%	Red	Floor Stiffner for Headstock	4	100%
Blue	Aux. Head stock	4	100%	Yellow	Sole Bar	4.5	28%	Blue	Draft Gear Bracket	2	100%
Red	Trough floor	2	29%	Blue	Centre plate	2	100%		SoleBar Stiffner	4	100%
	Bottom Wall Part	4.5	28%		Body panel/patch		100%		Door Top/Roof Patch		0%
	Window Module		8%		Window Sill	0	0%		Window Bar	0	0%
	Seat pillar/lav. Partition		100%		UIC end construction		0%				

End Drooping: Rotary End - EAST : 5, WEST : 5 Other End - EAST : 4, WEST : 6  
Start Date : 04-Dec-2019, Completion Date : 10-Dec-2019, Net Repair Days : 6, Total Man Hours : 1716

PANKAJ KU SINGH - JE	ALOK CHOUDHARY - JE	T K PANJA - SSE	V N GANVIR - SSE In-charge	Verified By:QU-Incharge
----------------------	---------------------	-----------------	----------------------------	-------------------------